

**NEW ZEALAND TEMPORARY AND PRELIMINARY NOTICES IN FORCE**  
(NZ NTM Edition No. 24 dated 24 November 2017)

NZ Notice	T/P	Charts Affected	Locality and Subject
		NZ Chart, ENC Cell	
41/14	P	<b>NZ 268</b>	Chatham Islands: Depths and Rocks
155/16	P	<b>NZ 4212</b>	West Coast, Hokianga Harbour: Uncharted depths and rocks
159/16	T	<b>NZ 4424, NZ404424</b>	West Coast, Taharoa Offshore Terminal: Buoy
182/16	P	<b>NZ 268</b>	Chatham Islands: Area of Restricted Access
267/16	T	<b>NZ 561, NZ 5612, NZ400561, NZ505612, NZ605612</b>	East Coast, Hawke Bay, Napier Roads: Buoy and AIS
44/17	P	<b>NZ 268, NZ 2683, NZ 2685, NZ402683, NZ526852</b>	Chatham Islands, Port Waitangi Wharf: Works
49/17	T	<b>NZ 532, NZ 5321, NZ 5324, NZ305321, NZ305322, NZ405321, NZ405324</b>	East Coast, Tamaki Strait: Light Characteristics
74/17	P	<b>NZ 5412</b>	East Coast, Bay of Plenty, Tauranga Harbour: Aids to Navigation
93/17	T	<b>NZ 82 (T 82), NZ 827 (T 827), NZ 8275 (T 8275), NZ300827, NZ408275</b>	Kingdom of Tonga, Tongatapu, Approaches to Nuku'alofa: Aids to Navigation
94/17	T	<b>NZ 63, NZ 632, NZ 6321, NZ300063, NZ400632, NZ506321</b>	East Coast, Lyttelton Harbour / Whakaraupō, Governors Bay: Light
132/17	P	<b>NZ 532, NZ 533, NZ 5321, NZ 5324, NZ 5325, NZ 5327</b>	East Coast, Tamaki Strait: Rocks
165/17	T	<b>NZ 14605 (INT 605), NZ 14638 (INT 638)</b>	Fiji, Viti Levu, Vanua Levu, Southern Lau Group & Northern Lau Group: Lights
166/17	T	<b>NZ 7142</b>	West Coast, Greymouth Harbour: Depths
171/17	P	<b>NZ 6612</b>	East Coast, Otago Harbour: Shoaling
177/17	T	<b>NZ 6422</b>	East Coast, Approaches to Timaru: Lit Buoy
182/17	T	<b>NZ 6321</b>	East Coast, Lyttelton Harbour/Whakaraupō, Port of Lyttelton: Marina Construction Activity
183/17	T	<b>NZ 4633</b>	South Coast, Wellington Harbour, Point Halswell Northwestwards: Lit Buoy
186/17	T	<b>NZ 56, NZ 561, NZ 5612</b>	East Coast, Hawke Bay, Whirinaki: Pan Pac Outfall Pipeline Reserved Area
188/17	T	<b>NZ 61, NZ 614, NZ 6142</b>	North Coast, Tasman Bay / Te Tai-o-Aorere and Golden Bay / Mohua: Spat Catching Areas
189/17	T		Maritime Safety Broadcasts - Optimum R/T Frequencies Within NAVAREA XIV
193/17	T	<b>NZ 23 (INT 640), NZ 26, NZ 55, NZ 56, NZ 14600 (INT 600)</b>	East Coast, Poverty Bay to Mahia Peninsula, Eastwards: Scientific Instruments
197/17	P	<b>NZ 6612</b>	East Coast, Otago Harbour, Port Chalmers: Wharf Works

**NZ 41(P)/14 SOUTH PACIFIC OCEAN – New Zealand – Chatham Islands – Depths and Rocks.**

Former notice – NZ 258(P)/13 is cancelled.

1. A recent survey in the vicinity of the Chatham Islands has located numerous depths less than charted and uncharted rocks. The most significant are:

Position	Depth	Feature
<b>Waitangi Bay</b>		
43° 53'.00S., 176° 58'.85W.	9.6	
43° 52'.53S., 176° 55'.78W.	1.3	Underwater rock
43° 53'.16S., 176° 55'.63W.	3.0	Underwater rock
43° 50'.35S., 176° 46'.98W.	7.9	Underwater rock
43° 48'.71S., 176° 42'.07W.	4.7	Uncharted Wreck
43° 54'.94S., 176° 34'.04W.	6.6	<i>Four Fathoms</i>
43° 55'.40S., 176° 32'.29W.	2.8	Underwater rock
<b>Pitt Strait</b>		
43° 59'.63S., 176° 22'.58W.	12.7	Wreck. Exclusion zone centred on position.
44° 01'.31S., 176° 21'.91W.	1.5	Underwater rock
44° 14'.31S., 176° 17'.81W.	9.1	
44° 13'.26S., 176° 09'.78W.	6	
44° 14'.22S., 176° 14'.23W.	1.4	Underwater rock
44° 14'.93S., 176° 02'.31W.	5	
<b>Kaingaroa Harbour</b>		
43° 43'.37S., 176° 16'.78W.	8.7	Underwater rock <i>The Lure</i>
43° 43'.92S., 176° 16'.38W.		Rock awash

2. Mariners are advised to exercise caution when navigating in the area.

3. Charting action will be taken in due course.

**Chart affected: NZ 268**

New Zealand Hydrographic Authority  
NI 17/2014

**NZ 155(P)/16 NEW ZEALAND – North Island – West Coast – Hokianga Harbour. Uncharted depths and rocks**

1. A recent survey (November 2015) indicates numerous changes to charted features and depths in Hokianga Harbour. The most significant depths are as follows:

Position	Depth	Feature
(a) 35° 24'.75S., 173° 26'.19E.	8.2	Dangerous underwater rock
(b) 35° 31'.68S., 173° 21'.44E.	4.3	Depth
(c) 35° 31'.39S., 173° 23'.05E.	5.4	Depth
(d) 35° 30'.92S., 173° 22'.62E.	8.3	Dangerous underwater rock
(e) 35° 27'.71S., 173° 24'.69E.	-0.6	Rock that covers and uncovers
(f) 35° 27'.09S., 173° 24'.76E.	10.3	Dangerous underwater rock
(g) 35° 26'.49S., 173° 24'.55E.	6.0	Dangerous underwater rock
(h) 35° 26'.40S., 173° 24'.55E.	6.4	Dangerous underwater rock
(i) 35° 25'.98S., 173° 24'.68E.	14.2	Dangerous underwater rock
(j) 35° 25'.53S., 173° 24'.52E.	14.5	Dangerous underwater rock
(k) 35° 23'.07S., 173° 32'.05E.	2.4	Depth
(l) 35° 22'.18S., 173° 33'.01E.	2.2	Dangerous underwater rock

2. Charting action will take place in due course.

**Charts affected: NZ 4212**

New Zealand Hydrographic Authority  
HITS 4212/44

**NZ 159(T)/16      NEW ZEALAND – North Island – West Coast – Taharoa Offshore Terminal. Buoy**

1. Lit yellow waverider buoy *FI(5)Y.20s* in position 38° 12'.00S., 174° 40'.00E. has been temporarily replaced by an unlit buoy until further notice.
2. The AIS transmission to the location remains unaffected.
3. Mariners are advised to exercise caution when navigating in the area.

**Charts temporarily affected: NZ 4424, NZ404424**

New Zealand Steel Ltd.  
HITS 4424/9

**NZ 182(P)/16      NEW ZEALAND – Chatham Islands. Area of Restricted Access**

1. An Area of Restricted Access has been established around the Chatham Islands.
  - a) The area extends 3 nautical miles off all islands of the Chatham Islands and outlying dangers, from The Sisters (Rangitatahi) at 43° 33'.6S., 176° 48'.1W., to The Pyramid (Tarakoikoia) at 44° 25'.9S., 176° 14'.4W. It includes all those areas between the exclusion zones of all the islands, (Pitt Strait and the area between The Sisters (Rangitatahi) and Chatham Island). The area includes Petre Bay, and up to 3 nautical miles outside of Petre Bay, and 6 nautical miles off Hanson Bay.
  - b) The area extends 3 nautical miles around Motuhara (Bertier or the Forty Fours) 43°57'.8S., 175° 50'.4W. (about 22 nautical miles E of Cape Fournier).
2. See Annual Notice to Mariners 10 for further details.
3. Charting action will take place in due course.

**Chart affected: NZ 268**

Maritime New Zealand  
HITS 268/170

**NZ 267(T)/16      NEW ZEALAND – North Island – East Coast – Hawke Bay – Napier Roads. Buoy and AIS**

1. A data gathering yellow wave/current buoy *FI(5)Y.20s* is temporarily moved from 39° 27'.804S., 176° 54'.462E to 39° 28'.850S., 176° 58'.950E and is fitted with AIS identification until further notice.
2. AIS identification of "A" Buoy *FI.G.4s* at position 39° 27'.812S., 176° 54'.529E has been temporarily removed until further notice.
3. Mariners are advised to exercise caution when navigating in the area.

**Charts temporarily affected: NZ 561, NZ 5612, NZ400561, NZ505612, NZ605612**

Hawke's Bay Regional Council  
HITS 5612/55

**NZ 44(P)/17      NEW ZEALAND – Chatham Islands – Port Waitangi Wharf. Works**

1. Mariners are advised that construction work is underway on and in the vicinity of the wharf until December 2017.
2. Mariners are advised to exercise caution when navigating in the area as uncharted structures, shoaler depths than charted and temporary lights can be expected.
3. Charting action will take place in due course.

**Charts affected: NZ 268, NZ 2683, NZ 2685, NZ402683, NZ526852**

Environment Canterbury & Memorial Park Alliance  
HITS 2685/4

1. Changes to the light characteristics of the following aids to navigation have been reported :

<i>Position</i>	<i>Name</i>	<i>Reported Characteristics</i>
(a) 36° 47'.57S., 175° 11'.35E.	Pakatoa Island. NW end. Wharf Head	Unlit
(b) 36° 47'.80S., 174° 54'.94E.	Motutapu Island	VQ(6) + LFI W 15s
(c) 36° 48'.53S., 174° 57'.66E.	E Cardinal	Q(3)W 5s
(d) 36° 48'.56S., 174° 58'.14E.	West cardinal buoy	Q(9) 15s
(e) 36° 49'.30S., 174° 57'.40E.	Special purpose buoy	Unlit
(f) 36° 51'.70S., 175° 08'.30E.	Special purpose buoy	Unlit
(g) 36° 51'.72S., 175° 07'.39E.	Special purpose buoy	Unlit
(h) 36° 53'.21S., 174° 58'.76E.	No. 6	Unlit
(i) 36° 53'.27S., 174° 58'.95E.	No. 7	Q.G
(j) 36° 53'.26S., 174° 58'.95E.	No. 8	Q.R
(k) 36° 53'.29S., 174° 59'.03E.	W Breakwater. Off head	Oc G 4s
(m) 36° 53'.27S., 174° 59'.05E.	E Breakwater. Off head	Oc R 4s

2. Pine Harbour Marina entrance channel lit beacons are reported as out of sync.

3. Mariners are advised to exercise caution when navigating in the area.

**Charts temporarily affected: NZ 532, NZ 5321, NZ 5324, NZ305321, NZ305322, NZ405321, NZ405324**

NZ Light List: 3845.2, 3845.25, 3850.14, 3850.15, 3850.16, 3850.17, 3850.18, 3851

IXSurvey Pty Ltd.  
HITS 5324/88

NZ 74(P)/17 NEW ZEALAND – North Island – East Coast – Bay of Plenty – Tauranga Harbour. Aids to Navigation

1. Former notice – NZ 33(P)/17 is cancelled.
2. Aids to navigation have been revised in the Tauranga Harbour. The following new aids to navigation have been installed:

	<i>Position</i>	<i>Feature</i>	<i>Name</i>	<i>Light Characteristics</i>
(a)	37° 37'.468S., 176° 10'.014E.	Port Lateral Buoy	C	Q.R
(b)	37° 37'.886S., 176° 09'.699E.	Starboard Lateral Buoy	D	Iso.G.2s
(c)	37° 38'.068S., 176° 09'.924E.	Port Lateral Buoy	Tanea No2	Iso.R.2s
(d)	37° 38'.160S., 176° 10'.003E.	Port Lateral Buoy	Tanea No4	Iso.R.2s
(e)	37° 38'.242S., 176° 10'.366E.	Starboard Lateral Beacon	P3	Fl.G.3s
(f)	37° 38'.265S., 176° 10'.221E.	W Cardinal Beacon	P1	VQ(9)10s
(g)	37° 38'.301S., 176° 09'.817E.	Starboard Lateral Buoy	No1	Iso.G.2s
(h)	37° 38'.313S., 176° 10'.578E.	Starboard Lateral Beacon	P5	Q.G
(i)	37° 38'.362S., 176° 10'.418E.	Port Lateral Beacon	No6	Iso.R.2s
(j)	37° 38'.398S., 176° 09'.991E.	N Cardinal Buoy	No3	VQ
(k)	37° 38'.434S., 176° 10'.675E.	S Cardinal Beacon	P7	Q(6)+LFl.15s
(l)	37° 38'.505S., 176° 10'.320E.	Starboard Lateral Buoy	No5	Iso.G.2s
(m)	37° 38'.568S., 176° 10'.490E.	Starboard Lateral Beacon	No7	Iso.G.2s
(n)	37° 38'.571S., 176° 09'.514E.	Starboard Lateral Buoy	WC3	Q.G
(o)	37° 38'.682S., 176° 09'.689E.	Port Lateral Buoy	WC2	Q.R
(p)	37° 38'.672S., 176° 10'.624E.	Starboard Lateral Beacon	No9	Q(2)G.2s
(q)	37° 38'.785S., 176° 10'.702E.	Starboard Lateral Beacon	No11	Iso.G.2s
(r)	37° 38'.912S., 176° 10'.746E.	Starboard Lateral Beacon	No13	Iso.G.2s
(s)	37° 39'.037S., 176° 10'.738E.	Starboard Lateral Beacon	No15	Iso.G.2s
(t)	37° 39'.307S., 176° 10'.598E.	Starboard Lateral Beacon	No17	Iso.G.2s
(u)	37° 39'.754S., 176° 10'.839E.	Port Lateral Beacon	No8	Iso.R.2s
(v)	37° 39'.961S., 176° 10'.589E.	Special Beacon	Town Reach	Fl.Y.5s
(w)	37° 40'.125S., 176° 10'.603E.	Port Lateral Beacon	No10	Q.R
(x)	37° 40'.260S., 176° 10'.536E.	Port Lateral Beacon	No12	Q.R

3. The following aids to navigation have been removed:

	<i>Position</i>	<i>Feature</i>	<i>Name</i>	<i>Light Characteristics</i>
(a)	37° 37'.490S., 176° 09'.988E.	Port Lateral Buoy	C	Q.R
(b)	37° 38'.067S., 176° 09'.921E.	Port Lateral Buoy	Tanea No2	Q.R
(c)	37° 38'.159S., 176° 10'.000E.	Port Lateral Buoy	No4	Iso.R.2s
(d)	37° 38'.242S., 176° 10'.367E.	Starboard Lateral Beacon	No3	Fl.G.3s
(e)	37° 38'.266S., 176° 10'.191E.	W Cardinal Beacon	No1	VQ(9)10s
(f)	37° 38'.300S., 176° 09'.818E.	Starboard Lateral Buoy	No1 W	Q.G
(g)	37° 38'.312S., 176° 10'.579E.	Starboard Lateral Beacon	No5	Q.G
(h)	37° 38'.338S., 176° 10'.352E.	Port Lateral Beacon	C2	Q.R
(i)	37° 38'.376S., 176° 10'.014E.	N Cardinal Buoy	Banks	Q
(j)	37° 38'.407S., 176° 10'.519E.	Port Lateral Beacon	C4	Q.R
(k)	37° 38'.434S., 176° 10'.676E.	S Cardinal Beacon	No7	Q(6)+LFl.15s
(l)	37° 38'.451S., 176° 10'.324E.	Starboard Lateral Buoy	C1	Q.G
(m)	37° 38'.552S., 176° 10'.527E.	Starboard Lateral Beacon	C3	Q.G
(n)	37° 38'.615S., 176° 09'.544E.	Starboard Lateral Buoy	WC3	Q.G
(o)	37° 38'.630S., 176° 09'.812E.	Port Lateral Buoy	No2W	Q.R
(p)	37° 38'.684S., 176° 10'.674E.	Starboard Lateral Beacon	C5	Fl.G.3s
(q)	37° 38'.810S., 176° 10'.739E.	Starboard Lateral Beacon	No11	Q.G
(r)	37° 38'.944S., 176° 10'.759E.	Lateral Beacon	No13	Q(3)G.7.5s
(s)	37° 39'.070S., 176° 10'.744E.	Starboard Lateral Beacon	No15	Q.G
(t)	37° 39'.243S., 176° 10'.669E.	Starboard Lateral Beacon	No17	Q.G
(u)	37° 39'.303S., 176° 10'.527E.	Starboard Lateral Beacon	Otumoetai 1	Q.G
(v)	37° 39'.405S., 176° 10'.580E.	Lateral Beacon	No19 The Leaner	Q(2+1)G.6s5M
(w)	37° 39'.754S., 176° 10'.840E.	Lateral Beacon	No6	Q(2)R.3s
(x)	37° 39'.961S., 176° 10'.594E.	Starboard Lateral Beacon	No21	Q.G
(y)	37° 40'.122S., 176° 10'.602E.	Port Lateral Beacon	No8	Q.R
(z)	37° 40'.251S., 176° 10'.538E.	Port Lateral Beacon	No10	Q.R

(continued)

**NZ 74(P)/17            NEW ZEALAND – North Island – East Coast – Bay of Plenty – Tauranga Harbour. Aids to Navigation (continued)**

4. Mariners are advised to exercise caution when navigating in the area.
5. Charting action will take place in due course.

**\* Chart affected: NZ 5412**

\* *Indicates new or revised entry.*

NZ Light List: 3900.4, 3902, 3902.4, 3903, 3904.32, 3904.34, 3904.36, 3904.38, 3904.7, 3904.8, 3905, 3905.2, 3905.3, 3906, 3908.1, 3908.4, 3913, 3913.5, 3920.

Bay of Plenty Regional Council  
HITS 5412/382/2

**NZ 93(T)/17            SOUTH PACIFIC OCEAN – Kingdom of Tonga – Tongatapu – Approaches to Nuku'alofa. Aids to Navigation**

1. Former notice – NZ 84(T)/17 is cancelled
2. The following aid to navigation has been reported missing:

	<i>Position</i>	<i>Description</i>	<i>Characteristics</i>
(a)	21° 01'.39S., 175° 11'.62W.	Beacon	Fl.G.6s

- \* 3. The light from the Hakau Mama'o beacon in position 21° 00'.04S., 175° 12'.48W. is reported as a pale green colour.
4. Mariners are advised to exercise caution when navigating in the area.

**Charts temporarily affected: NZ 82 (T 82), NZ 827 (T 827), NZ 8275 (T 8275), NZ300827, NZ408275**

BA Light List (Volume K): 4646, 4646.65

MV Queen Victoria  
Ministry of Infrastructure Tonga  
HITS 8275/85

**NZ 94(T)/17            NEW ZEALAND – South Island – East Coast – Lyttelton Harbour / Whakaraupō – Governors Bay. Light**

1. The Governors Bay directional light in position 43° 37'.33S., 172° 38'.88E is temporarily operating on a reduced range.
2. Mariners are advised to exercise caution when navigating in the area.

**Charts temporarily affected: NZ 63, NZ 632, NZ 6321, NZ300063, NZ400632, NZ506321**

NZ Light List: 4289

Lyttelton Port of Christchurch Ltd.  
HITS 6321/157

**NZ 132(P)/17 NEW ZEALAND – North Island – East Coast – Tamaki Strait. Rocks**

1. A recent survey (2016/2017) in the vicinity of Waiheke Island indicates numerous changes to charted features and depths. The most significant changes are as follows:

<i>Position</i>	<i>Depth</i>	<i>Feature</i>
(a) 36° 43'.55S., 174° 57'.17E.	-1.3	Drying Rock
(b) 36° 47'.21S., 175° 09'.45E.	-0.3	Drying Rock
(c) 36° 48'.46S., 175° 02'.61E.	-0.9	Drying Rock

2. Charting action will take place in due course.

**Charts affected: NZ 532, NZ 533, NZ 5321, NZ 5324, NZ 5325, NZ 5327**

New Zealand Hydrographic Authority  
HITS 5324/93

**NZ 165(T)/17 SOUTH PACIFIC OCEAN – Fiji – Viti Levu, Vanua Levu, Southern Lau Group & Northern Lau Group. Lights**

1. Former notice – NZ 113(T)/17 is cancelled.
- \* 2. The following lights are reported as unlit:
- (a) 18° 30'.9S., 177° 58'.8E. Beqa South West Reef
  - (b) 17° 27'.0S., 178° 57'.7E. Makogai Island
  - (c) 19° 00'.0S., 179° 52'.0W. Totoya Island. South West Point
  - (d) 19° 50'.0S., 178° 13'.2W. Vatoa Island

3. Mariners are advised to exercise caution when navigating in the area.

\* *Indicates new or revised entry.*

**Charts temporarily affected: NZ 14605 (INT 605), NZ 14638 (INT 638)**

BA Light List (Volume K): 4695, 4733.4, 4758, 4759

Maritime Safety Authority of Fiji  
HITS 14638/308

**NZ 166(T)/17 NEW ZEALAND – South Island – West Coast – Greymouth Harbour. Depths**

1. Former notice – NZ 131(T)/17 is cancelled.
- \* 2. A recent survey (25 August 2017) indicates the following least depths below CD on the bar at the Grey River/Māwheranui entrance:
- |     |                               |            |      |
|-----|-------------------------------|------------|------|
| (a) | 42° 26'.306S., 171° 11'.367E. | North Lead | 4.1m |
| (b) | 42° 26'.327S., 171° 11'.371E. | Main Lead  | 3.5m |
| (c) | 42° 26'.294S., 171° 11'.282E. | South Lead | 3.9m |

3. Mariners should be aware that depths in Greymouth Harbour entrance are constantly changing and should contact the Harbourmaster for the latest conditions on (027) 435 3424 or (03) 768 5666 or Greymouth Harbour Radio Ch14.

\* *Indicates new or revised entry.*

**Chart temporarily affected: NZ 7142**

Port of Greymouth  
HITS 7142/72

**NZ 171(P)/17      NEW ZEALAND – South Island – East Coast – Otago Harbour – Dunedin Wharves and Goat Island/Rakiriri Southwestwards. Shoaling**

1. A survey indicates that depths significantly shoaler than charted can be expected in Dunedin Wharves extending eastwards from Cross Wharf and Victoria Wharf to Beacon No. 72.
2. Depths significantly less than charted can be expected extending southwestwards from Goat Island/Rakiriri to Beacon No.3 in vicinity of 45° 49'.65S, 170° 37'.33E.
3. Mariners are advised to exercise caution when navigating in these areas.
4. Charting action will take place in due course.

**Chart affected:    NZ 6612**

New Zealand Hydrographic Authority  
HITS 6612/259

**NZ 177(T)/17      NEW ZEALAND – South Island – East Coast – Approaches to Timaru. Lit Buoy**

1. The red port Outer Channel lit buoy, *Fl(3)R.10s* in position 44° 23'.12S., 171° 17'.36E. has been removed for maintenance until further notice.
2. Mariners are advised to exercise caution when navigating in the area.

**Chart temporarily affected: NZ 6422**

PrimePort Timaru  
HITS 6422/96

**NZ 182(T)/17      NEW ZEALAND – South Island – East Coast – Lyttelton Harbour/Whakaraupō – Port of Lyttelton. Marina Construction Activity**

1. Marina construction barges and floating plant will be undertaking construction activity in the area to the west of the limit bounded by the following co-ordinates, until further notice:
  - (a) 43° 36'.242S., 172° 42'.958E. (coastline)
  - (b) 43° 36'.441S., 172° 42'.791E. (coastline)
2. Un-lit piles, moored vessels, and other obstructions maybe encountered at any time.
3. The contractor working in the area can be contacted via VHF radio channel 12 or on 021 227 2191.
4. Mariners are advised to exercise caution when navigating in the area.

**Chart temporarily affected: NZ 6321**

Lyttelton Port of Christchurch  
HITS 6321/167

**NZ 183(T)/17      NEW ZEALAND – North Island – South Coast – Wellington Harbour. Point Halswell Northwestwards. Lit Buoy**

1. A lit yellow waverider buoy, *Fl(5)Y.20s*, is deployed in position 41° 16'.37S., 174° 50'.25E., until further notice.
2. Mariners are advised to exercise caution when navigating in the area.

**Chart temporarily affected: NZ 4633**

Greater Wellington Regional Council  
HITS 4633/120/1



**NZ 186(T)/17 NEW ZEALAND – North Island – East Coast – Hawke Bay – Whirinaki. Pan Pac Outfall Pipeline Reserved Area**

1. Former Notice – NZ 174(T)/17 is cancelled.
2. A reserved area for the exclusive use of construction traffic has been established until March 2018, bounded by the following co-ordinates:
  - (a) 39° 22'.31S., 176° 53'.95E.
  - (b) 39° 22'.90S., 176° 55'.75E.
  - (c) 39° 23'.85S., 176° 55'.25E.
  - (d) 39° 23'.41S., 176° 53'.35E.
3. Mariners are requested to keep clear of this area and exercise caution when navigating in the vicinity.

**Charts temporarily affected: NZ 56, NZ 561, NZ 5612**

New Zealand Diving & Salvage Ltd. & Hawke's Bay Regional Council  
HITS 5612/61

**NZ 188(T)/17 NEW ZEALAND – South Island – North Coast – Tasman Bay / Te Tai-o-Aorere and Golden Bay / Mohua. Spat Catching Areas**

1. Seasonal spat catching areas will be established in Tasman Bay / Te Tai-o-Aorere and Golden Bay / Mohua from November 2017 to May 2018. The perimeter corners are identified by cardinal marks at the following positions:

Tasman Bay / Te Tai-o-Aorere	(a) 41° 03'.32S., 173° 07'.21E.
	(b) 41° 04'.38S., 173° 04'.89E.
	(c) 41° 04'.55S., 173° 08'.23E.
	(d) 41° 05'.60S., 173° 05'.91E.
	(e) 41° 08'.53S., 173° 10'.93E.
	(f) 41° 08'.66S., 173° 11'.15E.
	(g) 41° 08'.72S., 173° 10'.70E.
	(h) 41° 08'.85S., 173° 10'.92E.
Golden Bay / Mohua	(i) 40° 45'.09S., 172° 50'.84E.
	(j) 40° 46'.03S., 172° 52'.88E.
	(k) 40° 46'.66S., 172° 49'.33E.
	(l) 40° 47'.62S., 172° 51'.33E.
	(m) 40° 42'.52S., 172° 46'.03E.
	(n) 40° 42'.58S., 172° 46'.58E.
	(o) 40° 43'.35S., 172° 46'.19E.
	(p) 40° 43'.47S., 172° 46'.76E.

2. Mariners are advised to exercise caution when navigating in the area.

**Charts temporarily affected: NZ 61, NZ 614, NZ 6142**

Tasman Bay Ring Road Spat Catching Ltd., Golden Bay Ring Road Spat Catching Ltd., Challenger Scallop Enhancement Co. Ltd. & Golden Bay Mussels Ltd.  
HITS 6144/53

**NZ 189(T)/17 SOUTH PACIFIC OCEAN. Maritime Safety Broadcasts - Optimum R/T Frequencies Within NAVAREA XIV**

1. Former notice - 142(T)/17 is cancelled.
2. The accompanying diagrams show the optimum R/T calling and working frequency bands and times for navigational warnings broadcast within 1000 nautical miles of Taupo Maritime Radio (ZLM) (38° 50'S., 176° 00'E. approx.) for the period November 2017 to January 2018.

Australian Government BoM Space Weather Services  
HITS -/49

**NZ 193(T)/17 NEW ZEALAND – North Island – East Coast – Poverty Bay to Mahia Peninsula, Eastwards. Scientific Instruments**

- \* 1. Former notice – NZ 176(T)/17 is cancelled.
- \* 2. Scientific instruments have been deployed on the seafloor at the following co-ordinates, until October 2018:

- (a) 38° 42'.44S., 178° 39'.68E.
- (b) 38° 42'.65S., 178° 39'.68E.
- (c) 38° 43'.51S., 178° 53'.66E.
- (d) 38° 51'.01S., 178° 52'.34E.
- (e) 38° 53'.59S., 178° 45'.29E.
- (f) 38° 54'.70S., 178° 59'.09E.
- (g) 39° 13'.96S., 178° 26'.04E.
- (h) 39° 16'.53S., 178° 43'.97E.
- (i) 39° 17'.82S., 178° 39'.19E.
- (j) 39° 18'.75S., 178° 32'.35E.

Mariners engaged in seabed trawling activities are requested to remain 2.5NM clear at all times.

- \* 3. Scientific instruments will be deployed on the seafloor in an area bounded by the following co-ordinates, from 1 December 2017 to 30 April 2018:

- (a) 38° 40'.45S., 178° 33'.42E.
- (b) 38° 53'.76S., 179° 01'.87E.
- (c) 38° 56'.55S., 178° 59'.75E.
- (d) 38° 43'.23S., 178° 31'.28E.

Mariners engaged in seabed trawling activities are requested to remain 500m clear at all times.

**Charts temporarily affected: NZ 23 (INT 640), NZ 26, NZ 55, NZ 56, NZ 14600 (INT 600)**

\* *Indicates new or revised entry.*

GNS Science  
HITS 55/127/2

**NZ 197(P)/17 NEW ZEALAND – South Island – East Coast – Otago Harbour – Port Chalmers. Wharf Works**

1. Mariners are advised that construction work is underway in the vicinity of the Multi Purpose Wharf until December 2018.
2. Mariners are advised to keep well clear of the area and to contact Harbour Control on VHF channel 14 for updates on water craft activity at the construction site.
3. The fixed green (neon) light at the north east corner of the existing wharf (45° 48'.58S., 170° 37'.67E.) has been temporarily removed.
4. Charting action will take place in due course.

**Charts affected: NZ 6612**

NZ Light List: 4369.86

New Zealand Hydrographic Authority  
HITS 6612/266