## **SLR Consulting New Zealand**

Level 2, 214 Collingwood Street, Hamilton 3204, New Zealand



19 March 2025

SLR Ref No.: Waipa s92 response

Attention: Hayley Thomas

**Project Planner** 

Waipā District Council

hayley.thomas@waipadc.govt.nz

SLR Project No.: 880.V11547.00001

Client Reference No.: 11547

Dear Hayley,

RE: Information Requested - LU/0231/24 & LU/0232/24 Former Tokanui

**Psychiatric Hospital** 

Please find below the information requested in your Request for Further Information under Section 92(1) of the RMA dated 12 February 2025 (the "Request").

Attachment 1 to the Request was Mr Jones' Environmental Health review. It is our understanding that this review includes his pre-lodgement review comments (which had been addressed), and that his review of the lodged application begins at the heading dated 14/05/25. However, a number of the earlier comments have been included in the Request – so we have addressed them for completeness.

#### 1. Acoustic Assessment

a) Clarification is requested to identify the location of the anticipated works and what will take place at the distances given from each of the occupied residences in Table 1. Confirmation that cumulative effects of multiple noise sources operating at the same time has been considered.

#### Response:

The Acoustic Assessment that was lodged as Appendix O to the Remediation Application was updated following Mr Jones' previous comments. Table 1 now states the separation distance between the 11 residences and the nearest below ground structure/element to be removed or area of remediation.

We confirm that cumulative effects of multiple noise sources operating at the same time have been considered.

b) Further information is requested to confirm if other noisy operations of the type listed above need to be assessed along with noise associated with movements of soil around the site, including lorry entry and exit routes.

## Response:

The Acoustic Assessment lists the anticipated noisy activities in the Project Description. These include excavators, milling plant, vibratory compactors, concrete crushing, and heavy truck movements. All of these activities have been assessed within the report.

c) Further information and clarification is sought to confirm locations of the works that have been assessed and what will be happening there. Additionally, further information is

19 March 2025 SLR Project No.: 880.V11547.00001 SLR Ref No.: Waipa s92 response

sought to confirm if other noisy construction plant, equipment and truck movement activities need to be assessed as well.

## Response:

This comment was taken from the conclusion of Mr Jones' comments and is already covered in the response to (a) and (b).

d) Further confirmation is sought that vibratory compaction will not be deployed on site.

#### Response:

Vibratory compaction is likely to be used but has been assessed as compliant. Please refer to section 3.2 of the Acoustic Assessment.

## 2. Demolition, Deconstruction and Remediation Management Plan (DDRMP)

An updated DDRMP to cover the recommendations outlined in Mr Jones review and comments provided in Attachment 1 regarding noise, dust and burning on site.

An updated DDRMP is attached to this response (Attachment A). Each of Mr Jones' comments are also addressed individually in the table below, as we did not consider that all of the comments required an update to the DDRMP.

#### Comment Response

## Dust, smoke and hazardous material

- 1. Proposals are requested to confirm the method of disposal of combustible waste materials on site. Burning of waste on site is almost always likely to cause complaint and should be avoided. The use of wood chipping and shredding with truck removal, is more friendly to local residents and environment than burning on site. However, the processing plant is noisy and needs to be located at a suitable separation distance from the residential locations and be included in the noise assessment.
- Text confirming no burning of waste was added to section 21.1 of the draft DDRMP following the pre-application comments. No further changes.

2. Movement of soil during the summer months is highly likely to cause dust issues unless managed appropriately. A Dust Management Plan will be required and strictly enforced. This Plan needs to include any proposals for hard material processing on site by crushing.

Additional text relating to dust management was added to section 20.1 of the draft the DDRMP following pre-application comments. With this addition, we consider a separate Dust Management Plan to be unnecessary. We prefer the demolition management measures to be contained primarily in one document.

3. An Asbestos Removal Plan needs to include mitigation of risk from airborne asbestos fibres leaving the site and security measures to prevent unauthorised access to asbestos materials or contaminated soils on site.

Text relating to mitigation of risk from airborne asbestos fibres was added to section 17.3.5 of the draft DDRMP, and site security is addressed in section 7.1 of the draft DDRMP. We consider a separate Asbestos Removal Plan to be unnecessary.

The site has 24/7 security measures in place, these will continue throughout demolition.



19 March 2025 SLR Project No.: 880.V11547.00001 SLR Ref No.: Waipa s92 response

#### Comment Response Noise Update the DDRMP to include the following in 20.2 NOISE: a) For clarity, the relevant noise compliance We agree with the first part of the comment criteria in NZS 6803 means that construction but consider that the noise limits from NZS noise level measured at 1m from the facade 6803:1999 are already clearly set out in Section 20.2 of the DDRMP, as well as the of any residential property shall not exceed 70 dB LAeg between 7.30am to 6.00pm on recommendations from the Acoustic any weekday or Saturday. It also means that Assessment which will ensure that these there will be no noisy activities involving limits are met and/or noise outcomes are movement of heavy vehicles or operation of acceptable. mechanical plant and equipment before 7.30am and after 6.00pm on any weekday or We disagree that no heavy vehicle movements or mechanical plant operation Saturday and none on Sundays and public holidays. could occur after 6pm. It is possible that this could comply with NZS 6803 depending on where it takes place within the site. Hours of operation are proposed to extend to 7pm to allow greater flexibility where the noise standards and acoustic recommendations are still able to be met. However, the DDRMP does restrict use of a hydraulic breaker and concrete crusher to 7.30am-6pm. No changes are proposed. b) There will be no physical detectable It is not considered useful or effective to add this into the DDRMP. The Acoustic vibration at any neighbouring residential property. Assessment has concluded that the vibration levels generated by the works is unlikely to impact on amenity and would avoid cosmetic damage surrounding buildings. at Compliance with DIN 4150-3 is readily expected. However, we cannot guarantee, nor is it a requirement of the standard, that there will be no physical detectable vibration at neighbouring residential properties. Identification of the most affected In our view this generally sits in the Acoustic premises where there exists the potential for Assessment rather than the DDRMP, as has noise/vibration effects. been done. The DDRMP then contains the recommended management resulting measures. No changes proposed. d) A description and duration of the works, The DDRMP contains a detailed description anticipated equipment and the processes to of the proposed works in sections 10 to 16. be undertaken. The Acoustic Assessment also contains a description of the works assessed with a focus on the noise generating activities/ equipment. No changes proposed. Section 22 of the DDRMP contains traffic e) Traffic management as vehicle noise mitigation measures. Measures to mitigate management measures including a speed limit. This has now been amended to include these noise effects would include for example, pot hole removal from roadways, some additional measures to mitigate vehicle speed restrictions, avoidance of tonal noise. However reversing signals are



Comment	Response
reversing signals and measures to mitigate	required for safety and it is not planned to
banging of tailgates.	avoid these.
f) Verification noise monitoring undertaken	Section 20.2 of the draft DDRMP has been
by an Acoustic Engineer at the first instance	amended to include the requirement
of tree removal works. The results of this	for acoustic verification monitoring at the first
monitoring to be used to identify appropriate	instance of any tree removal works that occur
mitigation measures to ensure that	within 45m of a dwelling, in line with condition
compliance with a level of 70 dBA LAeq is	D7 that was proposed in Appendix T to the
achieved. In the case of 203 and 207 Te	Remediation Application. It is only at this
Mawhai Road and any other properties	proximity to a dwelling that chainsaw noise
where the affected party approval has not	may exceed the noise limits (as assessed in
been obtained for this work to exceed a	the Acoustic Assessment) and as a result,
predicted exceedance of this noise limit, the	such vegetation removal is subject to
proposed options will be stated.	obtaining resource consent. We note that
	LINZ owns these properties as they are part
	of the subject site, therefore landowner
	approval is implicit.
g) Note: There will be an option to include an	We disagree that this is required. Offering
offer of alternative accommodation for the	alternative accommodation would generally
affected occupiers for the duration of work	only be the Best Practicable Option for night
where a level of 70 dBA LAeq is not able to	works exceeding internal noise limits. The
be achieved at their properties.	proposed hours of operation do not include
	night works, and internal noise limits are
	predicted to be met during the day (with
	windows closed if chainsawing is occurring in
	proximity).
h) Schedule and methods for monitoring and	The only noise/vibration monitoring
reporting on construction noise/vibration.	proposed is the verification monitoring for
	tree removal close to dwellings (as per
	above) and in response to noise and vibration complaints (see further below). No
	additional changes are required to the
	DDRMP.
i) Details of noise/vibration monitoring to be	Section 6.4 of the DDRMP contains details of
undertaken or in the event of any complaints	the complaints management system which
received. The results of such monitoring	relates to all complaints. Additional wording
shall be submitted to council within one week	relating specifically to noise complaints and
of receiving the complaint.	monitoring has been added.
j) Implementation of a complaint	Section 6.4 of the DDRMP contains details of
management system with contact numbers	the complaints management system. The
for key construction staff responsible for the	complaints register will be developed by the
implementation of the DDRMP and	Contractor and will include the requested
complaint investigation. This system should	procedures. No additional changes required.
include procedures for maintaining contact	
with stakeholders, notifying of proposed	
construction activities and handling of	
noise/vibration complaints.	As and and in any in the Court BREATH II
k) Construction operator training procedures.	As set out in section 4.3 of the DDRMP, the
	contractor's Site Management Plan will
	contain details of training requirements to
	prevent adverse effects on the environment.
	Additional wording related to training



19 March 2025 SLR Project No.: 880.V11547.00001 SLR Ref No.: Waipa s92 response

Comment	Response
	procedures has now been included in section 4.3.
2. 20.1 DUST of the DDRMP contains acceptable dust mitigation measures.	No action required.
3. The DDRMP will be updated at 21.2 BURNING to clarify that no vegetation will be burnt on site	Vegetation is not generally anticipated to be burnt with the possible exception of diseased trees that have biosecurity-related restrictions on their reuse/disposal. Section 21.2 of the updated draft DDRMP clarifies the circumstances under which vegetation may be burnt, and describes the controls that will be in place to ensure WRC's permitted activity requirements are met and neighbours do not experience offensive or objectionable effects.

## **Engagement Update (Not Part of Formal Further Information Request)**

There have been no written comments provided by iwi/hapū since the application was lodged. However, all interested parties were aware of the application being lodged and the details of the application. Since lodgement, engagement has continued, including monthly hui with Te Nehenehenui Trust, who have provided a letter of support for the proposal (Attachment B). TAR Block (Maria Maniapoto and Robert Te Huia) was also contacted and performed a karakia ahead of enabling vegetation removal works (not requiring consent) in February 2025.

We trust this response satisfies your queries. If you do however require any further information, please do not hesitate to contact us

Regards,

**SLR Consulting New Zealand** 

**Emily Buckingham** Principal Consultant - Planning

Emily.buckingham@slrconsulting.com

Mark Ashby Technical Director - Planning

Attachment A Updated draft Demolition, Deconstruction & Remediation Management Plan

Attachment B Letter from Te Nehenehenui Trust



19 March 2025

SLR Project No.: 880.V11547.00001

SLR Ref No.: Waipa s92 response



FORMER TOKANUI HOSPITAL
DEMOLITION AND REMEDIATION
DEMOLITION, DECONSTRUCTION & REMEDIATION
MANAGEMENT PLAN - DRAFT



Project No.	33205	Approved	for Issue
Version No.	7	Name	Sean Finnigan
Status	Final	Cianatura	1 4:00
Authors	E Bish / S Finnigan	signature	A Lig
Reviewer	S Finnigan	Date	18/03/2025

## Fraser Thomas Limited

Consulting Engineers, Licensed Surveyors Planners & Resource Managers Level 1, 21 El Kobar Drive, East Tamaki, Auckland, 2025

PO Box 204006, Highbrook, Auckland, 2025 Auckland, New Zealand

Tel: +64 9 278-7078 Email: sfinnigan@ftl.co.nz

# TOITŪ TE WHENUA – LAND INFORMATION NEW ZEALAND FORMER TOKANUI HOSPITAL DEMOLITION AND REMEDIATION

# **DEMOLITION, DECONSTRUCTION & REMEDIATION MANAGEMENT PLAN - DRAFT**

## **TABLE OF CONTENTS**

GLOSS	SARY	vii
1	INTRODUCTION	
2	OBJECTIVES	2
3	SCOPE	2
4	SPECIFIC REQUIREMENTS FOR DEMOLITION WORKS	4
4.1	COMPLIANCE WITH RESOURCE CONSENT REQUIREMENTS	4
4.2	ADHERENCE WITH STANDARDS, CODES, REGULATIONS AND GUIDELINES	4
4.3	SITE MANAGEMENT PLAN REQUIREMENTS.	4
5	CULTURAL AND ARCHAEOLOGICAL REQUIREMENTS.	6
5.1	CULTURAL REQUIREMENTS	
5.2	ARCHAEOLOGICAL DISCOVERY PROTOCOL	
6	COMMUNICATION	
6.1	INFORMATION FOR IWI, HAPU & SPECIAL INTEREST GROUPS	
6.2	INFORMATION FOR NEIGHBOURS	8
6.3	INFORMATION FOR THE GENERAL PUBLIC	
6.4	COMPLAINTS	8
7	GENERAL REQUIREMENTS	
7.1	SITE SECURITY	9
7.2	SITE OFFICE, CONTRACTORS YARD AND REFUELING	10
7.3	SERVICES AND AMENITIES	10
7.4	NEAREST MEDICAL CENTRE	11
7.5	OTHER CONTACTS	11
8	SITE CONSTRAINTS	11
9	EXISTING INFRASTRUCTURE TO BE PROTECTED	12
9.1	FARM WATER SUPPLY	12
9.2	WASTEWATER PUMP STATION	13
9.3	TERRACE RETAINING WALL	13
9.4	TRUNK STORMWATER	13
10	DEMOLITION/DECONSTRUCTION WORKS PHILOSOPHY AND SEQUENCING	14
10.1	DEMOLITION/DECONSTRUCTION PHILOSOPHY	14

10.2	POTENTIAL MATERIALS REUSE AND RECOVERY	14
10.3	WORKS BREAKDOWN AND SEQUENCING	15
11	BUILDINGS	16
11.1	SCOPE	16
11.2	METHODOLOGY	17
11.3	KEY BUILDINGS	18
	11.3.1 Boiler House (B68)	18
	11.3.2 Ward 21 (two storey portion) (B26)	20
	11.3.3 Waipā Community and Training Centre (B10)	21
	11.3.4 Ward B (two storey masonry portion) (B12)	22
	11.3.5 Main Administration Building (B1)	23
	11.3.6 Village Hall (B36)	24
11.4	OPUS (2015) BUILDING INSPECTION REPORTS	25
11.5	3D BUILDING SCANNING (2023)	
11.6	HAZARDOUS SUBSTANCES	25
12	HORIZONTAL INFRASTRUCTURE	26
12.1	ROADING/PAVEMENT	
	12.1.1 Background Information	26
	12.1.2 Coal Tar Assessment	27
	12.1.3 Removal of Roading/Pavement	28
12.2	CONCRETE DUCTING	32
	12.2.1 Background	32
	12.2.2 Removal of Concrete Ducting	
12.3	OTHER SERVICES	34
	12.3.1 Water Reticulation	35
	12.3.2 Wastewater Reticulation	36
	12.3.3 Stormwater Reticulation	37
	12.3.4 Power and Telecom	38
13	CONTAMINATED SOIL	38
14	WHAREKŌRINO STREAM EMBANKMENT REMOVAL AND REINSTATEMENT	
14.1	BACKGROUND	
14.2	METHODOLOGY	40
15	WWTP WORKS AND WORKS IN OR NEAR WETLAND AREAS	
15.1	NORTH-WESTERN WETLAND	
	15.1.1 Wastewater Pipeline	41

	15.1.2 Power Cabling	43
	15.1.3 Building 76	44
15.2	NORTH-EASTERN WETLAND - WWTP AREA	44
	15.2.1 Further WWTP Demolition Works	44
	15.2.2 WWTP Works within or near NE Wetland	52
16	PIPE LINING WORKS	53
17	HEALTH & SAFETY	_
17.1	GENERAL	54
17.2	SITE SPECIFIC SAFETY PLANS (SSSPS) & JOB SAFETY ANALYSES (JSAS)	
17.3	HAZARDOUS SUBSTANCES MANAGEMENT	55
	17.3.1 Asbestos Contaminated Building Materials (ACM)	55
	17.3.2 Asbestos Pipes	56
	17.3.3 Lead Paint Contaminated Building Materials	56
		57
	17.3.5 Contaminated Dust	57
	17.3.6 Buried Historical Demolition Debris	57
	17.3.7 Coal Tar Roading Materials	58
	17.3.8 Hazardous Substances	59
18	SITE SUPERVISION	
18.1	GENERAL	
18.2	KEY PERSONNEL CONTACT DETAILS	60
19	EROSION AND SEDIMENT CONTROL	60
20	DUST, NOISE AND VIBRATION	
20.1	DUST	
20.2	NOISE	62
20.3	VIBRATION	
21	MATERIALS MANAGEMENT	
21.1	BURNING	
21.2		
21.3	TREE PROTECTION AND REMOVAL	
21.4	TEMPORARY STORAGE/STOCKPILING	
21.5	MACHINERY/PLANT CLEANING FOR SEED/PLANT MATTER REMOVAL	
21.6	LOADING AND TRANSPORTING CONTAMINATED MATERIALS	65
21.7	IMPORTED CLEANFILL	65
21.8	OFF-SITE DISPOSAL	66

21.9	RECORD KEEPING	66
21.10	ACCIDENTAL DISCOVERY PROTOCOLS	67
22 22.1	TRAFFIC MANAGEMENTGENERAL	
22.2	SITE SPEED LIMIT	67
22.3	VEHICLE ACCESS	68
22.4	PUBLIC ROAD DILAPIDATION SURVEY	68
22.5	CONTRACTOR PARKING	68
22.6	TRAFFIC MANAGEMENT PLANNING AND CONTROL (ON-SITE)	68
22.7	TRAFFIC MANAGEMENT PLANNING AND CONTROL (OFF-SITE)	68
22.8	SIGNAGE	69
22.9	MINIMISING IMPACT ON ROAD NETWORK	69
22.10	PEDESTRIAN MANAGEMENT	69
23	REFERENCES	

## GENERAL DRAWINGS (INCLUDED IN THIS REPORT)

33205/G01 Site Features33205/G02 Site Amenities

# **DETAILED DRAWINGS (provided separately)**

33205/0001 LEGEND
33205/2001 WASTEWATER DEMOLITION PLAN (SHEET 1 OF 9)
33205/2002 WASTEWATER DEMOLITION PLAN (SHEET 2 OF 9)
33205/2003 WASTEWATER DEMOLITION PLAN (SHEET 3 OF 9)
33205/2004 WASTEWATER DEMOLITION PLAN (SHEET 4 OF 9)
33205/2005 WASTEWATER DEMOLITION PLAN (SHEET 5 OF 9)
33205/2006 WASTEWATER DEMOLITION PLAN (SHEET 6 OF 9)
33205/2007 WASTEWATER DEMOLITION PLAN (SHEET 7 OF 9)
33205/2008 WASTEWATER DEMOLITION PLAN (SHEET 8 OF 9)
33205/2009 WASTEWATER DEMOLITION PLAN (SHEET 9 OF 9)
33205/2010 WASTEWATER TREATMENT PLANT DEMOLITION WORKS
33205/2011 WASTEWATER DEMOLITION WORKS IN NW WETLAND – PIPE SUPPORT DETAILS
33205/2100 STORMWATER DEMOLITION PLAN LAYOUT
33205/2101 STORMWATER DEMOLITION PLAN (SHEET 1 OF 9)
33205/2102 STORMWATER DEMOLITION PLAN (SHEET 2 OF 9)
33205/2103 STORMWATER DEMOLITION PLAN (SHEET 3 OF 9)
33205/2104 STORMWATER DEMOLITION PLAN (SHEET 4 OF 9)
33205/2105 STORMWATER DEMOLITION PLAN (SHEET 5 OF 9)

33205/2106 STORMWATER DEMOLITION PLAN (SHEET 6 OF 9)

33205/2107 STORMWATER DEMOLITION PLAN (SHEET 7 OF 9)
33205/2108 STORMWATER DEMOLITION PLAN (SHEET 8 OF 9)
33205/2109 STORMWATER DEMOLITION PLAN (SHEET 9 OF 9)
33205/2200 WATER DEMOLITION PLAN LAYOUT
33205/2201 WATER DEMOLITION PLAN (SHEET 1 OF 9)
33205/2202 WATER DEMOLITION PLAN (SHEET 2 OF 9)
33205/2203 WATER DEMOLITION PLAN (SHEET 3 OF 9)
33205/2204 WATER DEMOLITION PLAN (SHEET 4 OF 9)
33205/2205 WATER DEMOLITION PLAN (SHEET 5 OF 9)
33205/2206 WATER DEMOLITION PLAN (SHEET 6 OF 9)
33205/2207 WATER DEMOLITION PLAN (SHEET 7 OF 9)
33205/2208 WATER DEMOLITION PLAN (SHEET 8 OF 9)
33205/2209 WATER DEMOLITION PLAN (SHEET 9 OF 9)
33205/2300 COMMS DEMOLITION PLAN LAYOUT
33205/2400 POWER DEMOLITION PLAN LAYOUT
33205/2401 POWER DEMOLITION PLAN (SHEET 1 OF 9)
33205/2402 POWER DEMOLITION PLAN (SHEET 2 OF 9)
33205/2403 POWER DEMOLITION PLAN (SHEET 3 OF 9)
33205/2404 POWER DEMOLITION PLAN (SHEET 4 OF 9)
33205/2405 POWER DEMOLITION PLAN (SHEET 5 OF 9)
33205/2406 POWER DEMOLITION PLAN (SHEET 6 OF 9)
33205/2407 POWER DEMOLITION PLAN (SHEET 7 OF 9)
33205/2408 POWER DEMOLITION PLAN (SHEET 8 OF 9)
33205/2409 POWER DEMOLITION PLAN (SHEET 9 OF 9)
33205/2500 CONCRETE STEAM DUCT DEMOLITION PLAN LAYOUT
33205/2700 ROADING DEMOLITION PLAN LAYOUT
33205/2702 EXISTING ROADING CONDITION ASSESSMENT
33205/2800 COMBINED SERVICES LAYOUT
33205/LF400 EXISTING CULVERT 2 PLAN
33205/LF410 PROPOSED CULVERT 2 REMOVAL – PROPOSED FINAL DESIGN PLAN
33205/LF430 PROPOSED CULVERT 2 REMOVAL CROSS SECTIONS
33205/LF440 PROPOSED CULVERT 2 CUT AND FILL PLAN
33205/EMB000 CULVERT 2 – EXISTING SITUATION
33205/EMB001 CULVERT 2 REMOVAL PLAN
33205/EMB002 CULVERT 2 REMOVAL – CROSS SECTIONS
33205/EMB003 CULVERT 2 REMOVAL – CUT AND FILL PLAN
•
2220F /DL004 FYICTING LIDGTDE ANA CTODNAVA ATED CATCUNATED DA AN


**EXISTING UPSTREAM STORMWATER CATCHMENT PLAN** 

33205/PL001

33205/PL002 STORMWATER TRUNK MAIN LAYOUT PLAN 33205/PL003 STORMWATER SYSTEM CCTV SURVEY PLAN

#### **APPENDICES**

- **Buildings Data Summary** Α
- В Wastewater Pipe Details in NW Wetland
- С

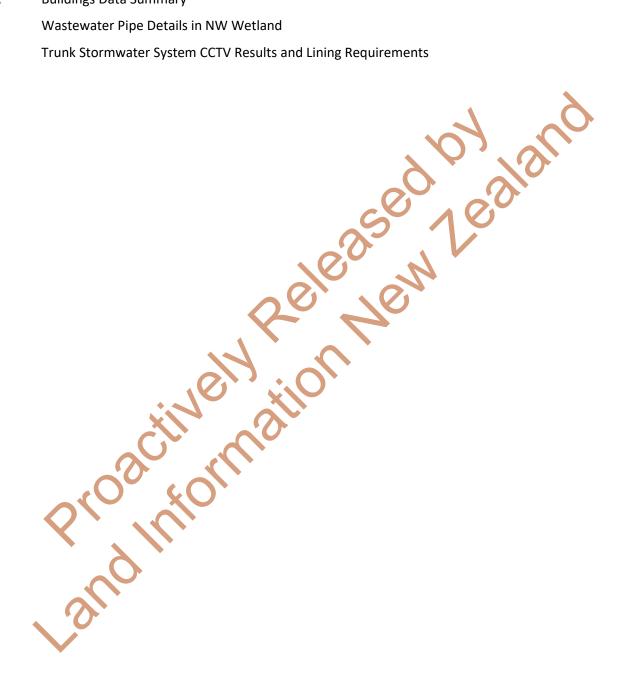

# **GLOSSARY**

CONTAMINATED	Hazardous building materials that pose some level of risk to human health and/or
MATERIALS	the environment, such as asbestos or lead-based paint, which potentially affects
	materials handling, haulage and/or disposal requirements.
	Please note, management of contaminated soil as part of the demolition and
	remediation project follows the remedial standards process as outlined in the
	Tokanui Hospital Deferred Selection Process.
CONTAMINATED	Contaminated land is defined by the Ministry for the Environment as sites at which
LAND	hazardous substances occur at concentrations above background levels and where
	assessment indicates it poses, or is likely to pose, an immediate or long-term risk to
	human health or the environment.
DEED OF	The Ngāti Maniapoto Deed of Settlement signed by Maniapoto and the Crown,
SETTLEMENT (DEED)	which was signed on 11 November 2021 and given effect by the Maniapoto
	Settlement Claims Act 2022, which came into force on 28 September 2022.
DEFERRED	Is as defined in s154 of the Maniapoto Settlement Claims Act 2022. It means a
SELECTION	property described in subpart A or C of part 4 of the property redress schedule for
PROPERTY	which the requirements for transfer under the deed of settlement have been
	satisfied.
DEMOLITION AND	The physical works required to carry out the demolition and remediation of each
REMEDIATION	Tokanui Hospital deferred selection property (excluding any new disposal site or
WORKS*	existing disposal site on that property) as described in paragraph 9.16
EXISTING DISPOSAL	The two existing sites (as described in the existing disposal consents) located on one
SITES*	of the Tokanui Hospital deferred selection properties that the Crown historically used
	to dispose of waste; indicated as 'Existing disposal sites' on the plan (subject to
	survey) 'Tokanui Hospital deferred selection properties' in part 7 of the attachments
GOVERNANCE	The Ngāti Maniapoto post settlement governance entity, Te Nehenehenui Trust
ENTITY	
HORIZONTAL	The roading and accessways, foundations and services that the Crown, with the
INFRASTRUCTURE*	consent of the relevant Ministers as required, decides must be retained on the
` \	relevant Tokanui Hospital deferred selection property, in accordance with
	paragraph 9.9 of the Deed.
	Please note, at the date of this report, it is assumed that building foundations will be
	removed as part of the vertical demolition package rather than under horizontal
	infrastructure as stated in the Deed.
MINISTERS*	The Minister of Finance, Minister for Land Information, and Minister for Treaty of
	Waitangi Negotiations
NEW DISPOSAL SITE*	A site which may be located on part of a Tokanui Hospital deferred selection
	property, such location to be determined in accordance with paragraph 9.9, where
	the Crown may, as part of the demolition and remediation works, dispose of
	contaminated and/or non-contaminated materials and waste in accordance with
	paragraph 9.12.

NON- CONTAMINATED MATERIALS	Building materials that do not contain any contaminated materials, as defined above and may be suitable for reuse and/or recycling	
PURCHASED TOKANUI HOSPITAL DEFERRED SELECTION PROPERTY*	Means a Tokanui Hospital deferred selection property that is also a purchased deferred selection property	
SETTLEMENT DATE	Is defined as s12 of the Maniapoto Settlement Claims Act 2022, being 24 November 2022.	
VERTICAL BUILDING STRUCTURES*	All above-ground built structures on a Tokanui Hospital deferred selection property, excluding horizontal infrastructure	
*DENOTES DEFINITIONS RELEVANT TO THIS REPORT COPIED FROM THE TOKANUI HOSPITAL DEFERRED SELECTION PROCESS, SUBPART A: DEFINITIONS.		

# TOITŪ TE WHENUA – LAND INFORMATION NEW ZEALAND FORMER TOKANUI HOSPITAL DEMOLITION AND REMEDIATION

## **DEMOLITION, DECONSTRUCTION & REMEDIATION MANAGEMENT PLAN - DRAFT**

#### 1 INTRODUCTION

The former Tokanui Hospital (the Site) was a psychiatric hospital approximately 80 hectares (ha) in area, with 76 buildings, a wastewater pump station, swimming pool, eight substations, a closed landfill (also referred to as the 'existing disposal site') and substantial roading and underground infrastructure and services. The site location and extent is shown in Figure 1

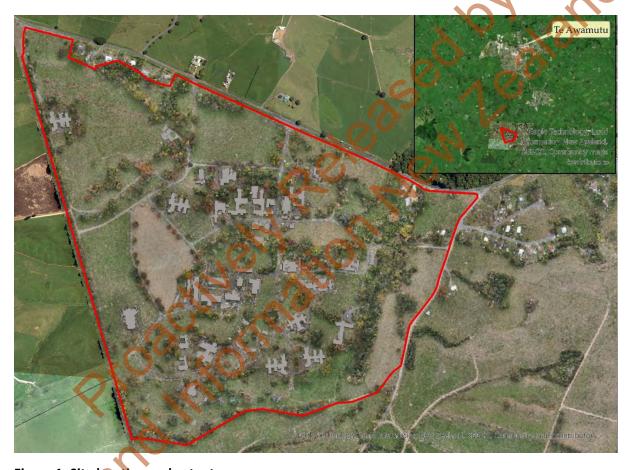


Figure 1: Site location and extent

The Site is currently managed by Toitū Te Whenua Land Information New Zealand (LINZ) on behalf of the Crown but has been held in the Treaty Settlements Landbank since 1999 following the hospital's closure in 1998. Land held in the Landbank is Crown land which has been declared surplus can be used as cultural or commercial redress in Tiriti o Waitangi Settlement claims.

The Ngāti Maniapoto (herein referred to as Maniapoto) Deed of Settlement (the Deed), that was initialed in December 2020, acknowledged the cultural significance of the Site and the need for demolition and remediation of the Site before it can be offered to Maniapoto.

Under the Deed, Maniapoto and the Crown have agreed that LINZ complete the demolition and remediation of the Site. The proposed demolition, deconstruction and remediation works cover the following:

- "Vertical building structures": all above-ground built structures within Areas 2, 3 and 4 of the Tokanui Hospital site, including associated footings/foundations.
- "Horizontal infrastructure": Partial removal of the roading, accessways, and services as defined in Table 1.
- "Contaminated land": Contaminated land is defined by the Ministry for the Environment as sites at
  which hazardous substances occur at concentrations above background levels and where assessment
  indicates it poses, or is likely to pose, an immediate or long-term risk to human health or the
  environment.

These works, for simplicity, are referred to in this plan as the "demolition works", while this plan is referred to as the **DDRMP** (Demolition, Deconstruction and Remediation Plan - Draft).

This document has been prepared and provided as a draft for consultation and use, and is intended to remain a live document, to ensure it is updated regularly.

#### 2 OBJECTIVES

The primary objective of this DDRMP is to:

- Provide relevant background information on the Site and the nature of the proposed demolition works:
- Describe the proposed demolition works scope; and
- Set out the requirements contractors need to follow in relation to the specified demolition works.

#### 3 SCOPE

The scope of the works is summarised in Table 1.

Table 1: Scope of Demolition, Deconstruction and Remediation Works

Item 🗸 🔾	Required Works	
BUILDINGS		
Buildings, including	Demolition and/or deconstruction of all buildings within Areas 2, 3 and 4 of the	
footings/	site, including all footings/foundations. This includes historic demolition debris	
foundations	buried around specified buildings that is inferred to come from historic building	
	renovation, demolition and/or extension works.	
HORIZONTAL INFRASTRUCTURE		
Roading/ paving	Removal of 3.49ha roading/paving and up to 4,180m³ of coal tar and reinstate	
(6.3ha, 8.8km)	with up to 13,730m³ backfill (solid measure); 3.5km residual roading retained	
	and converted to farm access track standard (i.e. remove paving and retain	
	hardfill basecourse (Option RD3)	
Old road	Removal of redundant road embankment crossing over Wharekorino Stream	
embankment &	(approximately 6m wide by 50-60m long); earthworks over 3000m <sup>2</sup> area of	
Culvert 2 (~1350dia)	approximately 6800m³ volume, stream bank grading and riparian planting	
	(Option RD4)	

Concrete Ducts	Remove entire system (2937m); 880m³ minimum backfilling (Option CD1)		
Other Services	Partial removal: 633 surface features (MHs, fire hydrants, valve boxes, etc.) and		
	associated infrastructure to 800mm depth for pipes/ducts (including water		
	supply, wastewater and stormwater pipes except for the trunk stormwater		
	system) and associated structures down to 1m depth (Option OS2C)		
WASTEWATER	Removal of remaining WWTP infrastructure, grit chamber, inlet pipe and		
TREATMENT PLANT	footbridge, trickling filter and stone media, UV treatment system, flow meter		
(WWTP)	and outlet pipe.		
CONTAMINATED SOIL			
Contaminated Soil	Low and moderate level contaminated soil from around the perimeters (halos)		
	of many buildings on-site, comprising almost entirely allophanic topsoil, and		
	containing primarily lead or asbestos contaminants, plus other non-building		
	areas with localised pockets of fill containing construction and demolition		
	debris and some heavy metal, hydrocarbon and/or asbestos contamination.		

**Note:** The options names referred to above come from the separate Horizontal Infrastructure report and are included here for easy cross-referencing to that report.

The 633 surface features referred to under "other services" are listed in Table 2.

Table 2: Infrastructure Features Inventory and Condition

Asset/underground	Comments	No	Condition
service			
Power	Light poles (99), power	124	Moderate to poor
	poles (18), other (7)	1	
Concrete ducting	Concrete duct access	37	Generally moderate
	chambers (37)		
Water	Fire hydrants (41), valves	66	Very poor
	(25)		
Stormwater	Manholes (145),	201	Moderate
	catchpits (56)		
Wastewater	Manholes (152)	152	Poor to very poor
Telecom	Telecom post	7	Moderate
Unknown lids	4x4 lids	46	Moderate
Total		633	

Note: WWTP remaining infrastructure is covered in Table 1.

Trunk stormwater system lining works are included in this report, but will be undertaken separately from the demolition works.

The scope does not cover:

- An existing farm water supply system.
- An existing stone and mortar retaining wall, comprising 3 terraces of variable height 0.55-1.70m high.
- A wastewater pump station.
- The closed disposal site (landfill).

This infrastructure is described in section 9 and needs protecting from damage during the demolition works.

#### 4 SPECIFIC REQUIREMENTS FOR DEMOLITION WORKS

Specific requirements for the demolition works are set out in this section covering resource consent requirements, adherence with standards, codes, regulations and guidelines and Site Management Plan requirements. These requirements are based on the best available information at this time and allow for contractors following a best practice approach, taking into account expected measures to manage and/or mitigate potential human health and environmental effects.

The works may be undertaken by one or more (main) contractors (and their sub-contractors) working in different areas.

## 4.1 COMPLIANCE WITH RESOURCE CONSENT REQUIREMENTS

LINZ is in the process of obtaining all necessary resource consents for the demolition works. This plan will be updated, to include any additional specific consent condition requirements not covered by it, following the granting of resource consent.

## 4.2 ADHERENCE WITH STANDARDS, CODES, REGULATIONS AND GUIDELINES

It is expected that all contractors will follow applicable standards, codes, regulations and guidelines during the contract, including but not limited to the following:

- Auckland Council, ACS740 Recycled Aggregates, version 1.0, Rev 0, December 2023
- BRANZ (2014), "Waste Reduction Demolition"
- BRANZ and ALGA (2017), "New Zealand Guidelines for Assessing and Managing Asbestos in Soil"
- Codes of Practices for Hazardous Substances refer epa.govt.nz and worksafe.govt.nz for further information.
- Ministry for the Environment, "Contaminated Land Management Guidelines
- Toitū Te Whenua Health and Safety Guidelines Working with Lead-based Paints
- NZDAA Best Practice Guidelines for Demolition in New Zealand 2011"
- WorkSafe New Zealand (2016), "Management and Removal of Asbestos Approved Code of Practice"
- WorkSafe New Zealand (2016) "Excavation Safety Good Practice Guidelines"

## 4.3 SITE MANAGEMENT PLAN REQUIREMENTS

Subject to the above, each main contractor shall prepare an overall Site Management Plan (SMP) that specifically addresses:

- Project team structure, resources (human and plant), methodology, staging and programme.
- Health and safety.
- Quality assurance/control.
- Traffic management.
- Environmental Management of activities within their Work Area or directly related to activities outside
  of their Work Area, noting that it is the intention of LINZ that all Main Contractors take all practicable
  steps to implement environmental controls so as to prevent discharges beyond the boundary of their
  Work Area.

• Incorporate any specific requirements of LINZ (as stipulated) in the overall management of discharges and/or other adverse effects that may or may not be an indirect result of the main contractor's activities (within or outside their Work Area).

The SMP must comply with this DDRMP and other supporting management plans. The following table sets out the proposed outline of each main contractor's SMP.

**Table 3: Contractor Site Management Plan Outline** 

Section/Component	Description
Project team structure,	Contractor proposed team structure (including responsibilities), including
resources (human and	sub-contractors, all resources (human and plant) and methodology for each
plant), methodology,	work component, staging and overall programme
staging and programme	
Health and safety	Health and safety plan, in compliance with best practice and NZ regulations
	and guidelines.
Quality	Quality assurance/control system, including any hold points, compliance
assurance/control	monitoring and certification details. See further below for specific
	environmental assurance and monitoring requirements.
Traffic management plan	Site traffic management plan, as the project will involve significant vehicle
	movements on and offsite.
Erosion and Sediment	Final ESCP for Council certification, based on draft ESCP included with
Control Plan (ESCP)	consent application.
Standards, Regulations	List the applicable standards, codes, regulations
and Guidelines	and guidelines the Contractor will apply during the contract.
Consents & Permits	Provide a register of all permits and consents pertaining to the
Register	activities being undertaken by the contractor.
Key Environmental	Provide a detailed description of the key environmental factors to be
Factors & Risks	managed during the construction. Undertake a risk assessment and provide
	a risk register defining the mitigation measures for all key environmental
	factors identified.
Competency & Training	Describe the specific training and/or competency requirements
	required to prevent adverse effects on human health and the environment
	from each key task type undertaken. Provide a description of how works
	management will be effectively addressed through site induction,
<b>~</b> O	competency certification and minimum training standards.
Communications	Provide a plan for how site management policies and
	procedures will be communicated to the project team.
Safe Work Method	Provide specific and detailed safe work method statements for the
Statements	management and mitigation of key human health and environmental risks
	identified by the contractor including procedures for the prevention,
	isolation and clean-up/removal of environmental incidents. Procedures shall
	be developed for the following, as a minimum:
	a. Transportation, unloading, storage, processing and reuse of
	materials removed from the site.
	b. Monitoring and reporting of the quantity, specific location and
	end use of materials removed from the site.

Section/Component	Description	
	c. Soil and water management.	
	d. Flora and fauna management, including trees, bats, birds and fish.	
	e. Visual, landscape and rehabilitation management.	
	f. Noise and vibration management.	
	g. Air quality management (including dust).	
	h. Accidental Discovery Protocol (procedure to stop work in the	
	unlikely event of a discovery of items of archaeological or heritage	
	significance, in accordance with this Site Management Plan).	
Assurance &	Provide a programme of and describe the quality and environmental	
Monitoring	assurance and monitoring activities that will be implemented to ensure	
	compliance with the requirements of this SMP, and specific	
	conditions imposed on LINZ as part of any resource consents, and to	
	prevent any adverse effects. Provide a checklist template for regular	
	inspections of site hazards and controls that will be used by the contractor	
	to verify that site management practices are in place.	
Complaints Procedure	Provide a detailed procedure for the management of complaints and	
& Register	the complaints register (refer Section 6).	
<b>Emergency Response</b>	Provide a detailed procedure for emergency response to each type of	
Plan	discharge/spill that might occur (as identified by the contractor's risk	
	assessment).	
Noise & Vibration	Training related to construction noise and vibration management and	
Management	awareness for personnel working on the site will be undertaken as part of	
	the site induction programme. This requires personnel to participate in an	
	induction training session when they commence work. Induction will	
	include:	
	Roles and responsibilities for the management of construction noise and	
	vibration.	
	Relevant noise and vibration criteria.	
	Information about noise and vibration sources on-site and locations of	
~~	critical surrounding receivers.	
~40	Noise and vibration mitigation measures and management procedures.	
	• Complaints management procedures.	
	In addition to the above general induction training, specific activities that	
	may generate significant noise and/or vibration effects will be identified at	
70,	"tool-box" meetings prior to those works being undertaken. The tool-box	
	meetings should also be used to address any concerns or complaints that	
'0'	have been raised.	

## 5 CULTURAL AND ARCHAEOLOGICAL REQUIREMENTS

## **5.1 CULTURAL REQUIREMENTS**

The former Tokanui Hospital site is of high cultural significance to tangata whenua, specifically to an identifiable subset of hapū with traditional and customary authority over the former hospital site Pokuru 1B and the surrounding geographical area. These hapū include: Ngāti Ngutu, Ngāti Huiao, Ngāti Paia, and Ngāti Paretekawa.

Specific recommendations from the Cultural Impact Assessment (CIA) prepared for the hospital site relevant to the demolition works are summarised in Table 4. The Archaeological discovery protocol is set out in section 6.2, while know significant heritage, cultural and archaeological features are summarised in section 8.

Table 4: CIA Recommendations relevant to Demolition Works

Recommendation	Contractor Requirement
Protecting waipuna/freshwater springs that may be discovered during remediation.	No springs identified to date. Contractor to stop work if any springs encountered and advise LINZ Project Engineer and Cultural Monitor.
Identification of trees with Iwi that will remain standing and those which will may be felled if required	Completed, with identified trees to be protected shown on 33205 series drawings; also refer section 20.2 for further information
Regard be given to the specific provisions in the Heritage New Zealand Pouhere Taonga Act (2014) and the Protected Objects Act (2006) to protect waahi tapu, significant cultural sites and taonga.  Development and implementation of a robust Accidental Discovery Protocol (ADP).  Precautionary approach to site works to manage the potential for waahi tapu and taonga tuku iho discovery.	Refer section 5.2 below.  Specific cultural/archaeological areas of concern identified and shown on drawing 33205/G01, precautionary approach taken through appointment of cultural monitors and procedures set out in section 5.2
The adverse effects of resource use and activity operations are managed so as to appropriately protect areas and sites of significance.	Addressed in this DDRMP, with contractors to cover in their SMP.
Ensure Tangata Whenua are actively involved in key project planning, contracting and cultural monitoring roles and decision processes.	In progress.
Cultural Monitors/Kaitiaki be appointed for the project to manage and monitor cultural safety protocols.	TBC. Details will be included in Table 14.

It is mandatory that all contractor staff attend a cultural induction prior to the commencement of any works on-site. Details of the induction will be provided during the tender process. The site may also be blessed prior to demolition works starting.

## 5.2 ARCHAEOLOGICAL DISCOVERY PROTOCOL

The following protocols should be followed in the event of the accidental or unexpected discovery of archaeological features, including human remains:

- 1. All work within the vicinity of the discovery should cease immediately.
- 2. A buffer of at least 5m should be set up around the discovery and this should be marked on the ground, preferably with pegs and tape, or similar.
- 3. All machinery and plant should be removed from the buffer zone where this is possible.
- 4. The site archaeologist, or other qualified archaeologist, should be informed.
  - i. Heritage New Zealand Pouhere Taonga (HNZPT) should be informed.

- ii. If the discovery is of Māori origin, the relevant tāngata whenua authorities should also be informed (i.e. the appointed Cultural Monitors/Kaitiaki). Appropriate protocols (tikanga) should be observed.
- iii. If the discovery is of human remains, the New Zealand Police should also be informed.
- 5. The archaeologist should take relevant steps to secure the area of the discovery.
- 6. The archaeologist will assess the discovery and advise HNZPT and the client on the relevant steps to be taken.
- 7. Works in the area of the discovery shall not recommence until authorised in writing by the archaeologist in consultation with any identified affected parties or HNZPT.

It should however be noted that these protocols are preliminary, and must be reviewed by mana whenua prior to physical works beginning at the site. They will also be updated to reflect the requirements of the Archaeological Authority for the project, once this is approved.

#### **6 COMMUNICATION**

## 6.1 INFORMATION FOR IWI, HAPU & SPECIAL INTEREST GROUPS

All communications between contractors and lwi, Hapu or any special interest groups must be approved by LINZ and be in accordance with the official communications plan for this project.

#### 6.2 INFORMATION FOR NEIGHBOURS

The nearby neighbours who may be affected by noise, dust or smoke will be made aware of:

- The extent and duration of the works and type of works proposed;
- The reasons for the demolition, deconstruction and remediation works; and
- A line of communication from the nearby property owners to:
  - (i) Contractor's representative.
  - (ii) The representative of the consultants managing the project.
  - (iii) The LINZ representative.

This line of communication will normally include work, after hours and mobile telephone numbers and a priority list of who to contact first to obtain assistance.

## 6.3 INFORMATION FOR THE GENERAL PUBLIC

Information to be provided to the general public will be in accordance with the official communications plan for this project.

#### 6.4 COMPLAINTS

All contractors shall include a detailed procedure for the management of complaints from the public and other stakeholders in their Site Management Plan.

A Complaints register shall be developed and maintained by the Contractor in a structured, clear and legible format. As a minimum, the following information about any complaints shall be recorded:

- The contact details of the complainant, including name, entity represented (if any), address, contact telephone number(s).
- The nature and description of the complaint.
- The location of the complainant, and of the place where the complaint was first noticed.
- Date and time of the complaint, plus any other details relevant to the complaint e.g. the prevailing wind direction for a dust complaint.
- How the complaint was resolved or followed up.

Any complaints identified as relevant to the construction activities shall be notified to the LINZ project representative as soon as practicable and within the same working day as a minimum. LINZ (or their nominated agent) shall be responsible for notifying Waipā District Council or Environment Waikato (as applicable) within 24 hours of receipt of a complaint, in accordance with any consent conditions, if required. LINZ (or its nominated party), in conjunction with the contractor, will be responsible for investigating and resolving all complaints as soon as practicable.

All complaints and means of resolution shall be discussed and minuted at the next project site meeting, to ensure that lessons learned are incorporated into forward work practices.

Noise and/or vibration complaints will be responded to in a prompt manner. In addition to recording the above information, the [Contractor's representative] shall:

- Immediately check activities and subjective noise or vibration levels in the area near the complainant's property and, if appropriate, other parts of the site.
- If activities are identified that are considered to be generating excessive noise or vibration, the
  project team representative shall take appropriate action (e.g., implementation of mitigation
  measures, change of construction methodology, etc.) to reduce noise or vibration to an acceptable
  level.
- Contact the complainant and advise them of the outcome of the investigation and make a written note in the complaint book of the event and the outcome.

If a complaint cannot be resolved through the above process, it may be necessary to arrange noise and/or vibration monitoring to determine the actual noise and/or vibration levels on the complainant's property. The results of such monitoring shall be submitted to council within one week of monitoring.

#### 7 GENERAL REQUIREMENTS

## 7.1 SITE SECURITY

LINZ is responsible for maintaining security at the single site access point through the provision of security resources to:

- Prevent the egress of unauthorised person(s) onto the site.
- Undertake regular patrols of the site (excluding Contractor's Work Areas) to prevent the egress of unauthorised persons to parts of the Site outside of Contractor's Work Areas

Site security has their own portacom for night security located adjacent to the main access road. This area has its own dedicated power supply. The portacom is not to be removed or used by contractor staff. The

power supply to this portacom is to be protected from damage, with the contractor being responsible for repairing any damage to it caused by them.

The contractor shall discuss and agree with LINZ any additional security arrangements considered necessary to secure their works areas, including signage and possible fencing around equipment/plant/vehicles that will stay on site overnight. These additional measures would be implemented by the Contractor upon agreement with LINZ- This shall also apply to any other contractors or personnel that have not been directly engaged by a main contractor.

#### 7.2 SITE OFFICE, CONTRACTORS YARD AND REFUELING

The site office will be located at Building 75. There are kitchen and toilet facilities located here. It is likely additional facilities will be located around the site. The power supply to Building 75 will remain live for the duration of the demolition project, if any contractor damages the structure or power supply to Building 75, these will be repaired at the expense of the contractor.

The construction yard for plant/machinery parking and temporary storage/holding area shall be located at an appropriate location (e.g. paved industrial area). Any vehicle refuelling areas shall be clearly indicated and located well away from streams and protected vegetation. Any temporary fuel storage areas shall comprise double skinned tanks or bunded tanks, complying with WorkSafe regulations.

#### 7.3 SERVICES AND AMENITIES

The site is relatively isolated.

There are only two power connections into the site that are known to still be live. These are to Building 75 and to the security staff portacom.

Water and wastewater to the site office (B75) are understood to be supplied separately via services running through the paddock to the north to Te Mawhai Rd. The wastewater reticulation is a low pressure system.

Mobile phone/internet connectivity is poor and should not be relied on.

There are no nearby shops, stores or petrol stations. The nearest places for purchasing food, water and other supplies is Kihikihi, approximately 6km north of the site, while Te Awamutu is 12km from the site.

Accommodation in the local area is of limited supply.

LINZ have installed a 75mm diameter water line, adjacent to the security Portacom, feeding off the Te Mawhai Rd supply, for contractor use during the demolition works.

Given the size of the site and the only toilet available for contractor use being in the site office, it is recommended that the contractor provide additional portaloos at appropriate locations on-site for use by their staff.

#### 7.4 NEAREST MEDICAL CENTRE

The nearest medical centre is:

Mahoe Medical Centre Mega Centre 670/4 Cambridge Road, Te Awamutu 3840

Tel: 07 872 0923

administration@mahoemed.co.nz

Hours: 8am-8pm Mon – Fri; 9am-3pm Sat-Sun

#### 7.5 OTHER CONTACTS

- (a) Electricity Waipā Networks, 240 Harrison Drive, Te Awamutu; Tel: 07 872 0745; 24hrs faults call: 07 870 2000
- (b) Telecommunications Ultra Fast Fibre, 0800 342 735
- (c) WorkSafe NZ 0800 030 040

## **8 SITE CONSTRAINTS**

There are a number of constraints across the site, that must be taken into consideration and accounted for by the contractor in their work. The current site constraints are listed and detailed below, and further identified on the attached DDRMP Features Plan (drawing 33205/G01).

Table 5: Site Constraints and Proposed Management/Mitigation Measure

Item	Description	Management/Mitigation Measure
Leased areas for grazing	Majority of site is leased to farmer for grazing	Assumed grazing will continue during demolition works, with areas of work being isolated from the stock
Highly productive land use classification  Ecology	Soils across site classified as LUC Class 2 or 3  Trees	Proposed works will remove building footings/foundations and horizontal infrastructure to sufficient depth that it will help to restore the land to LUC Class 2 or 3, provided drainage is maintained in these areas − this should be achieved by leaving any drainage media present in pipe trenches in place, where the pipe itself is removed. Recommended that all large trees (native & exotic) are retained to avoid adverse effects on fauna, and to retain amenity values, where possible. Hence, large trees (≥15+ meters) or any protected trees should be managed to mitigate any detrimental impacts on these trees. However, some trees that may require removal or trimming, to facilitate the demolition works are shown on the 33205 series
	Bats	drawings. Also refer section 20.2.  Contractor must comply with the Bat Management Plan (BMP) provided separately.
	Wetlands	Two natural wetlands identified on-site as shown in the 33205 series drawings. Works within 10m of any

		<ul> <li>of these wetlands will be covered under specific resource consent conditions. This includes:</li> <li>Demolition of buildings 75 &amp; 76 (to be confirmed, as this is the site office and associated garage and may remain on-site post-demolition).</li> <li>Removal of possible water pipe north-west of B76 (unlikely to exist based on available data)</li> <li>Removal of wastewater pipes and concrete supports in the NW wetland and removal of grit chamber, inlet pipe, footbridge and outlet pipe in NE wetland.</li> </ul>
Groundwater	Potentially elevated groundwater table, especially during winter months.	Majority of site encompassing the hospital infrastructure is classified as "poorly" or "imperfectly" drained areas on Landcare S-Maps. GHD advised that Aecom (DSI) found groundwater levels of 1.3-2.4m bgl over period May-Sep, inferred to represent winter conditions, while GHD only found groundwater in one location (B74, TP2) at 2.1m bgl. Contractor is responsible for any groundwater dewatering that may be required during works, these works will be covered under specific resource consent conditions. Available information and generally shallow nature of demolition works indicates this is low risk.
Heritage, cultural or archaeological significant areas	Five areas identified to date: NW and NE wetlands; area around B55; large area SW of Buildings B75/76 (location of 3 former buildings); corridor alongside Wharekōrino Stream; refer 33205 demolition series drawings	Works need to follow DDRMP section 6 requirements, including pre-approval from LINZ and

## 9 EXISTING INFRASTRUCTURE TO BE PROTECTED

Existing infrastructure to be protected on-site includes the following:

- (a) Farm water supply refer section 9.1;
- (b) Wastewater pump station refer section 9.2;
- (c) Existing stone and mortar retaining wall, comprising 3 terraces of variable height 0.55-1.70m high, located north of Building 56 refer section 9.3;
- (d) The trunk stormwater system comprising approximately 1770m of 675-900dia pipe. This is to be relined under a separate contract following the completion of the demolition works. Refer section 9.4.
- (e) The closed disposal site (landfill). This is located outside the works area and is described in separate reports.

#### 9.1 FARM WATER SUPPLY

At present, approximately 32.85 ha of undeveloped grassed land within the hospital site are leased to AgResearch. These lands are used for cattle grazing, and as such, have their own dedicated water supply, providing water to troughs for a stock water supply. This water supply network has never been officially

surveyed, but the best available sketch of the supply, provided by AgResearch, is provided on the attached Drawing 33205/G01.

As this water supply is sourced from the AgResearch site, contractors are not permitted to utilize the farm water supply for any means.

Contractors also need to protect this water supply from damage during the works and will be required to repair any lines damaged or destroyed by them at their cost.

#### 9.2 WASTEWATER PUMP STATION

The Hospital had its own independent wastewater reticulation system, conveying wastewater to a wastewater treatment plant (WWTP) located in the north-eastern corner of the site, adjacent to the Wharekōrino Stream. The WWTP was decommissioned in 2021, when a new gravity sewer line was installed along Te Mawhai Road. Part of the former WWTP compound now contains a new wastewater pump station. The wastewater pump station area and associated concrete pad is to be protected from damage during the remaining WWTP demolition works.

## 9.3 TERRACE RETAINING WALL

There is only one retaining wall onsite, located on the north-western corner of B56. This retaining wall comprises three terraces, which were inspected in 2023 and found to be in good condition and worth keeping.

Contractors must make every practicable effort to not damage or undermine the retaining wall. Photographs should be taken of the retaining wall at specific locations prior to the works, and then again at the same locations on completion of the works, or any other occasions subject to damage. The contractor will be responsible for repairing any damage to the retaining walls resulting from the demolition works at their cost.

## 9.4 TRUNK STORMWATER

Stormwater runoff from rural farm land to the west of the site flows into and through the site via a combination of open channels and pipe reticulation, discharging into a tributary of the Wharekōrino Stream and then flowing to the north under Te Mawhai Road, into the Pūniu River a short distance downstream. This system is referred to as the trunk stormwater system. The two natural wetlands onsite are located in different areas along the trunk stormwater system.

Archived plans show that the stormwater system was designed to have some flood detention areas located in the central and north-eastern corner of the site, before discharging into a tributary of the Wharekōrino Stream. A stormwater pipe is shown on these plans as running under the flood detention basin, which has separate culverts feeding into it, with a re-entry structure conveying water from the flood detention basin into the underlying stormwater system.

It is proposed to reline all trunk stormwater pipes on site, which is expected to increase the lifetime of the system by at least 50 years. This work falls outside of the main demolition works scope and will be undertaken after completion of the demolition works, when heavy plant and machinery has been removed from site. These works are described in section 16 of this report.

LINZ will undertake CCTV of the trunk stormwater line pre- and post-demolition works to check for any damage to this network caused by the contractor. The extent of the CCTV survey will be confirmed by LINZ but is likely to go from grate to grate in Figure 2, as this is the main area where it is considered possible damage to the trunk line may occur.

The contractor shall be responsible for repairing any damage to the trunk system, or removing any debris washed into this line from the MH removal and backfilling, attributed to their activities, based on the CCTV survey results.

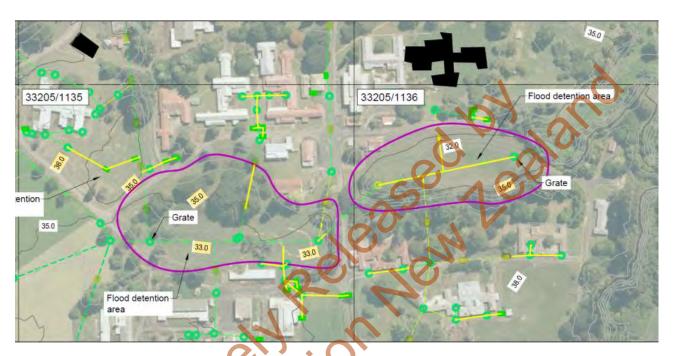


Figure 2: Likely Extent of Pre- and Post-demolition works CCTV of Trunk Stormwater System

## 10 DEMOLITION/DECONSTRUCTION WORKS PHILOSOPHY AND SEQUENCING

## 10.1 DEMOLITION/DECONSTRUCTION PHILOSOPHY

LINZ's philosophy for the demolition works is set out in the following:

- (a) To undertake the demolition works in accordance with industry best practice and guidelines, complying with all resource consent requirements.
- (b) To maximise materials recovery, as much as possible.
- (c) To generally leave infrastructure in the ground that is deeper than 800mm (for pipes) and 1m (for structures—e.g. manholes, catchpits, etc.), except for building footings/foundations, which are to be completely removed. The contractor should address this in their methodology.

#### 10.2 POTENTIAL MATERIALS REUSE AND RECOVERY

The contractor should as part of their methodology identify the materials they are proposing to recover for reuse/recycling and the associated recovery methodology. LINZ has undertaken a preliminary recycling potential exercise, the results of which are summarised below.

**Table 6: Potential Recycling Opportunities** 

Recycling Potential	Materials	Comments
High	Untreated timber	Significant quantities of native timber in many buildings suitable for recovery/reuse; alternative use as biofuel
	Concrete from buildings and foundations; external concrete slabs and paving	Crushing to GAP40 or drainage aggregate or for use as backfill
	Access road/paving subbase and basecourse	Possible reuse as backfill material
	Soils identified as cleanfill	Possible reuse as backfill material and retopsoiling, including the majority of the Wharekorino Stream embankment materials.
	Copper pipes/bronze fittings (in old building heating system ducting)	Sale as scrap metal
Medium	Brick and tile	Include with concrete for crushing, bricks for recycling
	Electrical wiring	Scrap metal recycling, but may not be economic
	Metals (e.g. iron roofing, galvanised metal fixtures, old boilers)	Depends on nature/quality/value of metal and if "pure" or contaminated with other materials (e.g. paint, lagging)
	Guano	Mix with mulch from site vegetation to make compost, or take to composting facility off-site; subject to being free of any cross-contamination (e.g. lead paint, asbestos)
Low	Treated timber, framing or external decking, fencing	Possible use as biofuel
	Gypsum based plasterboard	May be difficult to extract and not viable if painted
	Plastic	Depends on type of plastic – explore possible use by Future Post (futurepost.co.nz)
	Access roading/pavement asphalt	Excluding asphalt containing coal tar (some areas)
	External non-ACM cladding	Varies; may not be viable if painted
None	ACM building materials, pipes and other items	

## 10.3 WORKS BREAKDOWN AND SEQUENCING

This section summarises the works to be undertaken and the preferred order. The demolition of vertical buildings is to be started first. The contractor may undertake some tasks in parallel, particularly where this may result in cost and/or time savings, or reductions in human health/environmental risks.

Specific background information and requirements for the contract works have been split into the following categories:

- (a) Buildings refer section 11.
- (b) Horizontal infrastructure refer section 12.
- (c) Contaminated soil briefly discussed in section 13, and covered in detail in a separate Remedial Action Plan (RAP) (to be provided).
- (d) Wharekorino Stream Embankment Removal and Reinstatement section 14.
- (e) Works within wetland areas or within 10m of these wetlands section 15.

Works sequencing is summarised below.

**Table 7: Proposed Work Sequencing** 

Phase	Works	Indicative
		Timeframe
1	1. Site establishment;	8.5 months to 2.2 yrs
	2. Environmental Clean of Structures;	
	<ol><li>ACM Removals (including void spaces except for sub-floor);</li></ol>	
	4. Lead based paint (LBP) Removals;	
	5. Visual clearance inspections;	
	6. Soft strip and salvage;	
	7. Structural demolition and salvage;	
	8. Removal of demolished materials;	
	9. Sub-floor investigation	
2	Sub Floor ACM remediation;	4.5 – 6 months
	2. Slab and foundation removal;	<b>O</b>
	3. Contaminated HALO scrape and validation;	
	4. Backfilling and topsoiling.	
3	1. ACM Services removal;	11-13 months
	2. SW WW services removal;	
	3. Concrete duct and other service removal;	
	4. Hardstand (roading/paving) removal (including coal tar), including	
	embankment over Wharekōrino Stream;	
	5. Backfilling and finishing/topsoiling/grassing.	
	6. WWTP demolition and remediation works.	

**Note:** Phase 1 - In some buildings, consideration may be given to undertaking the sub-floor investigation earlier, as it is possible that above floor demolition activities may mobilise any sub-floor asbestos contamination (e.g. dust from vibration). The sub-floor investigation will not involve any soil disturbance other than very small volumes for soil sampling.

Contaminated soil removal is covered under a separate Remedial Action Plan.

### 11 BUILDINGS

## **11.1 SCOPE**

The scope of work involves removing all existing buildings, excluding the security portacom and potentially buildings 75/76, as the latter will be used as the site office and may be left in place post-demolition.

Appendix A provides a list of all buildings and summarises the following information for each building where available:

- Building ID and name, roof area (m<sup>2</sup>), built date, building type, number of storeys, footing/foundation details where available.
- Lead paint and ACM survey results.

- Historical HALO demolition debris. This relates to some buildings where during soil sampling works, old demolition debris, presumably from historical building renovations, was found buried in some locations around the building footprint.
- Special requirements relating to each building (i.e wetland separation, protected tree(s), significant cultural/archaeological features, etc.
- Data reliability, information sources and relevant notes.

It is important to reiterate that the site has a long and varied history, with limited information available for some buildings, and particularly for footings/foundations for most buildings. Appendix A also includes individual pages for each building containing the Opus 2015 building survey results and the 4Sight lead paint and ACM survey results referred to above.

#### 11.2 METHODOLOGY

Suitable above ground infrastructure is to be deconstructed, in agreement with LINZ, with building materials recycled, where practicable.

It is anticipated that excavators (ranging from 5-20T) with demolition attachments and hydraulic breakers will be used, along with an on-site mobile concrete crusher plant that will be in the centre of the site, as shown in drawing 33205/G02.

Prior to any demolition or salvage of building materials off of existing structures, all asbestos removals and environmental cleaning to remove guano and other fauna excrement must have taken place. For all structures where asbestos has been removed, a clearance inspection and associated clearance certificate must be received by the main contractor or LINZ prior to any demolition/deconstruction taking place. Furthermore, all works involving lead-based paint related contamination or removal of materials contaminated with lead-based paint must be completed in accordance with the recommendations outlined in the 'Toitū Te Whenua Health and Safety Guidelines – Working with Lead-based Paints'. Further advice is outlined in section 17.3.3 of this report.

If deconstruction is not possible or deemed impractical or uneconomic for a structure, then demolition debris must be loaded directly into trucks and removed from site for offsite disposal. Temporary stockpiling of demolition debris onsite, for extended periods shall not be allowed, except where agreed with LINZ due to special circumstances.

All contractors will be required to provide Safe Work Method Statements detailing their proposed deconstruction and demolition methods, which will be reviewed by LINZ and the project SQEP.

For each building, contractors will be responsible for keeping the site tidy (i.e. specific building and immediate surrounds), including removing all demolition materials and making the building area and immediate surrounds safe and tidy within one month of each building's demolition. All structural footprints are to be backfilled with suitable recycled or imported materials, topsoiled and grass seeded, within 1 month of the slab and foundations removal and any associated contaminated HALO scrape, validation for each building and removal of any services within the vicinity of each building.

In the event of phased demolition (i.e. where the above ground structures are to be demolished in one phase, followed by a later phase involving slab and foundations removal, any associated contaminated HALO scrape

and validation for each building), contractors will be responsible for removing all demolition waste generated as part of that phase within one month of the phased demolition of each building. Any grass around each building that is damaged by demolition machinery is also to be re-seeded within the same timeframe and the immediate surrounds are to be made safe and tidy.

#### 11.3 KEY BUILDINGS

There are a number of structures across the site that require careful demolition due to more complex construction and/or significant hazards and/or risks during the demolition phase. This information is summarised from the Opus (March 2015) building structural assessment demolition report. These buildings are:

- Boiler House (B68);
- Ward 21 (two storey portion) (B26);
- Waipā Community and Training Centre (B10);
- Ward B (two storey masonry portion) (B12);
- Main Administration Building (B1); and
- Village Hall (B36).

The below structure information, sequencing and guidance has been provided in order to facilitate the safe demolition of these structures and removal of the associated building materials from site. The Opus (March 2015) report is available as a separate document.

### 11.3.1 Boiler House (B68)

The boiler house (B68) is shown in Figure 3.

#### A. Structure

- Boiler house building contains a row of three reinforced concrete hopper structures (dimensions approximately 15m long by 4m wide by 8m high) to the south elevation, designed to feed coal into the main boilers.
- Hoppers are supported by 400x400 reinforced concrete columns in each corner, with a reinforced
  concrete ring beam around the top of the hopper cones constructed from reinforced concrete and
  suspended from a concrete ring beam at approximately 5m above slab level.
- The hopper cones are also constructed from reinforced concrete and hang from the ring beams.
- The hopper walls are constructed from in-situ concrete, up to approximately 8m above ground, supported by the concrete ring beam and capped with a flat concrete roof slab.
- An independent steel portal frame vehicle bay (8m high), reinforced concrete coal drop/ramp and vertical coal screw is located to the east of main boiler room.
- Single storey workshops located to west of boiler room. Lightweight roof and steel frame portals in a two bay north light configuration. In situ concrete walls including full height gables to the west elevation and a central dividing wall at the low point of the roof.
- Large steel frame lean-to addition to the north of the main boiler room and bolted back to the reinforced concrete hopper framing.
- Steel frame portal legs cased in concrete to approximately 3m above ground level. Reinforced concrete perimeter walls to same height with timber framing above.
- Three large diameter metal chimneys to 15-20m above ground level stabilised with tie wires attached to main building.

• Slab-on-grade ground floor. Assumed pad bases to columns and strip footings to masonry walls.



Figure 3: Boiler House

#### B. Suggested Demolition Sequence

- Take down the projecting metal chimneys and remove the boilers.
- Demolish the independent steel portal vehicle bay structure together with the associated concrete ramp structure and coal screw.
- Demolish the lean-to additions to the North and single storey workshops to the West in order to leave the three hoppers standing independently.
- Stabilise the three suspended hopper cones by propping from ground level or installing a steel cradle frame in order to relieve the load from the perimeter ring beams and/or hopper walls.
- Break out the concrete roof slab and take down the hopper walls to the top of ring beam level.
- Detach the hopper cones from the perimeter ring beams (while supported from ground level) and either break out and remove piece by piece or lift out whole using a crane.
- Demolish the remaining concrete ring beams and columns down to ground.
- Break out ground floor slab and grub out foundations.

## C. Key Hazards & Specific Requirements

- Temporary stability of the concrete hopper structures and suspended cones to be maintained while remainder of building is taken down.
- The hoppers need to be taken down in a controlled manner. No detailed drawings are available but it is possible/likely that the suspended hopper cones are reliant on the concrete walls above. The weight of the cones should be relieved by propping before the hopper walls are taken down.
- Given the location of the Boiler House, it is proposed that this structure be demolished last out of the structures covered in this section.

## 11.3.2 Ward 21 (two storey portion) (B26)

Ward 21 (B61) is shown in Figure 4.



Figure 4: Ward 21 (B26)

#### A. Structure

- Two Storey timber frame ward accommodation block.
- Two independent blocks in an L-shape configuration with short linking corridors.
- Cross wall configuration with load bearing bedroom walls and central full-length corridors at both levels. Lateral stability provided by plasterboard linings
- Light weight duo-pitch roof with central ridge line. Long run metal sheet finish and plasterboard ceilings.
- Cement board finish to external walls.
- Timber first floor and suspended timber ground floor with concrete perimeter walls.
- Reinforced concrete basement boiler room in centre of block.

## B. Suggested Demolition Sequence

- Remove all identified Class B ACM as per Table 7, 4Sight Asbestos and Lead Paint Demolition Survey Report, Area 2, dated December 2022.
- Demolish each wing progressively in a longitudinal direction.
- Break out basement and grub out perimeter walls/piles foundations.

#### C. Key Hazards & Specific Requirements

- Class B ACM present to building exterior, ceiling void and internal building structure.
- No demolition hazards noted.

Given location and demarcation as a culturally significant area, removal of this structure will require
observation by a cultural monitor at all times, especially during removal of any below ground
infrastructure.

## 11.3.3 Waipā Community and Training Centre (B10)

The Waipā Community and Training Centre (B10) is shown in Figure 5.



Figure 5: Waipā Community and Training Centre (B10)

#### A. Structure

- Two Storey unreinforced masonry (URM) building. Approximately 17m wide by 11m deep by 6.5m high
- Traditional hipped timber roof with heavy concrete tile finish.
- Roof and timber first floor supported off central URM spine walls running in both East-West and North-South directions
- Remainder of internal walls at both floor levels constructed using lightweight timber framing.
- Slab-on-grade ground floor construction.
- Traditional strip footings assumed under perimeter walls and URM spine walls.
- Single storey extension at rear constructed using timber framing with external brick veneer

## B. Suggested Demolition Sequence

- Remove all identified Class A & Class B ACM as per Table 10, 4Sight Asbestos and Lead Paint Demolition Survey Report, Area 1, dated December 2022.
- Remove roof.
- Demolish URM walls and timber first floor.
- Break out ground floor slab and grub out foundations.

#### C. Key Hazards & Specific Requirements

- Class A ACM present in roof void and internal building structure.
- No demolition hazards noted.
- Suggested early demolition and removal, to create more space and turning bays on main access road.

### 11.3.4 Ward B (two storey masonry portion) (B12)

Ward B (B12) is shown in Figure 6.

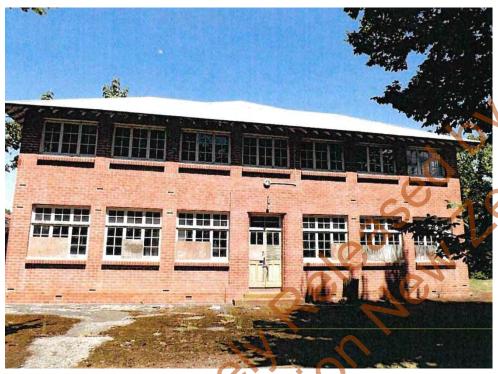


Figure 6: Ward B (B12)

#### A. Structure

- Two Storey URM building. Approximately 1.7m wide by 11m deep by 6.5m high
- Traditional pitched timber roof with long run metal sheet finish.
- Roof and timber first floor supported off URM corridor walls running in north-south direction in the ward dormitory.
- Full width roof trusses and timber first floor supported on steel beams (6.1m clear span) in the communal areas to the northern end.
- URM chimney and lean-to additions to the communal area, including a two-storey addition to the North elevation.
- Suspended timber ground floor construction.
- Traditional strip footings assumed under perimeter walls and internal URM walls.

#### B. Suggested Demolition Sequence

- Remove all identified Class B ACM as per Table 12, 4Sight Asbestos and Lead Paint Demolition Survey Report, Area 1, dated December 2022.
- Remove roof and take down URM Chimney.
- Demolish URM walls and timber first floor working progressively in a longitudinal direction starting from one end of the building.

Break out ground floor slab and grub out foundations

### C. Key Hazards & Specific Requirements

- Class B ACM identified to internal components of boiler room, sheds and switchboards.
- No demolition hazards noted.
- Suggested early demolition and removal, to create more space and turning bays on main access road.

### 11.3.5 Main Administration Building (B1)

The main administration building (B1) is shown in Figure 7.

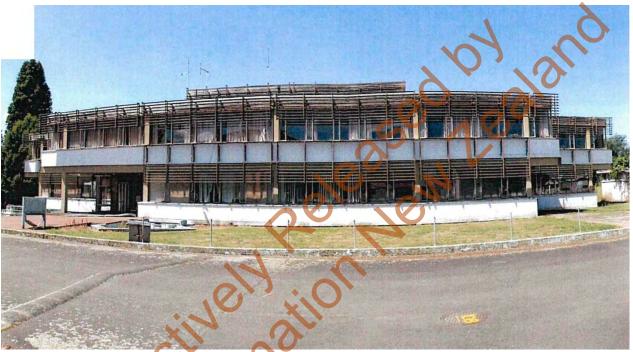


Figure 7: Main Administration Building (B1)

### A. Structure

- Two Storey Reinforced Concrete Frame. Approximately 45m long by 21m deep by 6.5m high.
- Longitudinal one-way concrete frames at approx. 3.8m centres. Perimeter columns only extend up to roof level.
- Concrete first floor slab, one-way transverse span between concrete frames.
- Lateral stability provided by concrete masonry stairwells at the rear (North-East and South- East corners) and concrete masonry walls up to the first-floor slab at the front (West).
- Lightweight timber roof with internal gutter and central butterfly roof portion.
- Roof appears to be supported on load-bearing timber wall panels built directly off the first-floor slab.
- Slab-on-grade ground floor. Assumed pad bases to columns and strip footings to masonry walls.

### **B.** Suggested Demolition Sequence

• Remove all identified Class A & B ACM as per Table 1, 4Sight Asbestos and Lead Paint Demolition Survey Report, Area 1, dated December 2022.

- Remove roof and demolish timber framing down to first floor level.
- Demolish concrete frame, first floor slab and masonry walls progressively in a longitudinal direction from one end of the building.
- Break out ground floor slab and grub out foundations.

### C. Key Hazards & Specific Requirements

- Class A & B ACM identified to external and internal components.
- No demolition hazards identified.
- Suggested early demolition and removal, to create more space and turning bays on main access road.

### 11.3.6 Village Hall (B36)

The Village Hall is shown in Figure 8.



Figure 8: Village Hall (B36)

### A. Structure

- Single Storey structure. Predominately open plan. Approx. 14.5m long by 9m deep by 3.8m high
- Light weight mono-pitch roof supported on a series of 600mm deep plywood box beams or steelwork lattice beams clad with timber.
- Load bearing concrete masonry walls with 400mm square piers (max 3.1m high) supporting the
- Concrete masonry spandrel panels and full height infill panels acting as shear walls in each corner.
- Concrete slab-on-grade ground floor.

### **B.** Suggested Demolition Sequence

- Remove all identified Class A ACM as per Table 2, 4Sight Asbestos and Lead Paint Demolition Survey Report, Area 3, dated December 2022.
- Remove roof sheeting, ceiling and timber roof joists.
- Lift off main 8m long roof beams
- Demolish concrete masonry piers and wall panels, progressing in one direction along the length of the building.
- Break out slab-on-grade and grub out any foundations.

### C. Key Hazards & Specific Requirements

- Class A ACM identified to internal components of structure.
- No demolition hazards identified.

### 11.4 OPUS (2015) BUILDING INSPECTION REPORTS

Opus undertook building inspections of 50 buildings at the site in 2015. This information is summarised in Appendix B, while the Opus report is available as a separate document. Contractors should refer to this appendix and the Opus 2015 report for more detailed information on each building, including photos.

### 11.5 3D BUILDING SCANNING (2023)

Barry Satchell undertook 3D scanning of 10 buildings at the site in 2023, providing "walkthrough" details of each building. These buildings are:

- B01 Admin
- B11 Ward A
- B13 Ward C
- B27 Ward 5
- B29 Ward 7
- B30 Ward 8
- B48 Ward 16
- B53 Ward 19
- B56 Ward E
- B65 Store

Links to these scans will be provided separately to the contractor due to file size.

IIVEN AII

### 11.6 HAZARDOUS SUBSTANCES

The main hazardous materials identified in relation to the building demolition works are guano, lead paint and asbestos. In addition, two further issues were identified:

- Some buildings with buried historical demolition debris in their HALOs.
- Some hazardous substances stored within different buildings.

These hazards and their management are described in more detail in section 17.3 of this plan.

#### 12 HORIZONTAL INFRASTRUCTURE

### 12.1 ROADING/PAVEMENT

This section provides an overview of the existing pavement composition, thickness and condition at the Tokanui hospital site to help contractors understand what will be required to maintain relevant portions of this network in working order during the demolition works and to then undertake the relevant pavement related works, post-demolition activities.

### 12.1.1 Background Information

Roading and paving around the site will have been present since the hospital's inception in 1916. The earliest aerial photography information available indicates an extensive roading network was developed by 1944, alongside construction of the main hospital buildings. This network expanded up until 1966, when the site was fully developed. Based on available information, the road network is understood to be well over 50 years old.

Pavement specifications indicate typical design comprised 25-40mm AC (asphalt concrete), on 125-150mm M4 basecourse on 50mm sand or directly on subgrade, which represents a relatively "skinny" pavement.

WSP undertook a pavement investigation in 2023 with the results being presented in a factual report provided separately. Overall, they found that the existing road network is in a reasonable condition except for some localised failures. Most of the failures are surficial, indicating a good structure pavement. The existing asphalt and chip-seal surfaces are in poor condition and appear to be at the end of their life, evidenced by potholes, cracks and moss developing. The road generally has good drainage except for some localised issues and around the intersections. Kerb and channel are in good condition but require cleaning. There is some localised settlement near service trenches crossings and inspection chambers. The following table provides a summary of the investigation results and root cause analysis. Refer to the HIR report, WSP 2023 report and to drawing 33205/1700 and 1701 for more details and drawing 2702.

Table 8: Pavement Evaluation/Condition Assessment

Item	Assessment
Shape	The roads are generally in good shape without rutting or significant depressions. Some settlement was observed at service manholes and trenches, indicating poor backfill and compaction.
Surface	The existing surface comprises approximately 30mm of asphalt and chip-seal. The existing surfaces are in poor condition and appear to be at the end of their life, evidenced by potholes, cracks and moss developing. However, no deformation, heaving, shoving or rutting was observed, indicating the underlying pavement is structurally sound.
Drainage	The road generally has good drainage with well-formed kerb and channel at most locations. There are catchpits at regular intervals, typically in moderate to poor condition.  The kerb and channel are overgrown with grass and moss and require cleaning.  There are some localised ponding issues around the carparks and intersections due to poor cross-fall.

Geometric	The roads are generally 5.4m and 7.0m wide, suitable for two-way traffic. The roads have flat to moderate longitudinal gradients with good dual cross-fall on the main roads and single cross-fall on the side roads.  However, some intersections and parking areas have poor cross-fall, which leads to drainage issues.
Pavement thickness	The road pavement varies significantly across the site. The total pavement depth ranges between 100mm and 600mm, with a mean of 300mm.  The basecourse thickness is between 30mm and 380mm with a mean of 170mm, comprising medium dense to dense well-graded AP40.  There is up to 350mm of fill at some locations.  The existing pavement thickness is generally suitable for the historical low-traffic volume environment at the site.
Deflection	The Benklemen Beam deflection ranges between 0.4 and 3.7mm. The high deflection values are generally in parking areas. In contrast, most roads have a deflection value of less than 1.6mm, suitable for the historical low-traffic volume at the site. High deflection is generally associated with inadequate pavement strength and thickness and poor subgrade.
Potholes	Potholes were observed at some locations, generally associated with a lack of surface waterproofness, dirty basecourse and poor drainage, particularly near the intersections, trenches and speed humps. These should be fixed to prevent further deterioration by applying pothole patches or similar prior to and during the works.
Subgrade	The existing subgrade strength CBR ranges from 1% to 10%. The weakest subgrade was found in the parking areas. Most road subgrade CBR is between 4% and 10%, indicating a weak to moderate subgrade. At TP10 and 11, the subgrade CBR is 2% indicating a very weak subgrade. A subgrade CBR of 4% was adopted for the pavement evaluation.
Shallow/Deep- seated damage	Most of the damage is shallow surficial, indicating that the underlying pavement is structurally sound. Some deep-seated failures were observed at service trenches indicating poor backfill and compaction.

Analysis of the effects of demolition traffic on the existing pavement has found that the existing asphalt and chip-seal surface is at the end of its service life and unlikely to be able to withstand the construction traffic. Apart from the main entrance, the pavement is expected to be at the end of its service life after the site-clearing work.

The contractor will be responsible for maintaining the access and internal roading during the works so that the scheduled demolition/deconstruction/remediation works can be carried out.

### 12.1.2 Coal Tar Assessment

GHD undertook an initial high level coal tar assessment in February 2023, checking for the presence of coal tar in the binding of the pavement and underlying basecourse material on the hospital site, involving the collection and laboratory analysis of 26 pavement/basecourse samples for polycyclic aromatic hydrocarbons (PAHs) and TCLP (toxicity characteristic leaching procedure) testing of 12 asphalt samples for PAHs. This investigation found four locations where coal tar use was considered likely. Leaching of PAHs from all samples was very low.

FTL subsequently undertook several more in-depth investigations of both the road construction and for coal tar in the paving, basecourse and subbase roading layers, using a multiple lines of evidence approach

involving a combination of paint tests, UV light fluorescence and laboratory testing to better determine the horizontal and vertical extent of coal tar content in the roading pavement layer and the underlying basecourse and subbase. The results of this investigation are reported on separately in the FTL Coal Tar Intrusive Investigation Report (September 2025). Figure 9 shows the sampling plan for the road surface (pavement) layers, to give an understanding of the sampling density undertaken.

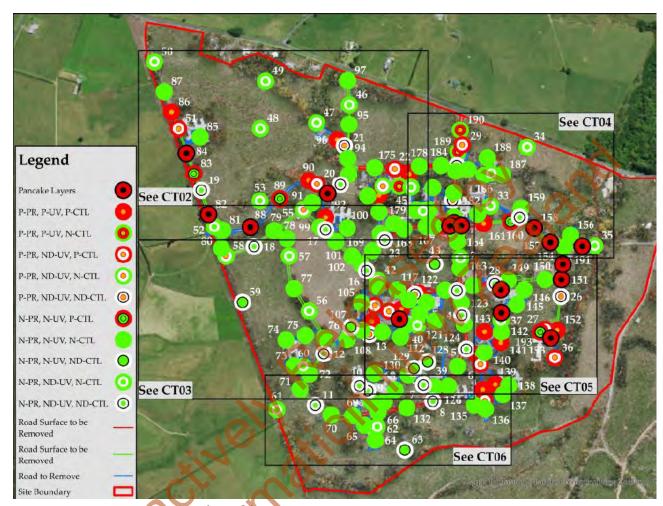


Figure 9: Coal Tar Road Surface (Paving) Overall Sampling Plan

# 12.1.3 Removal of Roading/Pavement

The road network within the Hospital site is approximately 8.8km in length, and has expanded over the lifetime of the hospital and been subject to ongoing repairs, resealing and maintenance works over the years.

As part of the Hospital demolition works, the roading network has been split into three portions, reflecting different management/removal options considered, primarily based on road function, degree of use and age. These are identified as the red, green and blue networks, each with their own management/removal requirements. The blue network is essentially minor roading and paving in and around buildings. The red network is the key "spine" roads that provide reasonable access to the main hospital areas, while the green network represents additional secondary access roads that provide extended access around the entire hospital site.

The Blue portion of the road network in FTL Drawing 33205/2700 is to be fully removed (surface, basecourse and subbase). The Blue network covers an estimated 5.37km (3.49ha) (56% of road network) with an

estimated removal volume of 10,424m<sup>3</sup>. This portion of the road network will be reinstated with clean soils to existing ground level. Backfill requirements involve an average of 150mm subsoils overlain by 150mm topsoil to tie in with the surrounding ground and regrassing.

The remaining portions of the road network (3.48km, 2.79ha) are split into Red and Green in the FTL Drawing 33205/2700. These areas will be partially removed, essentially removing the surface pavement down to basecourse, then topping up the basecourse to existing ground level to form "farm tracks" for ongoing use. The estimated total paving volume to be removed is 1,480m<sup>3</sup>.

Coal tar is present across all three road network colours and roading layers. The majority of the coal tar, in terms of areal coverage, is in the surface pavement layers, with the areas with coal tar decreasing in the basecourse and further decreasing in the subbase. A conservative approach has been taken here, in that the entire basecourse and subbase depth profile has been assumed to contain coal tar, based on either a positive paint test and UV reaction or a positive lab result from a single test of these layers at each location. Given these layers are typically significantly thicker than the paving layer, this results in reasonable quantities of coal tar being calculated to be present in both the basecourse and subbase. Furthermore, there are localised areas of the site where multiple 'top ups' of the basecourse and pavement have been done over the years, forming a "pancake" roading structure. Figures 10, 11 and 12 show the areal distribution of coal tar in the paving, basecourse and subbase layers.

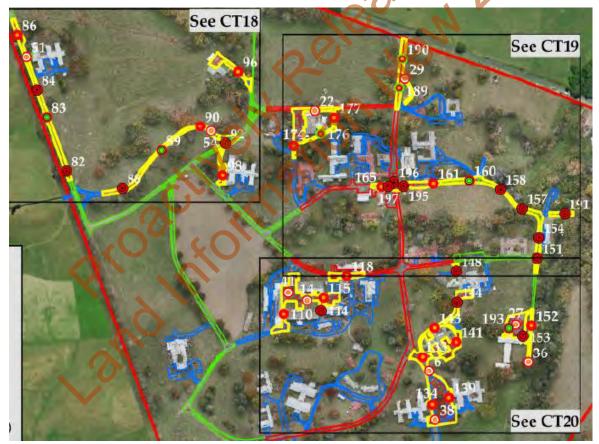


Figure 10: Coal Tar in Roading Surface (Paving) Location Plan – yellow polygons

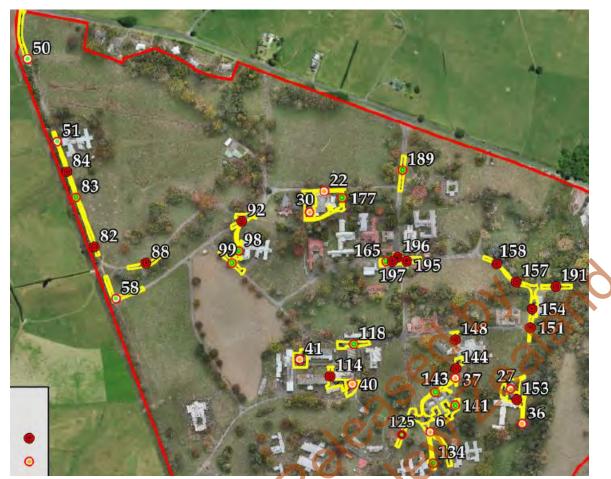


Figure 11: Coal Tar in Roading Basecourse Location Plan - Yellow Polygons

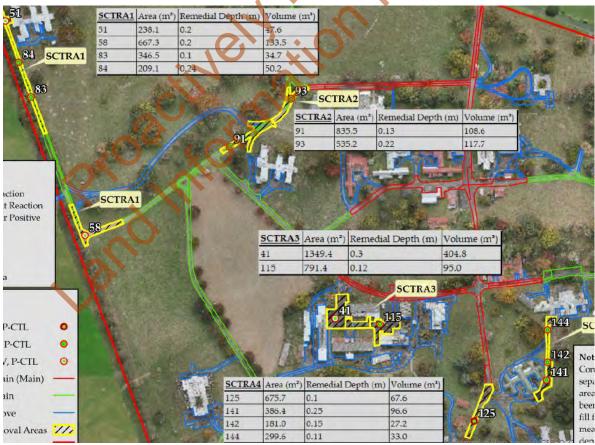


Figure 12: Coal Tar in Roading SubBase Location Plan - Yellow Polygons

All confirmed coal tar roading materials are to be removed from the site, regardless of depth within the road network. The proposed methodology for this is set out in the following:

- Remove all surface pavement in up to 50mm increments (to limit cross contamination) in line with FTL Coal Tar Drawings, utilising excavators and/or milling plant (if proposed by contractor). Surface material is to be placed directly into bins adjacent to the works area and/or stockpiled in controlled areas until sufficient volume is generated to fill trucks for offsite disposal. All excavated surface material to be placed in like for like bins or stockpiles, i.e. coal tar into coal tar bins/stockpiles, asphalt into asphalt bins/stockpile and chipseal into chipseal bins/stockpiles;
- In the Red/Green Road network areas, any surface layers that have been identified at depth (multiple layers of surface material) will also require removal by excavator and/or milling plant. This material is to be handled and placed in bins/stockpiles as detailed above;
- In the Red/Green Road network areas, any material removed will be "topped up" with basecourse using
  well graded Farm AP40 (FAP40), compacted to tie in with the existing basecourse material and forming
  rural "hardfill/gravel" farm tracks for ongoing use;
- In the Blue Road network area, all material (surface, basecourse and subbase) will be removed by excavator and/or milling plant. Material is to be handled and placed in bins/stockpiles as detailed above;
- In Blue Road network areas, the entire removal area to be reinstated with soil and returned to grazing land use:
- All roading material removed during this process is to be disposed of offsite to a suitably licensed disposal facility, or a processing facility for recycling and reuse.
- Some isolated other materials (concrete, coal tar vein) will be similarly removed during this process.

Table 9 summarises the estimated quantities of each layer of roading material across the red, green and blue networks. Table 10 summarises the corresponding estimated quantities of coal tar and Table 11 summarises the estimated quantities of roading materials to be removed from site, either due to the presence of coal tar or as part of the planned removal of the entire blue roading network. It should be noted, that where possible, basecourse and subbase from the blue road network will be used to 'top-up' excavations from elsewhere onsite.

Table 9: Total Roading Quantities (m3)

Item	Red	Green	Blue	Total
Pavement	554	926	1,604	3,084
Basecourse	1,711	2,720	4,096	8,527
Subbase	1,159	2,102	4,724	7,985
Total	3,424	5,749	10,424	19,597
Other	Concrete: 118	Coal tar vein: 28	0	146
Revised Total	3,542	5,777	10,424	19,743

Table 10: Coal Tar Roading Quantities (m<sup>3</sup>)

Item	Red	Green	Blue	Total
Pavement	175	395	506	1,075
Basecourse	437	868	624	1,929
Subbase	68	448	657	1,172
Total	680	1,711	1,787	4,177

Table 11: Total Roading Removal Quantities – Coal tar and Non-coal Tar (m³)

Item	Red	Green	Blue	Total
Pavement				
Coal tar	175	395	506	1,075
Non-coal tar	379	531	1,098	2,008
Basecourse				
Coal tar	437	868	624	1,929
Non-coal tar	N/A	N/A	3,472	3,472
Subbase				
Coal tar	68	448	657	1,172
Non-coal tar	N/A	N/A	4,067	4,067
Total			•	
Coal tar	680	1,711	1,787	4,177
Non-coal tar	379	531	8,637	9,547

**Note:** Values in red are maximum values; total maximum backfill requirement (solid measure) is 13,724m<sup>3</sup> of which 3,301m<sup>3</sup> is hardfill and the remaining 10,424m<sup>3</sup> soil.

The removal of this contaminated material should be undertaken by contractors with PPE as described in section 17 below.

### 12.2 CONCRETE DUCTING

### 12.2.1 Background

The Hospital had an extensive building heating system comprising steam pipes supplied from the hospital boiler to the majority of buildings, and return condensate pipes. This pipe network was located within concrete ducting with access chambers at regular intervals and is referred to as the "concrete ducting" system in this DDRMP. Based on comparisons of available historical aerial photographs, it is understood the concrete ducting was installed site wide between 1944 – 1979, and hence is estimated to be 45-80 years old.

Based on historical plans, composition of the steam lines was generally ungalvanized mild steel of either medium or heavy grade. The return condensate lines were copper. In some areas there was a third pipe, conveying hot water pipes, but some drawings refer to this as "to be removed". Bronze anchors and guides for the condensate pipes are referred to on some drawings. Pipe sizes are shown as varying from 1.5" to 2.5" (38-63mm for condensate) and 2"-6" (50-150mm) for steam. The pipe system includes significant numbers of valves, anchors, brackets and guides. Cover over the concrete ducting varies but is around 400mm on the drawings reviewed, which only cover a small part of the overall system.

Some photos of the ducting are included below for information. More details and photos are included in the Horizontal Infrastructure Report.





Figure 13: Representative Photos of the Concrete Ducting System

### 12.2.2 Removal of Concrete Ducting

Prior to starting these works, the contractor shall check that any contaminated soil removal works in areas where concrete duct demolition is also required have been completed and certified, prior to starting concrete duct demolition works. Where the concrete ducting is located within vegetation areas as identified in the plans, refer to section 21.2 of this DDRMP for the procedures to follow.

The contactor is to remove all concrete ducting (of estimated length 2940m), pipework and fittings, and associated access chambers, as shown on drawing 33205/2500. All appropriate metal pipes, fittings, etc. should be checked and sorted into different categories for recycling.

The contractor shall backfill excavated cavities and trenches with compacted cleanfill, followed by topsoiling and grassing, except at road crossings that are to remain post-works, which should be backfilled with approved, compacted hardfill. A minimum of 880m³ of backfill material is estimated to be required, as well as excavation works to remove the soil overlying the ducting, temporarily stockpile it and then replace it on completion of ducting removal.

### 12.3 OTHER SERVICES

All other services listed and detailed below will be removed to 800mm bgl (below ground level) for all pipes (to top of pipe), ducting and cables, with any associated structural components removed to 1000mm bgl.

#### 12.3.1 Water Reticulation

As explained in the FTL Horizontal Infrastructure Report (2023) (refer section 6.6 of that report), the existing houses along Te Mawhai Road and the two clusters to the east of the site (Croasdale Rd and Tokanui Village), as well as the reservoir further to the east, are provided with water from a relatively new watermain and are now independent of any water reticulation within the Tokanui hospital village itself. This means that removal of the water reticulation system within the Site will not cut off the water supply to users outside of the Site. Hence, the hospital site's water reticulation network, including the 200dia AC pipe referred to below, is completely redundant.

The water reticulation system within the site comprises an extensive network of water reticulation servicing the hospital buildings. A water tower used to be located adjacent to B54 and a water treatment plant was housed within Building B7.

Following inspections across the site to identify and assess the condition of water reticulation pipes, it was determined that the northern portion of the site is serviced by metallic pipes, identified as unpainted 100NB ductile iron pipes (approximately 2,970m) wrapped in denso tape. Watermains were identified at variable depths across the site.

The water reticulation pipes in the southern portion of the Hospital were not picked up during Electromagnetic Location Surveying (EML), which indicated the pipes were non-metallic. Further potholing works identified that the southern water reticulation pipe network was Asbestos Cement Pipes (AC).

Furthermore, a separate 200dia AC water feeder pipe system (approximately 790m) was found running through the northern half of the site that used to bring water from Te Awamutu to a header tank east of the hospital. This system is now redundant.

The existing water supply system and the required water supply demolition works are shown on drawings 32205/2200-2209 inclusive. The extent of the AC and non-AC pipes is labelled on these drawings.

The contractor shall:

- Check that any contaminated soil removal works in areas where water demolition is also required have been completed and certified, prior to starting water demolition works.
- Remove all identified ACM pipes, following the procedures set out later in this report.
- Remove all other water pipes down to 800mm depth (to top of pipe) and all water related fixtures, fittings, etc. down to 1m depth. Where the pipes or fixtures are located within vegetation areas as identified in the plans, refer to section 21.2 of this DDRMP for the procedures to follow.
- Cap any exposed pipe ends left in the ground.
- Survey the locations of any water pipes and associated structures left in the ground and prepare asbuilt plans.
- Backfill excavated cavities and trenches with compacted cleanfill, followed by topsoiling and grassing, except at road crossings that are to remain post-works, which should be backfilled with approved, compacted hardfill.

The contractor shall take care during works in the vicinity of B75/B76 (site office) not to remove or damage the water supply system to these buildings.

#### 12.3.2 Wastewater Reticulation

As explained in the FTL Horizontal Infrastructure Report (2023) (refer section 6.8 of that report), the Site had its own independent wastewater reticulation system conveying wastewater to a wastewater treatment plant (WWTP) located in the north-eastern corner of the Site adjacent to the Wharekōrino Stream. The WWTP was decommissioned in 2021 and a new gravity sewer line was installed along Te Mawhai Road to a new wastewater pump station located at the former WWTP location which pumps wastewater into the new Waikeria Wastewater rising main along SH3 (Otorohanga Road). This rising main also collects wastewater from the two residential clusters to the east of the site (Croasdale Rd and Tokanui Village). This means that removal of the wastewater reticulation system within the Site will not cut off any of these existing houses outside of the Site.

Whilst the site's WWTP has been decommissioned, the now redundant wastewater reticulation network within the site has been left in place. During the services condition assessment, it was found that significant portions of the main trunk sewer going through the middle of the site to the pump station in the north east corner of the site were mostly unable to be surveyed as the lines were blocked and filled with water. It was found that the wastewater pipe system comprised of 100mm, 150mm and 225mm diameter pipes throughout the site with 225mm pipes being found on the CCTV survey connecting into the trunk sewer. As the remainder of the trunk sewer was flooded, it was assumed that this is 225mm diameter as well. The wastewater trunk sewer traversing through the middle of the site was investigated on site and was found to be very deep (approximately 4m). The total length of redundant wastewater reticulation pipework is estimated to be approximately 4910m, of which an estimated 1890m is to be removed. There is one internal wastewater pump station remaining within the site which is to be removed. No details are available for this pump station.

The existing wastewater reticulation and the required wastewater demolition works are shown on drawings 32205/2000-2009 inclusive. Drawing 32205/2004 shows the location of the wastewater pump station to be removed.

The contractor shall:

- Check that any contaminated soil removal works in areas where wastewater demolition is also required have been completed and certified, prior to starting wastewater demolition works.
- Remove all wastewater pipes down to 800mm depth (to top of pipe) and all wastewater related manholes, fittings, etc. down to 1m depth, including the one pump station. Allow for dewatering, as required, and disposal of any trapped water within the sewer network off-site by sucker truck for disposal as trade waste. This should include allowing for testing of the water to determine appropriate disposal requirements.
- If during this process, new pipes <800mm depth (to top of pipe) are found that are not shown on the demolition drawings, advise LINZ project manager/site representative, who will issue instruction for any additional removal works.
- Where the pipes or fixtures are located within vegetation areas as identified in the plans, refer to section 21.2 of this DDRMP for the procedures to follow.
- Where any pipes are left in the ground, these shall be capped at any exposed ends.
- Survey the locations of any wastewater pipes and associated structures left in the ground and prepare asbuilt plans.

 Backfill excavated cavities and trenches with compacted cleanfill, followed by topsoiling and grassing, except at road crossings that are to remain post-works, which should be backfilled with approved, compacted hardfill.

The contractor shall take care during works in the vicinity of B75/B76 (site office) not to remove or damage the wastewater system serving these buildings.

#### 12.3.3 Stormwater Reticulation

The site has an extensive stormwater reticulation network, draining into the trunk stormwater system. This comprises an estimated total non-trunk length of approximately 4460m of 100-375mm dia pipe in moderate to poor condition, of which approximately 990m has been identified as needing removal.

The existing stormwater reticulation and the required stormwater demolition works are shown on drawings 32205/2100-2110 inclusive. Drawing 32205/2110 shows the location of the trunk stormwater system to be retained. This system includes the grated inlets draining the flood detention areas shown on these drawings. These grates are not to be removed.

#### The contractor shall:

- Check that any contaminated soil removal works in areas where stormwater demolition is also required have been completed and certified, prior to starting stormwater demolition works.
- Remove all non-trunk stormwater pipes down to 800mm depth (to top of pipe) and all stormwater related catchpits, manholes, gratings, etc. down to 1m depth. Allow for dewatering, as required. As some of this system is connected to catchpits in the road network, it is recommended that stormwater drainage serving the red and green road networks not be removed in critical areas that may result in inadequate road drainage/ponding until other demolition works are complete. Instead, it would be undertaken later, as part of reinstating these areas to a "farm access" standard. Alternatively, the contractor may provide alternative drainage measures in these critical areas.
- If during this process, new pipes <800mm depth (to top of pipe) are found that are not shown on the demolition drawings, advise LINZ project manager/site representative, who will issue instruction for any additional removal works.
- Where the pipes or fixtures are located within vegetation areas as identified in the plans, refer to section 21.2 of this DDRMP for procedures to follow.
- Cap any exposed ends of pipes left in the ground.
- Survey the locations of any stormwater pipes and associated structures left in the ground and prepare asbuilt plans.
- Backfill all other excavated cavities and trenches with cleanfill, followed by topsoiling and grassing, except at road crossings that are to remain post-works, which should be backfilled with approved, compacted hardfill.

It is possible that some of the stormwater pipes being removed or plugged may also have field and/or roading/pavement subsoil drainage connected into them, which may potentially cause waterlogging/ponding in areas that are no longer able to drain via the pipe network. It has been assumed that drainage metal bedding under the stormwater pipes being removed, will continue to provide a drainage pathway for any subsoil drainage connected to the stormwater system.

On the completion of site demolition and remediation works, the stormwater system that will remain in place will comprise the trunk stormwater reticulation system, as shown on drawing 33097/PL002, including the five inlets to the upgradient off-site rural area, the on-site flood detention areas shown and associated grated inlets. Damaged sections of the stormwater trunk main will be lined to repair them, as explained in section 16. All other stormwater pipe reticulation will be removed or capped. Overland flowpaths will be unchanged. Culvert 2 and its associated embankment will also be removed and the stream restored through this area (refer section 14).

#### 12.3.4 Power and Telecom

The existing power and telecom infrastructure has been deemed obsolete, as its essentially at its 'end of life' and is in an inferred moderate to poor condition. The infrastructure to be removed only serves the hospital site and its removal will not affect any of the houses along Te Mawhai Road or the housing clusters in Croasdale Rd and Tokanui Village.

The existing comms and power services and the required comms/power demolition works are shown on drawings 32205/2300 (comms) and 32205/2400-2409 respectively. Limited potholing found that most of the underground power cabling is direct buried, and likely most of the comms as well. The available information is shown on these drawings.

#### The contractor shall:

- Check that any contaminated soil removal works in areas where power/telecom demolition is also required have been completed and certified, prior to starting power/telecom demolition works.
- Direct pull cables out of the ground from cable pits or potholes at selected locations (power ~7320m; comms ~4630m). Hence, the affected trees shown on the associated drawings is primarily for contractor information and no tree removal or other specific tree protection measures are proposed.
- Removal of cables deeper than 800mm for scrap metal recovery will be agreed between the contractor, engineer and LINZ, using the same methodology as above.
- Remove any associated ducting and concrete cable protection measures encountered during these
  works, and remove any associated structures to 1000mm, excluding the power supply to B75/76 (site
  office) and to the site security portacom.
- Remove any overhead power lines and light poles.
- Survey the locations of any power/telecom service lines and associated structures left in the ground and prepare asbuilt plans.
- Backfill excavated cavities and trenches with cleanfill, followed by topsoiling and grassing, except at road
  crossings that are to remain post-works, which should be backfilled with approved, compacted hardfill.

### 13 CONTAMINATED SOIL

This involves the removal of low-moderate level contaminated soil from around the perimeters (halos) of many buildings on-site, comprising almost entirely allophanic topsoil, and containing primarily lead or asbestos contaminants.

**Lead:** There are at least 20 buildings (possibly 22) that appear to require remediation for lead paint-derived contamination in the adjacent soil: B2, B5, B7, B8, B11, B13, B15, B17, B18, B21, B23, B24, B27, B29, B33, B35, B41, B52, B58, B59, possibly B19 and B55. Soil remediation details are provided in the Remedial Action

Plan, based on meeting the adopted rural residential remedial standard of 120 mg/kg. If the buildings were instead placed into a managed zone with a higher remedial standard, the amount of soil to be removed would be less but the contamination greater. The 95<sup>th</sup> UCL (upper confidence limit) concentration 0.5m from these buildings is around 900 mg/kg, and the estimated TCLP-leachable lead at this concentration is approximately 1.2 mg/L. Any management or remediation works involving lead-based paint related contamination will be required to follow the recommendations outlined in the 'Toitū Te Whenua Health and Safety Guidelines – working with lead-based paints'.

**Asbestos:** There are eight buildings and a couple of substations that appear to require remediation for asbestos in soil based on asbestos fibres/friable asbestos (AF/FA) more than 0.001 %. These are B29, B30, B58, B63, B65, B68, B69, B74, and S8 and S3 with buried asbestos. Soil remediation details are provided in the separate Remedial Action Plan. The highest recorded AF/FA was 0.039 %.

Buildings B29 and B58 have both asbestos and lead as contaminants.

In addition, there is at least one building with elevated zinc but no lead, and one building with herbicide contamination around it.

Several non-building areas have also been identified with localised contamination or more than minor quantities of construction and demolition waste, that will be remediated.

Contaminated soil remediation is described in detail in the separate Remedial Action Plan.

Where the contaminated soil areas are located within vegetation areas as identified in the plans, refer to section 21.2 of this DDRMP for procedures to follow.

# 14 WHAREKŌRINO STREAM EMBANKMENT REMOVAL AND REINSTATEMENT

### 14.1 BACKGROUND

There is a redundant road embankment crossing the Wharekōrino Stream that provided an historical side road entrance to the Site. This road crossing is located in the north-eastern areas of the hospital site and is shown on drawing 33205/EMB001. The culvert through this embankment has not been able to be located yet, due to it being completely submerged. This culvert is estimated to have a diameter of 1350mm to be consistent with the upstream culvert 3. The road embankment is approximately 6m wide (at the top) by 50-60m long. It is relatively high, with an estimated height of 5.5m from the stream bed to the embankment crest. This culvert has a significant influence on flood levels affecting the existing disposal site while the road embankment acts as a dam, affecting stream flow patterns and ecology. The embankment itself was heavily overgrown and had been subject to fly tipping, but this has recently been cleared, with all debris, waste and vegetation removed.

The stream bed is very flat through this area, with significant water ponding both upstream and downstream of the culvert. This means it will be challenging to remove the bottom section of embankment within the stream bed itself.

Geotechnical investigation of this embankment found that the majority of the fill material appears to be controlled fill, likely borrowed from a nearby source. The exception was fill material, containing minor

(ETP05), trace (ETP06) and abundant (ETP07) construction debris including concrete, bricks, metal and wire in 0.6-1.0m layers.

Embankment fill testing for contamination found that all samples complied with site specific remedial standards. Most samples were within or slightly above background levels, although Benzo-a-pyrene equivalent (BAP) was detected in one sample at 5.4mg/kg and asbestos was detected at one location at <0.001wt %, adjacent to where an asbestos pipe was found.

Based on the above, it seems the majority of the fill embankment can be reused for backfilling within the hospital site.

#### 14.2 METHODOLOGY

Removal of this culvert would involve the following works over an approximately 3,000m<sup>2</sup> area, involving total excavation volume (soil and roading materials) of 6,800m<sup>3</sup>:

- (a) Vegetation and tree removal, with trees being mulched on-site, where practical (estimated 2800m<sup>2</sup> area);
- (b) Establishment of erosion and sediment controls; including temporary damming of stream (likely both upstream and downstream) and diversion of stream runoff by pumping around the works area.
- (c) Removal of redundant road paving, basecourse and subbase material to stockpile. Reuse suitable materials on-site as backfill material and dispose of other materials off-site to appropriate processing or disposal facility.
- (d) Remove road embankment (assumed soil material) to stockpile. Reuse suitable materials on-site for backfill material and dispose of excess spoil off-site to appropriate facility.
- (e) Remove culvert estimated 1350mm dia x 20-30m long and associated inlet/outlet structures.
- (f) Trim stream banks to tie in with existing stream profile (3000m²).
- (g) Place clean topsoil along stream batters estimated 100-150mm thick and cover with biodegradable coir matting or similar.
- (h) Grass and/or plant upper stream banks (estimated 1500m²) and plant lower stream banks (estimated 1500m<sup>2</sup>).
- (i) Remove temporary dams and erosion/sediment controls.

These works are shown on the attached plans 33205/EMB001-003 and are explained in more detail in the separate ESCP. Any stream works must comply with the Fish Management Plan (separate document).

### 15 WWTP WORKS AND WORKS IN OR NEAR WETLAND AREAS

Demolition related works within wetland areas or within a 10m buffer of wetlands are described in this section, including the proposed works methodology. This includes all remaining WWTP demolition works, as the majority of these are located in or near the north-eastern wetland on the site.

#### 15.1 NORTH-WESTERN WETLAND

Works in the north-western (NW) wetland comprise the following:

(a) Removal of an above ground wastewater reticulation network comprising 150-160mm diameter pipework, with concrete supports and thrust blocks at regular intervals.

- (b) Removal of a below ground electrical supply cable, that runs to sub-station S7. This is likely to be a 11kV line and may be either direct buried or ducted in steel pipes. Site investigations found that most electrical pipes were on average 0.9m deep.
- (c) Removal of the garage associated with the Doctor's Flats (Building B76).

### 15.1.1 Wastewater Pipeline

The extent of the wastewater pipeline within the NW wetland is shown in Figures 14 and 15 below.



Figure 14: Above ground wastewater lines through NW wetland area

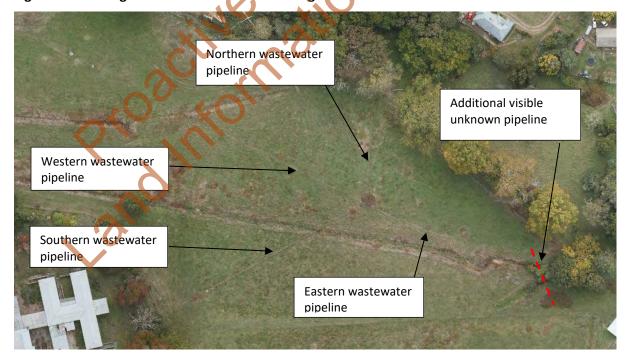


Figure 15: Visible wastewater lines in wetland area

GIS imagery (Figure 15) shows that this pipeline (approx. 150-190mm diameter) is generally above ground, with some areas covered by vegetation.

A site investigation of this pipeline network found it has a variety of supporting structures. Soil disturbance calculations and representative photographs are included in Appendix B. Site findings are summarised below.

The pipe supports on the southern pipeline comprise metal footings (approximately 860mm in length) and are spaced at 3m intervals. These extend into a concrete foundation which is approximately 1000mm (width) and 1200mm (length), and is embedded approximately 200mm into the ground in this area, based on site measurements.

The pipe supports of the southern pipeline on the northern side of the waterway comprise of concrete piles that are at 3m intervals. These range from 200 – 450mm (width) and 200 – 450mm (height). They are embedded approximately 200mm bgl. Two concrete chambers also encase the pipeline in this area. One measures 500mm (width), 1040mm (length) and 360mm (height). The second measures 540mm (width), 640mm (length) and 340mm (height). Both are embedded bgl by approximately 200mm.

The remaining pipelines are generally located on a concrete slab foundation which is approximately 500mm (width) and 420mm (height) throughout the extent of the pipeline. The embedment of the concrete foundation varies across the extent of the pipeline, ranging from 150mm bgl to the entire foundation below ground level. Some parts of the western and eastern pipelines are buried, while one section of the eastern pipeline is encased in concrete – this concrete chamber extends along the eastern pipeline approximately 17m, measuring 450mm (width) and 280mm (height). The concrete chamber is embedded an additional 400mm into the ground.

At the junction of all four sections of pipeline, the pipes connect into a concrete chamber which is approximately 1220mm (width), 1520mm (length) and 600mm (height). The chamber is embedded an additional 400mm bgl.

An additional pipeline that was not identified in the GIS imagery was observed during the site walkover. This was located within the eastern portion of the wetland, running under the eastern wastewater pipe across the waterway. It is not visible above ground throughout the remainder of the wetland, and it is unknown where it extends to, or whether it is still live. Checks of other services plans do not show any pipe in this location.

Pipe supports have been grouped into a number of categories and are illustrated on drawing 33205/2011.

These pipes will be removed using the following methodology:

- These works will be done during an extended summer dry period to minimise the potential for damage to the wetland area.
- A small excavator (8T or 13T) will travel on swamp mats placed along the route of the pipeline. This will
  remove the pipe in small sections and it will then be transported by the excavator or a small truck (4W
  or 6W) or similar to a storage area for processing either for recycling of disposal.
- The pipe supports will be lifted out by the excavator and transferred by the same truck to the storage area for processing for recycling or disposal.

- This process will create an estimated 53m³ void volume, typically 0.2-0.4m deep. These voids will be backfilled with topsoil, that will be placed and tamped down, followed by reseeding/replanting with appropriate grass/plants to match the vegetation in the wetland area.
- The swamp mats will be removed on completion of the works and any damaged vegetation areas reinstated.

### 15.1.2 Power Cabling

The length of power cabling through the wetland area is approximately 210m long, as shown in Figure 16 below. There is also a small section of overhead power cabling that passes through the southern tip of the wetland.

These pipes will be removed using the following methodology:

- These works will be done during an extended summer dry period to minimise the potential for damage to the wetland area.
- A small excavator (8T or 13T) will travel on swamp mats placed along the route of the cabling. The cable
  will be exposed at each end and then pulled out by excavator. The cabling will be cut into suitable lengths
  for transport and transferred by a small truck to the storage area for processing for recycling or disposal.
- This process will create a narrow trench where the cable has come out of the ground. Any displaced soil
  from the trench will be placed back into it and the trench topped up with topsoil and tamped down,
  followed by reseeding/replanting with appropriate grass/plants to match the vegetation in the wetland
  area.
- The swamp mats will be removed on completion of the works and any damaged vegetation areas reinstated.

The overhead power cable can be removed without touching the wetland area.



Figure 16: Extent of below ground power cable and above ground power cable in wetland area.

### 15.1.3 Building 76

Building 76 is shown as being located within the 10m wetland buffer. This is the garage to the Doctor's Flats. Building information indicates this building is approximately 24m<sup>2</sup> in area and has a "concrete plinth with post brackets" footing. Estimated ground disturbance for building footings removal is approximately 7m<sup>3</sup>. These will be removed and reinstated with soil.

### 15.2 NORTH-EASTERN WETLAND - WWTP AREA

#### 15.2.1 Further WWTP Demolition Works

The WWTP was decommissioned several years ago and has already been partially demolished.

The WWTP, pre-demolition, is shown below in Figure 17. Wharekorino stream flows to north Treated wastewater Outlet pipe (approx) Drying beds Flow meter Site Office Humus tank Imhoff tank Chemical store Shed with asbestos cladding Intake pipe Trickle filter tank Flow Direction Dry well and chlorine store

Figure 17: Former WWTP Pre-decommissioning

The following items have been decommissioned and removed:

- Drying beds
- Site office

- **Imhoff Tank**
- **Humus Tank**
- **Chemical Store**
- Shed
- Dry well and chlorine store

A new wastewater pump station has been installed in the north-east part of the compound. This comprises a number of inground tanks and chambers, including the pump station, set into a concrete pad, and an above ground control panel. This system is shown below in Figures 18 and 19.

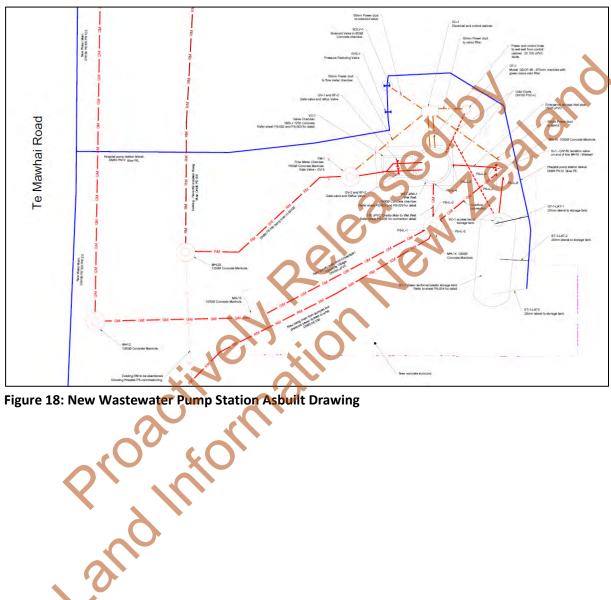


Figure 18: New Wastewater Pump Station Asbuilt Drawing



Figure 19: New Wastewater Pump Station (in ground tanks and chambers under concrete pad)

The WWPS system, including the concrete pad, needs to be protected from damage during further proposed demolition works in this area (item 1 in attached drawing 33205/2010).

When the WWPS became operational, an existing section of wastewater rising and gravity mains from MH20 to the end of the wastewater line (MH23) was abandoned, as shown in Figure 20. This work comprises three DN150 PVC gravity pipes of total length around 67m, with three associated wastewater manholes, and a short section of 3800D stormwater pipe as shown in Figure 20. All of this pipework is less than 800mm deep, except the first 18m of wastewater pipe from MH23 towards MH22.



Figure 20: Abandoned wastewater line and MHs (item 13)

The following additional demolition works are to be undertaken in the WWTP compound area as part of the hospital demolition works (refer drawing 33205/2010):

- Item 2: Remove flow meter and associated concrete pad.
- Item 3: Remove redundant UV treatment system. LINZ want this to be salvaged for reuse elsewhere. Soil sampling of the WWTP area found soil near this system had slightly elevated arsenic concentration (15mg/kg) exceeding the site-specific managed standard. This will be remediated as discussed in the separate RAP.
- Item 4: Remove outfall pipe.
- Item 5: Remove shallow retaining wall and steps; regrade higher ground behind retaining wall to tie in with natural ground on lower side of retaining wall.
- Item 6: Remove edging around former humus tank.
- Item 7: Remove trickling filter and stone media. The stone media is suitable for reuse, but may need cleaning first, as it is likely to be caked with dead, dried slime material.
- Item 8: Remove grit chamber on wastewater inlet line.
- Item 9: Remove inlet wastewater pipe strapped to footbridge. Trace at each end and seal off with concrete once pipe depth reaches 800mm.
- Item 10: Remove footbridge.
- Item 11: Remove any associated ancillary cabling/ducts (e.g. electrical controls, former monitoring cables, etc. from footbridge).
- Item 12: Relocate fence to reduce compound size. LINZ to confirm extent.
- Item 13: Remove wastewater pipes down to 800mm depth out to the boundary with the road reserve and remove the stormwater pipe and associated three WWMHs shown in Figure 20. Cap the line at the road reserve boundary and at each end of the wastewater pipe greater than 800mm depth from MH23 to MH22.

These items are shown on the attached plan and in the following photos.



Figure 21: Former flow meter area



Figure 22: Redundant UV Treatment Plant



Figure 23: Outfall Pipe

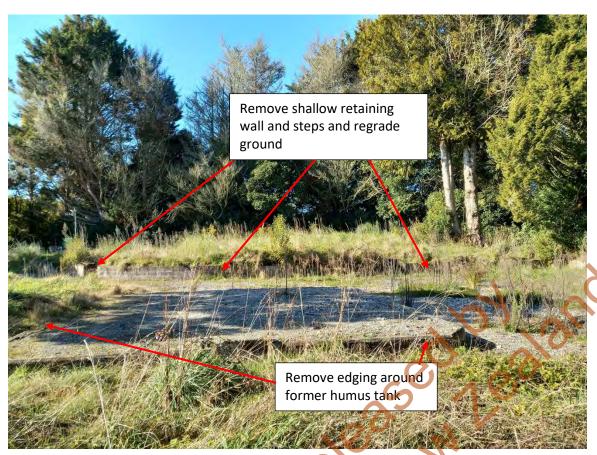


Figure 24: Remove shallow retaining wall and steps and regrade ground (item 5); remove edging around former humus tank and regrade ground (item 6)



Figure 25: Remove trickling filter (circular tank in background) and stone media (item 7).



Figure 26: Remove grit chamber on wastewater inlet line, wastewater inlet pipe strapped to footbridge, any ancillary cables/ducting, and footbridge itself (items 8-11)



Figure 27: Closeup of grit chamber showing concrete blockwork construction and grated metal lid (largely hidden under vegetation)





Figure 29: Relocate perimeter fence to reduce compound size. LINZ to confirm extent

#### 15.2.2 WWTP Works within or near NE Wetland

Of these works, the following involve works either within the wetland or within the wetland 10m buffer:

- (a) Item 4 outfall pipe removal (~7m within wetland buffer zone)
- (b) Item 6 removing edging around former humus tank (within buffer)
- (c) Item 7 removing trickling filter and media (partly in buffer area)
- (d) Items 8-11 removing grit chamber, wastewater inlet pipe and footbridge (within wetland).
- (e) Item 13: Removing wastewater pipes down to 800mm depth out to the boundary with the road reserve and remove the short length of 3800D stormwater pipe and associated three WWMHs (partly within wetland buffer area).

### Item 4: Outfall pipe removal

This pipe would be removed using the following methodology:

- These works will be done during an extended summer dry period to minimise the potential for damage to the wetland area.
- A small excavator (8T or 13T) will travel on swamp mats placed along the route of the pipeline. This will remove the pipe in small sections and it will then be transported by the excavator or a small truck (4W or 6W) to a storage area for processing either for recycling or disposal.
- This process will involve estimated earthworks of 7.2m³ (30m length x 300mm wide trench x maximum 0.8m depth), of which approximately 1.7m³ will be within the wetland buffer zone. Soil disturbed during pipe removal would be reinstated within the trench (subsoils first and then topsoil) and the trench would be topped up with topsoil that will be placed and then tamped down, followed by reseeding/replanting with appropriate grass/plants to match the vegetation in the wetland area.
- The swamp mats will be removed on completion of the works and any damaged vegetation areas reinstated.

### Item 6: Removing edging around the humus tank

This involves removing some edging around the former humus tank and then regrading the retaining soil to tie in with the adjacent ground. All the soil disturbed is inferred to be bedding for the former humus tank and hence there should be minimal if any disturbance of the underlying natural ground.

## Item 7: Removing trickling filter and media

This involves removing the above ground trickling filter tank and its media and reinstating this area. There is expected to be minor disturbance of the underlying natural ground. Only approximately 10% of the trickling filter area is located within the wetland 10m buffer zone and these works are not expected to have any impact on the wetland.

### Items 8-11: Removing Grit Chamber, Wastewater Inlet Pipe, Ancillary Cabling and Footbridge

These works are entirely located within the wetland area. They would be undertaken, working backwards from the grit chamber to the WWTP compound. They would involve the following:

• Remove the grit chamber – concrete block construction with grated metal lid. This will have to be done manually working from the footbridge, as it is not possible for an excavator to access this area.

- Remove the wastewater inlet pipes strapped to footbridge and trace back at each end. Stop at 0.8m depth (likely stream bank) and plug pipe with concrete.
- Remove any ancillary cabling.
- Remove footbridge, including the timber support posts this would likely be done with a large excavator, working from the WWTP side.
- The wastewater inlet pipe and any ancillary cabling currently strapped to the footbridge will be removed by hand and/or small excavator when possible. When access is available for an excavator, swamp matting will be used.

Item 13: Removing wastewater pipes down to 800mm depth out to the boundary with the road reserve and remove the short length of 3800D stormwater pipe and associated three WWMHs.

Approximately 18m of the wastewater line, one WWMH and the short length of stormwater pipe are located within the wetland buffer area. The same methodology would be used for these works as for the outfall removal. This process will involve estimated earthworks of 22m³ (57m length WW line x 300mm wide trench x maximum 0.8m depth + 7.5m long SW line x 600mm wide trench x maximum 0.8m depth + 3 1050dia MHs to maximum 1m depth), of which approximately 9m³ will be within the wetland buffer zone.

#### 16 PIPE LINING WORKS

The upgradient rural catchment areas feeding into the trunk stormwater system are shown on drawing 33205/PL001, while the trunk system itself is shown on drawing 33205/PL002. The pink highlighted pipes are to remain and be lined. This system has 5 inlets, receiving runoff from off-site, upgradient rural areas. It also drains some flood detention basins within the site (the blue shaded areas) via open grates which will be retained. It discharges to a tributary of the Wharekorino Stream at Location O1. A comprehensive CCTV survey was undertaken of this system, as shown in drawing 33205/PL003. This found that the lower portion of this system was "drowned", with this either due to partial blockage or to backwater effects from the main stream.

Stormwater non-trunk pipe removal and capping works will be undertaken separately as part of site demolition works and in advance of stormwater trunk pipe lining works, so that all piped inlets into the trunk main system will be removed or capped, except for those pipes draining flood detention areas.

The trunk pipe system comprises the following:

- 1170m x 900dia pipe
- 143m x 825dia pipe
- 292m x 750dia pipe
- 163m x 675dia pipe

Review of the CCTV shows limited sections within these pipe lengths that are damaged and require lining. Hence, it is proposed to "patch" these lines at these localised locations rather than line the entire line. The CCTV footage for the trunk system is included in Appendix C. This also includes a summary of the identified sections of pipe requiring lining.

The works are likely to take around 3-6 weeks and would be conducted during summer – likely January-March to take advantage of the typically driest time of year. Given the size of the contributing catchments and

photos/videos of flow in pipes from the CCTV survey, it is considered unlikely these works can be done at a time of no flow (i.e. there is always likely to be some flow through pipes). Hence, temporary stream diversions will be required to facilitate the works. A proposed methodology for these works is set out in the separate Erosion and Sediment Control Plan.

#### 17 HEALTH & SAFETY

#### 17.1 GENERAL

The Contractor has a duty to conduct activities in such a manner so that the health and safety of their employees carrying out construction works are safeguarded to the best of their ability. The Contractor is expected to include the following in their Health and Safety Plan:

### (i) Commitment

- Commitment to active management of health and safety
- Set clear goals and areas of responsibility

#### (ii) Planning

- Comprehensive hazard identification
- Hazard assessment
- Determination of appropriate control measures and management strategies

#### (iii) Action

Control measures and management strategies implemented including:

- Information
- Training and supervision
- Workplace/worker monitoring
- Emergency procedures
- Accident reporting and investigation

#### (iv) Application

• The Health and Safety Plan applies to principals, employees, contractors, sub-contractors and all land modification, civil and construction works being carried out on the development.

### 17.2 SITE SPECIFIC SAFETY PLANS (SSSPS) & JOB SAFETY ANALYSES (JSAS)

All primary contractors engaged by LINZ or subcontractors engaged by primary contractors will be required to provide SSSPs & JSAs for the tasks they are engaged for. These documents will be reviewed by LINZ or relevant project staff. No work may commence until each contractor has received a certified SSSP and/or JSA. These documents need to address the following site hazards and any additional hazards identified by the contractor.

**Table 12: Assessment of Site Hazards** 

No	Hazard
1	General – remote work site
2	Public entering work site area (including after hours)
3	Injury from moving machinery
4	Injury from falling objects/insecure loads
5	Injury from falling from height
6	Trip hazards
7	Injury from incorrect use or overuse of manual equipment and lifting loads
8	Injury from animals/insects (grazing animals in vicinity, bee hives on site)
9	Sun exposure
10	Noise
11	Eye damage
12	Deep excavations
13	Steep contours, working on slopes – tripping, slipping and falling
14	Exposure to bird guano in buildings
15	Physical hazards associated with demolishing buildings (to be broken down into subcategories by contractor)
16	Exposure to asbestos
17	Exposure to lead paint
18	Exposure to contaminated soils
19	Working in close proximity to watercourse
20	Tree felling

# 17.3 HAZARDOUS SUBSTANCES MANAGEMENT

Hazardous substances to be managed include the following:

- Asbestos in building structures and some pipes;
- Lead paint contaminated building materials;
- Guano (bird poo) in buildings;
- Contaminated dust;
- Hazardous chemicals, stored in various buildings;
- Buried historical demolition debris;
- Coal tar in some roading materials;
- Contaminated soil (refer RAP).

### 17.3.1 Asbestos Contaminated Building Materials (ACM)

All asbestos contaminated building materials (ACM) must be removed in accordance with the Approved Code of Practice (WorkSafe) (2016), Health and Safety at Work (Asbestos) Regulations (2016) and the BRANZ New Zealand Guidelines for Assessing and Managing Asbestos in Soil (2017).

Each contractor involved in removal of ACM must provide evidence of certification to remove Class B and Class A building materials. Furthermore, each contractor involved in the asbestos containing building material removal must provide an Asbestos Removal Control Plan (ARCP), covering their specific area of work. These ARCPs will be reviewed by the project SQEP and LINZ.

### 17.3.2 Asbestos Pipes

All asbestos pipe removals will be undertaken under Class B licensed removal work controls. All contractors involved in these works will need to provide ARCPs covering their removal areas and methods to the SQEPs and LINZ for review.

Prior to any removal works beginning, WorkSafe must be notified as these works will be licensed works.

All contractors must be wearing at minimum type 5/6 coveralls, gloves, steel capped gumboots and half or full mask respirators with P3 filters.

The age of asbestos pipes onsite is 60-80+ years old. Given this, the condition of these pipes is inferred to be highly weathered. Contractors should move to Full face masks where pipes are significantly damaged or in friable condition during removals.

Particular care shall be taken when separating pipe sections to minimise potential to cause cross-contamination of the adjacent soil.

### 17.3.3 Lead Paint Contaminated Building Materials

All contractors undertaking any management or remedial works involving materials contaminated with lead-based paint (LBP), or suspected to be contaminated with lead-based paint, must be familiar with and follow the requirements of the following documents:

- (a) AS/NZS 4361.2:2017 Guide to hazardous paint management Part 2: Lead paint in residential, public, and commercial buildings;
- (b) Guidelines for the management of lead-based paint WorkSafe; and
- (c) Toitū Te Whenua Land Information New Zealand 'Health and Safety Guidelines Working with Leadbased Paints'.

It should be noted, lead paint contaminated building materials are to be removed intact (where possible) with the lead paint attached. These will either be removed for reuse/recycling purposes or disposed of to an appropriate landfill. These materials may be divided into the following sub-categories as shown in Table 13 below, with appropriate disposal/reuse options provided:

**Table 13: Building Material Disposal/Reuse Options** 

Building Material	Disposal/Reuse Options
Wooden Weatherboard	<ul> <li>Chipped and used as biofuel;</li> <li>Salvaged for reuse (remove LBP following LINZ Guidelines), dispose of LBP after stripping;</li> </ul>
Structural Timber	Disposed of at licensed landfill with LBP intact.

Fit out material – GIB/Render	Removal of substrate under correct controls or demolition and disposal to appropriate landfill facility	
Concrete, Cement Blocks and Bricks	<ul> <li>If painted, dispose to licensed landfill with LBP intact;</li> <li>If removal is practical to allow for reuse, of cement/cement blocks, LBP to be removed (following LINZ LBP Guidelines)</li> </ul>	
ACM Fibre Cement	Removed under licensed asbestos removal works controls, disposed of at licensed landfill as asbestos waste.	

All contractors working with or in the vicinity of lead-based paint contaminated building material removal must be supplied with and wear the following PPE/RPE:

- P3 half or full-face respirator or powered air purifying respirator system;
- Type 5 disposal coveralls;
- Laceless boots able to be decontaminated or disposable boot covers; and
- Disposable nitrile gloves or similar.

# 17.3.4 Guano in Buildings

There is a significant amount of Guano (bird poo) throughout most structures within the Hospital site. LINZ have advised prior to any remediation and deconstruction/demolition taking place, a thorough environmental clean to remove the guano and other debris inside buildings will be completed. The guano may be mixed with mulch to make compost on-site, or taken to an off-site composting facility, subject to checking it is free of any cross-contamination (especially from lead paint and asbestos), or else taken to an appropriate disposal facility.

### 17.3.5 Contaminated Dust

There is potential for contaminated dust to be generated from various sources during the works.

- Asbestos dust: This should be managed through application of water and polymer-based solutions. Perimeter air monitoring and likely individual exposure monitoring around any Class A areas will also be needed. Particular care will be needed around building HALOS, where dust in the subfloor space may be mobilised from site works (e.g. vibration). These areas should be discussed with the LINZ Project Manager or their representative and the Asbestos Removal Supervisor prior to starting work in these areas.
- Lead paint in soil dust: this will be managed through keeping any such materials damp.
- Other heavy metals of concern in soil: these should be removed when any contaminated building HALO areas are excavated, so water suppression should suffice.

#### 17.3.6 Buried Historical Demolition Debris

During February 2024 site investigation work, some historical demolition debris, including some asbestos sheet fragments, filament bulbs, burnt material, terracotta/earthware pipes, etc. was found in rare/minor/small quantities at variable depths ranging from near surface to up to 1.2m on the northern sides of Buildings B02 (northern side of southern arm) and B26 (directly north in carpark area). A review of historical aerial photographs identified that some buildings, or parts of buildings, have been demolished in

these areas in the past. All of these areas have been investigated as part of intrusive investigations by AECOM/GHD with no significant demolition debris or contaminated soil found. Nevertheless, some fill and minor demolition debris may be found in these areas during associated demolition works, particularly during the removal of building footings/foundations and any buried services. This may also apply to the industrial area, where some discoloured fill was encountered. The extent of the historical demolition works is shown in Figure 30. The contractor should be aware of this, and advise LINZ or their nominated representative, if such fill/materials are found. Accidental discovery protocols will be triggered, if the find is significant (e.g. asbestos fragments, concentrated pockets of demolition debris.)

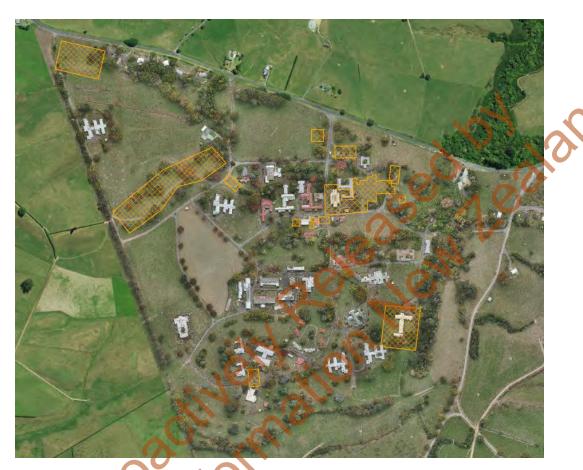


Figure 30: Extent of Historical Building Demolition Works

### 17.3.7 Coal Tar Roading Materials

Coal tar roading materials present on-site have been identified in the 33205 CT drawing series. These materials will be removed and disposed of off-site as part of the demolition works, as explained in section 12.1 of this report. This will include some basecourse and subbase at the locations identified in section 12.1 and the tables in these drawings.

The associated PAH contamination is tightly bound to the road materials and is generally considered a low human health risk. Standard PPE for disturbing and removing contaminated materials should apply to the removal of coal tar roading materials.

#### 17.3.8 Hazardous Substances

Some buildings that confirmed or potential hazardous substances are listed in Table 14 below, together with their current known status.

Table 14: Potential and/or Confirmed Hazardous Materials Present Onsite and Current Status

Source	Status
At least four boilers on-site	May still contain coal ash
Incinerator in shed 8	May still contain ash
4,500L of chemicals in swimming pool	Unknown if these chemicals (chlorine and
shed (from AECOM building hazard	hydrochloric acid) have been removed from the site.
register (2018))	
Fly tipping and whiteware are referred to	Relatively small volumes; some items may be
as being present at three different	recyclable; expect residual materials can be disposed
locations across the Site (including ashes	to Class 1 landfill but needs confirming.
and ACM).	5010
8 electricity substations – transformers	May still contain PCBs.

These materials will need to be handled and disposed of appropriately in accordance with EPA/WorkSafe requirements, with disposal receipts provided to LINZ.

#### **18 SITE SUPERVISION**

#### 18.1 GENERAL

The demolition works will be undertaken under a panel contract based on NZS3910:2013. Site observation will involve regular inspections by LINZ or their nominated representative, as well as a Contaminated Land Specialist (SQEP) and independent WorkSafe Licensed Asbestos Assessor.

The proposed demolition works involve a wide range of activities that affect different areas and involve soil disturbance to variable depths. Site supervision will include the following:

- Initial meeting;
- Pre-start meeting, following the installation of all erosion and sediment controls prior to any soil disturbance activities commencing.
- Regular site inspections during the works to check the contractor is following the DDRMP.
- Fortnightly progress meetings.
- Site inspection (call-out basis) if the contractor encounters any specific issues that cannot be resolved by phone or email.

#### 18.2 KEY PERSONNEL CONTACT DETAILS

Key personnel contact details are list below.

**Table 15: Key Personnel Contact Details** 

Position	Name	Email	Mobile
LINZ Project Manager	Bryan Daly	bdaly@linz.govt.nz	027 264 6885
LINZ Site Representative	TBC		
LINZ Site Security	Mark Collins		021 183 6985
Cultural Monitor/Kaitiaki	TBC		
Contractor Project Manager	TBC		
Contractor Site Supervisor	TBC		
<b>Asbestos Licensed Assessor</b>	TBC		
SQEP	Sean Finnigan	sfinnigan@ftl.co.nz	021 0223 0510

#### 19 EROSION AND SEDIMENT CONTROL

Activities onsite will involve various earthworks and land disturbance activities that have the potential for adverse environmental effects. Egress of silt and sediment in stormwater to nearby water bodies is to be minimised due to the presence of contaminants in soil. These contaminants bind to soil particles and hence good silt and sediment control is required to ensure contaminants are not released into the wider environment.

All sediment control works are to be operational prior to any other works commencing on site and shall remain in place until development works are complete and measures are in place to minimise erosion. All erosion and sediment controls shall comply with the Waikato Regional Council document 'Erosion & Sediment Control Guidelines for Soil Disturbing Activities' dated January 2009, technical report number No.2009/02, updated in 2014, with current information on specific items found online (<a href="https://waikatoregion.govt.nz/services/publications/tr200902/">https://waikatoregion.govt.nz/services/publications/tr200902/</a>).

Erosion and sediment control requirements are set out in the separate Erosion and Sediment Control Plan (ESCP), which should be referred to for further details.

#### 20 DUST, NOISE AND VIBRATION

#### **20.1 DUST**

Dust control aims to prevent or reduce the movement of dust from disturbed soil surfaces that may create nuisance, health hazards, traffic safety problems and/or off-site damage and discharge to the environment.

The activities that will take place at the site which may generate discharges to the air are;

- Deconstruction and demolition;
- Earthworks:
- Vehicle and plant movements;
- Bulk materials handling and processing, including crushing of some hard materials (e.g. concrete);

• Wind generated dust from dry exposed surfaces such as stockpiles, roads and impervious surfaces.

The major factors that influence dust emissions from surfaces are;

- Wind speed across the surface the critical wind speed for pick up is 5m/s, while dust pickup increases rapidly for wind speed above 10m/s;
- The percentage of fine particles in the material on the surface;
- The area of exposed surface;
- Disturbances such as traffic, demolition, excavation, loading and unloading of materials;
- The height of the source above the surrounding ground level.

Standard dust control measures will be used to control dust at the site and soil disturbance measures will be suspended if dry and windy conditions prevail, or alternatively the disturbance area shall be watered and maintained in a slightly moist state to minimise dust generation.

Dust management during the excavation works and stockpiling will generally comply with the procedures set out in *Good Practice Guide for Assessing and Managing Dust* (Ministry for the Environment, 2016).

Dust will be controlled at the works site using appropriate measures from the following toolbox:

- Minimising the extent of the exposed area at any one time.
- Limiting traffic to specified construction access roads and minimising travel distances by optimising site layout.
- Controlling vehicle speeds.
- Maintaining road surfaces.
- Minimising tracking of dirt on vehicle wheels onto paved surfaces.
- Minimising drop heights when loading and unloading vehicles.
- Limiting stockpile heights.
- Providing shelter from the wind for stockpiles.
- Consolidating and sealing off loose surface material.
- Progressive placement of hardfill (sub-basecourse) for hardstand areas and mulching and grass establishment, as works are completed in grassed/vegetated areas.
- Use of water carts to dampen exposed areas.
- Use of soil binders to form a cohesive membrane or protective crust that reduces windblown dust generation (contingency measure).
- Use of textiles as temporary covers on stockpiles or partially completed batter slopes, or as permanent cover (e.g. vegetation promotion blanket) on completed areas (contingency measure).

Water for water cart usage will be sourced from a separate supply to be provided to a central location onsite by LINZ. Water usage will be carefully monitored to avoid overwatering, which may result in subsequent runoff of the dust laden water.

Any materials that are stockpiled onsite should be kept damp through water application. If stockpiled materials are expected to remain onsite long-term, then a polymer-based emulsion should be considered for application, to reduce ongoing dust generation issues.

Waste oil and any hazardous substance that is not licensed as a dust suppressant under HSNO are specifically excluded from being used as a dust suppressant.

Fixed plant that may be used on site includes equipment such as crushers, shredders and other processing equipment. These are point sources of dust emissions, which will be controlled by the equipment used includes standard dust capture technology, such as cyclones, wet scrubbers, and fabric filters. There is also potential for fugitive emissions from these types of plant, which would be controlled using a combination of one or more of the following measures:

- locating the fixed plant to provide maximum separation distances between it and any sensitive receptor;
- minimising of drop heights into hoppers and loading chutes;
- sprinklers or water sprays around hoppers and other transfer points;
- hooding or enclosure of significant fugitive sources, with the emissions being ducted to bag filters or other dust control equipment; and/or
- operating the fixed plant at times when meteorological conditions are not conducive to producing large dust plumes.

Fixed dust control systems can achieve control efficiencies ranging from about 70% for cyclones, and up to 95% or more for bag filters.

#### **20.2 NOISE**

All works will be undertaken in accordance with the requirements of NZS 6803: 1999 'Acoustic – Construction Noise' and any relevant resource consent conditions. All works on the site and the use of associated heavy machinery shall be undertaken between the following hours only:

Monday to Saturday: 7.30 am to 7.00 pm

Sunday and Public Holidays: No work

The New Zealand Standard NZS 6803:1999 "Acoustics - Construction Noise" (NZS6803) provides comprehensive guidelines for measuring and assessing noise from both existing and proposed construction work, including activities such as maintenance and demolition. Compliance with the noise limits in NZS 6803 should ensure that noise from demolition and/or removal of underground structures is assessed and managed in accordance with regulations and to minimise disruptions to the surrounding area.

NZS 6803 provides noise limits (at 1 m from the facade of any dwellings occupied during the works) to control and manage noise. The recommended noise limits for works, with an expected duration exceeding 20 weeks, are reproduced below.

**Table 16: Noise Compliance Requirements** 

Time of Week	Time Period	Long-term duration (more than 20 weeks)							
		LAeq, dB	LAmax, dB						
Weekdays	6:30 am – 7:30 am	55	75						
	7:30 am – 6:00 pm	70	85						
	6:00 pm – 8:00 pm	65	80						
	8:00 pm – 6:30 am	45	75						
Saturdays	6:30 am – 7:30 am	45	75						
	7:30 am – 6:00 pm	70	85						
	6:00 pm – 8:00 pm	45	75						
	8:00 pm – 6:30 am	45	75						
Sundays and	6:30 am – 7:30 am	45	75						
public holidays	7:30 am – 6:00 pm	55	85						
	6:00 pm – 8:00 pm	45	75.						
	8:00 pm – 6:30 am	45	75						

The nearest residence to the Hospital site is in the northern section of the site, and is approximately 25m away from the nearest infrastructure removal works (separation distances for building demolition are considerably greater). To ensure acceptable noise outcomes, the Acoustic assessment has made the following recommendations:

- Excavators no greater than 30 tonnes.
- Compaction works to be undertaken using a compaction roller no greater than 15 tonnes.
- No vibratory compaction work within 45m of any dwelling.
- Woodchipper / mulcher plant should be located more than 80m away from any dwelling.
- Consultation with occupants shall be undertaken to determine the most suitable time for chainsaw work (when the building is unoccupied) for planned tree removal using a chainsaw within 45m of any dwelling.
- Advise the immediate neighbours in writing, no less than three (3) days prior to works commencing. The written advice should include details of the location of the works, the duration of the works, a phone number for complaints and the name of the site manager.
- Complete all work as quickly as possible and control the on-time of plant when onsite.
- Where practicable, scheduling of the works closest to the neighbouring properties to avoid periods where the buildings are occupied.
- Consultation with occupants shall be undertaken to determine the most suitable time for chainsaw work (when the building is unoccupied) for planned tree removal using a chainsaw within 45m of any dwelling.
   At the first instance of any chainsaw work within 45m of any dwelling, verification acoustic monitoring shall be undertaken, and the results of that monitoring used to identify any further noise mitigation measures that are appropriate.

It is expected that all other residences will not be affected by noise compliance issues. Similarly, the operating hours of noisy activities (e.g. hydraulic breaker and concrete crusher) would be restricted to not occur after 6pm on working days.

Noise from other activities such as loading dump trucks and dump truck movements (on the basis that they would be quieter or at a similar level than those discussed above) would be expected to either comply or be controlled to achieve compliance with the relevant noise limit 70 dB LAeq, at surrounding receivers.

#### **20.3 VIBRATION**

Any effects of vibration will be temporary and limited to the duration of construction works. The effects of vibration will be limited by following relevant measures from DIN 4150-3:1999 "Structural Vibration – Part 3 Effects of Vibration on Structures".

#### 21 MATERIALS MANAGEMENT

#### 21.1 BURNING

No demolition or waste materials will be burned on-site.

Burning of vegetation onsite will only occur for biosecurity reasons. Any burning of vegetation will take place in the south-eastern or south-western corner of the Site (being the part of the Site which is located furthest from neighbouring sensitive land uses).

Any burning of vegetation will comply with permitted activity rule 6.1.13.1 – Open Burning and Incineration of the Waikato Regional Plan and associated conditions. Fire and Emergency NZ restrictions/requirements will be followed, including all applicable fire permits being obtained.

#### 21.2 VEGETATION

All suitable vegetation removed as part of the demolition works will be mulched and stockpiled for reuse onsite. The exception is any noxious plants, that shall be stockpiled separately and disposed of to landfill.

#### 21.3 TREE PROTECTION AND REMOVAL

Larger native trees are to be protected from damage during the works wherever practicable, as shown on the project drawings, as seeds from these trees are collected and utilised for propagation in the nursery at the marae.

Vegetation and tree removal will be minimised as much as practicable. Areas where services may potentially impact vegetation are shown on the 33205 services removal plans. The purpose of these drawings is to highlight areas where closer inspection of the vegetation is required to check the nature of the vegetation pre-works and to consider what measures can be practicably undertaken to minimise or mitigate damage to the affected vegetation. In the case of the identified larger native trees, appropriate mitigation measures may include hand digging and retention of the majority of the larger roots.

Any vegetation or trees that do need to be removed or pruned/trimmed to facilitate the demolition works shall be identified in advance and removed at the same time, implementing bat management protocols. It is expected that any tree materials removed will be mulched onsite where possible. Any large tree trunks that cannot be mulched will be stockpiled for reuse.

#### 21.4 TEMPORARY STORAGE/STOCKPILING

All materials to be reused as backfill or for topsoiling will be stockpiled in specified areas. Any temporary soil stockpiles that will be in place for more than one month shall be stabilised by mulching/seeding, as soon as practicable. Land left bare as a result of any temporary stockpiling of demolished building materials shall be stabilised by mulching/seeding, as soon as practicable and in no more than one month from when the stockpile was first generated.

Any recyclable materials that are being temporarily stored until there is sufficient volume to remove off-site shall be stored in dedicated skip bins or similar and covered in the event of heavy rain.

#### 21.5 MACHINERY/PLANT CLEANING FOR SEED/PLANT MATTER REMOVAL

Measures will be put in place to clean machinery and plant coming onto and off site to ensure that all seed and/or plant matter has been removed. This will be done using a range of dry and wet (e.g. water blaster) cleaning methods, as appropriate.

#### 21.6 LOADING AND TRANSPORTING CONTAMINATED MATERIALS

Trucks removing contaminated soil from site will park adjacent to the works area and be loaded directly from there by an excavator. This approach will minimise the need to stockpile the contaminated soil and speed up the removal works.

All trucks transporting contaminated soils from asbestos removal areas must be lined with polythene prior to being loaded with asbestos contaminated soils, and the polythene must be wrapped and sealed, prior to the trucks leaving the site.

All trucks transporting soils from heavy metal & hydrocarbon areas will need to check lining requirements with the receiving disposal facility. The trucks will need to be covered in any case.

No trucks shall be allowed to traverse any contaminated areas so that the potential for tracking contaminants outside of this area is minimised.

#### 21.7 IMPORTED CLEANFILL

Any imported soil brought to the site (if required) shall be verified cleanfill, as defined in the consent conditions for the site.

#### TO ADD FROM CONSENT IN FINAL VERSION

Any imported fill will be supplied from an approved quarry, civil contractor, landscaping supplier or similar. Dockets should be provided specifying the source of the cleanfill, and certification provided to confirm it is cleanfill as defined above.

For non-hardfill cleanfill material, the certification shall confirm that the imported materials come from a non-HAIL site or include the results of laboratory testing to confirm the material is cleanfill as defined above.

#### 21.8 OFF-SITE DISPOSAL

Demolition materials not otherwise recoverable and contaminated soils will be disposed off site to a consented landfill site appropriate to the material, namely Class 1 or 2 landfills, according to the WasteMINZ Technical Land Disposal Guidelines. The two most suitable Class 1 and 2 landfill sites within 100km travel distance by road from the site are the Hampton Downs regional landfill and the GRP facility at Rotawaro.

There are a number of other facilities classified as Class 3 or 4 landfills that could potentially be used for other materials, but some of these are over 100km away. The Te Kowhai facility has been identified as the nearest cleanfill.

This information was compiled in 2023 and has not updated since then. The contractor is responsible for advising what disposal sites they are proposing to use, and obtaining approval from LINZ for their use. Distance from site, in terms of minimising vehicle emissions, is a key consideration.

**Table 17: Off-site Disposal Facilities** 

Available Sites	Operator	Landfill/Fill	Distance from	Comments
		Class	Tokanui – one way (km)	10
North Waikato	Envirowaste	Class 1	99	Most modern, engineered landfill
	Services Ltd	Class 1		
Regional Landfill,		•		facility in region with capacity for
Hampton Downs	(ESL)			30,000,000m³ over its lifetime.
1161 Rotowaro	GRP Ltd (Green	Class 2 & 4	85	Active. Limited to 208,000T/yr;
Rd, Glen Afton	Gorilla)		N	Waste acceptance criteria (WAC)
				exclude asbestos and
				contaminated soils
205 Bedford Rd,	IH Wedding &	Class 2 & 4	50	Active, but can only accept
Te Kowhai	Sons (Waikato)			300m³/d. While consent allows
	Ltd			for accepting C&D waste, site is
	X			only accepting cleanfill now.
Riverview Rd,	Gleeson	Class 3 & 4	40	Going through consent appeal;
Huntly	Quarries			may not be operational by mid-
	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\			2024
225 Ridge Rd,	Ridge Road	Class 3 & 4	114	Active
Bombay	Quarry Limited			
Ridge Rd,	ESL	Class 3 & 4	114	Active
Bombay	7			
(Envirofill South)	()			

The responsibility for ensuring that demolition materials are appropriately disposed of in full compliance with resource consents of the receiving site and that any material specific Health & safety requirements (ACMs, contaminated soils) are met lies with the Contractor.

#### 21.9 RECORD KEEPING

The Contractor shall keep full records of all materials imported to site and reused, recycled or disposed of off-site including:

- Quantity of material in tonnes or m<sup>3</sup> as appropriate (dockets/receipts)
- Type of material

- Source or destination site
- Date of delivery/removal
- Location on Tokanui site where material sourced from
- Supporting photos
- Proof of compliance with cleanfill criteria for materials imported to site.

This information shall be provided to LINZ or their representative on a monthly or milestone basis.

LINZ will undertake independent audits of site operations to verify that consent requirements are being met.

#### 21.10 ACCIDENTAL DISCOVERY PROTOCOLS

If during demolition and/or remediation earthworks, any contractor encounters any visually stained or odorous soil, ACM, rubbish/building debris or other hazardous materials that appear to be contaminated that has not previously been identified, they shall stop work within a 5m radius of that area and advise the project SQEP who will then visit the site to determine the nature and extent of the potentially contaminated soil. This is likely to involve the collection of soil samples and laboratory analysis, followed by disposal off-site to an appropriate disposal facility. Subject to the approval of the Project SQEP, the affected material may be relocated to a secure stockpile and covered with tarpaulins or placed in covered bins, while waiting for the laboratory results.

Work shall not recommence within this area unless authorised by the project manager or nominated LINZ representative.

Discovery protocols for archaeological finds are detailed in Section 6.2 above.

#### 22 TRAFFIC MANAGEMENT

#### 22.1 GENERAL

It is anticipated that over the duration of the demolition works, there will be a significant number of total vehicle movements, but the actual number of vehicles per day will be relatively low. LINZ are in the process of undertaking an integrated Transport Assessment and submitting this to Waipā District Council for review and approval. Initial discussions with Waipā District Council (Paul Strange) have indicated that as the site has reasonable entrances therefore the assessment and associated approval should be straight forward. Any additional recommendations from the ITA or Council review/approval process, not covered in this section, will be added to a revised version of this plan.

### 22.2 SITE SPEED LIMIT

The site speed limit is set at 15 km/hr maximum.

Exceedance of this speed limit shall be considered an incident, and may result in, at LINZ's discretion, the temporary or permanent removal of the driver from the site.

#### 22.3 VEHICLE ACCESS

Site access shall be via a single point, being the main entrance off Te Mawhai Road (located at 146 Te Mawhai Road, Tokanui). LINZ will establish a site access pass system that positively identifies all employees of Main Contractors, Minor Contractors, Sub-contractors, LINZ and their representatives, who have been authorised to undertake work on the site and have undertaken a formal site induction (in addition to any other induction requirements of their employer or a contractor). LINZ, at their discretion, may allow visitors to enter the site, when escorted by an authorised person.

#### 22.4 PUBLIC ROAD DILAPIDATION SURVEY

Prior to works beginning at the site, a dilapidation survey for the main road 500m either side of the main site entrance and at the Te Mawhai Road intersection with SH3 will be undertaken by a contractor engaged directly by LINZ or the Main Contractor.

The condition of the main road 500m either side of the main entrance must be maintained by LINZ or the Main Contractor for the duration of the works. This will involve repairing potholes immediately if/when they are noted.

The dilapidation survey will be repeated at the end of the works, with the Main Contractor responsible for repairing any damage.

#### 22.5 CONTRACTOR PARKING

All vehicles not directly used in the demolition works shall be required to park in the general contractors parking area, this area is shown on drawing 33205/G02.

#### 22.6 TRAFFIC MANAGEMENT PLANNING AND CONTROL (ON-SITE)

All contractors and other person(s) involved in demolition works at the site shall be responsible for maintaining at all times access along the internal road corridors.

Should a contractor's activities result in an access corridor being restricted in any way, that contractor shall be responsible for the development and implementation of a Traffic Management Plan in accordance with the NZTA/Transit NZ "Code of Practice for Temporary Traffic Management" (CoPTTM) Fourth Edition, Amendment 3, November 2018. Such Traffic Management Plans shall be submitted and accepted by LINZ's Representative prior to restricting access.

In the event of any damage to the road network, the responsible contractor will be required to repair the road as soon as possible to the standard prior to damage.

#### 22.7 TRAFFIC MANAGEMENT PLANNING AND CONTROL (OFF-SITE)

Subject to the requirements of the ITA and any other requirements of Waipā District Council and the New Zealand Transport Agency, LINZ or the Main Contractor shall prepare and submit for approval a Traffic Management Plan for the control of vehicle movements at Te Mawhai Road and other access corridors required and external to the site. LINZ shall be responsible for establishing the required traffic controls.

#### 22.8 SIGNAGE

Council requirements (Rule 4.4.2.44(c)) for signage state no more than one sign may be erected at the site entrance, and it may not cover more than 2m<sup>2</sup> area.

#### 22.9 MINIMISING IMPACT ON ROAD NETWORK

Generally, heavy vehicle movements associated with demolition works operations are limited to the delivery and removal of the machinery and plant required to undertake the works and the transport of works related materials on and off-site.

The following measures shall be employed to ensure that there are limited impacts on the surrounding roading network resulting from the land disturbance operation:

- The entry/exit point is clearly defined and will ensure that the safe and convenient movement of traffic, pedestrians and cyclists is not compromised.
- All soils removed from site for disposal to landfill shall be transported in lined and/or covered trucks depending on receiving facility requirements.
- Tailgates on all moving vehicles will be secured at all times to ensure no unnecessary noise is generated, and no materials are lost during transport.
- A water blaster or similar facility is to be provided on-site, if necessary, in the immediate vicinity of entry/exit point to the site.
- The adjoining roading network is to be kept clear of mud and debris at all times.

#### **22.10 PEDESTRIAN MANAGEMENT**

No pedestrians will be allowed access to the site, unless prior approval has been sought from LINZ and the Main Contractor.

#### 23 REFERENCES

DOC (October 2021), Protocols for Minimising the Risk of Felling Bat Roosts

Fraser Thomas Ltd (November 2023), Former Tokanui Hospital, Demolition and Remediation, Horizontal Infrastructure Assessment Report

Fraser Thomas Ltd (November 2024), Former Tokanui Hospital, Coal Tar Investigation and Removal Report

Opus (March 2015), *Tokanui Mental Hospital Demolition* [structural requirements for safe demolition of specified buildings]

SLR (November 2023), Acoustic Assessment, Tokanui Hospital Demolition Works

SLR (November 2023), Acoustic Assessment, Underground Infrastructure Removal and Rehabilitation

Toitū Te Whenua Land Information New Zealand (October 2023), Health and Safety Guidelines – Working with Lead-based Paints

WSP (March 2023), *Tokanui Hospital Infrastructure Assessment – Pavement Investigations Factual Report* [Appendix B of FTL horizontal infrastructure report]

4Sight Consulting (part of SLR), (December 2022), Asbestos and Lead Paint Demolition Survey Report – Former Tokanui Hospital – Area 1

4Sight Consulting (part of SLR), (December 2022), Asbestos and Lead Paint Demolition Survey Report – Former Tokanui Hospital – Area 1

4Sight Consulting (part of SLR), (December 2022), Asbestos and Lead Paint Demolition Survey Report – Former Tokanui Hospital – Area 2

4Sight Consulting (part of SLR), (December 2022), Asbestos and Lead Paint Demolition Survey Report – Former Tokanui Hospital – Area 3


4Sight Consulting (part of SLR), (December 2022), Asbestos and Lead Paint Demolition Survey Report – Former Tokanui Hospital – Area 4

4Sight Consulting (part of SLR), (February 2023), Tokanui Psychiatric Hospital - Ecological Constrains and Opportunities

Proactively Released Lealan Re

Proactively Released Lealand
General Drawings

And Information

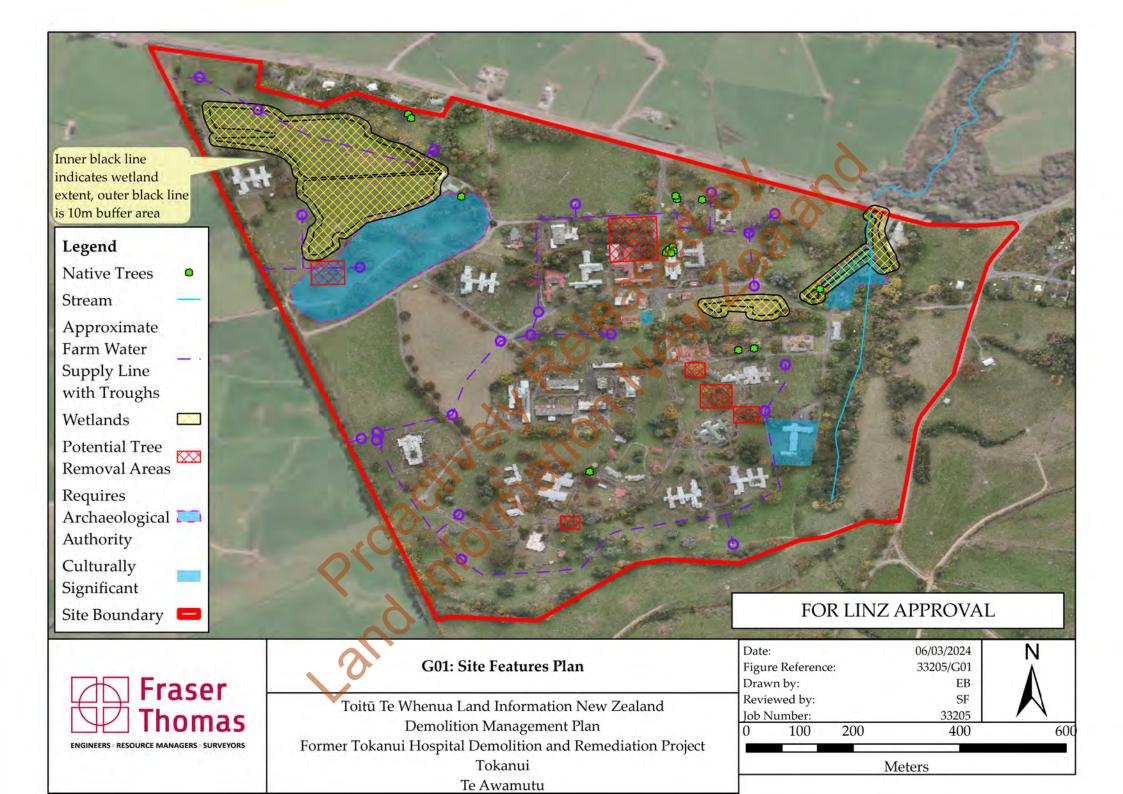

Appendix A

Roactive In Ruildings Data Summary

Rand Information

	Area 1
B1	Admin
B2	Ward 1 & 2
В3	SSDU
B4	Steeple & foundations of the Church
B5	Male Toilet
В6	Shed 5 (behind B5)
В7	Water Treatment
В8	Dentist
В9	Bus Shelter and Carport, by Admin
B10	Old Admin (WTC) & Pharmacy
B11	Ward A
B12	Ward B
B13	Ward C
B14	Shed 3 by Ward D
B15	Ward D
B16	Petrol Station
B17	Oct #1 left of Petrol Station
B18	Shed 6 behind Petrol Station
B19	Old Morgue left of Shed 6
B34	Shed 2 Toilet Block
B35	Shed 1, by SSDU
B58	Rec Hall
B72	Shed hidden in trees behind B18 (Shed 6)

_	Area 2	]		
			l	
B20	front ACM extension of Ward 6	1	B32	Shed 4
B21	Ward 6	Į.	B33	Ward 9
B22	rear ACM extension of Ward 6	1	B36	Hall
B23	Ward 4	1	B37	Wooden Shed
B24	Ward 22		B38	RFTD by Hall
B25	Morgue New		B39	RFTD Shed BY
B26	Ward 21 &21A		B40	Covered Area l
B27	Ward 5		B41	Shed 9
B28	OCT#2		B42	Building 15 inc
B29	Ward 7		B43	Building 14
B30	Ward 8		B44	Building 13
B31	Shed 10 beside B30 (Ward 8)		B45	Building 12
S1	Substation 1 by Steeple			Building 11
S2	Substation 2 by Admin	\ (	B47	Building 10
S3	Substation 3 by Ward 5		B48	Ward 16
S4	Substation 4 by Fire Station		B49	Ward 17
S5	Substation 5 by House by EDU	V	B50	Ward 18
S6	Substation 6 by Ward E		B51	EDU
S7	Substation 7 by Ward K		B52	Old House by E
S8	Substation 8 by Ward K	1		
23 20 19 22 22 84	Cilyens			
5,6				

	Area 3
B32	Shed 4
B33	Ward 9
B36	Hall
B37	Wooden Shed behind hall
B38	RFTD by Hall
B39	RFTD Shed BY Hall
B40	Covered Area by Hall
B41	Shed 9
B42	Building 15 includes shed at rear of building
B43	Building 14
B44	Building 13
B45	Building 12
B46	Building 11
B47	Building 10
B48	Ward 16
B49	Ward 17
B50	Ward 18
B51	EDU
B52	Old House by EDU

	Area 4
B53	Ward 19
B54	Water Tower
B55	Ward K
B56	Ward E
B57	Pool and Pool Shed
B59	Gardener
B60	Fitter
B61	Shed 11
B62	Racks
B63	Workshop
B64	Sports Pavillion & shed
B65	Store
B66	Assistant Engineers Office
B67	Shed 8
B68	Boiler House
B69	Fire Station
B70	Kitchen
B71	Garages
B73	Shed 7 by Laundry
B74	Laundry
B75	Doctors Flats (OCCUPIED)
B76	Doctors Flats Garages

#### **Building Count**

Area 1	23
Area 2	20
Area 3	19
Area 4	22
Total	84

#### Tokanui Hospital - Building Survey Data Summary

			Building						Special requirements								
a Buile	ding ID	Building name	Area (m2)	Built date	Building Type	No of storeys	Footings/ foundations	Lead paint	ACM	Historical HALO demo debris		Protected tree(s)	Cultural	Archeo- logical	Data reliability	Info sources	Notes
1 B1		Admin	796	1978	External: reinforced concrete block with cedar shiplap weatherboard. Tin tile on roof with corrugated ACM cladding in central roof portion. Internal: gib plasterboard, concrete block, timber frame, concrete floor with carpet and vinyl lino, ceiling finish painted gib plaster and stained pine.	ground floor and level 1	reinforced concrete perimeter footing with concrete slab	No	Yes - internal and external Class A & B	Yes - N and E side of building confirmed. Likely present S and W as well.		Yes, directly north of building	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL Environmental XRF Screening, FTL visual walkover & HALO demo debris Investigation	
В2		Ward 1 & 2	1152	1912-1928	External: in situ concrete with shiplap weatherboard cladding, Gabel roof construction with pitched corrugated iron roof. Timber window frames. Internal: gib plaster, fibrous plasted, concrete and brick walls, concrete and native timber flooring with vinyl lino floor finish. Ceiling fibrous plaster and timber, painted.	1	concrete perimeter footing with concrete piles, concrete slab under kitcken and toilets only.	Yes - internal and external	Yes - internal and external Class A & B	Yes, throughout internal courtyard area. Note: historical building demolished W of this structure.	No	Yes, directly west of building	No	No		OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL Environmental XRF Screening, FTL visual walkover & HALO demo debris Investigation	
В3		SSDU	425	1971	External: Concrete & plaster external walls with timber framing. Painted. Internal: Fibrous plaster, gib plaster, timber frame, accoustic tile, native timber flooring and carpet.		concrete perimeter footing with concrete piles, concrete slab under kitcken and toilets only.		Yes - internal and external Class A & B	No	No	30m NW of building	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation	
В4		Steeple & foundations of the Church	75	1960s-70s	Steeple and concrete slab from chapel is all that remains.	NA	concrete slab	NA	No	No	INO	Yes, directly NW of building and East.	No	No	Medium	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys	
B5		Male Toilet	24	1912-1928	External: concrete slab with concrete blockwork, board and baton, painted. Roof is pitched corrugated iron - painted. Internal: Hardboard walls - painted. Concrete floors with possible enamel coating. Ceiling is fibrous plaster, prefinished	1	Concrete slab	Yes - internal and external	No	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation	
В6		Shed 5 (behind B5)	6	1912-1928	External: brick - painted, pitched corrugated iron roof - painted. Internal: Brick with concrete floor	1	reinforced concrete perimeter footing with concrete slab	Yes - external	No	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	
В7		Water Treatment	35	1912-1928	External: reinforced concrete block with corrugated iron walls - painted. Internal: timber pannelling, hardboard - painted, concrete floor. Partial carpet. Ceiling timber & corrugated iron.	2 - basement and	reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - internal Class B	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	
В8		Dentist	145	1912-1928	External: walls timber frame with shiplap weatherboard - painted. Roof pitched corrugated iron - painted. Internal: hardboard walls - painted, timber particle board floors with lino cover. Fibrous plaster ceiling - painted.		concrete perimeter footing with concrete piles, concrete slab under kitcken and toilets only.	Yes - internal and external	Yes - External & Interna	Possible (not investigated). Historical Building directly East of structure demolished between 1961 & 1974	1	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	

2

В9	Bus Shelter and Carport, by Admin	70	1974-1979	Steel pole, timber rafters, timber frame, fibrolite cladding - painted	1	concrete slab	Yes	Yes	Possible area directly north of structure has demo debris noted from demo of old structures surrounding B01 & B02	NO	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover
В10	Old Admin (WTC) & Pharmacy	220 (Old Admin), 188 (Pharmacy )	Old Admin (1930), Pharmacy (1944-1961)	External: Brick, concrete insitu, walls brick & solid plaster. Concrete tile roofing. Galvanised bars over pharmacy windows. Internal: Gib plaster - painted, timber frame, in situ concrete, concrete and native timber floors with lino and carpet cover. Ceiling is gib plaster and fibrous plaster & concrete - painted.	Old Admin (2), Pha	1 '	Yes - internal and external	Yes - internal and external Class A & B	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover
B11	Ward A	1520	1912	External: timber frame, cement sheeting, shiplap weatherboard - painted. Roof pitched corrugated iron - painted. Internal: Gib plaster, timber pannelling, timber frame, hardboard, in situ concrete - painted, wallpaper, tiles, prefinished sheeting. Floors concrete/native timber covered with carpet/lino/tiles. Ceiling fibrous plaster/timber/ hardboard/seratone - painted.	l	concrete perimeter footing with concrete piles, concrete slab under kitchen and toilets only.	Yes - internal and external	Yes - internal and external Class A & B		No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover
B12	Ward B	510	1925	External: Brick, solid plaster and texture coat finshing and in situ concrete walls. Roof pitched corrugated iron - painted. Internal: gib plaster, timber pannelling, timber frame, brick, concrete in situpainted and some wallpaper. Flooring concrete/native timber covered with carpet/lino. Ceiling is gib plaster/fibrous plaster and timber - painted.	2		Yes - internal and external	Yes - internal class B	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover
B13	Ward C	1460	1912	External: concrete in situ, shiplap weatherboard, board and baton. Walls painted solid plaster. Internal: gib plaster, timber pannelling, timber frame, brick & in situ concrete. Painted wallpaper and prefinished sheeting. Flooring concrete/native timber with carpet or lino finish. Ceiling gib plaster/fibrous plaster, timber and hardboard - painted.		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - external and internal	Yes - internal and external Class A & B	No	No	No	No	No	⊔iah	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover
B14	Shed 3 by Ward D	47	1995-2000	External: vertical PVC weatherboard - painted. Pitched corrugated rood - painted. Internal: gib plaster, wallpaper. Floor: Timber particle board with carpet. Ceiling is gib plaster - painted.		raised timber piles	No	Yes - internal Class A	No	No	No	No	No	Medium	OPUS Building Inspection Reports

B15	Ward D	970	1917	External: Timber frame, shiplap weatherboard - painted. Roof - pitched corrugated iron - painted. Internal: Gib plaster, timber pannelling, timber framing - painted or wallpapered with some areas prefinished sheeting. Floors - concrete or native timber with carpet/lino cover. Ceiling - fibrous plaster/timber - painted.	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - internal Class A &	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	
B16	Petrol Station	385	Late 1970s	External: reinforced concrerte block walls with cement sheeting - painted. Roof is tin ribbed. Internal: Gib plaster, timber frame, hardboard and concrete block walls - painted or wallpaper. Floors Concrete with carpet or lino cover. Ceilings Gib plaster - painted	reinforced concrete 1 perimeter footing with concrete slab	No	Yes - internal and external Class B	Possible - not investigated on Western side. No demo debris S or E of structure.	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	
B17	Oct #1 left of Petrol Station	265	1912-1944	External: timber frame, shiplap weatherboard - painted. Roof - pitched corrugated iron - painted. Internal: Hardboard - painted. Floors - concrete or native timber with lino cover. Ceiling - gib plaster/timber - painted	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - external and internal	Yes - internal Class A and external Class B	Not on E or S side, possibly on N or W side	No	No	No	No	⊔iah	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	
B18	Shed 6 behind Petrol Station	336	1912-1944	Floors: Concrete & native timber with Lino cover. Ceiling: Pinex - painted.	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - internal ceiling vo	Not on E or S side, possibly on N or W side	No	No	No	No		OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover	
B19	Old Morgue left of Shed 6	36	1912-1944	External: Brick - painted, pitched corrugated iron roof - painted. Internal: Gib plaster - painted, Floors: Concrete. Ceilings: Pinex - painted.	reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - internal Class B	Not on E or S side, possibly on N or W side	No	No	Yes	No		OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, HAIL XRF Screening, FTL visual walkover & HALO demo debris investigation	
B34	Shed 2 Toilet Block	7	1970s-1980s	External: Reinforced concrete block. Roof: Pitched corrugated iron. Internal: timber frame, hardboard and concrete block - painted. Ceiling: Hardboard.	reinforced concrete perimeter footing with concrete slab	Yes - internal/ external timber	No	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys	
B35	Shed 1, by SSDU	50	1944-1961	External: Corrugated iron - painted. Roof: Pitched corrugated iron - painted. Internal: Timber frame. Floor: bare earth.	perimeter concrete, earth floor	Yes - internal and external	Yes - Class B internal	No	No	No	No	No		OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys	
B58	Rec Hall	1,110	1940	External: brick, concrete in situ with cement sheeting - painted. Roof: Pitched corrugated iron & Super Six ACM. Internal: gib plaster, timber pannelling, timber frame, hardboard - painted, wallpaper, pre finished sheeting. Floors: Concrete or native timber, covered with carpet or lino. Ceiling: fibrous plaster, acoustic tile, hardboard - painted or pre finished.		Yes - internal and external	Yes - internal and external Class A & B	No - but ACM is in HALO soils	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation	
В72	Shed hidden in trees behind B18 (Shed 6)	See B18													

2 B20 B21 B22	front ACM extension of Ward 6 Ward 6 rear ACM extension of Ward 6	1,310	1930	External: timber frame, bevel back weatherboard, hardiplank weatherboard - painted. Roof: Pitched corrugated iron. Internal: gib plaster, timber pannelling, timber frame, Pinex, Hardiboard - painted. Floors: Not stated - covered in carpet and lino. Ceiling: timber, fibrous plaster - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - Internal & external Class A & Class B (High Risk building)	No	No	Yes - Directly E of buildings	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation
В23	Ward 4	995	1928	External: timber frame, bevel back weatherboard - painted. Roof: Piched corrugated Iron - painted. Internal: Gib plaster, timber frame, pinex, hardboard, seratone, concrete in situ - painted or wallpapered. Floor: concrete, timber - painted or lino cover. Ceiling: Fibrous plaster, acoustic tile, concrete, wood - painted		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - Internal & external Class A & Class B (High Risk building)	No Co	No	Yes - Directly W of building	No No	No.	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation
В24	Ward 22	370	1022	External: timber frame, bevel back weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster, hardboard - wallpapered. Floors: concrete, native timber, carpet or lino cover. Ceiling: Pinex/fibrous plaster - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - external - no internal painted surfaces	Yes - Class B internal and external Class B	No	No	No	No	No	Medium	OPUS Building Inspection Reports, AECOM DSI, FTL visual walkover
B25	Morgue New	50		External: reinforced concrete block, solid plaster - painted. Roof: Tin ribbed - painted. Internal: concrete - painted. Floors: Concrete - lino cover. Ceiling: Hardboard - painted.		reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - external Class A and internal Class B	No	No	No	Yes	No	High	OPUS Building Inspection Reports, GHD DSI. FTL visual walkover
B26	Ward 21 &21A	1175	Ward 21 - 1960. Ward 21A -	External: concrete in situ, cement sheeting, timber framing, timber sheeting - painted or solid plaster cover. Roof: Pitched corrugated iron - painted. Internal: gib plaster, timber pannelling - painted or wallpaper. Floor: Concrete, native timber with carpet, tiles or lino cover. Ceiling: gib plaster, timber stained pine - painted.	Ward 21 - 2. Ward 21A - 2 + Basement	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - external and internal Class B	Likely under existing strucure, old farm building noted in historicals.	No	No	Yes	No		OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, GHD/AECOM DSI, FTL visual walkover & HALO demo debris Investigation, HAIL XRF screening
B27	Ward 5	1250	(western wing added in 1980s-	timber frame, pinex, seratone -		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - external Class B and Internal Class A.	No	No	No	No	No		OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation. HAIL XRF screening

B28	OCT#2	205	1944-1961	External: reinforced in situ concrete, solid plaster, timber frame. Solid plaster or textured coating finish. Roof: Tin tile - painted. Internal: gib plaster, timber panelling, timber frame, pinex. Painted or wallpapered. Floor: timber particle board with lino finish. Ceiling: pinex - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - external and internal Class B	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation. HAIL XRF screening	
B29	Ward 7	1,230	1912-1944	External: Timber frame, bevel back weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster, timber pannelling, timber frame, pinex, hardboard. Painted, wallpapered, tiled, pre finished sheeting. Floors: concrete, native timber covered with lino or carpet. Ceiling: gib plaster, fibrous plaster - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - external and internal Class A & Class B	No	No	No	No	No	Medium	OPUS Building Inspection Reports, AECOM DSI, 4Sight Pb Paint & ACM Surveys, FTL visual walkover	
B30	Ward 8	1425	1960	External: brick, concrete in situ, cement sheeting, finished with brick, solid plaster or painted. Roof: Pitched corrugated tin - tin ribbed - painted. Internal: gib plaster, timber pannelling, timber frame, brick. Finished with paint, wallpaper, tiles or pre finished sheeting. Floor: Concrete or native timber with carpet/lino or tile cover. Ceiling: gib plaster, fibrous plaster, pinex - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - internal Class A & B, external Class B	No.	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb Paint & ACM Surveys, FTL visual walkover & HALO demo debris Investigation. HAIL XRF screening	
B31	Shed 10 beside B30 (Ward 8)	60	1979-1995	No info available	1	No info available	No	No	No	No	No	No	No	Low	4Sight Pb paint & ACM Survey.	No OPUS Building Survey sheet available
S1	Substation 1 by Steeple	27	1961-1974	External: reinforced concrete block, painted. Roof: Pitched corrugated iron - painted. Locked during survey, no internal specifications.	1	reinforced concrete perimeter footing with concrete slab	Yes - internal and external	No	No	No	No	No	No	High	AECOM + GHD DSI, OPUS Building Inspection Report	
S2	Substation 2 by Admin	105	1961-1974	External: reinforced in situ concrete, galvanised steel - painted. Roof: Tin ribbed - painted. Internal: Reinforced concrete block - painted. Floor: Concrete - no finish. Ceiling: hardiflex - painted.		reinforced concrete perimeter footing with concrete slab	Yes - external	Yes - internal Class A & B, external Class B	Likely built on demo debris, historical structure footprint visible In 1944 historical image.	No	No	No	No	Medium	AECOM + GHD DSI, OPUS Building Inspection Report, HAIL XRF screening	
S3	Substation 3 by Ward 5	35	1961-1974	External: reinforced concrete block - painted. Roof: Pitched corrugated iron - painted. Internal: concrete block walls. Floors: Concrete.		reinforced concrete perimeter footing with concrete slab	Yes - External	No	No	No	No	No	No	Medium	AECOM + GHD DSI, OPUS Building Inspection Report, HAIL XRF screening	
S4	Substation 4 by Fire Station	35	1961-1974	External: reinforced concrete block painted. Roof: Pitched corrugated iron - painted. Internal: Locked no access		reinforced concrete perimeter footing with concrete slab	Yes - internal and external	No	No	No	No	No	No	Medium	AECOM + GHD DSI, OPUS Building Inspection Report, HAIL XRF screening	
\$5	Substation 5 by House by EDU	35	1961-1974	External: reinforced concrete block - painted. Roof: Pitched corrugated iron - painted. Internal: Concrete block walls - painted. Floors: Concrete. Ceiling: Timber - painted.		reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - Internal Class B	No	No	No	No	No	Medium	AECOM + GHD DSI, OPUS Building Inspection Report, HAIL XRF screening	

		1		External: reinforced concrete block -											
S6	Substation 6 by Ward E	27	1961-1974	painted. Roof: Pitched corrugated iron - painted. Internal: concrete block - painted. Concrete and native timber floors. Ceiling: Timber - painted.		reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - internal Class B	No	No	No	No	No	Low	AECOM + GHD DSI, OPUS Building Inspection Report
S7	Substation 7 by Ward K	27	1961-1974	External: reinforced concrete block - painted. Roof: Pitched corrugated iron - painted. Internal: concrete block wall - painted. Floor: Concrete and native timber. Ceiling: timber - painted.		reinforced concrete perimeter footing with concrete slab	Yes - external	Yes - Internal Class B	No	No	No	No	No	Low	AECOM + GHD DSI, OPUS Building Inspection Report
S8	Substation 8 by Ward K	18	1944-1961	External: reinforced concrete block - painted. Roof: Pitched corrugated iron - unpainted. Internal: concrete block walls - painted. Floor: Concrete.	1	reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - internal Class B	No	No	No	No	Yes	Medium	AECOM + GHD DSI, OPUS Building Inspection Report, HAIL XRF screening
B32	Shed 4	17	1974-1995	External: Painted plywood structure with plastic roof. Structure has fallen over, largely rotten.	1	none	Unlikely	No	No	No	No	No	No	Low	OPUS Building Inspection Report
В33	Ward 9	1,430	1960	External: brick, concrete in situ, cement sheeting, finished with brick, solid plaster or painted. Roof: Pitched corrugated tin - tin ribbed - painted. Internal: gib plaster, timber pannelling, timber frame, pinex, hardboard, brick. Finished with paint, wallpaper, tiles. Floor: Concrete or native timber with carpet/lino or tile cover. Ceiling: gib plaster, fibrous plaster, pinex - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - internal and external	Yes - internal Class A & B, external Class B	No	No	No	No	No	Medium	AECOM DSI, OPUS Building Inspection Reports
В36	Hall	205	1970	External: reinforced concrete block - painted. Roof: Tin ribbed - painted. Internal: concrete block - painted. Floor: concrete, carpet or lino cover. Ceiling: Plywood - painted.		reinforced concrete perimeter footing with concrete slab	Yes - external	Yes - internal Class A	No	No	No	No	No	Medium	OPUS Building Inspection Reports, HAIL XRF screening
В37	Wooden Shed behind hall	13	1974-1979	External: timber exterior with painted tin roof.	1	411	Yes - external	No	Unlikely	No	No	No	No	Low	4Sight Pb paint survey
B38	RFTD by Hall	60	1974-1979	External: timber frame, shiplap weatherboard - painted. Roof: pitched corrugated iron - painted. Internal: timber pannelling, pinex, hardboard - painted. Floor: timber with carpet or lino cover. Ceiling: fibrous plaster or timber - painted.		raised piles	Yes - exterior and interior	Yes - exterior Class B	No	No	No	No	No	Medium	OPUS Building Inspection Reports, 4Sight pb paint & ACM Survey
В39	RFTD Shed BY Hall	8	1979-1995	External: corrugated iron - painted. Roof: Pitched corrugated iron - painted. Internal: timber pannelling, timber framing - painted. Floor: timber particle board. Ceiling: not stated, painted.		Raised piles	Yes - external and internal	No	No	No	No	No	No		OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.
B40	Covered Area by Hall	65	1979-1995	External: galvanised steel, sheet cladding, timber poles, plywood. Roof: pitched corrugated iron - painted. Internal: concrete floor.	1	concrete slab with pole brackets	Yes - external	No	No	No	No	No	No		OPUS Building Inspection Reports, 4Sight Pb & ACM survey

B41	Shed 9	15	1974-1979	External: timber frame, bevel back weatherboard, brick - painted. Roof: Pitched corrugated iron - painted. Internal: bare timber, no finish. Floors: Concrete.		reinforced concrete perimeter footing with concrete slab	Yes - external	Yes - external Class B	No	No	No	No	No	Medium	AECOM DSI, OPUS Building Inspection Reports
В42	Building 15 includes shed at rear of building	250	1971	External: brick, cement sheet, bevel back weatherboard - painted or brick/stone. Roof: Pitched corrugated iron - painted. Internal: gib plaster, seratone, hardboard - painted/wallpapaer/vinyl. Floor: Timber with carpet or lino cover. Ceiling: Gib plaster - painted	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior	Yes - external Class B	No	No	Yes - Directly West of Building	No	No	Medium	OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.
B43	Building 14	160	1971	External: shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster, seratone, hardboard - painted or vinyl. Floors: timber with carpet or lino cover. Ceilings: gib plaster - painted.		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior only.	Yes - external class B	No Co	Ne	No	No	No	Medium	AECOM DSI, OPUS Building Inspection Reports, 4Sight Pb & ACM Survey
B44	Building 13	160	1971	External: shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster, seratone, hardboard - painted or vinyl. Floors: timber with carpet or lino cover. Ceilings: gib plaster - painted.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior only.	Yes - external and internal Class B	No	No	No - but large tree directly N of building.	No	No	1	OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.
B45	Building 12	160	1971	External: shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster, seratone, hardboard - painted or vinyl. Floors: timber with carpet or lino cover. Ceilings: gib plaster - painted.		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior only.	Yes - external and internal Class B	No	No	No	No	No	1	OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.
В46	Building 11	160	1971	External: shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster, seratone, hardboard - painted or vinyl. Floors: timber with carpet or lino cover. Ceilings: gib plaster - painted.		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior only.	Yes - external and internal Class B	No	No	No	No	No	1	OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.
B47	Building 10	260	1971	External: brick, cement sheet, bevel back weatherboard - painted or brick/stone. Roof: Pitched corrugated iron - painted. Internal: gib plaster, seratone, hardboard - painted/wallpapaer/vinyl. Floor: Timber with carpet or lino cover. Ceiling: Gib plaster - painted	·	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior only.	Yes - external Class B	No	No	No	No	No	1	OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.
B48	Ward 16	1750	1972	Reinforced concrete block, cement sheets, shiplap weatherboard - painted/brick. Roof: Pitched corrugated iron - painted. Internal: gib plaster, timber framing - painted/wallpaper/vinyl. Floor: Concrete with carpet or lino cover. Ceiling: Gib plaster, accoustic tile, timber - painted.		concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior and interior	Yes - Internal and external Class B	No	No	Yes - directly	No	No	1	OPUS Building Inspection Reports, 4Sight Pb & ACM survey. HAIL XRF screening.

B49	Ward 17	550	1976	External: reinforced concrete block, shiplap weatherboard - painted. Roof: tin ribbed - painted. Internal: gib plaster, timber pannelling, timber framing - painted, pre finished sheeting or vinyl cover. Floor: Concrete with Lino cover. Ceiling: Gib plaster or timber, painted.	1 + Basement	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - exterior and interior	Yes - internal and subfloor Class B	No	No	No	No	No	Medium	AECOM DSI, OPUS Building Inspection Reports, 4Sight Pb & ACM survey
B50	Ward 18	550	1975	External: reinforced concrete block, shiplap weatherboard - painted. Roof: tin ribbed - painted. Internal: gib plaster, timber pannelling, timber framing - painted or vinyl cover. Floor: Concrete with Carpet or Lino cover. Ceiling: Gib plaster or timber, painted.	1 + Basement	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - external	Yes - internal, exterior and subfloor Class B	No	No	No	No	No	Medium	OPUS Building Inspection Reports, 4Sight Pb & ACM survey, HAIL XRF screening
B51	EDU	635	1970	External: Reinforced concrete block, board and baton - painted and/or brick. Roof: Tin ribbed - painted. Internal: Timber frame, concrete block - painted. Floor: Concrete with carpet/lino/tile cover. Ceiling: Gib plaster - painted	:	concrete perimeter footing with concrete 1 piles, concrete slab under toilets and kitchens	Yes - external	Yes - internal Class A & B, external Class B	No	No	No	No	No	Medium	OPUS Building Inspection Reports, 4Sight Pb & ACM survey, HAIL XRF screening
B52	Old House by EDU	105	1974-1979	External: timber frame, shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: pinex/hardboard - painted. Floors: timber with lino cover. Ceiling: pinex - painted.	:	1 raised timber piles	Yes - external and internal	Yes - external Class B	No	No	No	No	No	Medium	OPUS Building Inspection Reports, 4Sight Pb & ACM survey, HAIL XRF screening
4 B53	Ward 19	2,080	1978	External: reinforced concrete block with cement sheeting - painted or solid plaster finish. Roof: Tin ribbed - painted. Internal: gib plaster, timber framing, concrete block - painted. Floors: Concrete - Lino cover. Ceiling: gib plaster - painted.	1 + Basement	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	No	Yes Internal and external Class B	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb & ACM survey, HAIL XRF screening, FTL visual walkover & HALO demo debris Investigation.
B54	Water Tower	10	1978	External: reinforced concrete in situ- painted or solid plaster cover. Roof: Concrete water tank - painted. Internal: Reinforced concrete in situ- not painted. Floors: Concrete. Ceiling: Concrete.		reinforced concrete perimeter footing with concrete slab	No	No	No	No	No	No	No	High	OPUS Building Inspection reports, 4Sight Pb & ACM survey, FTL visual walkover.
B55	Ward K	1,480	1944-1961	External: Brick, concrete in situ, reinforced concrete block, cement sheet, board and baton - painted/brick/solid plaster finish. Roof: Pitched corrugated iron, tin ribbed - painted. Internal: gib plaster, timber pannelling, timber framing, brick - painted/wallpapered/tiled/prefinished sheeting.		concreté perimeter footing with concrete 1 piles, concrete slab under toilets and kitchens		Yes - Class A internal, Class B external.	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb & ACM survey, HAIL XRF screening, FTL visual walkover & HALO demo debris Investigation.

В56	Ward E	1,480	1958	External: Brick, concrete in situ, reinforced concrete block, cement sheet - painted/brick/solid plaster finish. Roof: Pitched corrugated iron, tin ribbed - painted. Internal: gib plaster, timber pannelling, timber framing, seratone, concrete blocks, bricks - painted/wallpapered/tiled/pre finished sheets.	1	concrete perimeter footing with concrete piles, concrete slab under toilets and kitchens	Yes - Interior and exterior	Yes - internal Class A and B, External Class B	No	No	No	No	No	High	OPUS Building Inspection Reports, 4Sight Pb & ACM survey, HAIL XRF screening, FTL visual walkover & HALO demo debris Investigation.	
В57	Pool and Pool Shed	525	1961-1974	External: concrete in situ, reinforced concrete block, corrugated iron - painted or covered in solid plaster.Roof: Pitched corrugated iron - painted. Internal: timber frame, concrete block - painted. Floor: concrete. Ceiling: Hardboard - painted.	1	reinforced concrete perimeter footing with concrete slab	Yes - external.	Yes - external Class B	No	No	No	No	No		OPUS Building Inspection Report, 4Sight Pb & ACM Survey. GHD DSI	
B59	Gardener	260	1961-1974	External: Corrugated iron. Roof: Pitched corrugated iron - painted.Internal: Timber framing, concrete floor, building paper ceiling.	1	reinforced concrete perimeter footing with concrete slab	Yes - external	No	No	No	No	No	No		OPUS Building Inspection Report, 4Sight Pb & ACM Survey. GHD DSI, HAIL XRF Screening, FTL Visual walkover and HALO demo debris investigation	
В60	Fitter	100	1961-1974	External: timber frame, shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: gib plaster - painted. Floors: Concrete covered with carpet or lino. Ceiling: Gib plaster - painted.	1	Concrete perimeter footing with concrete piles. Concrete slab under toilets and kitchens only.	Yes - internal and external	No	No	No	No	No	No	Medium	OPUS Building Inspection Report, 4Sight Pb & ACM Survey. HAIL XRF Screening. FTL Visual walkover	
B61	Shed 11	16	1979-1995	External: reinforced concrete block - painted. Roof: tin ribbed - painted. Internal: concrete block - painted. Floor: concrete, no cover. Ceiling: no data.	1	reinforced concrete perimeter footing with concrete slab	Yes - external	Yes - Class A internal, Class B external.	No	No	No	No	No	Medium	OPUS Building Inspection Report, 4Sight Pb & ACM Survey. GHD DSI. HAIL XRF Screening. FTL Visual walkover	
B62	Racks	350	1961-1974	External: timber frame, shiplap weatherboard - painted. Roof: Corrugated ACM 'super six'. Internal: timber frame racks. Floors: Concrete, no finish. Ceiling: None.	1		Yes - external and internal	Yes - external and internal Class B	No	No	No	No	No	Medium	OPUS Building Inspection Report, 4Sight Pb & ACM Survey. HAIL XRF Screening. FTL Visual walkover and HALO demo debris Investigation	
B63	Workshop	1,100	1961-1974	External: reinforced concrete in situ, reinforced concrete slab, bevel back weatherboard - painted. Internal: gib plaster, seratone, concrete block - painted/wallpaper/tile. Floor: Concrete with lino/wallpaper/ tile cover. Ceiling: fibrous plaster - painted.		reinforced concrete perimeter footing with concrete slab	Yes - external and internal	Yes - internal Class A & B, external Class B	No	No	No	No	No	High	OPUS Building Inspection Report, 4Sight Pb & ACM Survey. AECOM & GHD DSI's. HAIL XRF Screening. FTL Visual walkover and HALO demo debris Investigation	
B64	Sports Pavillion & shed	(120)Dem olished	1944-1961	External: concrete in situ, shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: hardboard, seratone - painted. Floor: concrete with carpet or lino cover. Ceiling: gib plaster - painted.	1	Concrete perimeter footing with concrete piles. Concrete slab under toilets and kitchens only.	Yes, building demolished but pb in soil elevated.	Yes - external. Building now Demolished	Unlikely	No	No	No	NO		OPUS Building Inspection Report. GHD DSI's. HAIL XRF Screening. FTL Visual walkover.	Building demolished - no ACM in soil testing done
В65	Store	1,160	1961-1974	External: reinforced concrete in situ- painted. Roof: Corrugated ACM 'super six', tin ribbed - reinforced glass - painted. Internal: concrete in situ, timber framing, hardboard - painted. Floor: Concerete with lino, tile cover. Ceiling: Fibrous plaster, pinex - painted.	1	reinforced concrete perimeter footing with concrete slab	Yes - internal and external	Yes - internal Class A & B, external Class B	No	No	No	No	No	High	OPUS Building Inspection Report. GHD & AECOM DSI's. HAIL XRF Screening. FTL Visual walkover.	

				_				1								
B66	Assistant Engineers Office	250	1961-1974	External: corrugated iron - painted. Roof: Pitched corrugated iron - painted. Internal: concrete blocks - painted. Floor: Concete with carpet cover. Ceiling: gib plaster - painted.		reinforced concrete 1 perimeter footing with concrete slab	Yes - internal	Yes - internal and external Class B	No	No	No	No	No	Medium	OPUS Building Inspection Report. GHD & AECOM DSI's, 4Sight Pb & ACM Survey	
B67	Shed 8	20	1974-1979	External: reinforced concrete block, shiplap weatherboard - painted. Roof: Flat roof, tin ribbed - painted. Internal: Concrete block - painted. Floor: Concrete.		reinforced concrete 1 perimeter footing with concrete slab	Yes - external	Yes - External Class B, Internal Class A	No	No	No	No	No	Medium	OPUS Building Inspection Report. GHD & AECOM DSI's, 4Sight Pb & ACM Survey	
B68	Boiler House	630	1944-1961	External: concrete in situ, cement sheeting (ACM), galvanised steel - painted. Roof: Tin ribbed - painted. Internal: timber frame, hardboard, concrete in situ - painted. Floors: concrete. Ceiling: Hardboard - painted.	2 + Basement	reinforced concrete perimeter footing with concrete slab	Yes - exterior	Yes - internal Class A & B, external Class B	No	No	No	No	No		OPUS Building Inspection Report. GHD & AECOM DSI's, 4Sight Pb & ACM Survey	Salters Demolition specification noted by OPUS, havent seen this document though.
В69	Fire Station	290	1944-1961	External: reinforced concrete in situ, reinforced concrete block, corrugated iron - painted. Roof: Pitched corrugated iron - likely painted. Internal: timber pannelling, pinex, seratone, concrete blockwork, concrete in situ - painted. Floor: concrete with carpet/lino/tile cover. Ceiling: Pinex, hardboard, seratone, concrete - painted.		reinforced concrete 2 perimeter footing with concrete slab	Yes - internal	Yes - External Class B	No.	No	No	No	No	Medium	OPUS Building Inspection Report. AECOM DSI's, 4Sight Pb & ACM Survey. HAIL XRF Screening	
В70	Kitchen	780	1961-1974	External: Concrete in situ - painted. Roof: tin ribbed - painted. Internal: seratone, concrete in situ - painted or tiled. Floor: Concrete with carpet, lino, tile cover. Ceiling: gib plaster, concrete - painted.		concrete perimeter footing with concrete 1 piles, concrete slab under toilets and kitchens	Yes - internal	Yes - internal & external Class B	No	No	No	No	No	Medium	OPUS Building Inspection Report. AECOM DSI's, 4Sight Pb & ACM Survey.	
B71	Garages	300	1961-1974	External: reinforced concrete block - painted. Roof: tin ribbed - painted. Internal: concrete block - painted. Floor: Concrete with lino cover. Ceiling: Gib plaster - painted.		reinforced concrete 1 perimeter footing with concrete slab	Yes - internal and external	Yes - Internal and external Class B	No	No	No	No	No	Ligh	OPUS Building Inspection Report, 4Sight Pb & ACM Survey. HAIL XRF Screening, FTL visual walkover and HALO demo debris investigation.	
B73	Shed 7 by Laundry	23	1944-1961	External: concrete in situ, shiplap weatherboard - painted. Roof: Pitched corrugated iron - painted. Internal: timber frame, concrete in situ - painted. Floor: Concrete.	,0	reinforced concrete 1 perimeter footing with concrete slab	Yes - external	Yes - internal Class B	No	No	No	No	No		OPUS Building Inspection Report, 4Sight Pb & ACM Survey, GHD DSI. FTL Visual walkover.	
B74	Laundry	930	1944-1961	External: concrete in situ - painted. Roof: tin ribbed - painted & Corrugated ACM 'super six'. Internal: seratone, concrete in situ - painted. Floor: Concrete with lino cover. Ceiling: none.		reinforced concrete 1 perimeter footing with concrete slab	Yes - internal	Yes - internal Class A & B, external Class B	No	No	No	No	No		OPUS Building Inspection Report. AECOM & GHD DSI's, 4Sight Pb & ACM Survey.	

				External: Brick, concrete in situ, cement sheeting (ACM) - Painted/Brick. Roof: Pitched corrugated iron - painted. Internal:	concrete perimeter footing with concrete					Yes -			OPUS Building Inspection Report,	
B75	Doctors Flats (OCCUPIED)	335	1944-1961	gib plaster, timber pannelling, timber framing, hardboard, seratone - painted/wallpaper/pre- finished sheeting. Floors: Timber with carpet or lino cover. Ceiling: Gib plaster or hardboard - painted.		es - exterior	Yes - internal Class A & B, external Class B	No	Yes	directly south of structure	No	High	4Sight Pb & ACM Survey, HAIL XRF screening, FTL Visual walkover and HALO demo debris investigation.	
В76	Doctors Flats Garages	112	1944-1961	External: galvanised steel. Roof: Pitched corrugated iron. Internal: timber framing.	1 concrete plinth with post brackets	lo	No	No	Yes	Yes - Native vegetation directly north of structure	No	Medium	OPUS Building Inspection Report, 4Sight Pb & ACM Survey. FTL Visual Walkover	
<ol> <li>Building area</li> <li>Building built</li> </ol>	s are based on roof	f areas or Of te and from	PUS Building so review of hist	dentification spreadsheet urvey sheets; where measured off GIS, building for orical aerial photographs, unless stated on OPUS I ey				C	S	10	9,			
					Count Building L	ead Paint 7	ACM		2					
						<	50.	4	3					
					, (	KI	30							
					Cilv		Sy,							
					) × C									
					711/1									

#### Notes:

- 1. Building IDs and names from LINZ, Appendix 7 Building identification spreadsheet
- 2. Building areas are based on roof areas or OPUS Building survey sheets; where measured off GIS, building footprint will be slightly less
- 3. Building built date is approximate and from review of historical aerial photographs, unless stated on OPUS Building survey sheets.
- 4. Lead paint and ACM presence is from 4Sight building survey

Building		Lead Paint		ACM	
J	84		72		65

Table 1: Asbestos Containing Materials - BD1 - Admin

#### Table 24: LBP Identified - BO1 - Admin

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No Lead-Based lead p	aint samples v	vere identified	during the survey	<i>f</i> .

### OPUS Tokanui Building Inspection

General										
Building:	Admin	Year Built:	1978							
Footprint (m2)	800	Storeys:	2 Basement							
Surveyed by:	NE and RS	Survey Date:	2/02/2015							
General Comments:										

		EX	ternal	
Wall Material:	Reinfor	ced concrete blo	ock/Cedar shiplap weatherboard	
Wall Finish:	Painted			
Foundation:	Reinfor	ced concrete pe	rimeter footing Concrete slab	
Roof Material:	Tin Tite			
Roof Finish:			Gutters Present:	yes
Single Doors:		4	Double Doors:	0
Ranchsliders:		0	Windows:	148
Soffit Height (mm):		7000	Soffit Width (mm):	
Surrounding Feature	es: Service	sRoads		

crete columns between windows. Steel frames bolted to the façade with timber louvers. Reinforced cor (see photos) Too dangerous to see what the roof finish is. Central box gutter. Aluminium joinery. Some windows boarded up. Cedar weatherboard. Dried up outdoor water feature.

	lin lin	ternal			
Wall Material:	Gib Plaster Concrete Block Timber Frame				
Wall Finish:	Painted Wallpaper				
Floor Material:	Concrete				
Floor Finish:	Tiles Carpet Lino				
Ceiling Material:	Gib Plaster Stained pine				
Ceiling Finish:	Painted and stained				
Av. Stud Height (mm):	2650	Max. Stud Height (mm):	2670		
Rooms of Max. Stud Height:		Ground floor ceiling heights			
No. Rooms:	44	No. Internal Doors:	63		
No. Bathrooms:	7	No. Plant Rooms:	2		
Pipework Lagging:		Radiator Heating System:	yes		
Comments:	-		7.7		

Rotting carpet. Ceilings to central rooms upstairs are raking from 2650mm, under central box gutter to 5m at the highest point. Stained pine, negative detail ceiling finish. Floors: carpet rooms; lino & tile bathrooms; file stairs & ground main entrance. 29 rooms upstairs (40 doors), and 15 downstairs (23 doors). Has 10 internal glazing partitions upstairs and 17 downstairs, 3 bathrooms upstairs and 4

		Environmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	First floor main s	witch room of circuit boards. Upsta	irs & Downstairs Continu
Water Valve Loc:			
Surrounding Features:	Trees[Vegetation	1	
Comments:			
Toilet nearest the entranc	e works.		

Table 2: Asbestos Containing Materials – B02 – Ward 1 & 2

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B02 - Ward 1 & 2, Ground Floor	South-eastern rooms	Debris	Lagging	Hgh (11)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B02 - Ward 1 & 2 Ground Floor	Interior Throughout	Lagging	Insulation material	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B02 - Ward 1 & 2 Ground Floor	External Soffit	Lining to entrance awning, west elevation	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B02 - Ward 1 & 2 Ground Floor	Hallway - R31 Floor	Floor Lining	Tiles	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B02 - Ward 1 & 2 Ground Floor	Throughout Trusses	Infill panel	Fibre cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Table 25: LBP Identified - B02 - Ward 1 & 2

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B02 – Ward 1 & 2, Ground Floor	External	Light blue	Brick	Fair	LEAD-BÄSED 40,000
B02 – Ward 1 & 2, Ground Floor	External	Yellow	Timber	Poor	(EACHBASED 85,000
B02 – Ward 1 & 2, Ground Floor	External	Light blue	Concrete	Fair	LEAD-BASED 1,100
B02 – Ward 1 & 2, Ground Floor	External	Grey	Concrete	Poor	LEAD-BASED 32,000
B02 – Ward 1 & 2, Ground Floor	External	Light blue	Timber	Poor	LEAD-BASED 126,000
B02 – Ward 1 & 2, Ground Floor	External	White	Timber	Poor	(EAD) BASED ((2,DDD)
B02 – Ward 1 & 2, Ground Floor	Internal	Grey	Concrete	Poor	LAUU
B02 – Ward 1 & 2, Ground Floor	Internal	Yellow	Concrete	Poor	LEAD-BASED 1,700
B02 – Ward 1 & 2, Ground Floor	Internal	Blue	Concrete	Poor	1FAD-BASED 5,200
B02 – Ward 1 & 2, Ground Floor	Internal	Green	Concrete	Poor	18,000
B02 – Ward 1 & 2, Ground Floor	Internal	White	Plaster	Poor	LEAD-BASED LODG
B02 – Ward 1 & 2, Ground Floor	Internal	Beige	Hardboard	Poor	LEAD-BASED
B02 – Ward 1 & 2, Ground Floor	Internal	Beige	Hardboard	Poor	LEAD-BASED EZ,DIRI
B02 – Ward 1 & 2, Ground Floor	Internal	White	Timber	Poor	LEARL-BASEU 5-408
B02 – Ward 1 & 2, Ground Floor	External	Grey	Timber	Poor	LEAD BASED

### OPUS Tokanui Building Inspection

	Ger	neral	
Building:	Ward 1	Year Built:	Unknown
Footprint (m2)	1170	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	2/02/2015
General Comments:			

	Ex	ternal	
Wall Material:	Concrete in situ Shipla	o weatherboard	
Wall Finish:	Painted		
Foundation:	Concrete perimeter for & Kitchens Only	ting with concrete piles Concrete 5	Slab under Toilets
Roof Material:	Pitched corrugated iron	1	
Roof Finish:	Painted	Gutters Present;	yes
Single Doors:	9	Double Doors:	0
Ranchsliders:	0	Windows:	90
Soffit Height (mm):	3500	Soffit Width (mm):	300
Surrounding Features:	Stairs/Ramps Awnings Tanks	/Pergolas Services Road Concrete	Chimneys Header
Comments:			

Commentat	
Gable roof construction. Timber window frames. Mixed types of windows. Appears to be re-cladded	Ī
with timber weather board over reinforced insitu concrete.	P

	(n)	ternal	
Wall Material:	Gib Plaster Fibrous Pla	aster Concrete Brick	
Wall Finish:	Painted		
Floor Material:	Concrete Timber Native	e T/G	
Floor Finish:	Lino		
Ceiling Material:	Fibrous plaster/Timber	(TGV)	
Ceiling Finish:	Painted		
Av. Stud Height (mm):	3600	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	30	No. Internal Doors:	35
No. Bathrooms:	6	No. Plant Rooms:	1
	yes	Radiator Heating System:	yes
Pipework Lagging:			

	Envii	onmental	
Electricity Isolated:	yes	Water Isolated:	
Distribution Board Loc			
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			
Blackberries in central c	ourtyard.		

Table 3: Asbestos Containing Materials - BD3 - SSDU

Floor  B03 - SSDU Subfloo Ground boiler Floor	nal Wall or Under r room	EDB boxing	Rope seal	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
SSDU Subfloc Ground boiler Floor		Gasket	5000		Remove prior to demolition
B03 -			Debris	Medium (7)	by a licenced asbestos removalist under Class A controls
SSDU Interna	l Boiler - ework nges	Gaskets	Composite Material	Low (5)	Remove items intact prior to demolition by a licenced asbestos removalist under Class B controls
	r room /all	Coating	Plaster	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
	al Walls ughout	Coating	Plaster	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B03 - SSDU Ground Extern	al Soffit	Panels	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced as bestos removalist under Class B controls
B03 - SSDU Extern Ground Floor	nal Wall	EDB	Fuse insulation	Very Low (4)	Remove item intact prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 26: LBP Identified - 803 - SSDU

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B03 – SSDU, Ground Floor	R15	Blue	Concrete	Poor	U.AD-BASAD 2,000
B03 – SSDU, Ground Floor	R1	Yellow	Concrete	Poor	LEAD-BASED 1,300
B03 – SSDU, Ground Floor	R1, R6	Green	Concrete	Poor	LEAD-BASED 1,300
B03 – SSDU, Ground Floor	R13	Beige	Concrete	Fair	LEAD-BASET) - 1,300

J:\33 series\33205 Tokanui infrastructure\Demo Mgmt Plan\Building Summaries 240320

# OPUS Tokanui Building Inspection

		Year Built:	971? opened 197:
Footprint (m2)	505	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	3/02/2015

	EX	ternal			
Wall Material:	Reinforced in situ concrete Solid plaster Timber frame				
Wall Finish:	Painted				
Foundation:	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only				
Roof Material:	Flat RoofjTin Ribbed				
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	3	Double Doors:	1		
Ranchsliders:	2	Windows:	78		
Soffit Height (mm):	4000	Soffit Width (mm):	east and west side		
Surrounding Features:					
Comments:	I.				

Wall Material:	Gib Plaster Timber Fra	me				
Wall Finish:	Painted/Wallpaper					
Floor Material:	Timber Native T/G					
Floor Finish:	Carpet					
Ceiling Material:	Fibrous Plaster Accous	stic Tile				
Ceiling Finish:	Painted					
Av. Stud Height (mm):	3000	Max. Stud Height (mm):				
Rooms of Max. Stud Height:						
No. Rooms:	12	No. Internal Doors:	20			
No. Bathrooms:	2	No. Plant Rooms:	1			
Pipework Lagging:	yes	Radiator Heating System:	yes			
Comments:						

Electricity Isolated:	yes	Water isolated:	
Distribution Board Loc:			
Water Valve Loc:			
Surrounding Features:	Trees/Vegetation	l - T	
Comments:			



## OPUS Tokanui Building Inspection

General					
Steeple	Year Built:	Unknown			
3.2	Storeys:	1			
NE and RS	Survey Date:	20/02/2015			
	Steeple 3.2	Steeple Year Built: 3.2 Storeys:			

In situ concrete structure in shape of a cross each wall is 550L x 140w x 12 m high, with copper flashings where old Chapel roof used to be.

	Ext	ernal	
Wall Material:	Concrete in situ		
Wall Finish:	Painted		
Foundation:	Concrete slab		
Roof Material:			
Roof Finish:		Gutters Present:	no
Single Doors:	0	Double Doors:	177
Ranchsliders:		Windows:	0.
Soffit Height (mm):	11000	Soffit Width (mm):	550
Surrounding Features:	Services Road Other	0,	00
Comments:		6	10
Old chapel concrete slab	still remains use aerial in	nage for slab area cannot measu	re due to excessi

blackberry growth.

to the transfer of the transfe	Internal	
Wall Material:		
Wall Finish:		
Floor Material:		
Floor Finish:		
Ceiling Material:		
Ceiling Finish:		
Av. Stud Height (mm):	Max. Stud Height (mm):	
Rooms of Max. Stud Height:		
No. Rooms:	No. Internal Doors:	
No. Bathrooms:	No. Plant Rooms:	.0
Pipework Lagging:	Radiator Heating System:	no
Comments:		
010,010		


		nvironmental	
Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:	electrical boxes i	next to steeple	2.5
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 5: Asbestos Containing Materials - B05 - Male Toilet

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM id	dentified during the	e survey.	

#### Table 28: LBP Identified - B05 - Make Toilet

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B04 – Male Toilet, Ground Floor	External	White	Timber	Poor	(EAD-BASES)
B04 – Male Toilet, Ground Floor	External	White	Timber	Poor	LEAD-BASED 2,200
B04 – Male Toilet, Ground Floor	External	White	Timber	Poor	LEAD-BASETI 7,200
B04 – Male Toilet, Ground Floor	Internal	Cream	Timber	Poor	LEAD-BASED
					No ilo
				61116	

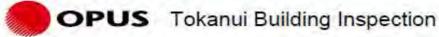

General					
Building:	Toilet Block	Year Built:	Unknown		
Footprint (m2)	28	Storeys:	1		
Surveyed by:	NE and DV	Survey Date:	4/02/2015		
General Comments:					

Wall Material:	Concrete block Board	Concrete block Board and baton				
Wall Finish:	Painted					
Foundation:	Concrete slab	Concrete slab				
Roof Material:	Pitched corrugated iron	T-				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	1	Double Doors:	0			
Ranchsliders:	0	Windows:	6			
Soffit Height (mm):	2200	Soffit Width (mm):	500			
Surrounding Features	5:					
Comments:						

Rooms of Max. Stud	erial:	Hardboard		
Floor Finish: Other Ceiling Material: Fibrous Plaster Ceiling Finish: Pre-finished Av. Stud Height (mm): 2400 Max. Stud Height (mm): Rooms of Max. Stud	sh: F	ainted		
Ceiling Material: Fibrous Plaster  Ceiling Finish: Pre-finished  Av. Stud Height (mm): 2400 Max, Stud Height (mm): Rooms of Max. Stud	terial:	Concrete		
Ceiling Finish: Pre-finished  Av. Stud Height (mm): 2400 Max, Stud Height (mm): Rooms of Max. Stud	ish:	Other		
Av. Stud Height (mm): 2400 Max, Stud Height (mm): Rooms of Max. Stud	aterial: F	ibrous Plaster		
Rooms of Max. Stud	inish: F	re-finished		
Rooms of Max. Stud Height:	Height (mm):	2400	Max, Stud Height (mm):	
neight	f Max. Stud			
No. Rooms: 1 No. Internal Doors:	ns:	1	No. Internal Doors:	0
No. Bathrooms: 1 No. Plant Rooms:	rooms:	1	No. Plant Rooms:	0
Pipework Lagging: no Radiator Heating System:	Lagging:	no	Radiator Heating System:	no
Comments:	te.		4.4	

	E	nvironmental	2	
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:			•	
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			
Comments:	B-112-12-12-11			

#### Table 29: LBP Identified - B06 - Shed 5

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B06 – Shed 5, Ground Floor	External	White	Timber	Fair	LEAD-BASED 4,000

#### Table 6: Asbestos Containing Materials - 806 - Shed 5

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM is	dentified during the	e survey.	



# OPUS Tokanui Building Inspection

	Ger	neral	
Building:	Shed 5	Year Built:	Unknown
Footprint (m2)	6	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	19/02/2015
General Comments:			***************************************

Wall Material:	Brick		
Wall Finish:	Painted		
Foundation:	Reinforced concrete p	erimeter footing Concrete slab	
Roof Material:	Pitched corrugated iron	n	
Roof Finish:	Painted	Gutters Present:	no
Single Doors:	0	Double Doors:	
Ranchsliders:		Windows:	0
Soffit Height (mm):	2400	Soffit Width (mm):	300
Surrounding Features:			
Comments:	brick 150 series		

Wall Material:	Brick	A	
Wall Finish:	10		
Floor Material:	Concrete		
Floor Finish:	18		
Ceiling Material:	No.		
Ceiling Finish:		the second of th	
Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	1	No. Internal Doors:	.0
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	no
Comments:	*		


	E	nvironmental	
Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:	N/A		
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 7: Asbestos Containing Materials - 807 - Water Treatment

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B07 - Water Treatme nt Ground Floor	Internal Throughout	Switches and fixings	Bakelite	Very Low (2)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 30: LBP Identified - 807 - Water Treatment

B07 - Water Treatment, Ground Floor  B07 - Water Treatment, Ground Floor  B07 - Water Treatment, Ground External  External  White Timber Poor	
LEAD-BIT	
Floor Write Timber Foot	1500
B07 – Water Treatment, Ground Internal Yellow Chipboard Fair Floor	
B07 – Water Treatment, Ground Floor  Internal Green Chipboard Fair	

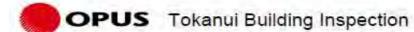

General					
W Treatment	Year Built:	Unknown			
30	Storeys:	1 Basement			
SD and AS	Survey Date:	16/02/2015			
e					
	W Treatment 30 SD and AS	W Treatment Year Built: 30 Storeys: SD and AS Survey Date:			

Wall Material:	Reinforced concret	e block Corrugated iron				
Wall Finish:	Painted None					
Foundation:	Reinforced concret	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated	iron				
Roof Finish:	Painted	Gutters Present:	no			
Single Doors:		Double Doors:	-1			
Ranchsliders:	. 0	Windows:	4.			
Soffit Height (mm):	0	Soffit Width (mm):	0			
Surrounding Features:	Road Services					
Comments:						
No soffit		_				

Wall Material:	Timber Pannelling Hard	dboard Other			
Wall Finish:	Painted Other	Painted)Other			
Floor Material:	Concrete				
Floor Finish:	Carpet Other				
Ceiling Material:	Other				
Ceiling Finish:	Pre-finished				
Av. Stud Height (mm):	2360	Max. Stud Height (mm):	2360		
Rooms of Max. Stud Height:		2			
No. Rooms:	3	No. Internal Doors:	1		
No. Bathrooms:	0	No. Plant Rooms:	1		
Pipework Lagging:	no	Radiator Heating System:	no		
Comments:					


Environmental					
Electricity Isolated:	yes	Water Isolated:	no:		
Distribution Board Loc:	First room	* - 5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 - 5 -	100		
Water Valve Loc:	V				
Surrounding Features:	Vegetation				
Comments:					

Table 31: LBP Identified - B08 - Dentist

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B08 – Dentist, Basement	Internal basement	Beige	Timber	Poor	1EAD BASED 37,000
B08 – Dentist, Ground Floor	External	Beige	Timber	Poor	(EAD-8A5ED 86,000
B08 – Dentist, Ground Floor	External	White	Timber	Poor	LEAD-BASED HO,000
B08 – Dentist, Ground Floor	External	White	Timber	Poor	(LAD-BASEN 12,000
B08 – Dentist, Ground Floor	Internal	Beige	Hardboard	Fair	1EAD-845ED 1/100

Table 8: Asbestos Containing Materials - B08 - Dentist

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B08 - Dentist Lower Ground	Subfloor Floor	Debris	Intact fibre cement and electrical components	Low (6)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls
B08 - Dentist Ground Floor	External Wall	Panel	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B08 - Dentist Ground Floor	Basement Wall	EDB	Composite material	very Low (3)	Remove intact prior to demolition by a licenced as bestos removalist under Class B controls

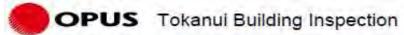

Building:	Dentist	Year Built:	Unknown	
Footprint (m2)	145	Storeys:	1	
Surveyed by:	NE and DV	Survey Date:	4/02/201	
General Comments:				

Wall Material:	Timber frame Shiplap	weatherboard			
Wall Finish:	Painted	Painted			
Foundation:	Concrete perimeter for & Kitchens Only	Concrete perimeter footing with concrete piles Concrete Slab under Toilet Kitchens Only			
Roof Material:	Pitched corrugated iron				
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	3	Double Doors:	- 1		
Ranchsliders:	.0	Windows:	12		
Soffit Height (mm):	3750	Soffit Width (mm):	350		
Surrounding Features	Stairs/Ramps				
Comments:					
Comments: Connected to wastewate	er treatment plant				

Wall Material:	Hardboard			
Wall Finish:	Painted			
Floor Material:	Timber Particle Board			
Floor Finish:	Lino			
Ceiling Material:	Fibrous Plaster			
Ceiling Finish:	Painted			
Av. Stud Height (mm):	2500	Max. Stud Height (mm):		
Rooms of Max. Stud Height:				
No. Rooms:	3	No. Internal Doors:		
No. Bathrooms:	.1	No. Plant Rooms:	0	
Pipework Lagging:	yes	Radiator Heating System:	yes	
Comments:			- 55	


Environmental					
Electricity Isolated:	yes	Water Isolated:	no		
Distribution Board Loc:	Unknown		-		
Water Valve Loc:					
Surrounding Features:	Vegetation				
Comments:					

Table 9: Asbestos Containing Materials - 809 - Bus Shelter

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B09 - Bus Shelter Ground Floor	External Wall	Lining	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 32: LBP Identified - B09 - Bus Shelter

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B09 – Bus Shelter, Ground Floor	External	Pink	Timber	Poor	LEAD BASED 600
B09 – Bus Shelter, Ground Floor	External	White	Timber	Poor	LEAD BASED 24.000

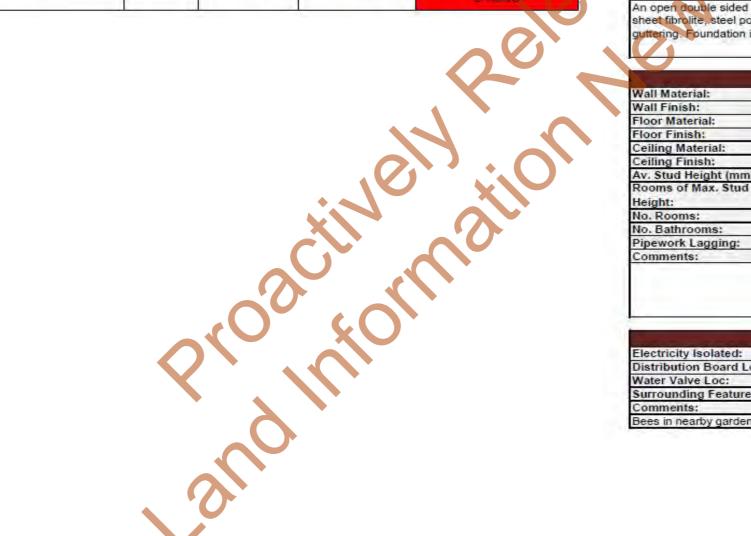

# OPUS Tokanui Building Inspection

	Gene	ral	
Building:	Bus shelter & carport	Year Built:	Unknown
Footprint (m2)	70	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	3/02/2015
General Comments:			

		ternal		
Wall Material:	Steel pole Timber rafters Timber frame Fibrolite cladding			
Wall Finish:	Painted			
Foundation:	Concrete slab			
Roof Material:	Pitched corrugated pvo			
Roof Finish:	None	Gutters Present:	yes	
Single Doors:	0	Double Doors:	0	
Ranchsliders:	0	Windows;	0	
Soffit Height (mm):	2500	Soffit Width (mm):		
Surrounding Features		*		

### Comments

An open double sided dual purpose structure (no doors) which has a middle wall which is cement sheet fibrolite, steel poles, and timber frame rafters. Roof is monopitched corrugated PVC with PVC guttering. Foundation is asphalt in the carport and footpath in the bus shelter.

Wall Material:			
Wall Finish:			
Floor Material:			
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:	0	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	N/A	Radiator Heating System:	no
Comments:		***************************************	

ALC: NO PERSON	Er	nvironmental	
Electricity Isolated:	N/A	Water Isolated:	N/A
Distribution Board Loc:	2		
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:	. 100		
Bees in nearby garden.			

## Table 33: LBP Identified - B10 - Old Admin & Pharmacy

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B10 – Old Admin & Pharmacy, 1	Old admin	White	Timber and metal	Intact	LEAD BASED 71,000
B10 – Old Admin & Pharmacy, 1	Old admin	White	Plasterboar d	Intact	LEAG-BASED 98.000
B10 – Old Admin & Pharmacy, 1	Old admin	Salmon	Timber	Poor	LEAG-BASED 2,000
B10 – Old Admin & Pharmacy, Ground Floor	Pharmacy internal	Green	Timber	Intact	LEAD-BASED 3,500
B10 – Old Admin & Pharmacy, Ground Floor	Pharmacy external	White	Timber and metal	Poor	LEAU-BASED 5,000
B10 – Old Admin & Pharmacy, Ground Floor	Old admin external	White	Timber and metal	Poor	(EAC-BASE) 5,180

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B10 - Old Admin & Pharmacy, 1 <sup>st</sup> Floor	Old admin - Roof void Pipes and floor	Pipe lagging and debris	Lagging	Hart (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B10 - Old Admin & Pharmacy Ground Floor	Internal Lagging throughout building	Lagging	Insulation material	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B10 - Old Admin & Pharmacy Ground Floor	Internal Ceiling inside wards	Textured ceiling	Textured coating	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B10 - Old Admin & Pharmacy Ground Floor	External - Pharmacy Soffits	Panels	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B10 - Old Admin & Pharmacy Ground Floor	Pharmacy Bathroom	Hot water cylinder	Cable wrap and insulation	Low (6)	Remove item intact prior to demolition by a licenced asbestos removalist under Class B controls
B10 - Old Admin & Pharmacy 1 <sup>st</sup> Floor	Old admin - cleaners cupboard Walls	Lining	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B10 - Old Admin & Pharmacy 1 <sup>st</sup> Floor	Old admin - R10 Wall	Switchboard	Backing	Very Low (4)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls

## OPUS Tokanui Building Inspection

	Gei	neral	
Building:	Pharmacy	Year Built:	Unknown
Footprint (m2)	108	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	9/02/2015
General Comments:	•		
Solid Rimu cabinetry			

	Ex	ternal			
Wall Material:	Brick Concrete in situ				
Wall Finish:	Brick Solid Plaster				
Foundation:	Concrete perimeter for & Kitchens Only	ting with concrete piles Concre	te Slab under Toilets		
Roof Material:	Other				
Roof Finish:	None	Gutters Present:	yes		
Single Doors:	2	Double Doors:	0		
Ranchsliders:	0	Windows:	9		
Soffit Height (mm):	2700	Soffit Width (mm):	350		
Surrounding Features:	Stairs/Ramps/Awnings	/Pergolas Road			
Comments:					

	Interi	nal	
Wall Material:	Gib Plaster Timber Frame	Concrete in situ	
Wall Finish:	Painted		
Floor Material:	Concrete Timber Native T/	G	_
Floor Finish:	Carpet Lino		
Ceiling Material:	Fibrous PlasterlConcrete		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			A
No. Rooms:	7	No. Internal Doors:	3
No. Bathrooms:		No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			
Large steel safe door and medicine shelving.	d steel entry door. Concrete	medicine store with sunken cond	rete floor. Ri

Water Isolated:	no
	•
	Water isolated:

Building:	Old admin WTC	Year Built:	1930
Footprint (m2)	290	Storeys:	2
Surveyed by:	NE and RS	Survey Date:	9/02/2015
Surveyed by: General Comments:	NE and RS	Survey Date:	9/0

	Ex	ternal	
Wall Material:	Brick/Concrete in situ		
Wall Finish:	Brick Solid Plaster		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Other		
Roof Finish:	None	Gutters Present:	yes
Single Doors:	1	Double Doors:	2
Ranchsliders;	.0	Windows;	40
Soffit Height (mm):	6230	Soffit Width (mm):	600
Surrounding Features:	Awnings/Pergolas/Roa	d Powerlines	
Comments:			
Concrete tile roofing			

Wall Material:	Gib Plaster Timber Frame Brick Concrete in situ								
Wall Finish:	Painted Wallpaper								
Floor Material:	Concrete Timber Native T/G								
Floor Finish:	Carpet Lino								
Ceiling Material:	Gib Plaster Fibrous Plaster								
Ceiling Finish:	Painted								
Av. Stud Height (mm):	3000	Max. Stud Height (mm):							
Rooms of Max. Stud Height:									
No. Rooms:	26	No. Internal Doors:	30						
No. Bathrooms:	2	No. Plant Rooms:	0						
Pipework Lagging:	yes	Radiator Heating System:	yes						
Comments:									

	Environmental									
Electricity Isolated:	yes	Water Isolated:	no							
Distribution Board Loc:	Ground hallway									
Water Valve Loc:										
Surrounding Features:	Trees Vegetation	t .								
Comments:										

Ward A fround Floor building Panel Floor building Panel AIB Medium (8) Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demo	Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action	Building & Floor	Location	Colour	Substrate	
Signate throughout the fillow pounds the fillow part of the format plant of the fillow part of the fillow pa		The state of the s	Dobris	Various	1000 / 11			Northern elevation	White	Timber	
Ward A Ground Floor Floor Ploor Ploo	Floor		Debits	Various	e			External	White	Timber	
B11 - Carpark Manhole Ground Floor and B10 Rope seal Insulation material Ricor and B10 Rope seal Services and gasket Ploor Plo	Ward A Ground	Internal Pipes		Print A . Tr. Dr. M. Tr.	Medium (9)	by a licenced asbestos removalist under Class A		External	Green	Timber	
Ground between B11 filternal R17 panel R17 filternal R18 filternal R19 panel R19 filternal R19 panel	B11 -			Insulation		Remove prior to demolition		External	Beige	Timber	
Ward A Ground Floor Floor by a licenced asbestos removalist under Class A controls  B11 - Ward A Ground Floor EDB Panel AIB Medium (8) Panel AIB P			Rope seal	material	Medium (8)	removalist under Class A		External	Red	Timber	
B11 - Ward A Ground Floor  Celling lining  Cement sheet  Low (5)  Remove prior to demolition by a licenced asbestos removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B11 - Ward A Ground Floor  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B11 - Ward A Ground Floor  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B11 - Ward A Ground Floor  B11 - Ward A	Ward A Ground	Act of the Part of	hot water		Medium (8)	by a licenced asbestos removalist under Class A		External	Grey	Timber	
Ward A Floor  B11 - Mark A Ground Floor  Celling lining (wet) areas  B11 - Ward A Ground Floor  B11 - Ward A Ground Floor  B11 - Ward A Ground Floor  Celling lining (wet) areas  B11 - Ward A Ground Floor  B11 - Ward A Ground Floor  Celling lining (wet) areas  B11 - Ward A Ground Floor  B11 - Ward A Ground Floor  B11 - Ward A Ground Floor  Celling lining (wet) areas  B11 - Ward A Ground Floor  Cement sheet  Low (5)  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B Controls  B11 - Ward A Ground Floor	B11 -	Internal R11				Remove prior to demolition		Internal R35	Grey	Plaster	
Ward A Ground EDB  Panel AIB  Medium (8)  Medium (10ss A Ground Floor  Memove prior to demolition by a licenced asbestos removalist under Class A Ground Floor  Mary A Ground Floor  Meroud A Ground Floor  Memove prior to demolition by a licenced asbestos removalist under Class A Ground Floor  Mary A Ground Floor  Memove prior to demolition by a licenced asbestos removalist under Class A Ground Floor  Mary A G	Ground	Wall behind	Panel	AIB	Medium (8)	removalist under Class A		Internal R35	Grey	Plaster	
B11 - Ward A Ground Floor [wet) areas Floor [wet) areas Floor [stored about 5] Floor [store	Ward A	Wall behind	Panel	AIB	Medium (8)	by a licenced asbestos		Internal R34, R23	Pink	Plaster	1
Ward A Ground Floor   Internal Ceiling   In bathroom (wet) areas   Ceiling lining   Cement sheet   Low (5)   by a licenced asbestos removalist under Class B controls    B11 - Ward A Ground Floor   External Exterior soffits - toilet blocks   - toilet blocks   Floor   Internal bathrooms   Floor Lining   Bituminous backing to vinyl   Very Low (4)    B11 - Ward A Ground Floor   Rathrooms   Floor Lining   Bituminous backing to vinyl   Switchboard   Backing board   Very Low (4)   Remove intact prior to demolition by a licenced asbestos removalist under Class A controls    Remove prior to demolition by a licenced asbestos removalist under Class A controls   Bituminous backing to vinyl   Very Low (4)   Remove intact prior to demolition by a licenced asbestos removalist under Class A controls   Bituminous backing to vinyl   Very Low (4)   Remove intact prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing board   Very Low (4)   Remove intact prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing board   Very Low (4)   Remove intact prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing board   Very Low (4)   Remove prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing to vinyl   Very Low (4)   Remove prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing to vinyl   Very Low (4)   Remove prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing to vinyl   Very Low (4)   Remove prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing to vinyl   Very Low (4)   Remove prior to demolition by a licenced asbestos removalist under Class B controls   Bituminous backing to vinyl   Very Low (5)   Bituminous backing to vinyl   Very Low (6)   Bituminous backing to vinyl   Very Low (6)   Bituminous backing to vinyl   Very Low (6)   Bituminou								Internal R33		Plaster	
External External External External External Exterior soffits - toilet blocks  B11 - Universal Bathrooms Floor  B11 - Ward A Ground Floor	Ward A Ground	in bathroom	Ceiling lining	Cement sheet	Low (5)	by a licenced asbestos removalist under Class B		Internal hallway	White	Timber	
B11 - Ward A Ground Floor Floor Lining Floor Lining Floor Lining Floor Lining Floor	Ward A Ground	Exterior soffits	Panels	Fibre cement	Low (5)	by a licenced asbestos	Ground Floor	Internal bathroom	se	Plaster	
Ward A Ground Floor Floor Floor Lining batking to vinyl Floor Lining Floor Lining Floor Fl						200000	Control Control of the Control of th	Internal hallways		Plaster	
B11 — Ward A Ground Floor Switchboard Backing board Wery Low (4) Backing board Floor Remove intact prior to demolition by a licenced asbestos removalist under Class B controls Ground Floor Remove intact prior to demolition by a licenced asbestos removalist under Class B controls	Ground	bathrooms	Floor Lining	backing to	Very Low (3)	removalist under Class A	Ground Floor	internal r	Green	Plaster	
Name of the control o	Ward A Ground	R17 Wall	Switchboard	Backing board	Very Low (4)	demolition by a licenced asbestos removalist under		Internal R1	Green	Hardboard/ timber	
Ward A Internal R31 Ground Floor Flo	Ground	and the second of the second o	Floor Lining		Very Low (3)	removalist under Class B	Cilly.				
B11 – Ward A Ground Floor  Roof void Timber framing Fibre Cement Fibre Cement Fibre Cement Fibre Cement Very Low (4)  Remove prior to demolition by a licenced asbestos removalist under Class B controls	Ward A Ground	42.47	The Day of Conference of the C	Fibre Cement	Very Low (4)	by a licenced asbestos removalist under Class B					

## Table 34: LBP Identified - B11 - Ward A

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm
B11 – Ward A, Ground Floor	Northern elevation	White	Timber	Poor	(FAU-BASEI) 55,000
B11 – Ward A, Ground Floor	External	White	Timber Poor		LEAD-BASED 150,000
B11 – Ward A, Ground Floor	External	Green	Timber	Poor	(EAD-8A5EI) 24,000
B11 – Ward A, Ground Floor	External	Beige	Timber	Poor	JEACHBASED JOB,DOD
B11 – Ward A, Ground Floor	External	Red	Timber	Poor	LEAG-MASED A7,000
B11 – Ward A, Ground Floor	External	Grey	Timber	Poor	11.008
B11 – Ward A, Ground Floor	Internal R35	Grey	Plaster	Poor	18,000
B11 – Ward A, Ground Floor	Internal R35	Grey	Plaster	Poor	LEAD-BASED
B11 – Ward A, Ground Floor	Internal R34, R23	Pink	Plaster	Poor	LEAD-BASED
B11 – Ward A, Ground Floor	Internal R33	Blue/gr een	Plaster	Poor	12,900
B11 – Ward A, Ground Floor	Internal hallway	White	Timber	Poor	LEAD-BASED 3.400
B11 – Ward A, Ground Floor	Internal bathroom	Turquoi se	Plaster	Poor	1EAD-BASED 9,200
B11 – Ward A, Ground Floor	Internal hallways	Light blue	Plaster	Poor	LEAD-BASED 5,900
B11 – Ward A, Ground Floor	internal r	Green	Plaster	Poor	(EAL) BAZED 7,900
B11 – Ward A, Ground Floor	Internal R1	Green	Hardboard/ timber	Poor	1EAD-BASED 1,900

	al	Ger	
1912	Year Built:	Ward A	Building:
1	Storeys:	1520	Footprint (m2)
9/02/201	Survey Date:	NE and RS	Surveyed by:
,	Survey Date:	NE and RS	Surveyed by: General Comments:

	Б	rternal								
Wall Material:	Timber frame/Cement	Timber frame Cement sheet Shiplap weatherboard								
Wall Finish:	Painted Solid Plaster									
Foundation:	Concrete perimeter for & Kitchens Only	oting with concrete piles Concrete	Slab under Toilets							
Roof Material:	Pitched corrugated iron	1								
Roof Finish:	Painted	Gutters Present:	yes							
Single Doors:	13	Double Doors:	2							
Ranchsliders:	.0	Windows:	243							
Soffit Height (mm):	4000	Soffit Width (mm);	400							
Surrounding Features:	Stairs/Ramps Awnings Tanks	/Pergolas Services Road Concrete	: Chimneys Heade							
Comments:	•									

Wall Material:	Gib Plaster Timber Par	nnelling Timber Frame Hardboard Con-	crete in situ						
Wall Finish:	Painted Wallpaper Tile Pre-finished sheeting								
Floor Material:	Concrete[Timber Native T/G								
Floor Finish:	Carpet Lino Tiles								
Ceiling Material:	Fibrous Plaster Timber (TGV) Hardboard Seratone								
Ceiling Finish:	Painted								
Av. Stud Height (mm):	2500 Max. Stud Height (mm):								
Rooms of Max. Stud Height:		5	-						
No. Rooms:	45	No. Internal Doors:	60						
No. Bathrooms:	.9	No. Plant Rooms:	0						
Pipework Lagging:	yes	Radiator Heating System:	yes						
Comments:									


Environmental								
Electricity Isolated:	yes	Water Isolated:	no					
Distribution Board Loc:								
Water Valve Loc:								
Surrounding Features:	Trees Vegetation							
Comments:								

### Table 35: LBP Identified - B12 - Ward B

ole 35: LBP Identified -	B12 - Ward B					Table 12: A	Asbestos Containing	g Materials - B12 - V	Ward B					
Suilding & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)	Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action		OPUS	Tokanui E
B12 – Ward B, 1	Internal	Pink	Plaster	Poor	LEAD-BASED 2,300	B12 - Ward B	Internal Boiler		45.00		Remove items intact prior to demolition by a licenced	Foot	ding: tprint (m2) veyed by;	Ward E 480 NE and F
312 – Ward B, 1	Internal	Yellow	Plaster	Poor	LEAD-BASED 3,400	Ground Floor	room	Equipment	Gaskets	Medium (7)	asbestos removalist under Class B controls		eral Comments:	
12 – Ward B, 1	Internal	Green	Plaster	Poor	LEAD-BASED 25,000	B12 – Ward B Ground	Internal Outer	Equipment and debris	Gaskets	Medium (7)	Remove items intact prior to demolition by a licenced asbestos removalist under		l Material:	Brick Concrete in
B12 – Ward B, Ground Floor	Internal	White	Brick	Poor	LEAT-BASED 3,200	B12 -	Taking I	Contact to a said and	6		Class B controls  Remove intact prior to	Wall	Finish: ndation:	Brick Solid Plaste Concrete permet & Kitchens Only
B12 – Ward B, Ground Floor	External	Beige	Timber	Poor	1E40-845ED 99,000	Ward B Ground Floor	Internal Northeast end	Switchboard and components	Composite material	Very Low (3)	demolition by a licenced asbestos removalist under Class B controls	Root	f Material: f Finish: gle Doors:	Pitched corrugate Painted 6
312 – Ward B, Ground Floor	External	Beige	Timber	Poor	LEAD-BASED 130,000						7 /	Soffi	chsliders: fit Height (mm): rounding Feature	0 6400 es: Stairs/Ramps Ser
12 – Ward B, Ground Floor	External	White	Timber	Poor	LEAD-BASED 24,000								nments: mal fire escape	
12 – Ward B, Ground Floor	Internal	Blue	Plaster	Poor	LEAD-BASED						.0		0	
12 – Ward B, Ground Floor	Internal	Salmon	Plaster	Poor	62,000 (EAD-BASED 5,500						9 4	Wall	Material:   Finish:	Gib Plaster Timbe
312 – Ward B, Ground Floor	Internal	Blue	Plaster	Poor	LEAD-HASES					20		Floo Ceiti	or Material: or Finish; ing Material: ing Finish;	Concrete Timber Carpet Lino Gib Plaster Fibrou
312 – Ward B, Ground Floor	Internal	Light blue	Plaster	Poor	J,100 (EAD-BASED) J1.000					0	N	Av. S	Stud Height (mm ms of Max. Stud	
						Č	11/6						ments:	es: Trees Vegetation
						<b>&gt;</b>								
					~40		&O							
						11								
					\ \									
					.0.									

### Table 12: Asbestos Containing Materials - B12 - Ward B

8 Floor  B12 - Ward B Ground Floor  B12 -		Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		oiler Equipment Gaskets Medium (7)			Remove items intact prior to demolition by a licenced asbestos removalist under Class B controls
		Gaskets		Medium (7)	Remove items intact prior to demolition by a licenced asbestos removalist under Class B controls
B12 – Ward B Internal Ground Northeast end Floor		Switchboard and components	Composite material	Very Low (3)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls

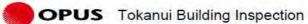

	Gei	neral	
Building:	Ward B	Year Built:	1925
Footprint (m2)	480	Storeys:	2
Surveyed by:	NE and RS	Survey Date:	9/02/2015
General Comments:			


Wall Material:	BricklConcrete in situ	W. S. S. S. S.				
C.T. CHILL PROCESSOR CONT.						
Wall Finish:	Brick Solid Plaster Text					
Foundation:	& Kitchens Only	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only				
Roof Material:	Pitched corrugated iron	1				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	6	Double Doors:	1			
Ranchsliders:	0	Windows:	111			
Soffit Height (mm):	6400	Soffit Width (mm):	500			
Surrounding Features:	Stairs/Ramps Services	Road Concrete Chimneys				
Comments:	-					

	In	ternal					
Wall Material:	Il Material; Gib Plaster[Timber Pannelling Timber Frame Brick Concrete in situ						
Wall Finish:	Painted Wallpaper						
Floor Material:	Concrete Timber Nativ	e T/G					
Floor Finish:	Carpet Lino						
Ceiling Material:	Gib Plaster Fibrous Pla	Gib Plaster Fibrous Plaster Timber (TGV)					
Ceiling Finish:	Painted						
Av. Stud Height (mm):	3100	Max. Stud Height (mm):					
Rooms of Max, Stud Height:							
No. Rooms:	35	No. Internal Doors:	50				
No. Bathrooms:	5	No. Plant Rooms:	- 1				
Pipework Lagging:	agging: yes Radiator Heating System:		yes				
Comments:							

	E	nvironmental		
Electricity Isolated:	yes	Water isolated:	no	
Distribution Board Loc:			- 5	
Water Valve Loc:				
Surrounding Features:	Trees/Vegetation			
Comments:				

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B13 – Ward C, Ground Floor	Internal Roof void – pipe heating network	Lagging	Insulation material	H-gh (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B13 – Ward C, Ground Floor	Internal Throughout	Lagging debris to floor	Insulation material	H@h [11]]	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B13 – Ward C Ground Floor	External Toilet block	Soffit	Fibre cement sheeting	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B13 – Ward C Ground Floor	External Toilet block	Window infill panel	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B13 – Ward C Ground Floor	External East elevation entrance	Door infill panel	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Score  Remove prior to demolition by a licenced assestors removalist under Class A controls  Remove prior to demolition by a licenced assestors removalist under Class A controls  Remove prior to demolition by a licenced assestors removalist under Class A controls  Remove prior to demolition by a licenced assestors removalist under Class A controls  Remove prior to demolition by a licenced assestors removalist under Class A controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition by a licenced assestors removalist under Class B controls  Remove prior to demolition during the prior to demolition by	Score    Suitation   Itel	Building & Floor Location Colour Substrate Condition Lead Result (ppm material insulation material insulat	Building & Floor Location Colour Substrate Condition Lead Result (ppm material insulation material insulat	Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove	13 – W				Table 36: LBP Identifie	ed - B13 - Ward C				1
Remove prior to demolition by a licenced abbestos removalist under Class A controls  Insulation material  Fibre cement sheeting  Fibre cement  Low (5)  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demoliti	Remove prior to demolition by a licenced abbestos removalist under Class A controls  Insulation material  Fibre cement sheeting  Fibre cement  Low (5)  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – War	Insulation material   Insulation material   Insulation material   Insulation material material   Insulation   Insulation material material material material   Insulation   Insulation material material material material material   Insulation   Insulation material mat	Insulation material   Insulation material   Insulation material   Insulation material material   Insulation   Insulation material material material material   Insulation   Insulation material material material material material   Insulation   Insulation material mat	Remove prior to demolition by a licenced abbestos removalist under Class A controls  Insulation material  Fibre cement sheeting  Fibre cement  Low (5)  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class A controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  Remove prior to demolition by a licenced abbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – War	ect al	Material Type	Material Risk Score	Recommended action	Building & Floor	Location	Colour	Substrate		Lead Result (ppm)
material material removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class B removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removali	material material removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class	material material removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground F	material material removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground F	material material removalist under Class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B removalist under class		Insulation			The second secon	External	Beige	Timber	Poor	F-10-7-10-7-10-7-10-7-10-7-10-7-10-7-10-
by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition demolition duration for timber  Remove prior to demolition duration floor  Remove prior to demolition duration floor duration floor  Remove prior to demolition floor floor  Remove prior to demolition floor  Remove prior to demolition floor  R	by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition	by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition linternal R1  Remove pri	by a licenced asbestos removalist under class A controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition by a licenced asbestos removalist under class B controls  Remove prior to demolition linternal R1  Remove pri	by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition by a licenced absetsor removalist under class B controls  Remove prior to demolition	3	The state of the s	H-ZH (10)	removalist under Class A		External	Green	Timber	Роог	
Fibre cement sheeting Low (5) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbesto removalist under Class B controls  Remove prior to demolition by a licenced asbesto removalist un	Fibre cement sheeting Low (5) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B B13 – Ward C, Ground Floor linternal R27 purple Hardboard and metal season by a licenced asbestos removalist under Class B B13 – Ward C, Ground Floor linternal north wing Orange Pink Timber Fair Lizen Bass II B13 – Ward C, Ground Floor linternal north wing Orange Pink Timber Fair Lizen Bass II B13 – Ward C, Ground Floor linternal north wing Orange Pink Timber Fair lizen Bass II B13 – Ward C, Ground Floor linternal north wing Orange Pink and place and place demonstration and place demonstrat	Fibre cement sheeting Low (5) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal R27 purple Hardboard and metal licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal no	Fibre cement sheeting Low (5) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal R27 purple Hardboard and metal licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal north wing Orange licenced asbestos removalist under Class B lia – Ward C, Ground Floor linternal no	Fibre cement sheeting Low (5) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B B13 – Ward C, Ground Floor linternal R27 purple Hardboard and metal season by a licenced asbestos removalist under Class B B13 – Ward C, Ground Floor linternal north wing Orange Pink Timber Fair Lizen Bass II B13 – Ward C, Ground Floor linternal north wing Orange Pink Timber Fair Lizen Bass II B13 – Ward C, Ground Floor linternal north wing Orange Pink Timber Fair lizen Bass II B13 – Ward C, Ground Floor linternal north wing Orange Pink and place and place demonstration and place demonstrat	ris to	- ASSC 3 ASSESSOR - C.	9(g) (10)	by a licenced asbestos		External	White	Timber	Poor	7.00
sheeting Low (5) removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B16 – Timber  Fair  LAB BASETI  ALB	sheeting Low (5) removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground	sheeting Low (5) removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19	sheeting Low (5) removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19	sheeting Low (5) removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Remove prior to demolition ward rooms  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground					A	Internal R1	Yellow		Poor	
Fibre cement Low (5) by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 - Ward C, Ground Floor  B14 - Ward C, Ground Floor  B15 - Ward C, Ground Floor  B16 - Ward Floor  B17 - Ward C, Ground Floor  B18 - Ward C, Ground Floor  B19 - Ward C, G	Fibre cement Low (5) by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, G	Fibre cement Low (5) by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 –	Fibre cement Low (5) by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 –	Fibre cement Low (5) by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, G		The state of the s	Low (5)	removalist under Class B		Internal throughout	White	Timber	Poor	
Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B	Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B	Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B	Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B	Remove prior to demolition by a licenced asbestos removalist under Class B controls  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B18 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B19 – Ward C, Ground Floor  B10 – Ward C, Ground Floor  B11 – Ward C, Ground Floor  B12 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B14 – Ward C, Ground Floor  B15 – Ward C, Ground Floor  B16 – Ward C, Ground Floor  B17 – Ward C, Ground Floor  B	nfill	Fibre cement	Low (5)	by a licenced asbestos			Pink	Timber	Fair	4.00
Fibre cement Low (5) by a licenced asbestos removalist under Class B controls  B13 - Ward C, Ground Floor Internal R27 Purple Hardboard and metal 38.000  B13 - Ward C, Ground Floor Internal north wing Orange Hardboard Fair Lab BASED 1,200  B13 - Ward C, Ground Floor Internal north wing Orange Timber Fair 38.000	by a licenced asbestos removalist under Class B controls  B13 - Ward C, Ground Floor  B14 - Ward C, Ground Floor  B15 - Ward C, Ground Floor  B16 - Ward C, Ground Floor  B17 - Ward C, Ground Floor  B18 - Ward C, Ground Floor  B19 - Ward C, Ground Floor	by a licenced asbestos removalist under Class B controls  B13 - Ward C, Ground Floor  B14 - Ward C, Ground Floor  B15 - Ward C, Ground Floor  B16 - Ward C, Ground Floor  B17 - Ward C, Ground Floor  B18 - Ward C, Ground Floor  B19 - Ward C, Ground Floor	by a licenced asbestos removalist under Class B controls  B13 - Ward C, Ground Floor  B14 - Ward C, Ground Floor  B15 - Ward C, Ground Floor  B16 - Ward C, Ground Floor  B17 - Ward C, Ground Floor  B18 - Ward C, Ground Floor  B19 - Ward C, Ground Floor	by a licenced asbestos removalist under Class B controls  B13 - Ward C, Ground Floor  B14 - Ward C, Ground Floor  B15 - Ward C, Ground Floor  B16 - Ward C, Ground Floor  B17 - Ward C, Ground Floor  B18 - Ward C, Ground Floor  B19 - Ward C, Ground Floor		3,24,53,000		controls			Blue	Timber	Fair	W. C.
B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Internal north wing  Orange  Hardboard  Fair  LEAD-BASED  1,260	B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Internal north wing Orange Hardboard Fair 1.260  Compared Timber Fair 1.260  Compared	B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Internal north wing  Orange  Hardboard  Fair  LEAD-BASED  1,260	B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Internal north wing  Orange  Hardboard  Fair  LEAD-BASED  1,260	B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  B13 – Ward C, Ground Floor  Internal north wing Orange Hardboard Fair 1.260  Compared Timber Fair 1.260  Compared	oanel	Fibre cement	Low (5)	by a licenced asbestos removalist under Class B		Internal R27	Purple		Fair	
Ground Floor Internal north wing Orange Timber Fair	Ground Floor Internal north wing Orange Timber Fair	Ground Floor Internal north wing Orange Timber Fair	Ground Floor Internal north wing Orange Timber Fair	Ground Floor Internal north wing Orange Timber Fair				controls		Internal north wing	Orange	Hardboard	Fair	
										Internal north wing	Orange	Timber	Fair	
									VIV					
								$\sim$ 0	•					
							•	(O)						

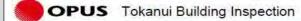

	Gei	neral	
Building:	Ward C	Year Built:	1912
Footprint (m2)	1460	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	10/02/2015
General Comments:			

Wall Material:	Concrete in situ Shipla	p weatherboard Board and baton				
Wall Finish:	Painted Solid Plaster					
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete	Slab under Toilets			
Roof Material:	Pitched corrugated iron	1,				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	8	Double Doors:	5			
Ranchsliders:	0	0 Windows: 260				
Soffit Height (mm):	3200	3200 Soffit Width (mm): 400				
Surrounding Features:	Stairs/Ramps Awnings	/Pergolas Services Road Header 1	anks			
Comments:	II.					

Wall Material:	Gib Plaster Timber Pannelling Timber Frame Brick Concrete in situ					
Wall Finish:	Painted Wallpaper Pre	-finished sheeting	199			
Floor Material:	Concrete/Timber Nativ	e T/G				
Floor Finish:	Carpet Lino					
Ceiling Material:	Gib Plaster Fibrous Pla	ster[Timber (TGV)]Hardboard				
Ceiling Finish:	Painted					
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	3800			
Rooms of Max. Stud Height:		6				
No. Rooms:	39	No. Internal Doors:	45			
No. Bathrooms:	7	No. Plant Rooms:	2			
Pipework Lagging:	yes	Radiator Heating System:	yes			
Comments:						


	no
2.1.1.1.1.1	
ation	
ation	


Table 37: LBP Identified - B14 - Shed 3

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No Lead-Based lead p	paint samples v	vere identified o	during the survey	r.

## Table 14: Asbestos Containing Materials - B14 - Shed 3

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B14 – Shed 3 Ground Floor	Internal Wall	Debris	AIB	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls

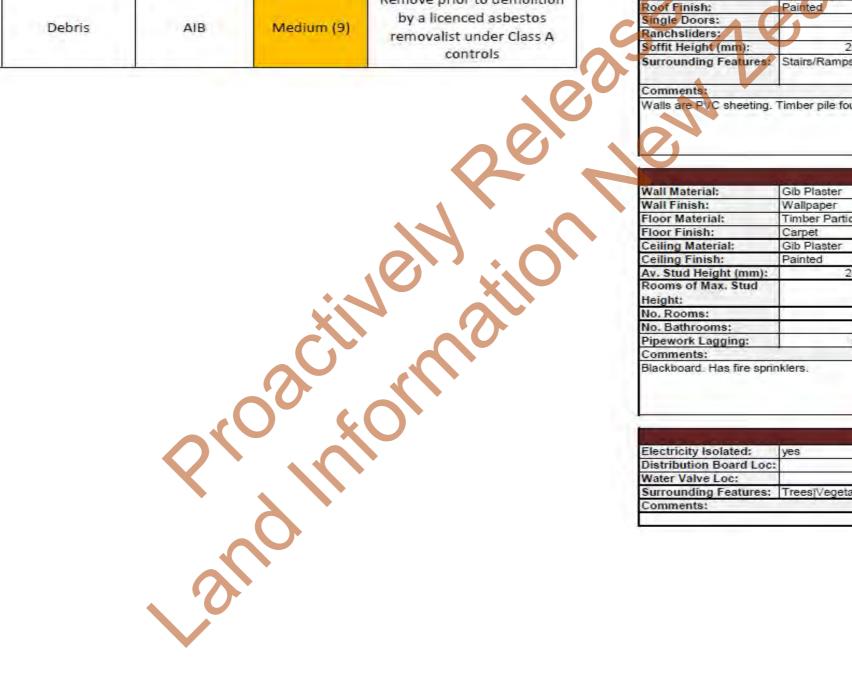

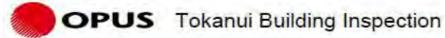

General					
Building:	Shed 3	Year Built:	Unknown		
Footprint (m2)	47	Storeys:	1		
Surveyed by:	NE and RS	Survey Date:	10/02/2015		
General Comments:					

	-	ternal	
Wall Material:	Vertical PVC weatherb	pard	
Wall Finish:	Painted		
Foundation:	Raised Timber Piles		
Roof Material:	Pitched corrugated iron	ř.	
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	1.	Double Doors:	0
Ranchsliders:	0	Windows:	3
Soffit Height (mm):	2800	Soffit Width (mm):	450
Surrounding Features:	Stairs/Ramps Awnings/	Pergolas Services Other	
Comments:			
Walls are PVC sheeting.	Timber pile foundation.	Awning attached to Ward D.	

Wall Material:	Gib Plaster		
Wall Finish:	Wallpaper		
Floor Material:	Timber Particle Board		
Floor Finish:	Carpet		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	1	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
	*		
Comments:			

Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:			
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:	700-21-21-21		

### Table 15: Achaetas Cantaining Materials - 815 - Ward D

### Table 38: LBP Identified - B15 - Ward D

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B15 – Ward D Ground Floor	Internal R30 Wall	Insulation panel	Asbestos insulation board	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B15 – Ward D Ground Floor	Internal Old HWC Cupboard	Wiring	Textile	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B or A controls, depending on ability to remove item intact.
B15 – Ward D Ground Floor	Internal R22 Upper walls	Lining	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B15 – Ward D Ground Floor	Internal R29- R32 Ceiling to wet areas	Panels	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

- W	/ard D			Table 38: LBP Identified	- B15 - Ward D						
ct.	Material Type	Material Risk Score	Recommended action	Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)	OPUS	Tol
	Asbestos		Remove prior to demolition by a licenced asbestos	B15 – Ward D, Ground Floor	External	White	Timber	Fair	LEAD-BASED F7,000	Building: Footprint (m2) Surveyed by:	
nel	insulation board	Medium (9)	removalist under Class A controls	B15 – Ward D, Ground Floor	External	White	Timber	Fair	1EAD-8A5ED 96,000	General Comments:	
	T49-	Laurille V	Remove prior to demolition by a licenced asbestos removalist under Class B or	B15 – Ward D, Ground Floor	External	White	Timber	Fair	1640-845ED 86,000	Wall Finish:	Timbe Painte
	Textile	Low (6)	A controls, depending on ability to remove item intact.	B15 – Ward D, Ground Floor	Internal	Cream	Plaster	Poor	LEAD BASED (3,000	Roof Material:	Concr & Kitch Pitche Painte
	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos	B15 – Ward D, Ground Floor	Internal	Beige	Plaster	Poor	LBOD	Single Doors: Ranchsliders: Soffit Height (mm): Surrounding Features:	Stairs
		(-)	removalist under Class B controls	B15 – Ward D, Ground Floor	Internal	Peach	Plaster	Poor	LEAU-BASED 1,880	Comments: Street lamps. Fire hydrant	
	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	B15 – Ward D, Ground Floor	Internal	Green	Fibre cement	Poor	1,800		
										Height: No. Rooms: No. Bathrooms: Pipework Lagging: Comments: 1 kitchen & 2 kitchenettes, in bathrooms.  Electricity Isolated: Distribution Board Loc: Water Valve Loc: Surrounding Features: Comments:	yes Kitche

General					
Building:	Ward D	Year Built:	1917		
Footprint (m2)	970	Storeys:	1		
Surveyed by:	NE and RS	Survey Date:	10/02/2015		
General Comments:		1			

Wali Material:	Timber FramelShiplap weatherboard			
Wall Finish:	Painted			
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete 5	Slab under Toilets	
Roof Material:	Pitched corrugated iron	1		
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	8	Double Doors:	1	
Ranchsliders:	0	Windows:	94	
Soffit Height (mm):	3800 Soffit Width (mm):			
Surrounding Features:	Stairs/Ramps Awnings	/Pergolas Services Concrete Chim	neys	
Comments:	*			
Street lamps. Fire hydran	nt			

Wall Material:	Gib Plaster Timber Pannelling Timber Frame					
Wall Finish:	Painted Wallpaper Pre-finished sheeting					
Floor Material:	Concrete Timber Nativ	Concrete/Timber Native T/G				
Floor Finish:	Carpet Lino Other					
Ceiling Material:	Fibrous Plaster[Timber	(TGV)				
Ceiling Finish:	Painted					
Av. Stud Height (mm):	3000	3000 Max. Stud Height (mm):				
Rooms of Max. Stud Height:		1				
No. Rooms:	34	No. Internal Doors:	50			
No. Bathrooms:	5	No. Plant Rooms:	1			
Pipework Lagging:	yes	yes				
Comments:						
	s. Max stud height in day	room, Native timber construction. Poli	shed concrete			


hen	•	
es Vegetation		

Table 39: LBP Identified - B16 - Petrol Station

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No Lead-Based lead p	paint samples v	vere identified o	during the survey	1.

## Table 16: Asbestos Containing Materials - B16 - Petrol Station

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B16 – Petrol Station Ground Floor	External Walls	Cladding, Gable End and Soffit	Fibre Cement Sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B16 – Petrol Station Ground Floor	External Fencing — Eastern Elevation	Wall	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B16 – Petrol Station Ground Floor	Internal Corner storage box	Lid lining	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B16 – Petrol Station Ground Floor	Internal Wall	Pump	Gasket	Very Low (4)	Remove item intact prior to demolition by a licenced asbestos removalist under Class B controls
B16 – Petrol Station Ground Floor	Internal Toilet wall	Shower lining	Fibre cement	Jery Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

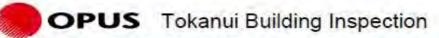

General					
Building:	Petrol Station	Year Built:	Unknown		
Footprint (m2)	385	Storeys:	1		
Surveyed by:	NE and RS	Survey Date:	10/02/2015		
General Comments:					
Still contains old pumps	and tanks to be removed by	y owners, (Shell, Mobil)			

Wall Material:	Reinforced concrete block/Cement Sheet			
Wall Finish:	Painted			
Foundation:	Reinforced concrete perimet	er footing Concrete slab		
Roof Material:	Tin Ribbed			
Roof Finish:	None	Gutters Present:	yes	
Single Doors:	3	Double Doors:	0	
Ranchsliders:	0	Windows:	28	
Soffit Height (mm):	3400 to underside of awning	Soffit Width (mm):	4500	
Surrounding Features:	Awnings/Pergolas Services F	Road		
Comments:	•			

Wall Material:	Gib Plaster[Timber Fra	me Hardboard Concrete Block	
Wall Finish:	Painted Wallpaper	727-50-71-71-50-71-10-7	
Floor Material:	Concrete		
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2500	Max. Stud Height (mm):	3500
Rooms of Max. Stud Height:		1	
No. Rooms:	4	No. Internal Doors:	8
No. Bathrooms:	1	No. Plant Rooms:	1
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			
Butterfly roof construction	formed with steel beam	on concrete block columns. Old pit in	floor - flooded.


Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Store room	4	- 5
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Table 17: Asbestos Containing Materials - B17 - Oct #1

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B17 – Oct #1 Ground Floor	Internal R1 wall	Insulation board lining	Asbestos insulation board	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B17 – Oct #1 Ground Floor	Internal R1 furnace	Furnace lining	Asbestos insulation board	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B17 – Oct #1 Ground Floor	External Wall	EDB	Fuse insulation	Very Low (4)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls

Table 40: LBP Identified - B17 - Oct #1

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B17 – Oct #1, Ground Floor	External	White	Timber	Poor	LEAD-SREED 270,000
B17 – Oct #1, Ground Floor	External	Burgund y	Timber and concrete	Poor	LEAD-BASEE) 140,000
B17 – Oct #1, Ground Floor	Internal	White	Timber	Fair	LEAD-BREEN 9,500
B17 – Oct #1, Ground Floor	Internal	Blue	Timber	Fair	LEAG-BASET
B17 – Oct #1, Ground Floor	Internal	Cream	Timber	Fair	EAD-BASED 15,000

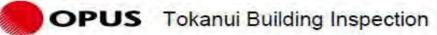

	Ger	neral	-
Building:	OCT1	Year Built:	Unknown
Footprint (m2)	265	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	10/02/2015
General Comments:			

Wall Material:	Timber frame Shiplap v	veatherboard		
Wall Finish:	Painted			
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete S	Slab under Toilets	
Roof Material:	Pitched compated iron	f	_	
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	1	Double Doors:	2	
Ranchsliders:	-1	Windows:	18	
Soffit Height (mm):	4100	Soffit Width (mm):	300	
Surrounding Features:	Stairs/Ramps Awnings	Pergolas Services Road		

Wall Material:	Hardboard				
Wall Finish:	Painted				
Floor Material:	Concrete Timber Nativ	e T/G			
Floor Finish:	Lino Other				
Ceiling Material:	Gib Plaster Timber (TG	iV)			
Ceiling Finish:	Painted				
Av. Stud Height (mm):	3500	Max. Stud Height (mm):			
Rooms of Max. Stud Height:					
No. Rooms:	12	No. Internal Doors:	12		
No. Bathrooms:	2	No. Plant Rooms:	0		
Pipework Lagging:	yes	Radiator Heating System:	yes		
Comments:					
Comments: Concrete floor in back we		radiator reading System.			


Electricity Isolated:	ves	invironmental Water Isolated:	no	
Distribution Board Loc:	4	Tratol ibolatos.	Inc	
Water Valve Loc:				
Surrounding Features:	Vegetation	Vegetation		
Comments:				

Table 18: Asbestos Containing Materials - B18 - Shed 6

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B18 – Shed 6 Ground Floor	Internal Ceiling void	HWC wiring	Cable wrap	Low (5)	Remove item intact prior to demolition by a licenced asbestos removalist under Class B controls

## Table 41: LBP Identified - B18 - Shed 6

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B18 – Shed 6, Ground Floor	Interior	Light Cream	Timber	Fair	LEAD-BASED 1,200
B18 – Shed 6, Ground Floor	Internal	White	Timber	Fair	LEAD-BASED LATE
B18 – Shed 6, Ground Floor	External	White	Timber	Poor	LEAD-BASED
B18 – Shed 6, Ground Floor	External	Beige	Timber	Poor	LEAC-BASETA

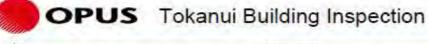

Year Built: Storeys:	Unknown
Storevs:	1
Survey Date:	10/02/2015
	Survey Date:

Wall Material:	Timber frame Shiplap weatherboard					
Wall Finish:	Painted					
Foundation:	Concrete p & Kitchens		ting with concrete piles Concrete S	Slab under Toilets		
Roof Material:	Pitched co	mugated iron				
Roof Finish:	Painted		Gutters Present:	yes		
Single Doors:		3	Double Doors:	2		
Ranchsliders:		0	Windows:	20		
Soffit Height (mm):		3100	Soffit Width (mm):	300		
Surrounding Features:	Stairs/Ram	nps Awnings	/Pergolas Services	,		
Comments:						

I	Beige	Timber	Poor					
	50.80		1,00,	\$34.7.PP		lint	ernal	
	4				Wall Material:	Hardboard		
					Wall Finish:	Painted		
					Floor Material:	Concrete Timber Native	T/G	
			•		Floor Finish:	Lino		
					Ceiling Material:	Pinex		
					Ceiling Finish:	Painted		
					Av. Stud Height (mm):		Max. Stud Height (mm):	
			· · · · · · · · · · · · · · · · · · ·	X	Rooms of Max. Stud Height:			
					No. Rooms:	8	No. Internal Doors:	14
					No. Bathrooms:	1	No. Plant Rooms:	0
					Pipework Lagging:	yes	Radiator Heating System:	yes
					Comments:	4		7
			( ( )	*		Enviro	onmental	
					Electricity Isolated:	yes		10
					Distribution Board Loc		11, 213, 13,13,13,13	
					Water Valve Loc:			
					Surrounding Features:	Trees/Vegetation		
					Comments:			
			▼					
	- 4							

Electricity Isolated:	yes	Water isolated:	no
Distribution Board Loc:	Kitchen		- 5
Water Valve Loc:			
Surrounding Features:	Trees/Vegetation		
Comments:			

Table 19: Asbestos Containing Materials - B19 - Old Morgue

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B19 – Old Morgue Ground Floor	Internal Wall	EDB	Thermoplastic	Low (5)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls

## Table 42: LBP Identified - B19 - Old Morgue

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B19 – Old Morgue, Ground Floor	External	White	Timber	Fair	(FAD-BASED) 76,000
B19 – Old Morgue, Ground Floor	Internal	White	Concrete	Fair	1EAD-BASED 2,100



General						
Building:	Old Morgue	Year Built:	Unknown			
Footprint (m2)	62	Storeys:	4			
Surveyed by:	NE and RS	Survey Date:	10/02/2015			
General Comments:						
Now used as plant room						

Wall Material:	Brick				
Wall Finish:	Painted				
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated iron		_		
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	1	Double Doors:	0		
Ranchsliders:	0	Windows:	5		
Soffit Height (mm):	2850	Soffit Width (mm):	500		
Surrounding Features:	Services Road				
Comments:					
Plant pipes feeding to wo	odwork shop and garage	9			

-1			2,100				
					lin lin	ternal	
				Wall Material:	Gib Plaster	out that	
				Wall Finish:	Painted		
				Floor Material:	Concrete		
				Floor Finish:	Other		
				Ceiling Material:	Pinex		
				Ceiling Finish:	Painted		
				Av. Stud Height (mm):		Max. Stud Height (mm):	
		16	X	Rooms of Max. Stud Height:			
				No. Rooms:	2	No. Internal Doors:	1
		X		No. Bathrooms:	0	No. Plant Rooms:	1
				Pipework Lagging:	yes	Radiator Heating System:	no
				Comments:			
			•				
	·O	(0)			=	annountal	
	<b>40</b> 00	60				onmental	
	10°	40		Electricity Isolated:	yes		10
	) (O'C	10		Distribution Board Loc	yes		10
	\O'C	(10)		Distribution Board Loc Water Valve Loc:	yes :: Back room		10
	1000	(10)		Distribution Board Loc Water Valve Loc: Surrounding Features:	yes :: Back room		10
	100	10,10		Distribution Board Loc Water Valve Loc:	yes :: Back room		10
	1000	10,10		Distribution Board Loc Water Valve Loc: Surrounding Features:	yes :: Back room		10
	000	10,10		Distribution Board Loc Water Valve Loc: Surrounding Features:	yes :: Back room		10
				Distribution Board Loc Water Valve Loc: Surrounding Features:	yes :: Back room		10
				Distribution Board Loc Water Valve Loc: Surrounding Features:	yes :: Back room		10

Environmental					
Electricity Isolated:	yes	Water Isolated:	no		
Distribution Board Loc:	Back room				
Water Valve Loc:					
Surrounding Features:	Trees Vegetation	1			
Comments:					

Table 43: LBP Identified - B34 - Shed 2 Toilet Block

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
, Ground Floor	Exterior/Interior	White	Timber	Poor	LEAD-BASED 34,000

## Table 20: Asbestos Containing Materials - B34 - Shed 2 Toilet Block

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM id	dentified during the	e survey.	

Electricity Is.
Distribution E
Water Valve LL
Surrounding Fe
Comments:
Comments:
Consideration: sep

	Gene	ral	
Building:	Shed 2 (toilet block)	Year Built:	Unknown
Footprint (m2)	17	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	3/02/2015
General Comments:			

		ternal	
Wall Material:	Reinforced concrete bl	ock	
Wall Finish:	None		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Pitched corrugated iron	í .	_
Roof Finish:	None	Gutters Present:	yes
Single Doors:	0	Double Doors:	0
Ranchsliders:	1	Windows:	2
Soffit Height (mm):	2300	Soffit Width (mm):	300
Surrounding Features:	Services Fence		
Comments:	4:		

Wall Material:	Timber FramelHardbo	pardiConcrete Block	
Wall Finish:	Painted!Other		
Floor Material:	Concrete		
Floor Finish:	Other		
Ceiling Material:	Hardboard		
Ceiling Finish:	7		
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:	2	No. Internal Doors:	
No. Bathrooms:	1	No. Plant Rooms:	0
Pipework Lagging:		Radiator Heating System:	no
Comments:	*		


	E	invironmental	1,7
Electricity Isolated:	yes	Water Isolated:	yes
Distribution Board Loc:			
Water Valve Loc:			
Surrounding Features:	Trees/Vegetation		
Comments:			
Consideration; sewage, B	uried in trees, 2 or	r 3 trees growing right next to it. No	lighting or water.

Table 21: Asbestos Containing Materials - 835 - Shed 1

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B35 – Shed 1 Ground Floor	Internal Lower wall lining	Wall lining	Fibre cement sheeting	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B35 – Shed 1 Ground Floor	Internal Ground	Fibre cement fragments	Debris	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 44: LBP Identified - B35 - Shed 1

uilding & Floor	Location	Colour	Substrate	Condition	Lead Result (ppm)
B35 – Shed 1, Ground Floor	External	Green	Metal	Poor	170.000
B35 – Shed 1, Ground Floor	External	Beige	Timber	Poor	120 006
B35 – Shed 1, Ground Floor	Internal	White	Timber	Fair	LEAD-BASED 2,200
				ist	
				dille	Sillo
				cille	War.
			·02	Cilly	
			7.OS		

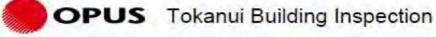

	Ger	neral	
Building:	Shed 1	Year Built:	Unknown
Footprint (m2)	50	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	3/02/2015
General Comments:			

Wall Material:	Comugated iron		
Wall Finish:	Painted		
Foundation:	Perimeter concrete ear	rth floor	
Roof Material:	Pitched corrugated iron	E	
Roof Finish:	Painted	Gutters Present:	no
Single Doors:	1	Double Doors:	0
Ranchsliders:	0	Windows:	8
Soffit Height (mm):	2500	Soffit Width (mm):	200
Surrounding Features	<b>i</b>		·
Comments:	9		

Wall Material:	Timber Frame		
Wall Finish:			
Floor Material:	Earth		
Floor Finish:	Other		
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:		No. Internal Doors:	
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	1	Radiator Heating System:	no
Comments:	*	***************************************	
Earth floor.			

Environmental				
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:				
Water Valve Loc:				
Surrounding Features:	Trees Vegetation	£		
Comments:				

### Table 22: Asbestos Containing Materials - 858 - Rec Hall

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B58 – Rec Hall Ground Floor	Internal Subfloor piping	Pipe Lagging	Insulation material	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B58 – Rec Hall Ground Floor	Internal Projector room	Wall and ceiling lining	Asbestos insulation board	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B58 – Rec Hall Lower Ground	Internal R13 subfloor on ground	Pipe Lagging and debris	Insulation material	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B58 – Rec Hall Ground Floor	Internal R5 pipes to subfloor	Pipe Lagging	Insulation material	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B58 – Rec Hall Ground Floor	External Cladding under window (infill panels)	Wall cladding	Fibre cement sheeting	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 — Rec Hall Ground Floor	External Cladding and gable ends	Wall cladding	Fibre cement sheeting	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Ground Floor	External Cladding above windows	Wall cladding	Fibre cement sheeting	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 — Rec Hall Ground Floor	Internal R5, R6 walls behind radiators	Radiator heat shielding	Fibre cement	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Ground Floor	External Wall	EDB	Fuse insulation	Low (5)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Roof	Roof Corrugated roof	Super six panels	Fibre cement	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Ground Floor	External Flat roof section	Roof membrane	Butyl roof	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Ground Floor	Internal R3, R4 showers	Wall lining	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced aspestos removalist under Class B controls
B58 – Rec Hall Ground Floor	Internal R10, R20 by door	EDB	Composite material	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Ground Floor	Internal R17 wiring to light fittings	Cable wrap	Woven material	Very Low (3)	Remove item intact prior to demolition by a licenced asbestos removalist under Class B controls or under Class A if intact removal is not possible:
B58 — Rec Hall Ground Floor	Internal R26 main water heater	Flange	Gasket	Very Low (3)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls
B58 – Rec Hall Ground Floor	Internal R26 supply pipe to feeder tank	Flange	Gasket	Very Low (3)	Remove item intact prior to demolition by a licenced asbestos removalist under Class B controls

## OPUS Tokanui Building Inspection

Building:	Rec hall	Year Built:	1940
Footprint (m2)	1110	Storeys:	2 Basement
Surveyed by:	NE and RS	Survey Date:	9/02/2015
General Comments:			

outprint (m2)	1110	Storeys.	2 Dasement
Surveyed by:	NE and RS	Survey Date:	9/02/2015
General Comments:			
Large brick and concrete	courtyard (see photo 1)		
		Service Co.	_
	EXT	ernal	
Wall Material:	Brick Concrete in situ Ce	ement Sheet	
Wall Finish:	Painted Brick		
Foundation:	Concrete perimeter foot	ing with concrete piles Concrete	e Slab under Toilets
roundation.	& Kitchens Only	9777777	
Roof Material:	Pitched corrugated iron		
Roof Finish:	None	Gutters Present:	yes
Single Doors:	3	Double Doors:	9
Ranchsliders:	0	Windows:	142
Soffit Height (mm):	3700	Soffit Width (mm):	600
Surrounding Features:	Stairs/Ramps Awnings/F Tanks	Pergolas Services Road Concre	ete Chimneys Header
Comments:			
Fibre cement corrogated	roofing. Possible asbesto	os sheet cladding.	
	Inte	ernal	
Wall Material:		nelling Timber Frame Hardboar	vi -
Wall Finish:	Painted Wallpaper Pre-f		
Floor Material:	ConcretelTimber Native		
Floor Finish:	CarpetlLino	110	
Ceiling Material:	Fibrous Plaster Accoust	ic TilelHardboard	
Ceiling Finish:	Painted Pre-finished	io Their tardioard	10.0
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	4700
Rooms of Max. Stud	2000	A A A A A A A A A A A A A A A A A A A	
Height:			
No. Rooms:	23	No. Internal Doors:	35
No. Bathrooms:	6	No. Plant Rooms:	1
io. Daniiovina.		Fidit Rooms.	

	Inter	nal	
Wall Material:	Gib Plaster Timber Pannel	ling Timber Frame Hardboard	
Wall Finish:	Painted Wallpaper Pre-fini	shed sheeting	
Floor Material:	Concrete Timber Native Ti	IG .	
Floor Finish:	Carpet Lino		
Ceiling Material:	Fibrous Plaster Accoustic	Tile Hardboard	
Ceiling Finish:	Painted Pre-finished		
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	4700
Rooms of Max. Stud Height:			
No. Rooms:	23	No. Internal Doors:	35
No. Bathrooms:	6	No. Plant Rooms:	1
Dinascrate Lauraines	) in a	Dedistan Heating Contems	

fain hall is steel portal and beam const nder stage most likely whole building. oms. Basement area under stage

The state of the s		nvironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Lobby cupboard		
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			


Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B58 – Rec Hall, Ground Floor	External	Purple	Timber	Fair	LEAD-BASED 94,000
B58 – Rec Hall, Ground Floor	External	White	Timber	Fair	LEAD-BASED LL,000
858 – Rec Hall, Ground Floor	Internal throughout	White	Plaster and wood	Fair	LEAD-BASED 3,200
B58→ Rec Hall, Ground Floor	Internal	Green	Plaster	Fair	PEAC-BASES 92,000
B58 – Rec Hall, Ground Floor	Internal	White	Wood	Fair	LEAD-BASED 59,000

Table 23: Asbestos Containing Materials - 873 - Shed behind B18

	1	Score	
No.4	CM identified during t	ne survey	
	No A	No ACM identified during the	No ACM identified during the survey.

## Table 23: Asbestos Containing Materials - 873 - Shed behind 818

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM is	dentified during the	e survey.	

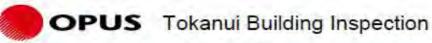

	General					
Building:	Shed 6	Year Built:	Unknown			
Footprint (m2)	320	Storeys:	1			
Surveyed by:	NE and RS	Survey Date:	10/02/2015			
General Comments:						
Woodworking workshop	•					

	E	xternal				
Wall Material:	Timber frame Shiplap	weatherboard				
Wall Finish:	Painted					
Foundation:	Concrete perimeter for & Kitchens Only	oting with concrete piles Concrete S	Slab under Toilets			
Roof Material:	Pitched corrugated iro	on .				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	3	Double Doors:	2			
Ranchsliders:	0	Windows:	20			
Soffit Height (mm):	3100	3100 Soffit Width (mm): 300				
Surrounding Features:	Stairs/Ramps Awning	s/Pergolas Services				
Comments:						

s reported in tab for B18			in.	ternal	
		Wall Material:	Hardboard	CT THE	
		Wall Finish:	Painted		
		Floor Material:	Concrete Timber Nativ	e T/G	
		Floor Finish:	Lino		
		Ceiling Material:	Pinex		
		Ceiling Finish:	Painted		
		Av. Stud Height (mm):	3000	Max. Stud Height (mm):	
	o XIO	Rooms of Max. Stud Height:			
		No. Rooms:	8	No. Internal Doors:	
		No. Bathrooms:	1	No. Plant Rooms:	
		Pipework Lagging:	yes	Radiator Heating System:	
		ļ			
		A CONTRACTOR OF THE PARTY OF TH	Envir	onmental	
_ (		Pile addition to about the	yes	Water Isolated: no	
		Electricity Isolated:			
		Distribution Board Loc		-3	
		Distribution Board Loc: Water Valve Loc:	Kitchen		
		Distribution Board Loc Water Valve Loc: Surrounding Features:	Kitchen		
		Distribution Board Loc: Water Valve Loc:	Kitchen		
		Distribution Board Loc Water Valve Loc: Surrounding Features:	Kitchen		

Environmental						
Electricity Isolated:	yes	Water Isolated:	no			
Distribution Board Loc:	Kitchen		1			
Water Valve Loc:						
Surrounding Features:	Trees Vegetation	Trees/Vegetation				
Comments:						

### Table 1: B20- Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 20- Ground Floor	External	Insulation	Lagging	mekten	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 20- Ground Floor	External	Cladding	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 20- Ground Floor	External wall	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 21: B20- Positive Lead Based Paint

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 20- Ground Floor	External	White	Wood	Poor	LEAD-BASATI 4,860
Building 20- Ground Floor	External	Pink	Wood	Poor	LECTION OF THE PARTY OF THE PAR
Building 20- Ground Floor	Internal	White	Plasterboard	Fair	HARAS-BAND BOAS
Building 20- Ground Floor	Internal	White	Wood	Fair	LUAD-RASETI LUIDI
Building 20- Ground Floor	Internal	Cream	Plasterboard and Wall paper	Fair	LEAD-BASED 6 300

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 21- Ground Floor	Ward 6 Floor	Discarded lagging and debris	Lagging and debris	1100 (10)	Remove prior to demolitior by a licenced asbestos removalist under Class A controls
Building 21- Ground Floor	Scullery laundry kitchen Floor	Discarded lagging and debris	Lagging and debris	11g(n (XII)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 21- Ground Floor	Kitchen Wall	Chimney	Insulation	High (11)	Remove prior to demolitior by a licenced asbestos removalist under Class A controls
Building 21- Ground Floor	Boiler Room Floor	Discarded lagging and debris	Lagging and debris	High (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 21- Ground Floor	Ceiling void	Insulation	Lagging	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 21- Ground Floor	Scullery, Laundry, and Bathrooms	Ceiling lining	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Locker Room	Ceiling lining	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Wall void	Ceiling lining	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B' controls
Building 21- Ground Floor	Boiler Room	Ceiling lining	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Porch	Ceiling lining	Cement sheet	Low (5)	Remové prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Boiler room	Pipework	Gaskets	Very law (*)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Porch	Ceiling Lining (Above Door by Ramp)	Cement sheet	Very low (4)	Remove prior to demolitio by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Porch	Ceiling Lining (Above Door by Visitors' Entrance)	Cement sheet	Very law (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Porch	Ceiling Lining (Above Door by Kitchen)	Cement sheet	Very law (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Porch	Ceiling Lining (Above Door)	Cement sheet	Very low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	External	Cladding	Cement sheet	Very low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Toilets	Wall Lining	Cement sheet	Very law (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 21- Ground Floor	Kitchen	Dishwasher	Gasket	Very low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## OPUS Tokanui Building Inspection

Building:	Ward 6	Year Built:	1930	
Footprint (m2)	1310	Storeys:	1	
Surveyed by:	NE and DV	Survey Date:	4/02/201	
General Comments:				

		ternal				
Wall Material:	Timber frame Bevel back weatherboard Hardiplank weatherboard					
Wall Finish:	Painted					
Foundation:	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only					
Roof Material:	Pitched corrugated iron	1				
Roof Finish:		Gutters Present:	yes			
Single Doors:	17	Double Doors:	5			
Ranchsliders:	0	Windows:	123			
Soffit Height (mm):	3200	Soffit Width (mm):	500			
Surrounding Features:	Stairs/Ramps Concrete	Chimneys Header Tanks				
Comments:	+					

	ln.	ternal				
Wall Material:	Gib Plaster Timber Par	nnelling Timber Frame Pinex Hardboar	d			
Wall Finish:	Painted					
Floor Material:	Other					
Floor Finish:	Carpet Lino					
Ceiling Material:	Timber (TGV) Fibrous Plaster					
Ceiling Finish:	Painted					
Av. Stud Height (mm);	2700	Max. Stud Height (mm):	380			
Rooms of Max. Stud Height:		1				
No. Rooms:	24	No. Internal Doors:	35			
No. Bathrooms:	15	No. Plant Rooms:	2			
Pipework Lagging:	no	Radiator Heating System:	yes			
Comments:			7/2			

Environmental					
Electricity Isolated:	yes	W	ater isolated:	no	
Distribution Board Loc:	Kitchen				
Water Valve Loc:					
Surrounding Features:	Trees Vegetation				
Comments:					

### Table 4: B23- Summary of ACM Identi

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 23- Ground Floor	Ward 4 Floor	Discarded lagging and debris	Lagging	High.(20)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 23- Ground Floor	Sub floor and ceiling Pipework	Insulation	agging	11(1) (1)(1)	Remove prior to demolition by a licenced asbestos removalist under Class A controls

## able 22: 821- Summary of LBP

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 21- Ward 6, Ground Floor	External	White	Timber	Poor	1840-94450 59.000
Building 21- Ward 6, Ground Floor	External	White	Timber	Poor	LEAD-BASED 88,007
Building 21- Ward 6, Ground Floor	External	White	Timber	Fair	LEAD-BASED 82,007
Building 21- Ward 6, Ground Floor	External	Grey	Concrete	Fair	(EAD-HASED 5,000
Building 21- Ward 6, Roof	External	Red	Corrugated Iron	Poor	(EMD-BASED) £800
Building 21- Ward 6, Ground Floor	External	Yellow	Timber cladding	Poor	(EAL-BASED) 87.000
Building 21- Ward 6, Ground Floor	Internal	White	Timber	Intact	(EAL-BASE) 1,800
Building 21- Ward 6, Ground Floor	Internal	White	Plasterboard	Fair	(EAD BASED) 2,900
Building 21- Ward 6, Ground Floor	Internal	Green	Fibreboard	Fair	(LEAD BASED) 1,100
Building 21- Ward 6, Roof	Internal	Blue	Brick and fibreboard	Fair	LEAE-BARTO 1,700

## Table 23: B22- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No lead-based pair	nt samples wer	e identified dur	ing the survey.	

### Table 24: B23- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 23- Ground Floor	External	White	Timber	Fair	LEAD PASED 82.000
Building 23- Ground Floor	External	Yellow	Timber	Fair	LEAD-BASED 85,000
Building 23- Ground Floor	External	Cream	Timber	Poor	LEAD BASED 3,600
Building 23- Ground Floor	External	Grey	Concrete	Fair	LEAD-MASED 6,000
Building 23- Ground Floor	Internal	Cream	Timber	Poor	LEAD BASED 2,800

able 4: B23	- Summary of ACM	1 Identified				Comments:
Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action	Concrete chimney. Header tank on roof. Timber window frames.
Building 23- Ground Floor	Ward 4 Floor	Discarded lagging and debris	Lagging	H3(h)10]	Remove prior to demolition by a licenced asbestos removalist under Class A controls	Wall Material: Gib Plaster[Timber Frame]Pinex Hardboard Serd Wall Finish: Painted Wallpaper Floor Material: Concrete[Timber Native T/G Floor Finish: Paint Lino Ceiling Material: Fibrous Plaster Accoustic Tile Concrete Wood
Building 23- Ground Floor	Sub floor and ceiling Pipework	Insulation	Lagging	Hen (11)	Remove prior to demolition by a licenced asbestos removalist under Class A controls	Ceiling Finish:   Painted
Building 23- Ground Floor	Floor	Discarded lagging and debris	Lagging	1000 (101	Remove prior to demolition by a licenced asbestos removalist under Class A controls	Pipework Lagging: yes Radiator Heating Comments: Internal walls are a mixture of timber frame, congrete fire walls, gib plaster, Hardflex, MDF, ceiling tile, and seratone. The ceiling has been reframed a Floors are mostly native timber t/g, but concrete in bathrooms. Has Interna Pipework lagging in plant room. Radiator reating system present
Building 23- Ground Floor	Floor	Debris	Insulating board	High (1))	Remove prior to demolition by a licenced asbestos removalist under Class A controls	Electricity Isolated: Jes Water Isolated: Distribution Board Loc: Kitchen Water Valve Loc: Surrounding Features: Trees/Vegetation
Building 23- Ground Floor	Hallway Floor	Discarded lagging and debris	Lagging	High (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls	Comments:
Building 23- Ground Floor	Dispensary Floor	Discarded lagging and debris	Lagging	(0p=100)	Remove prior to demolition by a licenced asbestos removalist under Class A controls	25
Building 23- Ground Floor	Boiler room Pipework	Flanges	Gaskets	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	No Mi
Building 23- Ground Floor	Ward 4 Scullery, laundry and bathrooms	Ceiling lining	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	70
Building 23- Ground Floor	Back porch Ceiling	Lining	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	
Building 23- Ground Floor	Ward 4 Boiler room	Ceiling lining	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	<b>3</b>
Building 23- Ground Floor	Porch Ceiling	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under class B controls	<b>,</b>
Building 23- Ground Floor	Back porch Ceiling	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	
Building 23- Ground Floor	Back porch Ceiling	Lining	Cement sheet	Very Law (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	
Building 23- Ground Floor	Side porch Ceiling	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	
Building 23- Ground Floor	Toilets Walls	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls	

Building:	Ward 4	Year Built:	1928
Footprint (m2)	995	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	3/02/2015

	Ex	ternal			
Wall Material:	Timber frame Bevel back weatherboard				
Wall Finish:	Painted				
Foundation:	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only				
Roof Material:	Pitched corrugated iron	1			
Roof Finish:	Painted	Gutters Present:	no		
Single Doors:	15	Double Doors:	3		
Ranchsliders:	0	Windows:	129		
Soffit Height (mm):	3200	Soffit Width (mm):	500		
Surrounding Features:	Header Tanks Concret	e Chimneys Services Road Fence			
Comments:					

	In.	ternal			
Wall Material:	Gib Plaster Timber Fra	me Pinex Hardboard Seratone Concre	te insitu		
Wall Finish:	Painted Wallpaper				
Floor Material;	Concrete Timber Native T/G				
Floor Finish:	PaintlLino				
Ceiling Material:	Fibrous Plaster Accoustic Tile Concrete Wood				
Ceiling Finish:	Painted				
Av. Stud Height (mm):	2750	Max. Stud Height (mm):			
Rooms of Max. Stud Height:					
No. Rooms:	25	No. Internal Doors:	32		
No. Bathrooms:	5	No. Plant Rooms:	1		
Pipework Lagging:	yes	Radiator Heating System:	yes		
Comments:					


	-	norte (	- 7	
yes		Water Isolated:		no
Kitchen			7	
				7
	yes	yes	yes Water Isolated:	yes Water Isolated:

Table 5: B24- Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 24- Ground Floor	Boiler Wall	Boiler room	Gasket	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 24- Ground Floor	External Electrical box	Electrical components	Fuses	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 25: B24- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 24- Ground Floor	External	White	Timber	Fair	LEAD-BASED 200,000
Building 24- Ground Floor	External	Cream	Timber	Poor	1EAD-BASED 29.000
Building 24- Ground Floor	External	Grey	Timber	Fair	LEAD-BASED 180,000
Building 24- Ground Floor	External	White	Steel	Poor	LEAD-BASED
Building 24- Ground Floor	External	White	Timber	Fair	LEAD-BASED 220,000
Building 24-	External	Grey	Steel	Poor	LEND-HASED

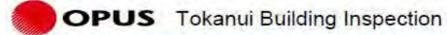

Year Built:	1922
O.C.	
Storeys:	1
Survey Date:	3/02/2015
	Survey Date:

Painted				
r Toilets				
10				
2				
50				
00				
5				

Wall Material:	Gib PlasterlHardboard	ternal	
Wall Finish:	Wallpaper		
Floor Material:	Concrete/Timber Nativ	e T/G	
Floor Finish:	Carpet Lino	- 110	
Ceiling Material:	Pinex/ fibrous plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2750	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	12	No. Internal Doors:	14
No. Bathrooms:	2	No. Plant Rooms:	- 1
Pipework Lagging:	yes	Radiator Heating System:	yes
Comments:			


Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:		4	
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Table 26: B25 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 25- Ground Floor	Internal	White	Timber	Poor	LEAG-BAKET
Building 25- Ground Floor	Internal	Cream	Concrete	Poor	LEAD-BASED (2.DUE)
Building 25- Ground Floor	External	Red	Steel	Poor	LEAC-BASED
Building 25- Ground Floor	External	White	Timber	Fair	LEAD-BASED 94.400

Table 6: 825- Summary of ACM Identified

& Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 25- Ground Floor	Morgue Ceiling	Electrical components	Rope	Medium (8)	Remove prior to demolitie by a licenced asbestos removalist under Class B controls
Building 25- Ground Floor	External Wall	Cladding	Render	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 25- Ground Floor	Store area Wall	Electrical items	EDB	Very Low (4)	Remove prior to demolitio by a licenced asbestos removalist under Class B controls

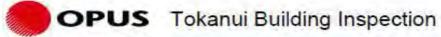

Building:	Morque (new)	Year Built:	Unknown
		Contract of the state of the st	Olikilowii
Footprint (m2)	50	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	3/02/2015
General Comments:			7.

Wall Material:	Reinforced concrete block Solid plaster					
Wall Finish:	Painted Solid Plaster					
Foundation:	Reinforced concrete p	erimeter footing Concrete slab				
Roof Material:	Tin Ribbed					
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	1	Double Doors:	0			
Ranchstiders:	0	Windows:	4			
Soffit Height (mm):	3800	Soffit Width (mm):	50			
Surrounding Features:	Road					
Comments:						

Wall Material:	Concrete		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	Lino		
Ceiling Material:	Hardboard		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	2	No. Internal Doors:	- 1
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:		Radiator Heating System:	no
Comments:	*		

Environmental Environmental					
Electricity Isolated:	yes	Water Isolated:			
Distribution Board Loc:	Left of entry	100000000000000000000000000000000000000			
Water Valve Loc:					
Surrounding Features:	Vegetation				
Comments:					

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 26- Ground floor	External	Cladding	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	External	Soffit	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	Corridor ceiling void	Cable wrap	Textile	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	Boiler room	Ceiling	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	Store room	Ceiling	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	Hallway	Electrical box	Fuse	Very low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	External	Electrical box	Fuse	Very low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 26- Ground floor	Hallway near entrance	Electrical box	Fuse	Very low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

### Table 27: B26-Summary of LBP Identified

ble 27: B26- Summary	of LBP Identified				1
Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 26- Ground Floor	Internal	Yellow	Fibre board	Poor	(AAD-MARED 1,200
Building 26- Ground Floor	External	Orange	Timber	Fair	15A144A180 220,000
Building 26- Ground Floor	External	Brown	Timber	Poor	(EAD-8ALED 150,000
Building 26- Ground Floor	Internal	Blue	Concrete	Fair	CEAD-BASE)
Building 26- Ground Floor	Internal	Yellow	Concrete	Fair	ENTO
Building 26- Ground Floor	Internal	Pink	Concrete	Poor	1,40E
Building 26- Ground Floor	Internal	White	Fibre board	Poor	LEAD-HASED 1,600
Building 26- Ground Floor	Internal	Grey	Timber	Fair	(EAE-BASE) 196,000
Building 26- Ground Floor	Internal	Yellow	Fibre board	Poor	LEAD-RASED
Building 26- Ground Floor	Internal	Pink	Fibre board	Poor	CHRAR-TAS)
Building 26- Lower Ground	External	Orange	Timber	Fair	(EAD-BASE) 12((000
Building 26- Lower Ground	External	White	Timber	Poor	14(,000
Building 26- Lower Ground	External	White	Metal	Poor	(EAD-BASE) F1.000

## OPUS Tokanui Building Inspection

General					
Building:	Ward 21	Year Built:	1960		
Footprint (m2)	892	Storeys:	2		
Surveyed by:	NE and RS	Survey Date:	3/02/2015		

	Extern	al.				
Wall Material:	Concrete in situl Cement sheet[Timber frame[Timber sheet					
Wall Finish:	Painted Solid Plaster					
Foundation:	Concrete perimeter footing & Kitchens Only	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only				
Roof Material:	Pitched corrugated iron	Pitched corrugated iron				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	3	Double Doors:	4			
Ranchsliders:	0	Windows:	153			
Soffit Height (mm):	3500/ 6000 at two storey	Soffit Width (mm):	600			
Surrounding Features:	Stairs/Ramps Road Fence C	Other	•			

	in	ternal	
Wall Material:	Gib Plaster Timber Par	nnelling	
Wall Finish:	Painted Wallpaper		
Floor Material:	Concrete Timber Nativ	e T/G	_
Floor Finish:	Carpet Lino Tiles		
Ceiling Material:	Gib Plaster Timber Sta	ined pine T/G	
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
Rooms of Max. Stud Height:		0.0	
No. Rooms:	45	No. Internal Doors:	.50
No. Bathrooms:	4	No. Plant Rooms:	1
Pipework Lagging:	yes	Radiator Heating System:	yes

	En	vironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Kitchen		
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:	-		

General						
Building:	Ward 21A	Year Built:	1975			
Footprint (m2)	265	Storeys:	2 Basement			
Surveyed by:	NE and RS	Survey Date:	3/02/2015			
General Comments:						
Much the same as the ac	ljoining Ward 21					

Wall Material:	Concrete in situl Cement sh	eet Timber frame Timber she	et
Wall Finish:	Painted/Solid Plaster		
Foundation:	Concrete perimeter footing & Kitchens Only	with concrete piles Concrete	Slab under Toilet
Roof Material:	Pitched corrugated iron		
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	1	Double Doors:	0
Ranchsliders:	1	Windows:	25
Soffit Height (mm):	3500/ 6000 at two storey	Soffit Width (mm):	600
Surrounding Features:	Stairs/Ramps Road Fence 0	Other	
Comments:			
Comments:	unding features include flood	ed basement, remnants of clo	othes lines, and

Wall Material:	Gib Plaster Timber Par	nnelling	
Wall Finish:	Painted]Wallpaper		
Floor Material:	Concrete Timber Nativ	e T/G	
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster Timber Sta	ined pine T/G	
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	19	No. Internal Doors:	25
No. Bathrooms:	2	No. Plant Rooms:	.0
Pipework Lagging:	yes	Radiator Heating System:	yes
Comments:			-
manufacture of the state of the	flooded. Radiator heatin	a evetem present	

Environmental				
lectricity Isolated:	yes	Water Isolated:		
Distribution Board Loc:	Kitchen		= :	
Water Valve Loc:				
Surrounding Features:	Trees Vegetation	n.		
Comments:				
Basement is completely fl	ooded			

Table 28: B27- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 27- Ground Floor	External	White	Timber	Poor	(680-8ASED 200,000
Building 27- Ground Floor	External	White	Timber	Poor	(EAD-BASED 19,000
Building 27- Ground Floor	External	Green	Concrete	Fair	LEAD-BASED
Building 27- Ground Floor	External	Blue	Concrete	Fair	LEAD-BASED
Building 27- Ground Floor	External	Green	Concrete	Poor	LEAD-8ASED LEAD
Building 27- Ground Floor	Internal	White	Timber	Fair	LEAD-BASED

Table 8: B27- Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 27- Ground Floor	Internal Ceiling space	Insulation material	Lagging	High (10).	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Internal Hallway	Insulation material	Lagging	(mg(c)x0)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Internal Floor	Insulation material	Lagging	High (Lo)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Int IM room Floor	Insulation material	Lagging	Hgh(10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Staff tea room Floor	Insulation material	Lagging	Hym (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Kitchen Floor	Insulation material	Lagging	Hatr (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Kitchen Floor	Insulation material	Lagging	1441-(140)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	External boiler room Floor	Debris	Debris	Hgt 1(0)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 27- Ground Floor	Exterior porch Ceiling	Lining	Cement sheet	Very Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 27- Ground Floor	External Entrance	Ceiling	Cement sheet	Very Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

J:\33 series\33205 Tokanui infrastructure\Demo Mgmt Plan\Info Summary for Demo Plan March 2024\33205 Building Summary 240403\_EB v2

# OPUS Tokanui Building Inspection

B27

Building:	Ward 5	Year Built:	Various
Footprint (m2)	1250	Storeys:	1
Surveyed by:	NE and DV	Survey Date:	4/02/2015
General Comments:			

Wall Material:	Timber frame Bevel ba	ck weatherboard	
Wall Finish:	Painted Other		
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete	Slab under Toilet
Roof Material:	Pitched corrugated iron		
Roof Finish:	Painted	Gutters Present:	no 💧
Single Doors:	11	Double Doors:	4
Ranchsliders:	0	Windows:	130
Soffit Height (mm):	3200	Soffit Width (mm):	500
Surrounding Features:	Awnings/Pergolas Hear	der Tanks Concrete Chimneys	
Comments:			

Wall Material:	Plaster Timber Pannel	ling Timber Frame Pinex Seratone	
Wall Finish:	Painted Wallpaper		
Floor Material:	Concrete Timber TGV	Timber Particle Board	
Floor Finish:	Carpet Lino	A	
Ceiling Material:	Gib Plaster Fibrous Pla	aster Accoustic Tile Timber (TGV) Pine	X
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	62	No. Internal Doors:	75
No. Bathrooms:	10	No. Plant Rooms:	2
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			1.500

Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Kitchen	1	
Water Valve Loc:			
Surrounding Features:	Vegetation		



Table 9: B28-Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 28- Ground Floor	Room 1 and 2	Heater	Cable wrap	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 28- Ground Floor	External	Canopy	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 28- Ground Floor	External	Downpipe	Cement pipe	Very Law (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 28- Ground Floor	Roof void	Chimney	Cement sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 29: B28- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 28- Ground Floor	External and internal	White	Timber	Poor	IAD-6ASED
Building 28- Ground Floor	External	Yellow	Timber	Roor	LEAT-BASED (5/2/m)
Building 28- Ground Floor	External	White	Timber	Poor	ISAS BASED ISASON
Building 28- Ground Floor	Internal	White	Timber	Fair	15AE-BASED 17,000
Building 28- Ground Floor	Internal	Cream	Fibreboard	Fair	LEAR-BASED 42,000
Building 28- Ground Floor	Internal	Yellow	Fibreboard	Fair	LEAR-BASED 73.000
Building 28- Ground Floor	Internal	Brown	Timber	Fair	LEAR-BASED 9.800

	Ger	neral	
Building:	OCT2	Year Built:	Unknown
Footprint (m2)	210	Storeys:	1
Surveyed by:	NE and DV	Survey Date:	4/02/2015
General Comments:			

Wall Material:	Reinforced in situ co	ncrete Solid plaster Timber frame			
Wall Finish:	Solid Plaster/Texture Coat				
Foundation:	Concrete perimeter f & Kitchens Only	ooting with concrete piles Concrete	Slab under Toilets		
Roof Material:	Tin Tile				
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:		Double Doors:	1		
Ranchsliders:	DU	Windows:	25		
Soffit Height (mm):	3600	Soffit Width (mm):	400		
Surrounding Features:	Stairs/Ramps				
Comments:	A Comment				

Wall Material:	Gib Plaster Timber Pa	nnelling Timber Frame Pinex	
Wall Finish:	Painted Wallpaper		
Floor Material:	Timber Particle Board		
Floor Finish:	Lino		
Ceiling Material:	Pinex		
Ceiling Finish:	Painted		
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	.5	No. Internal Doors:	
No. Bathrooms:	2	No. Plant Rooms:	.0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			- 100

Environmental					
Electricity Isolated:	yes	Water Isolated:	no		
Distribution Board Loc:	-7.5				
Water Valve Loc:					
Surrounding Features:	Trees Vegetation				
Comments:					

### Table 10: 829- Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 29- Ground Floor	Floor void	Pipes	Insulation	ealphyrol	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 22 Wall	Panel	Insulation board	Medium (7)	Remove prior to demolitior by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	External porch room 42 43 Ceiling	Lining	Cement lining	Low (5)	Remove prior to demolitior by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	External Roof	Roof	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	External Canopy	Ceiling panel	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 55 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 54 toilet Wall	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 54 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 56 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 56 Wall	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 45 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolitior by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 45 Wall	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 33 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 33 Wall	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 34 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 34 Wall	Lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 32 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 29- Ground Floor	Room 32 Wall	Lining	Cement sheet	Very Low (4)	Remové prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Room 15 Wall	Lining	Cement sheet	Very Law (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 29- Ground Floor	Bathroom room 3 Floor	Flooring	Terrazzo	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class A controls

## OPUS Tokanui Building Inspection

Building:	Ward 7	Year Built:	Unknown
Footprint (m2)	1235	Storeys:	1
Surveyed by:	NE and DV	Survey Date:	4/02/2015
General Comments:	*		

Wall Material:	Timber framalRoyal ho	ak waathadaard		
	Timber frame Bevel back weatherboard			
Wall Finish:	Painted			
Foundation:	& Kitchens Only	ting with concrete piles Concrete	Slab under Toilet	
Roof Material:	Pitched corrugated iron			
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	13	Double Doors:	1	
Ranchsliders:	0	Windows:	99	
Soffit Height (mm):	3400	Soffit Width (mm):	400	
Surrounding Features:	Concrete Chimneys			
Comments:				

	Iñ	ternal		
Wall Material:	Gib Plaster Timber Par	nelling Timber Frame Pinex Hardboar	d	
Wall Finish:	Painted(Wallpaper(Tile	Pre-finished sheeting		
Floor Material:	Concrete Timber Nativ	e T/G		
Floor Finish:	Carpet Lino			
Ceiling Material:	Gib Plaster/Fibrous Plaster			
Ceiling Finish:	Painted			
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	3200	
Rooms of Max. Stud Height:		2		
No. Rooms:	40	No. Internal Doors:	80	
No. Bathrooms:	8	No. Plant Rooms:	2	
Pipework Lagging:	yes Radiator Heating System: yes			
Comments:				

	En	vironmental			
Electricity Isolated:	yes	Water Isola	ited;	no	
Distribution Board Loc:	By kitchen				
Water Valve Loc:					
Surrounding Features:					
Comments:			_		

### Table 30: B29- Summary of LBP Identi

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 29- Ground Floor	External	Cream	Timber	Poor	LEAD-BASED 51,000
Building 29- Ground Floor	External	Cream	Timber	Poor	(EAD-BASED 53,000
Building 29- Ground Floor	External	Grey	Concrete	Poor	LEAD-BASED 2,000
Building 29- Ground Floor	External	Cream	Timber	Poor	LEAD-RASED 28,000
Building 29- Ground Floor	External	Cream	Timber	Poor	LÉAD/BASED 47,000
Building 29- Ground Floor	External	Cream	Timber	Poor	(EAD:BASED) -#3.000
Building 29- Ground Floor	External	Cream	Timber	Poor	LEAD-BASED 26,000
Building 29- Ground Floor	Internal	Grey	Timber	Fair	LEAD-BASED 4.700
Building 29- Ground Floor	Internal	Cream	Plasterboar d	Poor	LEAD-BASED 2,900
Building 29- Ground Floor	Internal	White	Plaster	Fair	LEAD-BASED 1,300
Building 29- Ground Floor	Internal	Cream,	Timber	Fair	LEAD-BASED 52,000
Building 29- Ground Floor	Room 41	Grey	Timber	Fair	LÉAD-BAGED 2,000
Building 29- Ground Floor	Internal	Cream/ grey	Plasterboar d	Poor	LEAD-BASED 4,600
Building 29- Ground Floor	Internal	Grey	MDF	Poor	LEAT-RASEL) 5,500
Building 29- Ground Floor	Internal	Cream	MDF	Intact	LEAC-BASED
Building 29- Ground Floor	Internal	Cream	MDF	Intact	LEAT-BASED 6,700
Building 29- Ground Floor	External	Red	Metal	Fair	LEAD-HASEN 9,000

### Table 11: B30- Summary of ACM Identified

& Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Building 30- Ground Floor	Internal subfloor Pipework	Insulation material	Lagging	H-RI) (TO)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	Room 18 Wall	Pipe	Insulation	2000 (200)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	Room 4 Wall	Boiler	Insulation	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	Room 3 toilets Pipes	Ceiling	Pipe wrap	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	Room 4 Wall	Boiler	Insulation	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	Internal Boiler room Wall	Pipework	Lagging	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	Internal Ceiling space and sub floor Insulation material	Pipework	Lagging	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Building 30- Ground Floor	External Wall	Soffit	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	External Wall	Boxing	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 34 Wall	Panels behind heaters	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 24 Wall	Panels behind heaters	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 26 Wall	Panels behind heaters	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 27 Wall	Panels behind heaters	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 31 Wall	Panels behind heaters	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 31 Wall	Wall panel	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 28 Wall	Wall panel	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 15 Wall	Wall panel	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 29 Wall	Wall panel	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 13 Wall	Wall panel	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	External Wall	Gable end	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 35 Wall	Electrical box	Fuse	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 42 boiler room Wall	Pipework	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	Room 42 Wall	Electrical box	Fuse	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Building 30- Ground Floor	External Wall	Electrical box	Fuses	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## OPUS Tokanui Building Inspection

	Ger	neral	
Building:	Ward 8	Year Built:	1960
Footprint (m2)	1415	Storeys:	1
Surveyed by:	NE and DV	Survey Date:	4/02/2015
General Comments:			

Wall Material:	Brick Concrete in situ Cement sheet				
Wall Finish:	Painted Brick Solid Plaster				
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete	Slab under Toilets		
Roof Material:	Pitched corrugated iron	Tin Ribbed			
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	10	Double Doors:	2		
Ranchsliders:	1	Windows:	110		
Soffit Height (mm):	3800	Soffit Width (mm):	400		
Surrounding Features:	Stairs/Ramps				
Comments:					
/arious concrete courtyar	ds and steel handrails a	round the building			

ln:	ternal		
Gib Plaster/Timber Pannelling/Timber Frame/Brick			
inted Wallpaper Tile	Pre-finished sheeting		
oncrete Timber Native	e T/G		
Carpet Lino Tiles			
Gib Plaster/Fibrous Plaster/Pinex			
inted			
2600	Max. Stud Height (mm):	3200	
	2		
30	No. Internal Doors:		
9	No. Plant Rooms:	3	
yes	Radiator Heating System:	yes	
	b Plaster Timber Par inted Wallpaper Tile norcrete Timber Nativ rpet Lino Tiles b Plaster Fibrous Pis inted 2600 30 9	b Plaster[Timber Pannelling Timber Frame Brick inted/Wallpaper Tile Pre-finished sheeting increte Timber Native T/G protect Timber Native T/G protec	

	Enviro	nmental		
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Kitchen and entry hall			
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			
Comments:				
- Contraction of the Contraction				
				_

## Table 31: B30- Summary of LBP Identifie

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 30- Ground Floor	External	White	Timber	Fair	1EAD-945ED 9,400
Building 30- Ground Floor	External	White	Timber	Poor	(EAD-BASED 41,000
Building 30- Ground Floor	External	White	Timber	Poor	LEAD-BASED SALGOD
Building 30- Ground Floor	External	White	Timber	Poor	LEAD-BASELY L9,000
Building 30- Ground Floor	External	White	Metal	Poor	LEAD-MASED 31,000
Building 30- Ground Floor	Internal	Cream	Cement	Poor	1EAD-BA5E0 -4.200
Building 30- Ground Floor	Internal	Grey	Cement	Poor	LEAD-BASED 1.300
Building 30- Ground Floor	Internal	White	Plasterboar d	Poor	LEAD-BASED 2,5(4)
Building 30- Ground Floor	Internal	Pale pink	Timber, plasterboar d	Poor	LEAD-RASTER 1,600
Building 30- Ground Floor	Internal	Light blue	Plasterboar d	Fair	LEAD-BASED 1,900
Building 30- Ground Floor	Internal	Red	Metal	Fair	LEAD-BASED 16,000
Building 30- Ground Floor	Internal	Purple	Timber	Intact	LEAD-BASEEX 1,200
Building 30- Ground Floor	Internal	Green	Timber, metal pipes	Fair	LEAD-BASED 2,700
Building 30- Ground Floor	Internal	White	Metal	Fair	(EAD-BASED) V,500
Building 30- Ground Floor	External	Grey	Timber	Poor	LLAD-BASED

## Table 32: B31- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No lead-based pair	nt samples wer	e identified dur	ring the survey.	

## Table 12: B31: Summary of ACM Identified

	Ne	o lead-based paint sa	amples were ident	ified during the su	rvey.				•
le 12: B31:	: Summary of AC	CM Identified				_			6
ilding Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action			10%	M
		No ACM was identi	fied or presumed	during the survey.			.es	<b>A</b> (2)	S)
							9	1	
							0.1		
					, 20	7	70		
				X					
				J.C.					
					0,				
				7/11,	·				
				0					
				•					

No OPUS Survey Sheet

Table 131 S1: Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM was identi	ified or presumed (	during the survey.	

## Table 33: S1- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Substation 1- Ground Floor	External and internal	Cream	Timber	Poor	HAD-SASED L3.000

Electricity Iso
Distribution B,
Water Valve Lo
Surrounding Fe.
Comments:
Couldn't access so

General					
Building:	Sub 1	Year Built:	Unknown		
Footprint (m2)	27	Storeys:	1		
Surveyed by:	NE and RS	Survey Date:	3/02/2015		
General Comments:					
Couldn't access. Main po	wer comes in - power line	stops here then cable to gre	ound.		

	В	ternal		
Wall Material:	Reinforced concrete bl	Reinforced concrete block		
Wall Finish:	Painted			
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab		
Roof Material:	Pitched corrugated iron	1		
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	1	Double Doors:	1	
Ranchsliders:	0	Windows:	0	
Soffit Height (mm):	3100	Soffit Width (mm):	200	
	Powerlines Fence Othe	er	•	
Comments:				

Wall Material:			
Wall Finish:			
Floor Material:			
Floor Finish:			
Ceiling Material:			
Ceiling Finish:		Victoria de la compansión de la compansi	
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:		No. Internal Doors:	
No. Bathrooms:	0	No. Plant Rooms:	
Pipework Lagging:		Radiator Heating System:	no
Comments:		* * * * * * * * * * * * * * * * * * * *	

	E	nvironmental	
Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:			
Water Valve Loc:			
Surrounding Features:	Trees Vegetation	_	
Comments:			
Couldn't access so can't o	comment on much		

Table 34: S2- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Substation 2- Ground Floor	External	Cream	Timber	Poor	LEAGHRAGELI 94,000
Substation 2- Ground Floor	External	White	Timber	Poor	LEAG-BASELI 32,000
Substation 2- Roof	External	Red	Metal	Fair	LEAG-GASED 88,000

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Substation 2- Ground Floor	Switch room	Panel	Insulating board	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
Substation 2- Ground Floor	External	Wall	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Internal	Wall	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Internal	Wall	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Internal	Wall	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Internal	Wall	Cement sheet	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Internal	Wall	Cement sheet	Low (6)	Remove prior to demolition by a licenced aspestos removalist under Class B controls
Substation 2- Ground Floor	Boiler room	Wall	Gaskets	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	External	Wall	Cement sheet	Very Low (8)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Switch room	Wall	Fuses	Very Low (1)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Boiler room	Wall	Fuses	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
Substation 2- Ground Floor	Boiler room	Wall	Fuses	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## OPUS Tokanui Building Inspection

General					
Building:	Sub 2	Year Built:	Unknown		
Footprint (m2)	104	Storeys:	1		
Surveyed by:	NE and RS	Survey Date:	2/02/2015		
General Comments:					

	Ex	ternal		
Wall Material:	Reinforced in situ concrete  Galvanised steel			
Wall Finish:	Painted			
Foundation:	Reinforced concrete perimeter footing Concrete slab			
Roof Material:	Tin Ribbed			
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	1	Double Doors:	3	
Ranchsliders:	0	Windows:	50	
Soffit Height (mm):	2500	Soffit Width (mm):	200	
Surrounding Features:	Road Powerlines Other			

Vent pipe. Centre box gutter. Foundations ~300mm deep. Timber window frames. Windows are half louvers with mesh and half reinforced glass. Timber doors. Padlocked (clidn't have key)/otherwise nailed or screwed shut. Each door goes to a separate room. Overhead lines (power pole next to it & overhead cables running to Admin building).

Wall Material:	Reinforced concrete block		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	None		
Ceiling Material:	Other		
Ceiling Finish:	Painted		
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	4	No. Internal Doors:	
No. Bathrooms:	0	No. Plant Rooms:	4
Pipework Lagging:		Radiator Heating System:	no
Comments:			


Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc			-
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

## Table 15: 53- Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		lo ACM were ident			

## Table 35: S3: Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)	Foundation:  Roof Material:  Roof Finish:  Single Doors:
Substation 3- Ground Floor	External	Cream	Timber	Poor	HAD-BASES SLOCO	Ranchsliders: Soffit Height (mm Surrounding Feat
Substation 3- Ground Floor	External	Cream	Timber	Poor	23:000	Comments: High voltage wires
						Wall Material: Wall Finish: Floor Material: Floor Finish: Ceiling Material: Ceiling Finish: Av. Stud Height (n Rooms of Max. St Height: No. Rooms: No. Bathrooms: Pipework Lagging Comments:

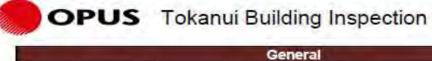

Ger	neral	
Sub 3	Year Built:	Unknown
35	Storeys:	1
NE and DV	Survey Date:	4/02/2015
֡	Sub 3 35	35 Storeys:

Wall Material:	Reinforced concrete bl	ock		
Wall Finish:	Painted			
Foundation:	Reinforced concrete perimeter footing[Concrete slab			
Roof Material:	Pitched corrugated iron			
Roof Finish:	Painted	Gutters Present:	no	
Single Doors:	0	Double Doors:	1	
Ranchsliders:	0	Windows:	0	
Soffit Height (mm):	2600	Soffit Width (mm):	200	
Surrounding Features	h	,		
Comments:				
High voltage wires wan	ning on door			

Wall Material:				
Wall Finish:				
Floor Material:	Concrete			
Floor Finish:				
Ceiling Material:	1			
Ceiling Finish:				
Av. Stud Height (mm):		Max.	Stud Height (mm):	
Rooms of Max. Stud				
Height:				
No. Rooms:		No. I	nternal Doors:	
No. Bathrooms:	0	No. P	lant Rooms:	1
Pipework Lagging:		Radia	tor Heating System:	no

Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:		•	
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			


Table 36: S4- Summary of LBP identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Substation 4- Ground Floor	External and internal	White	Timber	Poor	LEAU-BASED 8.800
Substation 4- Ground Floor	External	White	Timber	Fair	LEAD-BASED 9,300

## Table 16: S4 Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		lo ACM were ident	ified or presumed	during the survey.	

J:\33 series\33205 Tokanui infrastructure\Demo Mgmt Plan\Info Summary for Demo Plan March 2024\33205 Building Summary 240403\_EB v2

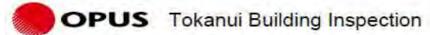

	Ger	neral	
Building:	Sub 4	Year Built:	Unknown
Footprint (m2)	36	Storeys:	1
Surveyed by:	SD and AS	Survey Date:	16/02/2015
General Comments:			

Wall Material:	Reinforced concrete bl	ock		
Wall Finish:	Painted			
Foundation:	Reinforced concrete perimeter footing Concrete slab			
Roof Material:	Pitched corrugated iron			
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	2	Double Doors:	1	
Ranchsliders:	0	Windows:	0	
Soffit Height (mm):	2670	Soffit Width (mm):	300	
Surrounding Features:	Road Powerlines			
Comments:				

Wall Material:		
Wall Finish:		
Floor Material:		
Floor Finish:		
Ceiling Material:		
Ceiling Finish:		
Av. Stud Height (mm):	Max. Stud Height (mm):	
Rooms of Max. Stud Height:		
No. Rooms:	No. Internal Doors:	
No. Bathrooms:	No. Plant Rooms:	0
Pipework Lagging:	Radiator Heating System:	no
Comments:		
No access available. Pried doors apart possible	enough to look inside. Transformer still there. No	other v

	Enviro	onmental		
Electricity Isolated:		Water isolated:	N/A	
Distribution Board Loc:	No idea if isolated		-	
Water Valve Loc:				
Surrounding Features:				
Comments:				

Table 17: 55- Summary of ACM Identified


Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Substation 5- Ground Floor	Switch Room	Electrical components	Fuses	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 37: S5- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Substation 5- Ground Floor	External and internal	Cream	Timber	Poor	LEAD-HASED 2,500

Wall Material:
Wall Finish:
Floor Mat/
Cellip
Celli

J:\33 series\33205 Tokanui infrastructure\Demo Mgmt Plan\Info Summary for Demo Plan March 2024\33205 Building Summary 240403\_EB v2

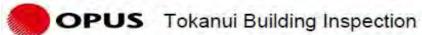

	Ger	neral	
Building:	Sub 5	Year Built:	Unknown
Footprint (m2)	30	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	10/02/2015
General Comments:			
Same as Sub 7, Wasn't a	able to access.		

Reinforced concrete block				
Painted				
Reinforced concrete perimeter footing Concrete slab				
Pitched corrugated iron	6			
Painted	Gutters Present:	yes		
2	Double Doors:	1		
0	Windows:	.0		
2800	Soffit Width (mm):	200		
Services Powerlines Fe	ence			
	Painted Reinforced concrete pe Pitched corrugated from Painted 2 0 2800	Painted Reinforced concrete perimeter footing Concrete slab  Pitched corrugated iron Painted Gutters Present:  2 Double Doors: 0 Windows:		

Wall Material:	Concrete Block		
Wall Finish:	Painted		
loor Material:	Concrete		
Floor Finish:	Other		
Ceiling Material:	Timber (TGV)		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	3	No. Internal Doors:	
No. Bathrooms:	0	No. Plant Rooms:	3
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			- 77


	En	vironmental	
Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:	i		
Water Valve Loc;			
Surrounding Features:	Vegetation		
Comments:	713.4		


Table 38: S6- Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Substation 6- Ground Floor	External and internal	Cream	Timber	Poor	15AD-5ASED 17,000
Substation 6- Ground Floor	Internal	White	Timber	Poor	LEAD-BASED B.700

## Table 18: S6- Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Substation 6- Ground Floor	Switch Room	Electrical items	Fuses	Very Law (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

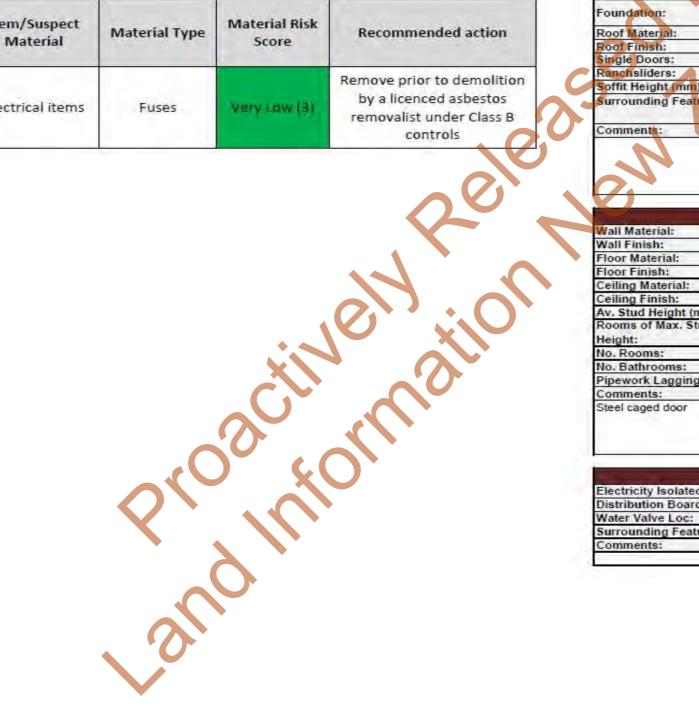

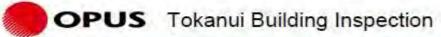

Building:	Sub 6	Year Built:	Unknown
Footprint (m2)	27	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	5/02/2015
General Comments:			

Wall Material:	Reinforced concrete block				
Wall Finish:	Painted				
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated iron				
Roof Finish:	Painted Gutters Present:				
Single Doors:	2	Double Doors:	1		
Ranchsliders:	.0	Windows:	0		
Soffit Height (mm):	2800	Soffit Width (mm):	200		
Surrounding Features:	Road Powerlines				

Wali Material:	Concrete Block	ternal			
MANAGEMENT OF THE PROPERTY.	TOTAL TIST TOTAL				
Wall Finish:	Painted				
Floor Material:	Concrete Timber Nativ	e T/G			
Floor Finish:					
Ceiling Material:	Timber (TGV)				
Ceiling Finish:	Painted				
Av. Stud Height (mm):	2800	Max. Stud Height (mm):			
Rooms of Max, Stud					
Height:					
No. Rooms:	3	No. Internal Doors:	- 1		
No. Bathrooms:	0	No. Plant Rooms:	3		
Pipework Lagging:	no	Radiator Heating System:	no		
Comments:					
Steel caged door					


Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:		,	
Water Valve Loc:			
Surrounding Features:	Vegetation	_	·
Comments:			

Table 19: S7- Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Substation 7- Ground Floor	Switch room	Electrical items	Fuses	Very Law (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 39: S7-Summary of LBP Identified

	17.				Foundation:	ricanorde
Location	Colour	Substrate	Surface Condition	Lead Result (ppm)	Roof Material: Roof Finish: Single Doors:	Pitched c Painted
External	Cream	Timber	Poor	LVAD-BAGED 13,000	Soffit Height (mm):	Road
				00	Comments:	•
				20,	Wall Material: Wall Finish:	Concrete Painted
						Concrete
						Other Timber (1
					Ceiling Finish:	Painted
					Av. Stud Height (mm):	
					Rooms of Max. Stud	-
					No. Rooms:	
					No. Bathrooms:	1
					Pipework Lagging:	
		2			x steel taged door man	uc
	_	30	<b>&amp;O</b>			
		140	KO		Electricity Isolated:	yes
			KO		Distribution Board Loc	
		oro,			Distribution Board Loc Water Valve Loc:	
		250	MIC		Distribution Board Loc	
				Condition	External Cream Timber Poor	External Cream Timber Poor Timber Poor Single Poors: Ranchsliders: Soffit Height (pm): Stirrounding Features:  Comments:  Wall Material: Wall Finish: Floor Material: Floor Finish: Ceiling Material: Ceiling Material: Ceiling Material: Ceiling Material: Ceiling Material: No. Rooms:

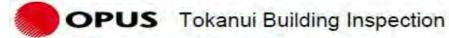

Building:	Sub 7	Year Built:	Unknown
Footprint (m2)	27	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	5/02/2015

		ternal	
Wall Material:	Reinforced concrete block		
Wall Finish:	Painted		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Pitched corrugated iron	1 g g	
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	2	Double Doors:	1
Ranchsliders:	0	Windows:	0
Soffit Height (mm):	2800	Soffit Width (mm):	200
Surrounding Feature	s: Road		

Wall Material:	Concrete Block			
Wall Finish:	Painted	-		
Floor Material:	Concrete Timber Native T/G			
Floor Finish:	Other			
Ceiling Material:	Timber (TGV)			
Ceiling Finish:	Painted			
Av. Stud Height (mm):	2700	Max. Stud Height (mm):		
Rooms of Max. Stud Height:				
No. Rooms:	3	No. Internal Doors:	1	
No. Bathrooms:	0	No. Plant Rooms:	3	
Pipework Lagging:	no	Radiator Heating System:	no	
Comments:		***************************************		
1 x steel caged door insid	ie			

SOURCE STORY MANAGEMENT	En	vironmental	
Electricity Isolated:	yes	Water isolated:	N/A
Distribution Board Loc:			1
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Table 40: S8-Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Substation 8- Ground Floor	External and internal	Cream	Timber	Poor	LEAD-BASED 9 320

## Table 20: S8: Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
Substation 8- Roof	Roof lining	Building paper	Paper	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

amolition
asbestos
ander class B
.ontrols

Wall Material:
Wall Finish:
Floor Finity
Ceiling /
Ceiling /
P.

Way
P.

	Ger	neral	
Building:	Sub 8	Year Built:	Unknown
Footprint (m2)	18	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	5/02/2015
General Comments:			
Empty of most plant used	to store old TV. Has som	e old cables coming up fron	n service trench

Wall Material:	Reinforced concrete b	lock			
Wall Finish:	Painted				
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated iron				
Roof Finish:	None	Gutters Present:	no		
Single Doors:	0	Double Doors:	-1		
Ranchsliders:	D	Windows:	0		
Soffit Height (mm):	2800	Soffit Width (mm):	200		
Surrounding Features:					
Comments:	1				

Wall Material:	Concrete Block		
Wall Finish:	Painted		
Floor Material;	Concrete		
Floor Finish:			
Ceiling Material:	1		
Ceiling Finish:			
Av. Stud Height (mm):	2800	Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:	1	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	no
Comments:	*	and the second s	

Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:		*	
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Not surveyed during 4Sight ACM & Pb Paint surveys

General				
Building:	Shed 4	Year Built:	Unknown	
Footprint (m2)	17	Storeys:	1	
Surveyed by:	NE and RS	Survey Date:	19/02/2015	
General Comments:				

		External	
Wall Material:	Other		
Wall Finish:	Painted		
Foundation:	Other		- \'
Roof Material:			
Roof Finish:	None	Gutters Present:	по
Single Doors:	-1-	Double Doors:	
Ranchsliders:	y	Windows:	2
Soffit Height (mm):		Soffit Width (mm):	
Surrounding Features:	Road	0	
Comments:	•		
Painted plywood structure	e with timber bearer a	nd joint subfloor	

		ernal	
Wall Material:	Timber Frame		
Wall Finish:	Painted		
Floor Material:	Timber Particle Board		
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):	2200	Max. Stud Height (mm):	
Rooms of Max. Stud Height:	XIO		
No. Rooms:	1	No. Internal Doors:	
No. Bathrooms:		No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	по
Comments:		*	

Electricity Isolated:	Water Isolated:	
Distribution Board Loc:		
Water Valve Loc:		
Surrounding Features:		
Comments:		

Table 1: Asbestos Containing Materials - B33 - Ward 9

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B33- Ward 9 Ground Floor	Boiler Room To boiler main section	Lagging	Lagging insulation	Medium (8)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B33- Ward 9 Ground Floor	Internal Boot Room	Boxing	Cement Sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B33- Ward 9 Ground Floor	Exterior Soffits to roofline	Soffits	Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B33- Ward 9 Ground Floor	Sprinkler Cupboard To pipework	Gaskets	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B33- Ward 9 Roof	Roof Water Tank Sheds Walls	Cladding	Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B33- Ward 9 Ground Floor	Front Entrance Gables Gable Ends	Cladding	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B33- Ward 9 1 <sup>st</sup> Floor	Ceiling Space Under metal roof	Paper lining	Bitumen paper	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 16: LBP Identified - B33 - Ward 9

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B33-Ward 9 Ground Floor	Exterior	White	Wood	Poor	LEAD-BASED 3.2,000
B33-Ward 9 Ground Floor	Exterior	Yellow	Wood	Fair	LEAD BASED
B33-Ward 9 Ground Floor	Interior	Green	Plaster- board	Fair	LEAD-BASED 7 900

# OPUS Tokanui Building Inspection

	Ger	neral	
Building:	Ward 9	Year Built:	1960
Footprint (m2)	1430	Storeys:	1
Surveyed by:	NE and DV	Survey Date:	4/02/2015
General Comments:			

Wall Material:	Brick Concrete in situ C	Brick Concrete in situ Cement sheet				
Wall Finish:	Painted Brick Solid Plas	Painted Brick Solid Rlaster				
Foundation:	Concrete perimeter foo & Kitchens Only	Concrete perimeter footing with concrete piles Concrete Slab under Toile & Kitchens Only				
Roof Material:	Pitched corrugated iron	Pitched corrugated iron[Tin Ribbed				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	10	Double Doors:	2			
Ranchsliders:	1	Windows:	110			
Soffit Height (mm):	3800	Soffit Width (mm):	400			
Surrounding Features	: Stairs/Ramps					
Comments:	1					

Various concrete courtyards and steel handrails around the building

	ln.	ternal		
Wall Material:	Gib Plaster Timber Pannelling Timber Frame Pinex Hardboard Brick			
Wall Finish:	Painted Wallpaper Tile			
Floor Material:	Concrete Timber Nativ	Concrete Timber Native T/G		
Floor Finish:	Carpet Lino Tiles	Carpet Lino Tiles		
Ceiling Material:	Gib Pfaster[Fibrous Pfa	ister Pinex		
Ceiling Finish:	Painted			
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	3200	
Rooms of Max. Stud Height:		2		
No. Rooms:	36	No. Internal Doors:	60	
No. Bathrooms:	10	No. Plant Rooms:	2	
Pipework Lagging:	yes	Radiator Heating System:	yes	
Comments:	*			
Kitchen dining and dayro kitchen appears to be so		. Roughly 60 doors. The overhead extr	raction in the	


Environmental				
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Hallway at entry	***************************************		
Water Valve Loc:				
Surrounding Features:				
Comments:				


Table 17: LBP Identified - B36 - Hall

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B36-Hall Ground Floor	Exterior	Red	Metal	Poor	LEAD-BASED 5:800

Table 2: Asbestos Containing Materials - B36 - Hall

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B36-Hall Ground Floor	R6	Electrical Insulating Backing Board	AIB	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls

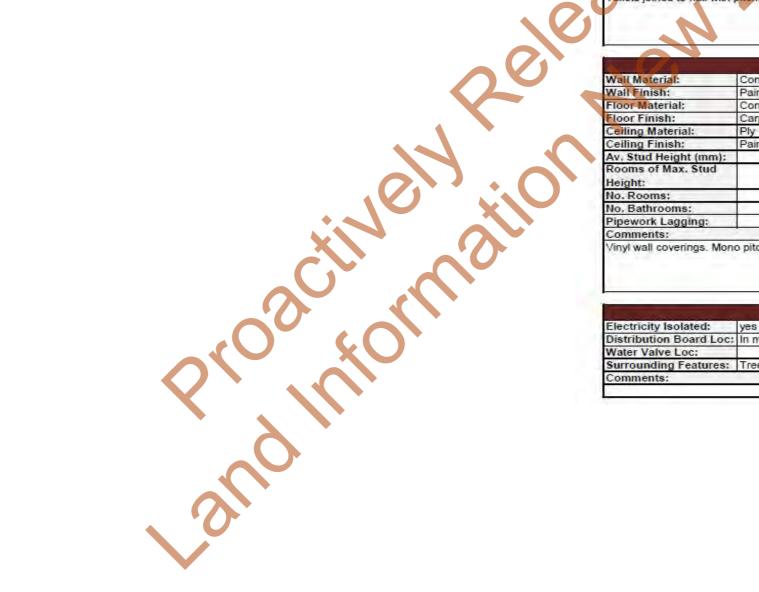

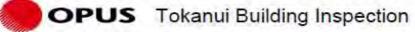

	Ger	neral	
Building:	Half	Year Built:	1970
Footprint (m2)	260	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015
General Comments:			

Wall Material:	Reinforced concrete block			
Wall Finish:	Painted			
Foundation:	Reinforced concrete perimeter footing Concrete slab			
Roof Material:	Tin Ribbed			
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	3	Double Doors:	2	
Ranchsliders:	0	Windows:	31	
Soffit Height (mm):	3900	Soffit Width (mm):	1200	
Surrounding Features:	Services Road			
Comments:				

		ternal	
Wall Material:	Concrete Block		
Wall Finish:	Painted Other		
Floor Material:	Concrete		
Floor Finish:	Carpet Lino		
Ceiling Material:	Ply		
Ceiling Finish;	Painted	The transfer of the second	
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	3200
Rooms of Max. Stud Height:		2	
No. Rooms:	5	No. Internal Doors:	4
No. Bathrooms:	2	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:	,		
Vinyl wall coverings. Mor	no pitched ply ceiling (see	photo 6)	

		nvironmental	
Electricity Isolated:	yes	Water (solated:	no
Distribution Board Loc:	In main room opp	osite kitchen	-
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 18: LBP Identified - B37 - Wooden Shed Behind Hall


	Colour	Substrate	Surface Condition	Lead Result (ppm)
7-Wooden Shed behind Hall Exterio Ground Floor	White	Wood	Poor	LEAD-BASED 120,900
7-Wooden Shed behind Hall Exterio Roof		Metal	Poor	1EAD-8ASED 1,200

Table 3: Asbestos Containing Materials - B38 - RFTD by Hall

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B38-RFTD by Hall Ground Floor	Exterior Skirting by Ramp	Skirting Board	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 19: LBP Identified - B38 - RFTD by Hall

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B38-RFTD by Hall Ground Floor	Exterior	White	Wood	Poor	1LAD-BASED 350,000
B38-RFTD by Hall Ground Floor	R1 and R2	Blue	Wood	Fair	LEAD-BASED 44.500
B38-RFTD by Hall Ground Floor	R3, R4 and R5	Pink	Wood	Fair	LEAD-HASED 32,000
B38-RFTD by Hall Roof	Roof	Red	Metal	Poor	LEAD-BASED

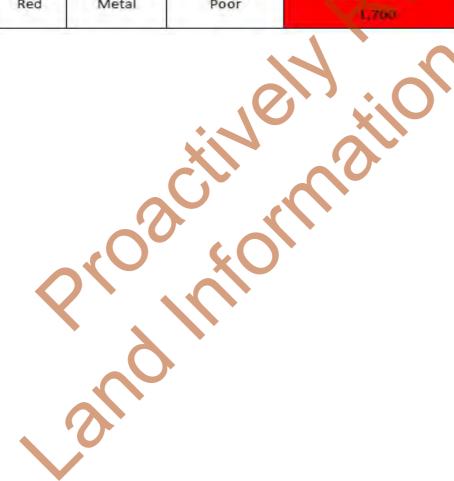

	Ger	neral	
Building:	RFTD	Year Built:	Unknown
Footprint (m2)	60	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015
General Comments:			

Wall Material:	Timber frame Shiplap	veatherhoard			
Wall Finish:	Painted Painted				
Foundation:	Raised piles				
Roof Material:	Pitched confugated iron	1	v		
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	2	Double Doors:	0		
Ranchsliders:	0	Windows:	7		
Soffit Height (mm):	2700	Soffit Width (mm):	300		
Surrounding Features:	Stairs/Ramps Road				
Comments:	1				


		ternal	_
Wall Material:	Timber Pannelling Pine	ex Hardboard	
Wall Finish:	Painted		
Floor Material:	Timber T/G		
Floor Finish:	Carpet Lino		
Ceiling Material:	Fibrous Plaster Timber	(TGV)	
Ceiling Finish:	Painted		
Av. Stud Height (mm):	3100	Max. Stud Height (mm):	3100
Rooms of Max. Stud			
Height:			
No. Rooms:	4	No. Internal Doors:	4
No. Bathrooms:	1	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:	1		
Appears most made of n	ative timber		

En	rvironmental	
yes	Water Isolated:	no
Main room		*-
Trees Vegetation		
	yes Main room	Main room

Table 20: LBP Identified - B39 - RFTD Shed by Hall

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B39-RFTD Shed by Hall Ground Floor	Exterior and Interior	Purple	Metal and timber	Fair	LEAD-BASED 34,000

No ACM identified

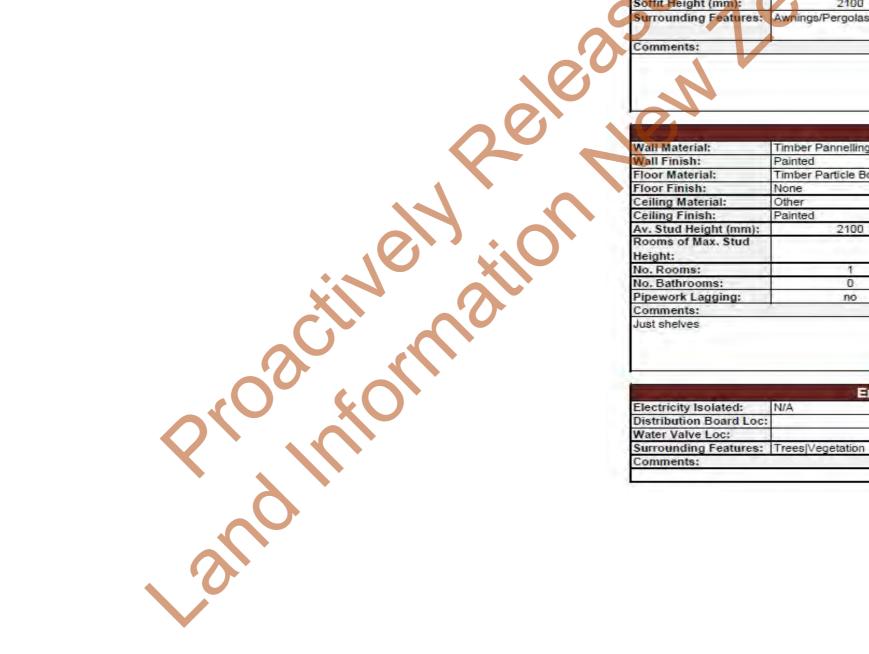

	Ger	neral	-
Building:	RFTD Shed	Year Built:	Unknown
Footprint (m2)	7	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015
General Comments:	*		

	5	dernal	
Wall Material:	Corrugated iron		
Wall Finish:	Painted	-	
Foundation:	Raised piles		
Roof Material:	Pitched corrugated iron	n =	
Roof Finish:	Painted	Gutters Present:	no
Single Doors:	1	Double Doors:	0
Ranchsliders:	0	Windows:	1
Soffit Height (mm):	2100	Soffit Width (mm):	
Surrounding Features:	Awrings/Pergolas		
Comments:			


Wall Material:	Timber Pannelling Tim	ber Frame			
Wall Finish:	Painted				
Floor Material:	Timber Particle Board				
Floor Finish:	None				
Ceiling Material:	Other				
Ceiling Finish:	Painted				
Av. Stud Height (mm):	2100	Max. Stud Height (mm):			
Rooms of Max. Stud Height:					
No. Rooms:	1	No. Internal Doors:	0		
No. Bathrooms:	0	No. Plant Rooms:	0		
Pipework Lagging:	no	Radiator Heating System:	no		
Comments:					
Just shelves		_			

Electricity Isolated:	N/A	Water Isolated:	no
Distribution Board Loc:		***************************************	
Water Valve Loc;			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 21: LBP Identified - B40 - Covered Area by Hall

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B40 - Covered Area by Hall Roof	Exterior	Green	Metal	Poor	LEAD-BASED B7,000

Covered Area by Hall – Small single storey shelter building with concrete floor slab, timber structural poles, corrugated metal pitched roof. A small metal shed is attached as part of the structure

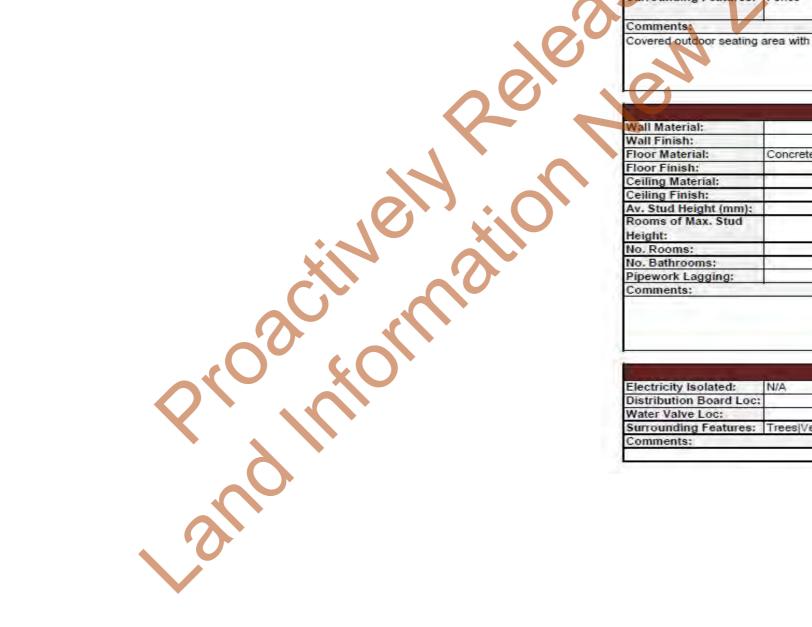

Building:	Covered area by Hall	Year Built:	Unknown
Footprint (m2)	65	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015

Wall Material:	Galvanised steel She	et cladding Timber pole Ply	
Wall Finish:	Painted		
Foundation:	Concrete slab with po	le brackets	
Roof Material:	Pitched corrugated in	on	
Roof Finish:	Painted	Gutters Present:	no
Single Doors:	0	Double Doors:	0
Ranchsliders:	0	Windows:	0
Soffit Height (mm):		Soffit Width (mm):	
Surrounding Features	: Fence		
Comments	4		
Covered outdoor seatin	g area with bridal storag	e shed	

Wall Material:		4 4 4 4	
Wall Finish:			
Floor Material:	Concrete		
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:		No. Internal Doors:	
No. Bathrooms;		No. Plant Rooms:	0
Pipework Lagging:	N/A	Radiator Heating System:	no
Comments:	•		


	E	nvironmental	
Electricity Isolated:	N/A	Water Isolated:	N/A
Distribution Board Loc:		*	-
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 4: Asbestos Containing Materials - B41 - Shed 9

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B41-Shed 9 Ground Floor	Exterior Soffits	Soffit linings	Cement Sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B41-Shed 9 Ground Floor	Interior To pipework	Gaskets	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 22: LBP Identified - B41 - Shed 9

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B41-Shed 9 Ground Floor	Exterior	Yellow	Wood	Poor	15,000
B41-Shed 9 Ground Floor	Exterior	Brown	Concrete and Metal	Poor	LEAD-BASED
				16	
				din	
			~?	<b>)</b>	
			340°	10	
			5,00		
			\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\		

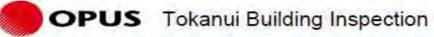

	Ger	neral	
Building:	Shed 9	Year Built:	Unknown
Footprint (m2)	13	Storeys:	1
Surveyed by:	SD and AS	Survey Date:	16/02/2015
General Comments:			

The base from a 100 and the		
I imber frame Bevel ba	ck weatherboard Brick	
Painted		
Reinforced concrete pe	erimeter footing Concrete slab	
Pitched corrugated iron		
Painted	Gutters Present:	yes
1	Double Doors:	0
0	Windows:	1
2500	Soffit Width (mm):	300
Road		,
	Painted Reinforced concrete per Pitched corrugated iron Painted 1 0 2500	Painted Reinforced concrete perimeter footing/Concrete slab  Pitched confugated iron Painted Gutters Present: Double Doors: Umdows: 2500 Soffit Width (mm):

Wall Material:	Bare timber		
Wall Finish:	none		
Floor Material:	Concrete		
Floor Finish:	None		
Ceiling Material:	none		
Ceiling Finish:			
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	
Rooms of Max, Stud Height:			
No. Rooms:	1	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	- 1
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			


Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Inside on left		- 5
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Table 23: LBP Identified - B42 - Building 15

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B42-Building 15 Roof	Exterior	Red	Metal	Poor	LEAN-BASED 7,600

#### Table 5: Asbestos Containing Materials - B42 - Building 15

B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  Exterior Infill panels around windows  Floor  Soffits Cement Sheet  Cement Sheet  Cement Sheet Very Low (3)  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very Low (3)	Soffit to roofline  B42-Building Exterior Infill panels around Floor  Infill Panels Windows  Soffits Cement Sheet Very Low (3)  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Very Low (3)  Remove prior to demolition by a licenced asbestos removalist under Class B controls	B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  Infill panels around F	B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  B42-Building 15 Ground Floor  Exterior Infill panels around Windows  Infill Panels Floor  Cement Sheet  Very Low (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls	Soffits Soffits Soffits Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  B42-Building 15 Infill Panels Ground Windows Infill Panels Windows  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (3) Remove prior to demolition by a licenced asbestos removalist under Class B controls  Cement Sheet Very tow (4) Remove prior to demolition by a licenced asbestos removalist under Class B controls	Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B42-Building 15 Infill panels around Floor Infil	B42-Building 15 Infill panels Ground Floor Infill Panels  Cement Sheet  Very Low (3)  Remove prior to demolition by a licenced asbestos removalist under Class B controls	B42-Building 15 Infill panels around Floor Infill panels I	B42-Building 15 Ground Floor  Infill panels around windows  Infill Panels  Cement Sheet  Very Low (3)  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Under Class B controls	Infill panels around windows  Infill Panels  Cement Sheet  Very Low (3)  Remove prior to demolition by a licenced asbestos removalist under Class B controls  Very Low (3)	15 Ground	Soffit to	Soffits	Cement Sheet	Very Low (3)	a licenced asbestos removalist
				Proactively stion	15 Ground	Infill panels around	Infill Panels	Cement Sheet	Very Low (3)	a licenced asbestos removalist
										60.4
										no. 115

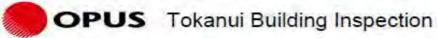

	Ger	neral	
Building:	Building 15	Year Built:	1971
Footprint (m2)	250	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015
General Comments:			
Same as building 10			

Wall Material:	Brick Cement sheet Be	vel back weatherboard	
Wall Finish:	Painted Brick		
Foundation:	Concrete perimeter for & Kitchens Only	ting with concrete piles Concrete	Slab under Toilets
Roof Material:	Pitched corrugated iron	1)	
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	3	Double Doors:	30.
Ranchsliders:		Windows:	30
Soffit Height (mm):	2900	Soffit Width (mm);	500
	s: Stairs/Ramps Road		
Comments:			

		ternal	
Wall Material:	Gib Plaster Seratone	Hardboard	
Wall Finish:	Painted/Wallpaper/Vin	yi	
Floor Material:	Timber T/G.		
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	2450
Rooms of Max. Stud			
Height:			
No. Rooms:	14	No. Internal Doors:	30
No. Bathrooms:	2	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			
S S HILLIANDS I			


		nvironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Hallway		-
Water Valve Loc:			
Surrounding Features:	Trees/Vegetation		
Comments:			

Table 6: Asbestos Containing Materials - B43 - Building 14

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B43-Building 14 Ground Floor	Exterior Soffit to roofline	Soffits	Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B43-Building 14 Ground Floor	Exterior Infill panels around windows	Infill Panels	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 24: LBP Identified - B43 - Building 14

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B43-Building 14 Ground Floor	Exterior	Pink	Wood	Poor	12.000
B43-Building 14 Ground Floor	Exterior	White	Wood and Fibre Cement	Fair	4EAL-BASED 9,200
B43-Building 14 Ground Floor	Exterior	White,	Wood	Poor	1,200
B43-Building 14 Roof	Exterior	Red	Metal	Poor	1EAD DASED
			) (O)		
			6.		

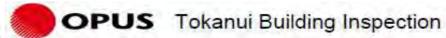

	Gei	neral	-
Building:	Building 14	Year Built:	1971
Footprint (m2)	150	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015
General Comments:			

	Ex	ternal	
Wall Material:	Shiplap weatherboard		
Wall Finish:	Painted		
Foundation:	Concrete perimeter too & Kitchens Only	ting with concrete piles Concrete	Slab under Toilets
Roof Material:	Pitched corrugated iron		
Roof Finish;	Painted	Gutters Present:	yes
Single Doors:	8	Double Doors:	
Ranchsliders:		Windows:	15
Soffit Height (mm):	2800	Soffit Width (mm):	600
Surrounding Features:	Stairs/Ramps Road		
Comments:			

Wall Material:	Gib Plaster Seratone H	ardboard	
Wall Finish:	Painted[Vinyl		
Floor Material:	Timber T/G		
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	- 11	No. Internal Doors:	23
No. Bathrooms:	2	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:	*-	3	


	En	vironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Hallway		****
Water Valve Loc:			
Surrounding Features:	Trees/Vegetation		
Comments:			

Table 25: LBP Identified - B44 - Building 13

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B44-Building 13 Ground Floor	Exterior	Blue	Wood and Fibre Cement	Fair	AEAD-BASED 1,300
B44-Building 13 Ground Floor	Exterior	White	Wood	Poor	TEAD BASED 1 600
B44-Building 13 Ground Floor	Exterior	White	Wood	Poor	LEAD-BASED 1,200
B44-Building 13 Roof	Exterior	Red	Metal	Poor	LEAD BASED 1,700

Table 7: Asbestos Containing Materials - B44 - Building 13

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B44-Building 13 Ground Floor	Exterior To Ground	Loose Pipe	Cement Pipe	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B44-Building 13 Ground Floor	Exterior To Roofline	Soffits	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B44-Building 13 Ground Floor	Exterior Panels around Windows	Infill Panels	Cement Sheet	Very Low (3)	Remove prior to démolition by a licenced asbestos removalist under Class B controls
B44-Building 13 Ground Floor	Rooms R2 R11 To Ceilings	Light Fittings	Bakelite	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

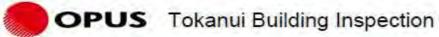

Ger	neral	
Building 13	Year Built:	1971
150	Storeys:	1
NE and SD	Survey Date:	12/02/2015
	Building 13 150	150 Storeys:

Wall Material:	Shiplap weatherboard					
Wall Finish:	Painted					
Foundation:	Concrete perimeter foo & Kitchens Only	Concrete perimeter footing with concrete piles Concrete Slab under Toilet & Kitchens Only				
Roof Material:	Pitched corrugated iron	Pitched corrugated iron				
Roof Finish:	Painted	yes				
Single Doors:		Double Doors:	0			
Ranchsliders:	0	Windows:	15			
Soffit Height (mm):	2800	Soffit Width (mm):	600			
Surrounding Features	Stairs/Ramps Road					

Wall Material:	Gib Plaster Seratone H	ardboard	
Wall Finish:	Painted Vinyl		
Floor Material:	Timber T/G		
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	11	No. Internal Doors:	23
No. Bathrooms:	2	No. Plant Rooms;	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			- 577


Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Hallway			
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			
Comments:				

Table 8: Asbestos Containing Materials - B45 - Building 12

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B45-Building 12 Ground Floor	Exterior To Roofline	Soffits	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B45-Building 12 Ground Floor	Exterior Panels around Windows	Infill Panels	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B45-Building 12 Ground Floor	Rooms R2 R3 R8 To Ceilings	Light Fittings	Bakelite	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B45-Building 12 Ground Floor	Exterior To Ground	Loose Pipe	Cement Pipe	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Table 26: LBP Identified - B45 - Building 12

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B45-Building 12 Ground Floor	Exterior	Cream	Wood and Fibre Cement	Poor	LEAD-BASED
B45-Building 12 Ground Floor	Exterior	White	Wood	Poor	11.4.D-8.ASED 23,000
B45-Building 12 Roof	Exterior	Red	Metal	Poor	LEAD-BASED 5,000

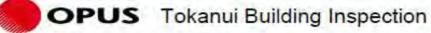

Building:	Building 12	Year Built:	1971
Footprint (m2)	150	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015

Wall Material:	Shiplap weatherboard					
Wall Finish:	Painted					
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete	Slab under Toilets			
Roof Material:	Pitched corrugated iron	1				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	2	Double Doors:	0			
Ranchsliders:	0	Windows:	15			
Soffit Height (mm):	2800	Soffit Width (mm):	600			
Surrounding Features:	Stairs/Ramps[Road					
Comments:	1					

Wall Material:	Gib Plaster Seratone F	lardboard	
Wall Finish:	Painted Vinyl		
Floor Material:	Timber T/G		
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:	11	No. Internal Doors:	23
No. Bathrooms:	2	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			


Electricity Isolated:	yes	Water isolated:	no	
Distribution Board Loc:	Hallway			
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			_
Comments:				

Table 27 LBP Identified - 846 - Building 11

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B46-Building 11 Ground Floor	Exterior	White	Wood and fibre cement	Poor	11 AD-HASED 29,000
B46-Building 11 Ground Floor	Exterior	White,	Wood	Poor	LEAD-BASED 34,000
B46-Building 11 Ground Floor	Exterior	White,	Wood	Poor	LEAD-BASED 1,200
B46-Building 11 Roof	Exterior	Red	Metal	Poor	16AD-HA5EO .2,600

#### Table 9: Asbestos Containing Materials - B46 - Building 11

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B46-Building 11 Ground Floor	Exterior Soffit to roofline	Soffits	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalis under Class B controls
B46-Building 11 Ground Floor	Exterior Infill panels around windows	Infill Panels	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced aspestos removalis under Class B controls
234 93			1	Cil	
				2000	
			6,		
				7	

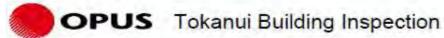

ling 11 Year Built: 1971
50 Storeys: 1
and SD Survey Date: 12/02/2

Wall Material:	Chinlan	weatherboard					
A STATE OF THE PARTY OF THE PAR		Painted					
Wall Finish:	Concrete perimeter footing with concrete piles Concrete Slab under Toilets						
Foundation:		ns Only	build with concrete plies/concrete.	Sidd under Tollets			
Roof Material:	Pitched	corrugated iron	n	Vie			
Roof Finish:	Painted		Gutters Present:	yes			
Single Doors:	1 (-	3	Double Doors:	0			
Ranchsliders:		0	Windows;	15			
Soffit Height (mm):		2800	Soffit Width (mm):	600			
Surrounding Features:	Stairs/R	amps Road Fe	ence				
Comments:							
Surrounding Features: Comments: Steel mesh fence	Stairs/R	amps Road Fe	ence				

Wall Material:	Gib Plaster Seratone H	ardboard			
Wall Finish;	Painted Vinyl				
Floor Material:	Timber T/G				
Floor Finish:	Carpet Lino				
Ceiling Material:	Gib Plaster				
Ceiling Finish:	Painted				
Av. Stud Height (mm):	2450	Max. Stud Height (mm):			
Rooms of Max. Stud Height:					
No. Rooms:	11	No. Internal Doors:	23		
No. Bathrooms:	2	No. Plant Rooms:	0		
Pipework Lagging:	по	Radiator Heating System:	yes		
Comments:	A	Anna a management			
Rimu shelves					


	E	nvironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Hallway	*9004 04004	
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 10: Asbestos Containing Materials - 847 - Building 10

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B47- Building 10 Ground Floor	Exterior Soffit to roofline	Soffits	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B47- Building 10 Ground Floor	Exterior Infill panels around windows	Infill panels	Cement sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 28: LBP Identified - B47 - Building 10

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B47-Building 10 Ground Floor	Exterior	Yellow,	Wood	Fair	LEAD-BASED
B47-Building 10 Ground Floor	Exterior	White	Wood and Fibre Cement	Fair	LEAD BASED 5,400
B47-Building 10 Roof	Exterior	Red	Metal	Poor	LEAD-BASED
			~\O?	% O	
		<b>&lt;</b>	?`.	10,	

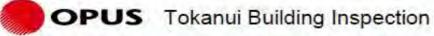

Building:	Building 10	Year Built:	1971
Footprint (m2)	250	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	12/02/2015
General Comments:	INE and SD	Survey Date.	12/02/2

	B	xternal					
Wall Material:	Brick Cement Sheet B	evel back weatherboard					
Wall Finish:	Painted Brick						
Foundation:	Concrete perimeter fo & Kitchens Only	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only					
Roof Material:	Pitched corrugated iron						
Roof Finish:	Painted	Gutters Present:	yes				
Single Doors:	3	Double Doors:	0				
Ranchsliders:	.0	Windows:	30				
Soffit Height (mm):	2900	Soffit Width (mm):	500				
Surrounding Features	: Stairs/Ramps Road	1					
Comments:							

Wall Material:	Gib Plaster Seratone H	ardboard			
Wall Finish:	Painted Wallpaper Viny	A			
Floor Material:	Timber T/G				
Floor Finish:	Carpet Lino				
Ceiling Material:	Gib Plaster				
Ceiling Finish:	Painted				
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	245		
Rooms of Max, Stud Height:					
No. Rooms:	14	No. Internal Doors:	30		
No. Bathrooms:	2	No. Plant Rooms:	0		
Pipework Lagging:	no	Radiator Heating System:	yes		
Comments:					


Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Hallway		
Water Valve Loc:			
Surrounding Features:	Trees[Vegetation		
Comments:			

Table 29: LBP Identified - B48 - Ward 16

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B48-Ward 16 Ground Floor	Exterior	White	Concrete and wood	Intact	LEAD-RASED 24,000
B48-Ward 16 Ground Floor	Exterior	Green	Wood and fibre cement	Intact	LEAD-BASED 23,000
B48-Ward 16 Ground Floor	Interior	Light Green	Wood	Fair	LEAD-MASED 1,300

## Table 11: Asbestos Containing Materials - 848 - Ward 16

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B48-Ward 16 Exterior	Infill panels around windows - Rock Surface	Infill Panels	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B48-Ward 16 Boiler Room	Boiler Room Flanges	Flange Gaskets	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B48-Ward 16 Exterior	Soffits by linen store	Soffits	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced aspestos removalist under Class B controls
B48-Ward 16 Exterior	Soffits by Kitchen	Soffits	Cement Sheet	Very Law (4)	Remove prior to demolition by a licenced aspestos removalist under Class B controls
B48-Ward 16 Exterior	Fascia boards under soffits	Fascia Boards	Cement Sheet	very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B48-Ward 16 Exterior	Infill panels around windows - Smooth Surface	Infill Panels	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B48-Ward 16 Exterior Roof	To skylight surround	Cladding	Cement Sheet	yery tow (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

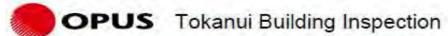

	Ger	neral	
Building:	Ward 16	Year Built:	1972
Footprint (m2)	1760	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	11/02/2015
General Comments:			

Wall Material:	Reinforced concrete to	Reinforced concrete block Cement sheet Shiplap weatherboard				
Wall Finish:	Painted Brick Other					
Foundation:	Concrete perimeter for & Kitchens Only	oting with concrete piles Concrete S	Slab under Toilets			
Roof Material:	Pitched corrugated iro	on				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	9	Double Doors:	9			
Ranchsliders:	0	Windows:	138			
Soffit Height (mm):	3400	Soffit Width (mm):	800			
Surrounding Features:	Stairs/Ramps Awning	s/Pergolas Services Road				
Comments:	*					
Courtyards						

Walleday		ternal				
Wall Material:	Gib Plaster Timber Fra					
Wall Finish:	Painted Wallpaper Viny	A				
Floor Material:	Concrete					
Floor Finish:	Carpet Lino	Carpet Lino				
Ceiling Material:	Gib Plaster Accoustic	Tile[Timber (TGV)				
Ceiling Finish:	Painted					
Av. Stud Height (mm):	3000	Max. Stud Height (mm):				
Rooms of Max. Stud						
Height:						
No. Rooms:	38	No. Internal Doors:	60			
No. Bathrooms:	5	No. Plant Rooms;	1			
Pipework Lagging:	yes	Radiator Heating System:	yes			
Comments:			- 277			
THE PARTY OF THE P	construction.					


Company of the Compan	121	vironmental		
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Hallway	-	-	
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			
Comments:				

Table 12: Asbestos Containing Materials - B49 - Ward 17

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B49-Ward 17 Exterior	South Porch	Cladding	Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B49-Boiler House Subfloor	Subfloor	Underfloor Boxing	Corrugated Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 30: LBP Identified - B49 - Ward 17

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B48-Ward 17 Ground Floor	Exterior	Yellow	Wood	Fair	1.000 1.900
B48-Ward 17 Ground Floor	Exterior	Brown	Wood	Fair	LEAD BASED
B48-Ward 17 Ground Floor	Exterior	Brown	Metal	Fair	LEAD-BASED
B48-Ward 17 Ground Floor	Interior	White	Wood	Fair	LEAD-BASED
			0		
			>,,	Nico	
			6		

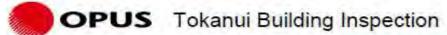

General						
Building:	Ward 17	Year Built:	1976			
Footprint (m2)	580	Storeys:	1 Basement			
Surveyed by:	NE and SD	Survey Date:	11/02/2015			
General Comments:						

Wall Material:	Reinforced concrete bi	Reinforced concrete block Shiplap weatherboard				
Wall Finish:	Painted	Painted				
Foundation:	Concrete perimeter for & Kitchens Only	oting with concrete piles Concrete S	Slab under Toilets			
Roof Material:	Tin Ribbed					
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	4	Double Doors:	4			
Ranchsliders:		Windows:	46			
Soffit Height (mm):	2800	Soffit Width (mm):	600			
Surrounding Feature	s: Stairs/Ramps Services	Road				
Comments:	-					
Aluminum joinery			_			

Wall Material:	Gib Plaster Timber Par	nnelling[Timber Frame			
Wall Finish:	Painted Pre-finished sh	neeting(Vinyl			
Floor Material:	Concrete	Concrete			
Floor Finish:	Lino	Lino			
Ceiling Material:	Gib Plaster Timber (TG	SV)			
Ceiling Finish:	Painted				
Av. Stud Height (mm):	2400	Max. Stud Height (mm):			
Rooms of Max. Stud Height:					
No. Rooms:	32	No. Internal Doors:	45		
No. Bathrooms:	6	No. Plant Rooms:	1		
Pipework Lagging:	yes	Radiator Heating System:	yes		
Comments:					


Annual Control of the	En	vironmental	
Electricity Isolated:	yes	Water Isolated:	по
Distribution Board Loc:		***************************************	
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			


Table 31: LBP Identified - B50 - Ward 18

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B50-Ward 18 Ground Floor	Exterior	Brown	Metal	Fair	1EAD BASED 4,500

Table 13: Asbestos Containing Materials - B50 - Ward 18

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B50-Boiler House Ground Floor	Boiler Room R7	Boiler Pipework Flanges	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B50-Ward 18 Exterior	South Porch	Cladding	Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B50-Boiler House Subfloor	Subfloor	Underfloor Boxing	Corrugated Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced aspestos removalist under Class B controls

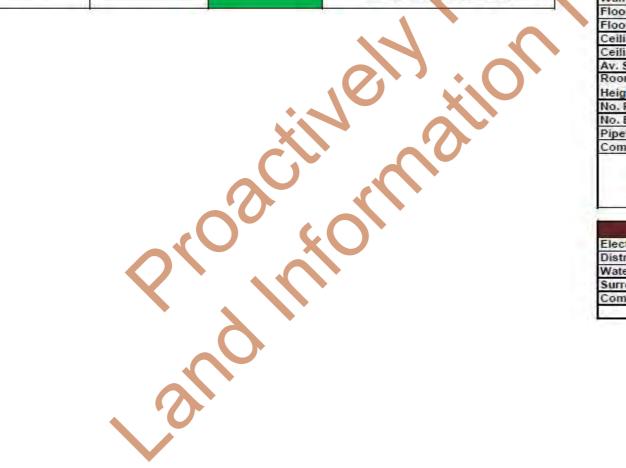

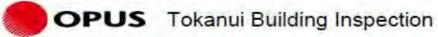

	GE	neral	
Building:	Ward 18	Year Built:	1975
Footprint (m2)	575	Storeys:	1 Basement
Surveyed by:	NE and SD	Survey Date:	11/02/2015
General Comments:			

Wall Material:	Reinforced concrete bl	ock Shiplap weatherboard	
Wall Finish:	Painted		
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete S	Slab under Toilets
Roof Material:	Tin Ribbed		
Roof Finish:	Painted None	Gutters Present:	yes
Single Doors:	6	Double Doors:	4
Ranchsliders:		Windows;	54
Soffit Height (mm):	2400	Soffit Width (mm):	600
Surrounding Features:	Stairs/Ramps Awnings	/Pergolas Services Road	
Comments:			
Steel fenced area on we	st side. Aluminium joinen	V.	

Wall Material:	Gib Plaster Timber Par	nnelling Timber Frame	
Wall Finish:	Painted Vinyl		
Floor Material:	Concrete		
Floor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster Timber (TG	SV)	
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	32	No. Internal Doors:	45
No. Bathrooms:	6	No. Plant Rooms:	1
Pipework Lagging:	yes	Radiator Heating System:	yes
Comments:			10,65


		nvironmental		
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Front of building	-		
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			
Comments:				

Table 14: Asbestos Containing Materials - B51 - EDU (Old School)

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B51-EDU (Old School) Ground Floor	Internal Areas Walls and Ceilings	Textured Ceiling	Textured Coating	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B51-EDU (Old School) Exterior	To Roofline	Soffits	Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B51-EDU (Old School) Exterior	Exterior back door to R23	Infill Panels	Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B51-EDU (Old School) Ground Floor	R32	Gaskets	Composite Material	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

## Table 32: LBP Identified - B51 - EDU (Old School)

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B51-EDU (Old School) Ground Floor	Exterior	Tan	Wood	Fair	LEAD BASSET
B51-EDU (Old School) Ground Floor	Exterior	Tan	Metal	Fair	LEAD-BASED 5.600
	Exterior	Tan	Metal	Fair	
			3//		

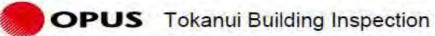

	Sei	neral	
Building:	EDU	Year Built:	1970
Footprint (m2)	640	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	11/02/2015
General Comments:	•		

Wall Material:	Reinforced concrete b	Reinforced concrete block Board and baton				
Wall Finish:	Painted Brick	Painted Brick				
Foundation:	Concrete perimeter fo & Kitchens Only	oting with concrete piles Concrete S	Slab under Toilets			
Roof Material:	Tin Ribbea		,			
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	2	Double Doors:	5			
Ranchsliders:	D	Windows:	78			
Soffit Height (mm):	2700	Soffit Width (mm):	0			
Surrounding Feature	s: Stairs/Ramps Service	s Road Concrete Chimneys Powerli	ines			
Comments:	-					
Skilion roofs						

Wall Material:	Timber Frame Concret	e Block	
Wall Finish:	Painted Other		
Floor Material;	Concrete		
Floor Finish:	Carpet Lino Tiles		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	24	No. Internal Doors:	30
No. Bathrooms:	4	No. Plant Rooms:	2
Pipework Lagging:	yes	Radiator Heating System:	yes
Comments:	*	Activities and the second second	


		nvironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:			
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Table 33: LBP Identified - B52 - Old House by EDU

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
B52-Old House by EDU Ground Floor	Exterior	White	Wood	Poor	14 AD-BASED 120,000
B52-Old House by EDU Ground Floor	Interior	Cream	Wood particle board	Fair	LEAD-BASED 1,890
B52-Old House by EDU Ground Floor	Interior	Pink Cream	Wood particle board	Fair	LEAD-BASED 1,400
B52-Old House by EDU Ground Floor	Interior	White	Wood particle board	Intact	LEAD-HASEU 1,500

#### Table 15: Asbestos Containing Materials - B52 - Old House by EDU

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B52-Old House by EDU Ground Floor	Exterior To skirting	Cladding	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
				a citi	N. Warr
				0,0	O
				7///	

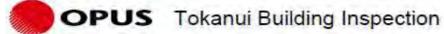

Building:	Old House (by EDU)	Year Built:	Unknown
Footprint (m2)	105	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	10/02/2015

Wall Material:	Timber frame/Shiplap	Timber frame Shiplap weatherboard				
Wall Finish:	Painted					
Foundation:	Raised Timber Piles					
Roof Material:	Pitched corrugated in	on .				
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	2	Double Doors:	0			
Ranchsliders:	0	Windows:	14			
Soffit Height (mm):	2800	Soffit Width (mm):	200			
Surrounding Feature	s: Stairs/Ramps Service	s Road	•			

Wall Material:	Pinex Hardboard		
Wall Finish:	Painted		
Floor Material:	Timber T/G		
Floor Finish:	Lino		
Ceiling Material:	Pinex		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2300	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	3	No. Internal Doors:	3
No. Bathrooms:	1	No. Plant Rooms:	0
Pipework Lagging:	yes	Radiator Heating System:	yes
Comments:	*		
Accoustic tile on walls to	0.		

		Environmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	17.5	***************************************	
Water Valve Loc:	ù.		
Surrounding Features:	Trees Vegetation	1	
Comments:			
Tap in handbasin works			

Table 1: 853 - Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B53 Ground Floor	Exterior	Walls Cladding Upper Elevation	Fibre Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Exterior	Fascia	Fibre Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Exterior	Soffit	Fibre Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Subfloor	Subfloor Formwork	Fibre Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Exterior to ward rooms only	Wall Cladding	Fibre Cement Sheet	Verý Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Room 77	Wall Cladding	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Room 83	Boiler unit main flange	Gasket	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B53 Ground Floor	Room 83	Pipework flanges	Gasket	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Table 22: B53 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No lead-based lead p	aint samples w	vere identified	during the survey	··

J:\33 series\33205 Tokanui infrastructure\Demo Mgmt Plan\Info Summary for Demo Plan March 2024\33205 Building Summary 240403\_EB v2

# OPUS Tokanui Building Inspection

General					
Building:	Ward 19	Year Built:	1978		
Footprint (m2)	2100	Storeys:	1 Basement		
Surveyed by:	NE and SD	Survey Date:	11/02/2015		
General Comments:					

Concrete washdown bays around exterior are  $4.6m \times 3.1 \times 6$  of ~2m apart on each side of building, and two wash down bays at  $6.9m \times 6.5m$  all with 2m high wall separating them with a walkway surrounding

Wall Material:	Reinforced concrete block/Cement sheet				
Wall Finish:	Painted Solid Plaster				
Foundation:	Concrete permeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only				
Roof Material:	Tin Ribbed				
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	16	Double Doors:	5		
Ranchsliders:	2	Windows:	4		
Soffit Height (mm):	3000	Soffit Width (mm):	800		
Surrounding Features:	Stairs/Ramps Awnings	/Pergolas Services Road			
Comments:					

Wall Material:	Gib Plaster[Timber Fra	me Concrete Block Other	
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	Lino		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2600	Max, Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	47	No. Internal Doors:	118
No. Bathrooms:	12	No. Plant Rooms:	1
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:	•	* ****	


Environmental						
Electricity Isolated:	yes	Water Isolated:	no			
Distribution Board Loc:		100000000000000000000000000000000000000				
Water Valve Loc:						
Surrounding Features:	Trees Vegetation					
Comments:						


#### Table 23: 854 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
1	No lead-based lead p	aint samples w	vere identified o	during the survey	

#### Table 2: B54 - Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No positive ACMs	were identified du	uring the survey.	

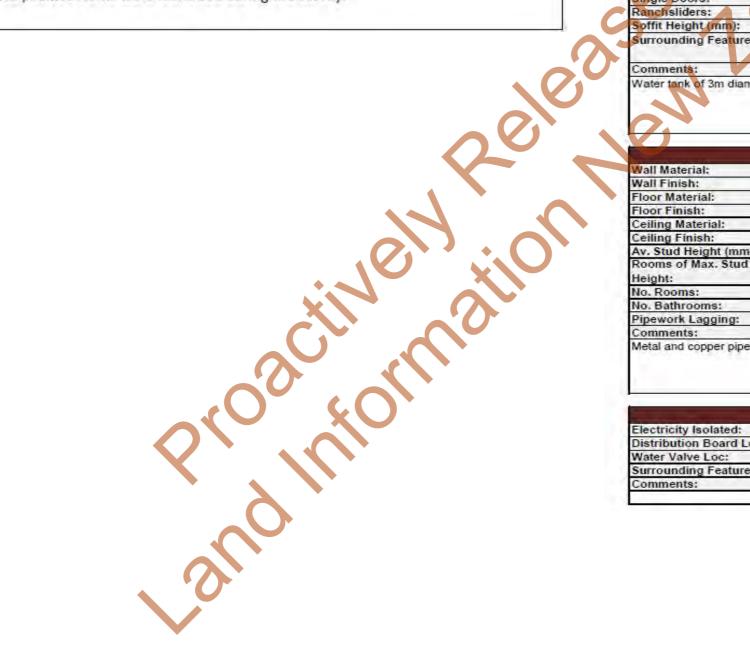

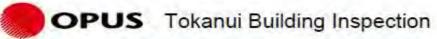

Water tank of 3m diameter on top by 2,5m high (see photo 3).

Building:	Water Tower	Year Built:	1978
Footprint (m2)	10	Storeys:	2
Surveyed by:	NE and SD	Survey Date:	11/02/2015

Wall Material:	Reinforced concrete in	situ				
Wall Finish:	Painted Solid Plaster	Painted Solid Plaster				
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab				
Roof Material:	Concrete Water Tank					
Roof Finish:	Painted	Gutters Present:	no			
Single Doors:	0	Double Doors:	0			
Ranchsliders:	0	Windows:	0			
Soffit Height (mm):	7000	Soffit Width (mm):				
Surrounding Features	Services					

	li li	iternal	
Wall Material:	Reinforced Concrete i	n situ	
Wall Finish:	None		
Floor Material:	Concrete		
Floor Finish:	None		
Ceiling Material:	Concrete		
Ceiling Finish:	None		
Av. Stud Height (mm):	6900	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	1 -	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	1
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			


Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:			
Water Valve Loc:	Still under pressu	re	
Surrounding Features:	Vegetation		
Comments:			

Table 3: 855 - Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B55, Ground Floor	Room 28 Ceiling	Pipe from ceiling	Lagging	(ligh ()1)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B55, Ground Floor	Boiler Room	Pipework	Insulation material	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B55, Ground Floor	Boiler Room	Boiler Unit	Insulation	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B55, Ground Floor	Room 29	Sub Main	Fuses	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B55, Ground Floor	Exterior	Around building	Fibre Cement Sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B55, Ground Floor	Room 11	Wall Lining	Fibre Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B55, Ground Floor	Room 19	Heater to Wall	Wiring	Very Low (4)	Remove intact prior to demolition by a licenced asbestos removalist under Class B controls
B55, Ground Floor	Room 42	Red gaskets	Gasket	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B55, Ground Floor	Exterior	Water Tank Housing	Fibre Cement Sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Table 24: 855 - Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 55 - Ward K, Ground Floor	Exterior	White	Wood	Poor	(#AD-BASED) 66,000
Building 55 - Ward K, Ground Floor	Exterior	Beige	Wood	Intact	).EAD-BASED 84,000

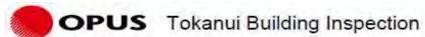

General					
Building:	Ward K	Year Built:	Unknown		
Footprint (m2)	1480	Storeys:	1		
Surveyed by:	NE and RS	Survey Date:	5/02/2015		
General Comments:					

Wall Material:	Brick/Concrete in situ	Reinforced concrete block/Cement	sheetlBoard and h
Wall Finish:	Painted Brick Solid Pl		onoodpodia dilo b
Foundation:	Concrete perimeter to & Kitchens Only	poting with concrete piles Concrete \$	Slab under Toilets
Roof Material:	Pitched corrugated in	on Tin Ribbed	
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	11	Double Doors:	.5
Ranchsliders:	2	Windows:	303
Soffit Height (mm):	3500	Soffit Width (mm):	500
Surrounding Features	Stairs/Ramps Awning Tanks	s/Pergolas Services Road Concrete	Chimneys Header
Comments:			

Vall Material:	Gib Plaster Timber Par	nnelling Timber Frame Brick				
Vall Finish:	Painted Wallpaper Tile Pre-finished sheeting					
loor Material:	Concrete Timber Native T/G					
loor Finish:	Carpet Lino Tiles					
Ceiling Material:	Plaster Fibrous Plaster					
eiling Finish:	Painted					
v. Stud Height (mm):	2500	Max. Stud Height (mm):	3200			
Rooms of Max. Stud leight:		3				
lo. Rooms:	38	No. Internal Doors:	60			
lo. Bathrooms:	6	No. Plant Rooms:	2			
Pipework Lagging:	yes	Radiator Heating System:	yes			
comments:		***************************************				
figh stud in dayroom kitc	hen dinning					

Environmental					
Electricity Isolated:	yes	Water Isolated:	no		
Distribution Board Loc:	Hallway entry	***************************************	***		
Water Valve Loc:					
Surrounding Features:	Trees Vegetation	1			
Comments:					

Table 25: B55 - Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building B56 - Ward E, Ground Floor	46-48	Blue	Plaster	Intact	11 AD-BASETI 1,700
Building B56 - Ward E, Ground Floor	Exterior	Yellow	Wood	Intact	LEAD-BASED
Building B56 - Ward E, Ground Floor	Exterior	White	Wood	Poor	LEAD-RASED 126,000
Building B56 - Ward E, Ground Floor	Exterior	Red	Concrete	Fair	1,300
Building B56 - Ward E, Ground Floor	Exterior	Green	Metal	Poor	(EAD-BASE) 50,000

Table 4: B56 - Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B56, Basement	Boiler Room and Subfloor Pipe	Lagging	ACM lagging	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B56, Ground Floor	Rooms 22,23,45,31,42, 39, 38, 36, 52-54	Wall Cladding	Fibre Cement Sheeting	Very Low (4)	Rémove prior to demolition by a licenced asbestos removalist under Class B controls
B56, Ground Floor	Exterior	Soffit	Fibre Cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B56, Ground Floor	Exterior	Fascia	Fibre Cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B56, Ground Floor	Room 29	Wall-Mounted Fuse Holder	Fuses	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B56, Ground Floor	Room 49	Flange	Gasket	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B56, Roof	Exterior	Water Tank Housings	Fibre Cement Sheet	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Building:	Ward E	Year Built:	1958
Footprint (m2)	1480	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	5/02/2015
General Comments:		7	

Mr. II Market L.	Balabica at a sit (Balaf and another black Consent about				
Wall Material:	Brick Concrete in situ Reinforced concrete block Cement sheet				
Wall Finish:	Painted Brick Solid Plaster				
Foundation:	Concrete perimeter fo & Kitchens Only	oting with concrete piles/Concrete S	Slab under Toilets		
Roof Material:	Pitched corrugated iro	n Tin Ribbed			
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	11	Double Doors:	5		
Ranchsliders:	2	Windows:	303		
Soffit Height (mm):	3500	Soffit Width (mm):	500		
Surrounding Features:	Stairs/Ramps/Awnings Tanks	s/Pergolas Services Road Concrete	Chimneys Heade		
Comments:					

		ternal			
Wall Material: Gi	b Plaster Timber Par	nelling Timber Frame Seratone Concr	ete Block Brick		
Wall Finish: Pa	Painted Wallpaper Tile Pre-finished sheeting				
Floor Material: Co	Concrete Timber Native T/G				
Floor Finish: Ca	Carpet Lino Tiles				
Ceiling Material: Gi	Gib Plaster Fibrous Plaster Timber (TGV)				
Ceiling Finish: Pa	ainted				
Av. Stud Height (mm):	2700	Max. Stud Height (mm):	3200		
Rooms of Max. Stud Height:		3			
No. Rooms:	39	No. Internal Doors:	60		
No. Bathrooms:	8	No. Plant Rooms:	2		
Pipework Lagging:	yes	Radiator Heating System:	yes		
Comments:			- 1		
High studs in kitchen and dir	ning dayroom				


	Er	nvironmental		
Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Hallway			
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			-
Comments:				

Table 5: B57 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B57, Ground Floor	1 Pool floor following pipe	Boxing to trench	Fibre Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B57, Ground Floor	4 Pipe	Flanges	Gasket	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B57, Ground Floor	4 Wall	Zip înternal	Cable wrap	Very Law (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 26: 857 Summary of LBP Identified

Building 57 - Pool and Pool Shed, Ground Floor	Exterior				
		White	Wood	Fair	LEPS-BASED
				16	
				dil	OJ.
			2		
			240	KO.	

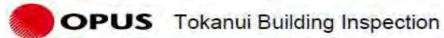

and pool shed	Year Built:	Unknown	
232			
525	Storeys:	1	
E and RS	Survey Date:	9/02/2015	
	E and RS		

	В	xternal			
Wall Material:	Concrete in situiReinforced Concrete block Corrugated iron				
Wall Finish:	Painted Solid Plaster	Painted Solid Plaster			
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated iro	in			
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	4	Double Doors:	0		
Ranchsliders:	0	Windows:	8		
Soffit Height (mm):		Soffit Width (mm):	N-		
Surrounding Features:	Stairs/Ramps Awnings	s/Pergolas Services Road			
Comments:	1		F1 747		
Comments: Concrete retaining wall a	at north end of pool see	photo. Concrete surrounding pool.	Kids in		

Wall Material:	Timber Frame Concret	e Block	
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	Other		
Ceiling Material:	Hardboard		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	4	No. Internal Doors:	
No. Bathrooms:	2	No. Plant Rooms:	- 1
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			

Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	17			
Water Valve Loc:				
Surrounding Features:	Trees Vegetation			
Comments:				


Table 27: B59 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 59 - Gardener, Ground Floor	Exterior	Pink	Wood	Fair	(EAD-BASED) JE0,000
Building 59 - Gardener, Ground Floor	Exterior	Maroon	Wood/ metal	Fair	(EAD-BASED) 71,000

#### Table 6: B59 Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM is	dentified during th	e survey.	

Wall Finish:
Floor Material:
Ceiling Material:
Ceiling Inish:
Av. Stud Height (mm):
Rooms of Max. Stud
Height:
No. Rooms:
No. Bathrooms:
Pipework Lagging:
Comments:

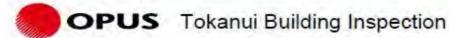

General						
Building:	Gardener	Year Built:	Unknown			
Footprint (m2)	280	Storeys:	1			
Surveyed by:	NE and SD	Survey Date:	12/02/2015			
General Comments:	*					

Wall Material:	Corrugated iron				
Wall Finish:	None				
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated iron	1			
Roof Finish:	Painted	Gutters Present:	no		
Single Doors:	0	Double Doors:	0		
Ranchsliders:	2	Windows:	5		
Soffit Height (mm):	2500	Soffit Width (mm):	300		
Surrounding Features	Road				
Comments:					

Wall Material:		ternal	
7 1.37 377.710 32 2743			
Wall Finish:			
Floor Material:			
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):		Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms:	1	No. Internal Doors:	
No. Bathrooms:		No. Plant Rooms:	0
Pipework Lagging:	N/A	Radiator Heating System:	yes
Comments:			

Environmental						
Electricity Isolated:	yes	Water Isolated:	no			
Distribution Board Loc:		343 35				
Water Valve Loc:						
Surrounding Features:	Vegetation					
Comments:						

Table 7: B60 Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACM id	dentified during th	e survey.	

#### Table 28: 860 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building B60 - Fitter, Ground Floor	Interior	Yellow pink	Wood	Intact	1.EAD BASEN 55.000
Building B60 - Fitter, Ground Floor	Exterior	Pink	Wood	Intact	LEAD-BASE() 120,000
Building B60 - Fitter, Ground Floor	Exterior	Maroon	Wood	Intact	LEAD BASED 8,300



General					
Building:	Fitter	Year Built:	Unknown		
Footprint (m2)	100	Storeys:	1		
Surveyed by:	NE and SD	Survey Date:	12/02/2015		
General Comments:					

Wall Material:	Timber frame Shiplap	weatherboard			
Wall Finish:	Painted				
Foundation:	Concrete perimeter for & Kitchens Only	oting with concrete piles Concrete S	Slab under Toilets		
Roof Material:	Pitched corrugated iron				
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	2	Double Doors:	0		
Ranchsliders:	0	Windows:	10		
Soffit Height (mm):	2500	Soffit Width (mm):	400		
Surrounding Features Comments:	Road	•			

Maroon	Wood	Intact	2,360	0,			
						(market)	
				THE CONTRACTOR		ternal	
				Wall Material: Wall Finish:	Gib Plaster Painted		
				Floor Material:	Concrete		
		<b>A</b>		Floor Finish:	Carpet Lino		
				Ceiling Material:	Gib Plaster		
				Ceiling Finish:	Painted		
				Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
				Rooms of Max. Stud	2.00	in an even rivigin (min)	
		• • •		Height:			
				No. Rooms:	6	No. Internal Doors:	6
		X		No. Bathrooms:	1	No. Plant Rooms:	0
				Pipework Lagging:	no	Radiator Heating System:	ye
				Comments:			
			_				
	.00	(0)			Fault	anniantal	
	(O'C	40				onmental	
	10°C	(40)		Electricity Isolated:	yes	Onmental  Water Isolated:	0
	1000	(40)		Distribution Board Loc	yes		0
Q	1000	(10)		Distribution Board Loc Water Valve Loc;	yes :		0
	1000			Distribution Board Loc Water Valve Loc: Surrounding Features:	yes :		0
	1000	(1/0)		Distribution Board Loc Water Valve Loc: Surrounding Features: Comments:	yes : Vegetation		0
	\O'\			Distribution Board Loc Water Valve Loc: Surrounding Features:	yes : Vegetation		0
	000			Distribution Board Loc Water Valve Loc: Surrounding Features: Comments:	yes : Vegetation		0
				Distribution Board Loc Water Valve Loc: Surrounding Features: Comments:	yes : Vegetation		0
				Distribution Board Loc Water Valve Loc: Surrounding Features: Comments:	yes : Vegetation		0
				Distribution Board Loc Water Valve Loc: Surrounding Features: Comments:	yes : Vegetation		0

Environmental					
Electricity Isolated:	yes	Water Isolated:	rio		
Distribution Board Loc:					
Water Valve Loc:					
Surrounding Features:	Vegetation				
Comments:					
Wasps and blackberries					

Table 29: B61 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building B61 - Shed 11, Ground Floor	Exterior	White	Wood	Fair	LEAD-BASED VS,DDD
Building B61 - Shed 11, Ground Floor	Exterior	Purple	Wood	Fair	(EAD BASED 55,000

Table 8: 861 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B61, Ground Floor	1 Floor corner	Lagging	Rope	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B61, Ground Floor	Exterior Soffit	Soffit	Cement sheet	Very Low (₫)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Cement sheet

Very Low (1)

Const.

Co

J:\33 series\33205 Tokanui infrastructure\Demo Mgmt Plan\Info Summary for Demo Plan March 2024\33205 Building Summary 240403\_EB v2

# OPUS Tokanui Building Inspection

3.0m x 3.6m concrete block shed

	Ger	neral	
Building:	Shed 11	Year Built:	Unknown
Footprint (m2)	16	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	19/02/2015
General Comments:			
Wasp nest present on do	oor cannot enter		

		ternal	
Wall Material:	Reinforced concrete bl	ock	
Wall Finish:	Painted		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Tin Ribbed		
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:		Double Doors:	1
Ranchsliders:	6/1	Windows:	0
Soffit Height (mm):	2300	Soffit Width (mm):	350
Surrounding Feature	s: Road/Powerlines		
Comments:			

Wall Material:	Concrete Block		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):	2200	Max. Stud Height (mm):	
Rooms of Max, Stud Height:			
No. Rooms:	1	No. Internal Doors:	
No. Bathrooms:		No. Plant Rooms:	0
Pipework Lagging:		Radiator Heating System:	no
Comments:			
Comments.	his shed		

	Environmental En					
Electricity Isolated:	yes	Water Isolated:	N/A			
Distribution Board Loc:						
Water Valve Loc:						
Surrounding Features:	Trees[Vegetation	1				
Comments:						
1						

#### Table 9: 862 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B62, Ground Floor	4,6 Ground and storage shelf	Debris	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B62, Ground Floor	External Wall	Cladding panel	Fibre cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 30: 862 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 62 - Racks, Roof	Exterior	Light blue	Metal	Intact	1540 845FD 1,100
Building 62 - Racks, Roof	Room 2,3,5	Purple	Plasterboar d	Intact	120,000
Building 62 - Racks, Roof	All exterior	White	Wood	Intact	LEAD-BASED LZC.BUG

		9	1	<b>)</b>
		0		
			~()	
		) ^(		
OPUS To	kanui Ruilding Inen	action		
OPUS To	kanui Building Inspe	ection		
OPUS To		ection		
OPUS To	kanui Building Inspe General Racks Year Build		nown	

Wall Material:	Timber frame Shiplap v	weatherboard	
Wall Finish:	Painted		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Pitched corrugated iron	1	
Roof Finish:	Painted	Gutters Present:	no
Single Doors:	0	Double Doors:	2
Ranchsliders:	3	Windows:	2
Soffit Height (mm):	3000	Soffit Width (mm):	258
Surrounding Features:	Road		
Comments:	*		

Wall Material:	Timber Frame (Native)	Racks	
Wall Finish;	1		
Floor Material:	Concrete		
Floor Finish:	None		
Ceiling Material:	None		
Ceiling Finish:			
Av. Stud Height (mm):	2400	Max. Stud Height (mm):	
Rooms of Max. Stud			
Height:			
No. Rooms;	7	No. Internal Doors:	- 5
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			

	Er	nvironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:		100000000000000000000000000000000000000	
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			

Table 31: B63 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 63 - Workshop, Ground Floor	Internal	Beige	Concrete	Intact	LEAD-BASED 3,000
Building 63 - Workshop, Ground Floor	Internal	White	Plaster	Intact	LEAD-BASED 37,000
Building 63 - Workshop, Ground Floor	Exterior	White	Wood	Intact	LEAD-BASED 69,000
Building 63 - Workshop, Ground Floor	Exterior	Purple	Wood	Intact	LEAD-BASET) 79,000
Building 63 - Workshop, Ground Floor	Exterior	Green	Concrete	Intact	LEAD-BASED 11,000

#### Table 10: 863 Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B63, Ground Floor	Rooms 9, 12	Radiator Pipe to Wall	Rope	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B63, Ground Floor	Rooms 6, 12	Pipes along Wall	Lagging	Medium (8)	Remove prior to demolition b a licenced asbestos removalis under Class A controls
B63, Ground Floor	Room 10	Spray booth	AIB	Medium (7)	Remove prior to demolition b a licenced asbestos removalis under Class A controls
B63, Ground Floor	Roof	Roof Sheeting	Fibre Cement	Low (5)	Remove prior to demolition b a licenced asbestos removalis under Class B controls
B63, Ground Floor	Room 4	Wall Cladding	Cement sheet	Very Low (4)	Remove prior to demolition b a licenced asbestos removalis under Class B controls
B63, Ground Floor	Rooms 2, 3	Wall Lining	Fibre Cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalis under Class B controls
B63, Ground Floor	Exterior	Soffits	Fibre Cement	Very Low (4)	Remove prior to demolition b a licenced asbestos removalis under Class B controls
B63, Ground Floor	External to 5	Wall Cladding	Fibre Cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalis under Class B controls
B63, Ground Floor	Exterior	Downpipes	Fibre cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalis under Class B controls
B63, Ground Floor	Room 6	Pipe	Gasket	Very Low (3)	Remove prior to demolition b a licenced asbestos removalis under Class B controls
B63, Ground Floor	Room 5	Dust extraction unit	Cement sheet	Very Low (4)	Remove prior to demolition b a licenced asbestos removalis under Class B controls
B63, Ground Floor	Exterior	Metal downpipes	Putty	Very Low (4)	Remove prior to demolition b a licenced asbestos removalis under Class B controls

Building:	Workshop	Year Built:	Unknown	
Footprint (m2)	1100	Storeys:	1	
Surveyed by: NE and SD		Survey Date:	12/02/2015	
General Comments:				

Wall Material:	Reinforced concrete in situ Reinforced concrete block Bevel back weatherb				
Wall Finish:	Painted				
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Pitched corrugated iron	Other			
Roof Finish:	None	Gutters Present:	yes		
Single Doors:	5	Double Doors:	6		
Ranchsliders:	6	Windows:	47		
Soffit Height (mm):	3150	Soffit Width (mm):	600		
Surrounding Features:	Stairs/Ramps Road				
Comments:			r		

	Inte		
Wall Material:	Gib Plaster Seratone Cor	crete Block	
Wall Finish:	Painted Wallpaper Tile		
Floor Material:	Concrete		
Floor Finish:	Lino Tiles Other		
Ceiling Material:	Fibrous Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	3150	Max. Stud Height (mm):	
Rooms of Max. Stud Height:		0,4	
No. Rooms:	3	No. Internal Doors:	2
No. Bathrooms:	1	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			- 1000
some shelves are solid	imu		

Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Lo	c: Fitters front room		200
Water Valve Loc:			
Surrounding Features	: Trees Vegetation Oth	er	
Comments:			

#### Demolished prior to 4Sight Pb & ACM Survey

Building:	Sports Pavilion	Year Built:	Unknown
Footprint (m2)	120	Storeys:	1
Surveyed by:	SD and AS	Survey Date:	16/02/2015
General Comments:			

Wall Material:	Concrete in situ Shiplap weatherboard				
Wall Finish:	Painted				
Foundation:	Concrete perimeter footing with concrete piles Concrete Slab under Toilets & Kitchens Only				
Roof Material:	Pitched corrugated iron	n e			
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	3	Double Doors:	1		
Ranchsliders:	0	Windows:	14		
Soffit Height (mm):	2800	Soffit Width (mm):	400		
Surrounding Features:	Concrete Chimneys				
Comments:					

	line	ernal				
Wall Material:	Hardboard Seratone					
Wall Finish:	Painted					
Floor Material:	Concrete					
Floor Finish:	Carpet Lino					
Ceiling Material:	Gib Plaster					
Ceiling Finish:	Painted					
Av. Stud Height (mm):	2400	Max. Stud Height (mm):				
Rooms of Max. Stud Height:		6	X			
No. Rooms:	6	No. Internal Doors:	2			
No. Bathrooms:	2	No. Plant Rooms:	0			
Pipework Lagging:	no	Radiator Heating System:	no			
Comments:						


	Er	vironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Main room		
Water Valve Loc:			
Surrounding Features:	Trees(Vegetation		
Comments:			

Table 11: B65 Summary of ACM Identified

Building & Floor	Location/Room Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B65, Ground Floor	Room 5	Pipe	Insulation material	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B65, Ground Floor	Room 5	Boiler unit	Insulation material	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B65, Ground Floor	External	Roof	Fibre Cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B65, Ground Floor	Room 5	Internal walls	Fibre Cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B65, Ground Floor	Room 1	Ceiling of entry	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B65, Ground Floor	External	Canopy	Bitumen	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B65, Ground Floor	Room 5	Flanges	Composite material (Gaskets)	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B65, Ground Floor	Rooms 10, 13, 19	Walls	Insulation	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Table 32: B65 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 65 - Store, Ground Floor	Internal	Blue	Concrete	Intact	16AD-8ADED 2,100
Building 65 - Store, Ground Floor	Internal	White	Wood/ plaster	Intact	LEAD-BASED 2,200
Building 65 - Store, Ground Floor	Exterior	White	Wood	Intact	LEAD-BASED (2,000)

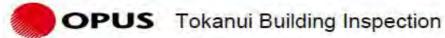

	Ger	neral	-
Building:	Store	Year Built:	Unknown
Footprint (m2)	1160	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	13/02/2015
General Comments:	NE and SE	Survey Date.	1 1302720

Wall Material:	Reinforced concrete in	n situ		
Wall Finish:	Painted	Painted		
Foundation:	Reinforced concrete p	perimeter footing Concrete slab		
Roof Material:	Tin ribbed Reinforced	glass		
Roof Finish:	painted	Gutters Present:	no	
Single Doors:	2	Double Doors:	2	
Ranchsliders:	2	Windows:	27	
Soffit Height (mm):	.0	Soffit Width (mm):	0	

Roof is concrete corrugated sheet likely asbestos. 2 large roller doors marked as sliders. South side stud to roof up mesh reinforced glasd along entire length

Wall Material:	Concrete in situ[Timber	r frame  Hardboard	
Wall Finish:	Painted	3,	
Floor Material:	Concrete		
Floor Finish:	Lino Tiles Other		
Ceiling Material:	Fibrous Plaster Pinex		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2740	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	21	No. Internal Doors:	19
No. Bathrooms:	2	No. Plant Rooms:	1
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:			- 220


Electricity Isolated:	yes	Water Isolated:	no	
Distribution Board Loc:	Room 1, which is	west end room. Room 2 (larger o	ne)	
Water Valve Loc:	0			
Surrounding Features:	Trees Vegetation			
Comments:	Val. 16 10 7 15 11 11			


Table 33: Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 66 - Assistant Engineers Office, Ground Floor	Interior	Cream	Concrete	Poor	18AD-84550 1,700
Building 66 - Assistant Engineers Office, Ground Floor	Interior	Beige	Wood	Intact	(EAD) BASED. (AC,UOU

Table 12: 866 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B66, Ground Floor	External Soffit to 1-5	Soffit	Fibre Cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B66 Ground Floor	5 East and South walls	Electrical board	Backing board	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

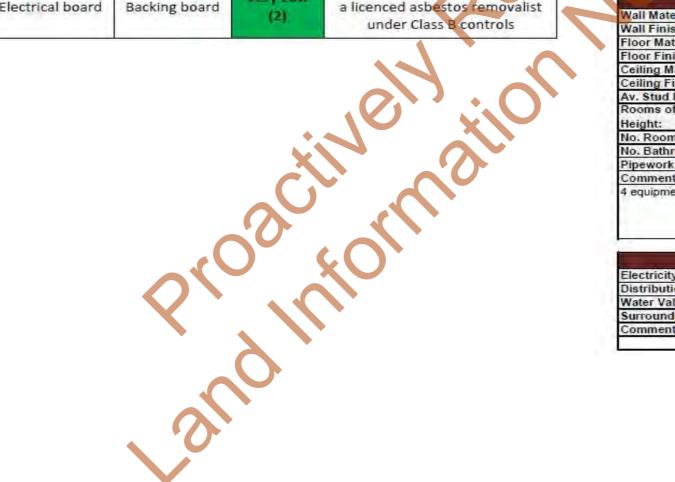

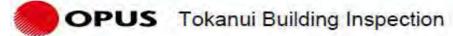

	Gener	al	
Building:	Assistant Engineers Office	Year Built:	Unknown
Footprint (m2)	250	Storeys:	1
Surveyed by:	SD and AS	Survey Date:	16/02/2015
<b>General Comments</b>	<b>:</b>		
Fuel spills on exterior	perimeter		

		ternal		
Wall Material:	Corrugated iron			
Wall Finish:	Painted			
Foundation:	Reinforced concrete pe	Reinforced concrete perimeter footing Concrete slab		
Roof Material:	Pitched corrugated iron			
Roof Finish:	Painted	Gutters Present:	yes	
Single Doors:	3	Double Doors:		
Ranchsliders:	3	Windows:	12	
Soffit Height (mm):	3540	Soffit Width (mm):	400	
Surrounding Features:	Stairs/Ramps Road	***************************************		
Comments:				
Roller doors marked as s	diders			

Wall Material:	Concrete Block		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	Carpet Other		
Ceiling Material:	Gib Plaster		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2650	Max. Stud Height (mm):	3600
Rooms of Max. Stud Height:		3	
No. Rooms:	4	No. Internal Doors:	4
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:	*		
4 equipment storage bay	s plus office building. Se	vere amount of animal poo throughout	

		invironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	West most room	of office lot	•
Water Valve Loc:	No evidence of w	ater for this building	
Surrounding Features:			
Comments:			


Table 13: B67 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B67, Ground Floor	External Soffit	Soffit	Fibre cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B67, Ground Floor	Room 1 Around flue	Wall lining	AIB	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class A controls

#### Table 34: B67 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 67 - Shed 8, Ground Floor	Exterior	Maroon	Wood	Fair	(EAD-BRSED) 1,100

W. Wah. Floor h. Ceiling Ma. Ceiling Finis. Av. Stud Height:
No. Rooms:
No. Bathrooms:
Pipework Lagging:
Comments:
Old furnace '

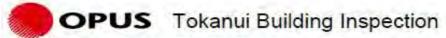

	Gen	eral	
Building:	Shed 8	Year Built:	Unknown
Footprint (m2)	20	Storeys:	1
Surveyed by:	NE, SD and AS	Survey Date:	16/02/2015
General Comments:			

Reinforced concrete blockReinforced concrete block Shiplap weatherboan			
Painted			
Reinforced concrete pe	erimeter footing Concrete slab		
Flat Roof Tin Ribbed			
Painted	Gutters Present:	yes	
0	Double Doors:	2	
0	Windows:	0	
2800	Soffit Width (mm):	300	
Stairs/Ramps Services	Road Powerlines		
	Painted Reinforced concrete per Flat Roof Tin Ribbed Painted 0 0 2800	Painted Reinforced concrete perimeter footing Concrete slab  Flat Roof Tin Ribbed Painted Gutters Present:  0 Double Doors: 0 Windows: 2800 Soffit Width (mm):	

2.4m steel chimney of furnace above roof line. There is a 1.2m high 12.6m long concrete block storage bay with concrete slab and a mesh fence joined to in situ concrete repair pit between shed 8 and the engineers office see photos

Wall Material:	Concrete Block		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):	2100	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	1	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	no
Comments:	•		
Old furnace housing			

	Env	vironmental	
Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:	By furnace	4	- 2
Water Valve Loc:			
Surrounding Features:	Trees[Vegetation		
Comments:			

Table 35: 868 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 68 - Boiler House, Ground Floor	Exterior	White	Wood	Fair	(EAN eASED 47,000

Table 14: 868 Summary of ACM Identified

Building & Floor	Location/Ro om Name	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B68, Ground Floor	12	Southern wall	Insulation material	High (11)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B68, Mezzanine	6	Above toilet/shower	Insulation material	Hegti (11)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B68, Ground Floor	1	Top of Boiler 3	Insulation	High (10)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B68, Ground Floor	3	Fuse cabinets to north wall	Rope	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B68, Mezzanine	1	Above boiler 3	Wire Insulation	Medium (7)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Roof	2	Roof	Fibre Cement	Very Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Ground Floor	1	Boiler 3	Rope	Very Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B68, Mezzanine	External	Wall Cladding	Fibre Cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Ground Floor	External	Soffits	Fibre Cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Ground Floor	1, 4, 12	Pipe flanges	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Ground Floor	Internal	Boiler House	Gaskets	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Mezzanine	Internal	Wall lining (throughout) and 9	Fibre cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B68, Ground Floor	1	Boiler 1	Insulation	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls using glovebag

# OPUS Tokanui Building Inspection

General				
Building:	Boiler House	Year Built:	Unknown	
Footprint (m2)	630	Storeys:	2 Basement	
Surveyed by:	NE and RS	Survey Date:	19/02/2015	
General Comments:				
Boiler mechanical and st	tructure for demo scoped b	y Graeme Salter, please at	tach his reports.	

Wall Material:	Concrete in situ Cem	Concrete in situ Cement sheet Galvanised steel			
Wall Finish:	Painted				
Foundation:	Reinforced concrete perimeter footing Concrete slab				
Roof Material:	Tin Ribbed				
Roof Finish:	Painted	Gutters Present:	yes		
Single Doors:	1	Double Doors:	4		
Ranchsliders:	5	Windows:	62		
Soffit Height (mm):		Soffit Width (mm):			
Surrounding Features:	Stairs/Ramps Awning	gs/Pergolas Services Road Powerline	es Other		
Comments:					
		rcase at west end of building to acce in canopy at average 8.5m high, 3 tin			

		ternal	_
Wall Material:	Timber Frame Hardbox	ard Concrete in situ	
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:			
Ceiling Material:	Hardboard		
Ceiling Finish:	Painted		-
Av. Stud Height (mm):	2750	Max. Stud Height (mm):	6500
Rooms of Max. Stud Heights		3	
No. Rooms:	112	No. Internal Doors:	8
No. Bathrooms:	1	No. Plant Rooms:	5
Pipework Lagging:	yes	Radiator Heating System:	no
Comments:	9	4	


Concrete column and I beam construction with timber purlins. High roof purlins appear to be clean solid Rimu. There are service trenches in the floor throughout, some are missing covers. Old chemical drums and containers present. Old batteries present. Lagged pipework overhead throughout. Valve house contains basement area with stagnant water flooding. Boiler stacks are solid concrete

	E	invironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Generator room		*
Water Valve Loc:			
Surrounding Features:	Vegetation		
Comments:			
Extreme risk of asbestos	and chemical conf	tamination.	

Table 15: B69 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B69, Roof	Roofing	Corrugated Sheet	Fibre cement	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B69, 1	External walls	Cladding	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B69, Roof	Roof to 12 Flue	Flue lining	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B69, Roof	Roof to 12 Flue	Bitumen Membrane	Bitumen Paper	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B69, Roof	Entrance Canopy	Waterproof Membrane	Bitumen	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

Table 36: B69 Summary of LBP Identified

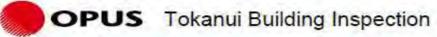

	Ger	neral	
Building:	Fire station	Year Built:	Unknown
Footprint (m2)	400	Storeys:	2
Surveyed by:	NE and SD	Survey Date:	13/02/2015
General Comments:			

Wall Material:	Reinforced concrete in	situ Reinforced concrete block Co	orrugated iron
Wall Finish:	Painted		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Pitched corrugated iron	Other	
Roof Finish:	None	Gutters Present:	no
Single Doors:	5	Double Doors:	4
Ranchsliders:	1	Windows:	23
Soffit Height (mm):	None	Soffit Width (mm):	None
Surrounding Features:	Stairs/Ramps Road	*	
Comments:	*		
Cannot see roof type			

Wall Material:	Timber Pannelling Pine	ex Seratone Concrete Block Concrete i	n situ
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	Carpet Lino Tiles		
Ceiling Material:	Pinex[Hardboard]Serat	tone Concrete	
Ceiling Finish:	Painted		
Av. Stud Height (mm):	3600	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	13	No. Internal Doors:	12
No. Bathrooms:	1	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:		400000000000000000000000000000000000000	3,80
1 internal room is a fridge a lot of stainless steel be			


	E	nvironmental	
Electricity Isolated:	yes	Water Isolated:	no
Distribution Board Loc:	Dining area		
Water Valve Loc:			
Surrounding Features:			
Comments:			

Table 37: B70 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 70 - Kitchen, Ground Floor	Interior	Green	Wood	Fair	LEAD PASED 38.000

#### Table 16: B70 Summary of ACM Identified

B70, Ground Floor  B70, B70, Mezzanine  Remove prior to d a licenced asbesto under Class B  Remove prior to d a licenced asbesto under Class B  Putty  Putty  Remove prior to d a licenced asbesto under Class B  Remove prior to d a licenced asbesto under Class B  Remove prior to d a licenced asbesto under Class B	s removalis controls emolition by
Mezzanine Ducting Sealant Putty (2) a licenced asbesto under Class B	
Pomove prior to d	The second secon
B70, Tunnels Basement Flanges Gaskets Gaskets Gaskets (2)  **Remove prior to de a licenced asbeste under Class B	
B70, Basement Concrete to tunnel roof  Tunnels Ceiling above concrete to tunnel roof  Cement sheet  Cement sheet  Cement sheet  Cement sheet  (4)  Remove prior to do a licenced aspesto under Class B	s removalis
B70, Ground Exterior Soffit Soffit Cement sheet (4) Rémove prior to de licenced asbesto under Class B	s removalis

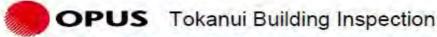

Durit din in		neral	Madagasan
Building:	Kitchen	Year Built:	Unknown
Footprint (m2)	780	Storeys:	1
Surveyed by:	SD and AS	Survey Date:	16/02/2015
General Comments:			

	EX	ternal	
Wall Material:	Concrete in situ		
Wall Finish:	Painted		
Foundation:	Concrete perimeter foo & Kitchens Only	ting with concrete piles Concrete S	Slab under Toilets
Roof Material:	Tin Ribbed		,
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	4	Double Doors:	5
Ranchsliders:	2	Windows:	37
Soffit Height (mm):	3900	Soffit Width (mm):	150
Surrounding Features:	Stairs/Ramps Road Co	ncrete Chimneys Other	
Comments:			
Mass rooftop ventilation :	system		

	In	ternal	
Wall Material:	Seratone Concrete in s	situ	
Wall Finish:	Painted Tile	7	
Floor Material:	Concrete		
Floor Finish:	Carpet Lino Tiles		
Ceiling Material:	Gib Plaster Concrete		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	2600	Max. Stud Height (mm):	2800
Rooms of Max. Stud Height:		12	
No. Rooms:	16	No. Internal Doors:	-8
No. Bathrooms:	2	No. Plant Rooms:	0
Pipework Lagging:	yes	Radiator Heating System:	yes
Comments:			


		nvironmental	
Electricity Isolated:	no	Water Isolated:	no
Distribution Board Loc:	Main room	4	
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:			

Table 17: B71 Summary of ACM identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B71, Ground Floor	External Fascia	Fascia	Fibre cement	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B71, Ground Floor	Room 4 Hot water cylinder cupboard	Wiring	Wrap	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B71, Ground Floor	Exterior to 3 South wall	Infill panels	Cement sheet	Low (5)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B71, Ground Floor	Rooms 1,6,7 Between Wall joins	Expansion gap	Sealant	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 38: B71 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 71 - Garages, Ground Floor	3,4,5	Blue	Wood and concrete	Fair	LEAD BASED
Building 71 - Garages, Ground Floor	Exterior	Red	Wood	Poor	LEAD-HASED 11,000
Building 71 - Garages, Ground Floor	Exterior	Blue	Metal	Intact	LEAD-BASED 7,700
rioti				(C)	1
			(0)	<i>y</i> ((	
		<	2/	101	
			\ \ \ \ \		

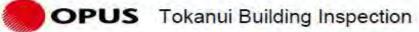

Building:	Garages	Year Built:	Unknown
Footprint (m2)	300	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	13/02/2015

Wall Material:	Reinforced concrete k	olock	
Wall Finish:	Painted		
Foundation:	Reinforced concrete p	perimeter footing Concrete slab	
Roof Material:	Tin Ribbed		
Roof Finish:	Painted	Gutters Present:	no
Single Doors:		Double Doors:	12
Ranchsliders:		Windows:	2
Soffit Height (mm):	3300	Soffit Width (mm):	1000
Surrounding Features	Road		
Comments:			

Wall Material:	Concrete Block		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	Lino Other		
Ceiling Material:	Gib PlasterjOther		
Ceiling Finish:	Painted		
Av. Stud Height (mm):	3000	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	8	No. Internal Doors:	6
No. Bathrooms:	1	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	yes
Comments:	•		


	nvironmental		
N/A	Water Isolated:	по	
Inside west end	-		
Trees Vegetation			
	N/A Inside west end	N/A Water Isolated:	N/A Water Isolated: no Inside west end

Table 39: B73 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 73 - Shed 7 by Laundry, Ground Floor	Exterior	White	Wood and concrete	Poor	LEAD BASES 1,600
Building 73 - Shed 7 by Laundry, Ground Floor	Exterior	Red	Metal	Intact	LEAD-BASED 91,000
Building 73 - Shed 7 by Laundry, Ground Floor	Exterior	Purple	Wood	Poor	LEAD-BASED 1,200
Building 73 - Shed 7 by Laundry, Ground Floor	Exterior	Yellow	Wood	Poor	(£40-64550 (3,000)

Table 18: 873 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B73, Ground Floor	Room 2, Large pipe run supports	Boxing	Fibre Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
					(0):
				10°C	
				) (	<b>(0)</b>
				1/1/	
				<b>O</b>	

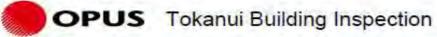

Concrete shed has pipework and service trench connecting to the laundry

	Ger	neral	
Building:	Shed 7	Year Built:	Unknown
Footprint (m2)	23	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	19/02/2015
General Comments:			

	Ex	ternal	
Wall Material:	Concrete in situ(Shipla	o weatherboard	
Wall Finish:	Painted		
Foundation:	Reinforced concrete pe	erimeter footing Concrete slab	
Roof Material:	Pitched corrugated iron	i a	
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	3	Double Doors:	
Ranchsliders:		Windows:	6
Soffit Height (mm):	2200	Soffit Width (mm):	100
Surrounding Features	: Services/Road		

Wall Material:	Timber Frame Concre	te in situ	
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:			
Ceiling Material:			
Ceiling Finish:			
Av. Stud Height (mm):	2200	Max. Stud Height (mm):	240
Rooms of Max. Stud Height:		2	
No. Rooms:	2	No. Internal Doors:	
No. Bathrooms:		No. Plant Rooms:	1
Pipework Lagging:	no	Radiator Heating System:	no
Comments:		***************************************	

	Er	nvironmental	
Electricity Isolated:	yes	Water Isolated:	N/A
Distribution Board Loc:	Timber shed		- 2
Water Valve Loc:			
Surrounding Features:	(1)		
Comments:			

Table 19: 874 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B74, Ground Floor	Rooms 2, 9, 11,12, 13 Pipe	Lagging	Insulation material	Medium (9)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B74, Ground Floor	Rooms 2 and 13 Ceiling	Ceiling lining	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B74, Ground Floor	Internal Flange	Gasket	Gasket	Very Low- (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B74, Ground Floor	Rooms 2 and 13 Wall	Wall lining	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B74, Roof	Exterior Roof to	Corrugated sheet	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B74, Ground Floor	Rooms 4,5,6, 9 Wall	Wall lining	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B74, Ground Floor	Exterior To Rooms 8, 10, 11, 12	Cladding	Cement sheet	Very Low (4)	Remove prior to demolition by a licenced aspestos removalist under Class B controls
B74, Ground Floor	Exterior Extension to loading bay southern elevation.	Cladding	Cement sheet	Very Law (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

#### Table 40: B74 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 74 - Laundry, Ground Floor	Interior	White	Concrete and wood	Poor	LEAD-BASED 00E.1
Building 74 - Laundry, Ground Floor	13	Blue	Concrete	Fair	LEAD-BASED LAIRI

# **OPUS** Tokanui Building Inspection

	Ger	neral	
Building:	Laundry	Year Built:	Unknown
Footprint (m2)	930	Storeys:	1
Surveyed by:	NE and SD	Survey Date:	13/02/2015
General Comments:			

Wall Material:	Concrete in situ		
Wall Finish:	Painted		
Foundation:	Reinforced concrete p	erimeter footing Concrete slab	
Roof Material:	Tin Ribbed		
Roof Finish:	Painted	Gutters Present:	yes
Single Doors:	1	Double Doors:	2
Ranchsliders:	4	Windows;	15
Soffit Height (mm):	0	Soffit Width (mm):	0
Surrounding Features:	Road Other	-	

South wall stud to roof top steel mesh reinforced glaas along entire length of southern wall. SE corner has loading bay with 2 x 6m high rollers. 4 roller doors marked as sliders, 2 of these are 6m high. Other surrounding features includes drainage and transformer shed with oil contamination but no

Wall Material:	Concrete in situ Seratone		
Wall Finish:	Painted		
Floor Material:	Concrete		
Floor Finish:	LinojNone		
Ceiling Material:	None		
Ceiling Finish:			
Av. Stud Height (mm):	2800	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	9	No. Internal Doors:	9
No. Bathrooms:	1	No. Plant Rooms:	1
Pipework Lagging:	yes	Radiator Heating System:	no
Comments:			-

Environmental							
Electricity Isolated:	yes	Water Isolated:	no				
Distribution Board Loc:	Room by itself, le	ft hand side in entrance corridor					
Water Valve Loc:							
Surrounding Features:	Trees/Vegetation						
Comments:							
Full of guano							

Table 41: 875 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
Building 75 - Doctors Flats, Ground Floor	Exterior	White	Wood	Intact	154D 6455D 73,000
Building 75 - Doctors Flats, Ground Floor	Exterior	Green	Metal	Intact	1EAD BASED 20,000

#### Table 20: B75 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
B75, Ground Floor	Room 13,17/18 Ceiling space Packing to flue	Insulation board	AIB	Low (6)	Remove prior to demolition by a licenced asbestos removalist under Class A controls
B75, Ground Floor	Room 4, 10 Floor	Floor lining	Vinyl	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls if via cu and drop". Otherwise remove under Class A controls
B75, Ground Floor	External Wall	Cladding	Fibre cement	Very Low (4)	Remove prior to demolition by a licenced asbestos removalist under class B controls
B75, Ground Floor	External Gable ends	Eaves	Fibre cement	Very Low	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B75, Ground Floor	External Soffit	Soffit	Fibre cement	Very Low	Remove prior to demolition by a licenced asbestos removalist under class B controls
B75, Ground Floor	Room 18 Wall	Electrical board	Board	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls or inspect once power is isolated
B75, Ground Floor	Room 19 Wall and ceiling	Lining	Cement sheet	Very Low (3)	Remove prior to demolition by a licenced asbestos removalist under Class B controls
B75, Ground Floor	Exterior Porch to 1, infill panel to 1 and infill panel to 11	Cladding	Fibre Cement	Very Low (2)	Remove prior to demolition by a licenced asbestos removalist under Class B controls

# OPUS Tokanui Building Inspection

	Ger	eral	-
Building:	Doctors Flats	Year Built:	1981/1982
Footprint (m2)	335	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	20/02/2015
General Comments: These flats are tenanted	_	journey pater	1 20:02:20

	<u> </u>	ternal				
Wall Material:	Brick Concrete in situ Cement sheet					
Wall Finish:	Painted Brick					
Foundation:	Concrete perimeter foo & Kitchens Only	Concrete permeter footing with concrete piles Concrete Slab under Toilet: & Kitchens Only				
Roof Material:	Pitched corrugated iron					
Roof Finish:	Painted	Gutters Present:	yes			
Single Doors:	5	Double Doors:	0			
Ranchsliders:	0	Windows:	27			
Soffit Height (mm):	3400	Soffit Width (mm):	600			
Surrounding Features:	Stairs/Ramps Awnings/ Chimneys Powerlines	Pergolas Services Road Concrete				
Comments:						

47m2 of concrete patio areas see photos. There is a insitu concrete retaining wall around the south and west side of the flats tapering from. 2m to 1.5m at highest point, aprox 28m long see photo. Old clothes lines x2 and old 10m2 shed slab at west side of flats.

Wall Finish:			tone
van Finish:	Painted Wallpaper Pre-	-finished sheeting	
loor Material:	Timber T/G	7 - 5 10 3 2	
loor Finish:	Carpet Lino		
Ceiling Material:	Gib Plaster Hardboard		
Ceiling Finish:	Painted	A de la companya de l	
Av. Stud Height (mm):	2450	Max. Stud Height (mm):	
Rooms of Max. Stud leight:			
lo. Rooms:	21	No. Internal Doors:	25
lo. Bathrooms:	3	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	no
Comments:			


Electricity Isolated:	no	Water Isolated:	no
Distribution Board Loc:	west wall flat one		
Water Valve Loc:			
Surrounding Features:	Trees Vegetation		
Comments:	V		


#### Table 21: B76 Summary of ACM Identified

Building & Floor	Location	Item/Suspect Material	Material Type	Material Risk Score	Recommended action
		No ACMs were ide	ntified or presumed	during the survey.	

#### Table 42: B76 Summary of LBP Identified

Building & Floor	Location	Colour	Substrate	Surface Condition	Lead Result (ppm)
	No lead-based pair	nt samples wer	e identified dur	ing the survey.	

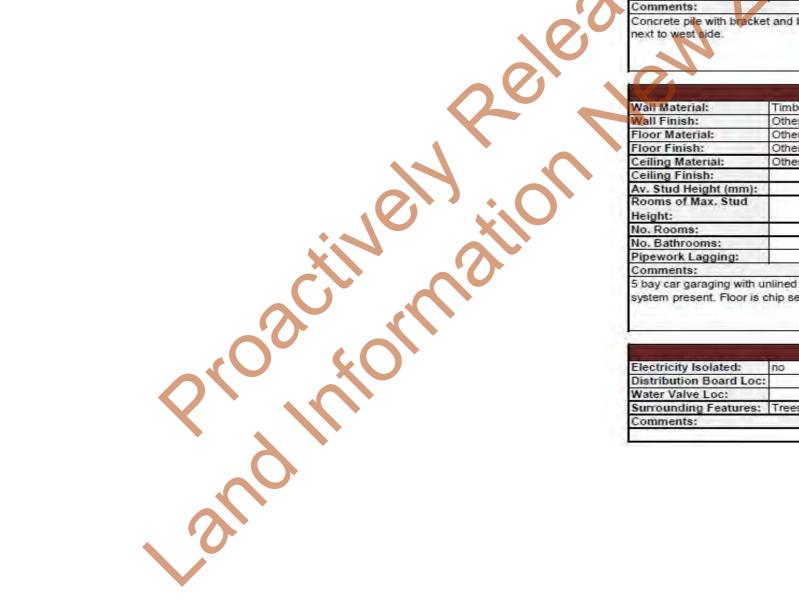

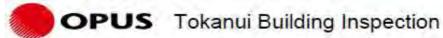

	Gene	ral	
Building:	Doctors Flats Garages	Year Built:	1981/1982
Footprint (m2)	112	Storeys:	1
Surveyed by:	NE and RS	Survey Date:	20/02/2015
General Comments:			

	Ex	ternai	
Wall Material:	Galvanised Steel		
Wall Finish:			
Foundation:	Concrete plinth with po	st brackets	
Roof Material:	Pitched corrugated iron	i e	
Roof Finish:	None	Gutters Present:	no
Single Doors:	0	Double Doors:	0
Ranchsliders:	0	Windows:	- 0
Soffit Height (mm):	2460	Soffit Width (mm):	200
Surrounding Features:	Services Road Fence		
Comments:			

Wall Material:	Timber Frame		
Wall Finish:	Other		
Floor Material:	Other		
Floor Finish:	Other		
Ceiling Material:	Other		
Ceiling Finish:			
Av. Stud Height (mm):	2380	Max. Stud Height (mm):	
Rooms of Max. Stud Height:			
No. Rooms:	5	No. Internal Doors:	0
No. Bathrooms:	0	No. Plant Rooms:	0
Pipework Lagging:	no	Radiator Heating System:	no
Comments:	*		

	E	nvironmental	
Electricity Isolated:	no	Water Isolated:	no
Distribution Board Loc:			
Water Valve Loc:			
Surrounding Features:	Trees[Vegetation	p.	
Comments:			

Appendix B

Wastewater Pipe Details in NW Wetland

#### Works in NW Wetland

								Dimension	S			
Pipe	Location	Description	L (m)	Dia (mm)	XS Area bgl (m2)	XS Vol bgl (m3)	Soil disturbance (m3)	Width (m)	Depth bgl	Split AG/BG	Notes	
Eastern	1	Above ground pipe on concrete bed	4.8				0.00					
		Below ground pipe, ~200-400mm deep x										
		500mm wide concrete bed	10	150	0.15		1.50	0.5	0.3			
	2	Pipe approx 50:50 split between above ground and in ground; in ground = concrete bed					1.10	0.5	0.2	0.5	5	
		Pipe on concrete bed	21	191	0.1		2.10		0.2			
		Pipe extends west underground and/or covered by vegetation; top of pipe ~240mm bgl	49				8.26	1	0.43		Assumed width = pipe of side	lia +100mm ea
		Pipe encased in concrete chamber	17				3.06		0.4			
		Concrete chamber at pipe junction	1.52		0.48		0.73		0.4			
Northern	6	Short section with concrete cradle	1.7				0.36		0.3			
		Rest on concrete bed	51.3				6.16		0.3			
Western	7	Pipe on concrete bed	129				15.48		0.3			
		Rest of pipe bgl, ranging from 0 to estimated 0.8m depth	55	191	0.1564	$\wedge$	8.60	0.391	0.4		Assumed avg depth = 4	00mm
Southern	8	Pipe support varies:										
		> concrete block 1	1.04	. (/)	0,1		0.10	0.5	0.2			
		> concrete block 2	0.64		0.108		0.07	0.54	0.2			
		> individual concrete piles	1.8		0.09		0.16	0.45	0.2		No = 4 L (ea) =	0.45 m
	9	> concrete blocks with metal brackets	26.4		0.2		5.28	1	0.2		No = 22 L (ea) =	1.2 m
		Total	392.2		O		53.0				,	
		Total		KOK				Avg	0.28			



Southern pipeline with footings



 $Southern\ pipeline\ with\ concrete\ casing$ 



Southern pipeline footings and concrete foundation



Southern pipeline with concrete pile



Pipeline situated on concrete foundation



Westernmost pipeline below ground level




Pipeline situated on concrete foundation



Concrete chamber connecting all four pipelines





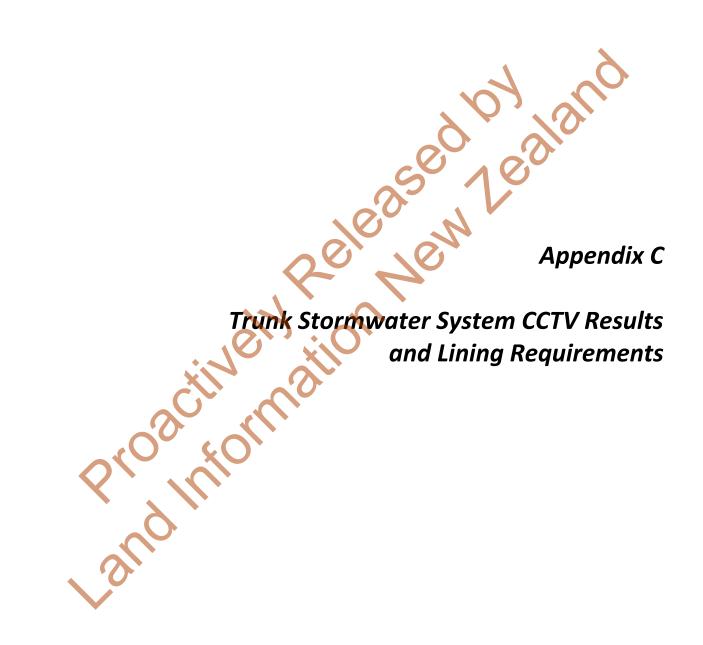

	Run	Distance from	Defect	Full Observation	Comments
Node 1 SWMH L.0	Node 2 SWMH L	Node 1 (m) 5.32	Holo	Ding holed, the hole has been repaired at 12 o'clock	
SVVIVITI L.U	SAAIAIL F	5.32	Hole	Pipe holed, the hole has been repaired at 12 o'clock Pipe holed, the hole is greater than 20% of the pipe	
		37.13	Hole	circumference and has not been repaired from 12 o'clock to 3	
				o'clock / Hole has been fixed	
		65.61	Lateral Issue	Lateral problem, large defect at 2 o'clock / Unknown water	
				running Lateral sealing faulty, evidence exist that the connection	
		69.67	Lateral Issue	between the lateral and the main pipe is leaking at 9 o'clock /	
				Water seeping in	
		69.99	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
SWMH L.1	SWMH L.0			No Defects recorded	
		48.44	Encrustation	Encrustation deposits, clear diameter is reduced by 10% to 25%	
SWMH L.2	SWMHL.1	40.44	Enerastation	from 6 o'clock to 9 o'clock	
		49.21	Lateral Issue	Lateral problem, large defect at 9 o'clock / Signs of ground	
		49.21	Laterarissue	water	
		60.78	Faulty Joint	Joint faulty, medium cracking or spalling, unlikely through the	
				pipe wall from 12 o'clock to 2 o'clock Joint faulty, minor cracking or spalling from 10 o'clock to 12	
		74.13	Faulty Joint	o'clock	
			Hole	Pipe holed, the hole has been repaired at 12 o'clock, end /	
		99.47		Lifting eye	
SWMH L.2	SWMH L.3	4.52	Hole	Pipe holed, the hole has been repaired at 12 o'clock Encrustation deposits, clear diameter is reduced by less than	
		4.66	Encrustation	10% from 4 o'clock to 8 o'clock	
		40.27	Faulty Joint	Joint faulty, minor cracking or spalling from 12 o'clock to 2	
		+∪.∠/	r durty JUIIIL	o'clock / tiny chip	
		44.68	Encrustation	Encrustation deposits, clear diameter is reduced by less than	
				10% from 12 o'clock to 2 o'clock / tiny chip Joint faulty, major cracking or spalling, likely through the pipe	
		50.19	Faulty Joint	wall from 3 o'clock to 6 o'clock / Roots protruding joint	
		50.19	Root intrusion	Root intrusion, roots restrict flow by 10% or less of full flow from 3	
		30.13	Noot intrasion	o'clock to 7 o'clock, start	
		52.96	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 6 o'clock / Roots protruding	
				Joint faulty, major cracking or spalling, likely through the pipe	
		54.62	Faulty Joint	wall from 4 o'clock to 8 o'clock / Roots protruding	
		57.42	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
			,	wall from 6 o'clock to 10 o'clock / Roots protruding joint	
		59.17	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 4 o'clock to 10 o'clock / Roots protruding joints	
		61.72	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		61.72	Root intrusion	Root intrusion, roots restrict flow by 10% or less of full flow from 3	
		-		o'clock to 7 o'clock  Joint faulty, major cracking or spalling, likely through the pipe	
SWMH L.3	SWMH L.4	0.24	Faulty Joint	wall from 12 o'clock to 6 o'clock	
			Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
		1.87	Taulty Joint	wall from 4 o'clock to 8 o'clock / tiny roots protruding	
		12.1	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		24.94	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		36.69 81.27	Hole Hole	Pipe holed, the hole has been repaired at 12 o'clock Pipe holed, the hole has been repaired at 12 o'clock	
		83.37	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		86.05	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
SWMH L.4	Inlet L.5			No Defects recorded	
CMANALL	CVAVAALLA	0.7	Faulty Joint	Joint faulty, minor cracking or spalling from 4 o'clock to 8 o'clock	
SWMH L.3	SWMH 1 L.3	2.14	Hole	/ Roots protruding joint Pipe holed, the hole has been repaired at 10 o'clock	
		9.55	Hole	Pipe holed, the hole has been repaired at 1 o'clock	
		12.46	Hole	Pipe holed, the hole has been repaired at 3 o'clock	
	_	17.57	Hole	Pipe holed, the hole has been repaired at 4 o'clock	
		20.11	Hole	Pipe holed, the hole has been repaired from 7 o'clock to 9 o'clock / Lifting eyes seeping water	
				Joint faulty, minor cracking or spalling from 12 o'clock to 11	
	ľ	59.23	Faulty Joint	o'clock	
		70.76	Faulty Joint	Joint faulty, minor cracking or spalling from 12 o'clock to 11	
				o'clock	
		72.33 73.43	Faulty Joint	Joint faulty, minor cracking or spalling from 1 o'clock to 7 o'clock	
			Faulty Joint	Joint faulty, minor cracking or spalling from 2 o'clock to 5 o'clock Encrustation deposits, clear diameter is reduced by less than	
		89.18	Encrustation	10% from 6 o'clock to 8 o'clock	
		96.71	Encrustation	Encrustation deposits, clear diameter is reduced by less than	
		30.71	Liiciustation	10% from 4 o'clock to 6 o'clock	
		108.36	Faulty Joint	Joint faulty, medium cracking or spalling, unlikely through the	
		100.50			
		110.58	Debris	pipe wall from 5 o'clock to 9 o'clock Debris greasy, small, clear diameter is reduced by less than	

		1		Encrustation deposits, clear diameter is reduced by less than	
SWMH 1L.3	Inlet 2L.3	0.53	Encrustation	10% from 4 o'clock to 10 o'clock	
		22.1	Root intrusion	Root intrusion, restrict flow by more than 25% of full flow from 3o'clock to 9 o'clock, start	
		25.68	Root intrusion	Root intrusion, restrict flow by more than 25% of full flow from 3	
		25.00		o'clock to 9 o'clock, end  Debris greasy, small, clear diameter is reduced by less than	
SWMH L.1	SWMH 1L.1	0.45	Debris	10% from 5 o'clock to 7 o'clock, start	
		5.42	Encrustation	Encrustation deposits, clear diameter is reduced by less than	
		6.89	Faulty Joint	10% from 3 o'clock to 7 o'clock Joint faulty, minor cracking or spalling from 2 o'clock to 3 o'clock	
		13.68	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		15.3	Encrustation	Encrustation deposits, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, start	
		17.75	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		57.79	Lateral Issue	Lateral sealing faulty, gaps between the lateral pipe and the main pipe that appear open at 12 o'clock	
		59.54	Lateral Issue	Lateral protruding, into the pipe by 10% to 25% of the diameter	
				of the pipe at 10 o'clock Joint faulty, major cracking or spalling, likely through the pipe	
		61.93	Faulty Joint	wall from 3 o'clock to 9 o'clock / Tiny root protruding	
		64.92	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 5 o'clock to 8 o'clock / Roots protruding joint	
		66.33	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		83.36	Lateral Issue	Lateral sealing faulty, small gaps between the lateral and the main pipe which are not open at 10 o'clock	
		86.03	Root intrusion	Root intrusion, roots restrict flow by 10% or less of full flow from 4	
		00.03	Noot merasion	o'clock to 8 o'clock, end / Protruding joints  Joint faulty, major cracking or spalling, likely through the pipe	
		92.02	Faulty Joint	wall from 4 o'clock to 7 o'clock / Roots protruding joint	
		99.31	Lateral Issue	Lateral sealing faulty, small gaps between the lateral and the main pipe which are not open at 11 o'clock	
		116.45	Hole	Pipe holed, the hole has been repaired at 12 o'clock	
		141.52	Faulty Joint	Joint faulty, medium cracking or spalling, unlikely through the	
		144.95	Faulty Joint	pipe wall from 11 o'clock to 1 o'clock Joint faulty, minor cracking or spalling at 5 o'clock	
		152.52	Debris	Debris greasy, small, clear diameter is reduced by less than	
		152.52	Francistation	10% from 5 o'clock to 7 o'clock, end Encrustation deposits, clear diameter is reduced by less than	
		152.52	Encrustation	10% from 4 o'clock to 8 o'clock, end	
SWMH 2L.1	SWMH 1L.1	10.5	Hole	Pipe holed, the hole has been repaired from 11 o'clock to 1 o'clock / Faulty lifting eye	
		47.54	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
		17.51	16	wall from 2 o'clock to 7 o'clock / Roots protruding joint Inspection abandoned / Unable to pass the same point 0	
			Obstruction	Lateral protruding, into the pipe by 10% to 25% of the diameter	Full pipe extent has not
SWMH 2L.1	SWMH 3L.1	36.87 0.8	Hole	of the pipe at 10 o'clock Pipe holed, the hole has been repaired at 12 o'clock	undergone CCTV
		4.83	Hole	Pipe holed, the hole has been repaired from 11 o'clock to 1	
		5.67	Faulty Joint	o'clock, start / Lifting eye  Joint faulty, minor cracking or spalling from 7 o'clock to 9 o'clock	
		7.74	Debris	Debris greasy, small, clear diameter is reduced by less than	
		110	XC	10% from 4 o'clock to 8 o'clock, start  Encrustation deposits, clear diameter is reduced by less than	
		17.74	Encrustation	10% from 7 o'clock to 9 o'clock	
		29.99	Hole	Pipe holed, the hole is up to 20% of the pipe circumference and has not been repaired from 11 o'clock to 1 o'clock	
		<b>'</b> \ \ \ \	Root intrusion	Root intrusion, roots restrict flow by 10% or less of full flow from 5	
		51.86	Root intrusion	o'clock to 7 o'clock	
		51.86	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 4 o'clock to 8 o'clock / Roots protruding joint	
		53.36	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
		<b>U</b> 20	Latoral Issue	wall from 2 o'clock to 7 o'clock / Roots protruding joint Lateral sealing faulty, gaps between the lateral pipe and the	
		55.38	Lateral Issue	main pipe that appear open at 3 o'clock	
		56.94	Faulty Joint	Joint faulty, medium cracking or spalling, unlikely through the pipe wall from 1 o'clock to 3 o'clock	
		67.94	Hole	Pipe holed, the hole is up to 20% of the pipe circumference and	
		82.42	Faulty Joint	has not been repaired at 12 o'clock Joint faulty, medium cracking or spalling, unlikely through the	
		02.42	r aurty John	pipe wall from 10 o'clock to 12 o'clock Pipe holed, the hole is up to 20% of the pipe circumference and	
		83.19	Hole	has not been repaired from 11 o'clock to 1 o'clock	
		83.82	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 12 o'clock to 10 o'clock	
		85.74	Hole	Pipe holed, the hole is up to 20% of the pipe circumference and	
				has not been repaired at 12 o'clock Encrustation deposits, clear diameter is reduced by less than	
		86.65	Encrustation	10% from 1 o'clock to 6 o'clock	
		88.2	Encrustation	Encrustation deposits, clear diameter is reduced by less than	
I	I	I		10% from 1 o'clock to 8 o'clock	I

.		137.48	Faulty Joint	Joint faulty, minor cracking or spalling at 3 o'clock	1
			Hole	Pipe holed, the hole has been repaired from 11 o'clock to 1	
SWMH 3L.1	Inlet 4L.1	1.91		o'clock / Lifting eye faulty Joint faulty, major cracking or spalling, likely through the pipe	
.		7.02	Faulty Joint	wall from 12 o'clock to 11 o'clock	
.			Hole	Pipe holed, the hole is up to 20% of the pipe circumference and	
.		23.4		has not been repaired from 11 o'clock to 1 o'clock Joint faulty, major cracking or spalling, likely through the pipe	
		24.6	Faulty Joint	wall from 12 o'clock to 11 o'clock	
SWMH 3L.1	Inlet 4L.1A	0.8	Faulty Joint	Joint faulty, minor cracking or spalling at 11 o'clock Pipe holed, the hole has been repaired from 11 o'clock to 1	
.		1.4	Hole	o'clock	
.		4.00	Hole	Pipe holed, the hole has been repaired from 11 o'clock to 1	
.		4.03		o'clock, start / Faulty lifting eye Joint faulty, major cracking or spalling, likely through the pipe	
.		9.4	Faulty Joint	wall from 6 o'clock to 9 o'clock / Rubber seal out	
.		20.11	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 8 o'clock to 10 o'clock	
.		34.27	Joint Displacement	Joint open, displacement is less than 20mm	
.		41.66	Hole	Pipe holed, the hole has been repaired from 11 o'clock to 1	
		41.66		o'clock, end / Faulty lifting eye Pipe holed, the hole has been repaired at 12 o'clock, start /	
SWMH L.0	SWMH N.0	0.99	Hole	Lifting eyes faulty, seeping water	
		28.08	Faulty Joint	Joint faulty, minor cracking or spalling from 1 o'clock to 3 o'clock	
.		48.84	Faulty Joint	Joint faulty, minor cracking or spalling from 12 o'clock to 2 o'clock	10
		52.42	Faulty Joint	Joint faulty, minor cracking or spalling from 11 o'clock to 1	
				o'clock Lateral problem, medium defect at 2 o'clock / Constant water	SO
		67.43	Faulty Joint	trickling in	
.		85.93	Lateral Issue	Lateral sealing faulty, gaps between the lateral pipe and the	
.		85.93	Lateral issue	main pipe that appear open at 10 o'clock / Water seeping in around latera	
.		95.94	Root intrusion	Root intrusion, roots restrict flow by 10% or less of full flow from 11	
.				o'clock to 1 o'clock / Roots coming through lifting eye Lateral problem, large defect at 3 o'clock / Ground water	
.		108.68	Lateral Issue	seeping through lateral	
.		110.52	Hole	Pipe holed, the hole has been repaired at 12 o'clock, end / Lifting eyes faulty, seeping water	
SWMH N.0	SWMH N.1	2.41	Joint Displacement	Joint displaced, more than 25% of pipe diameter	
.		2.41	Joint Displacement	Joint open, displacement is greater than 40mm	
.		7.19	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 7 o'clock / Roots protruding join	
.			Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
.		10.87	•	wall from 3 o'clock to 6 o'clock / Roots protruding joint  Joint faulty, major cracking or spalling, likely through the pipe	
.		17.91	Faulty Joint	wall from 3 o'clock to 5 o'clock / Roots protruding joint	
.		23.31	Cracking	Cracks multiple, small, visible but not open from 11 o'clock to 1 o'clock	
.		25.51	Faulty Joint	Joint faulty, minor cracking or spalling from 12 o'clock to 11	
.		28.55		o'clock / All joints	
.		31.96	Cracking	Crack longitudinal, small, visible but not open at 12 o'clock Joint faulty, minor cracking or spalling from 12 o'clock to 11	
.		37.00	Faulty Joint	o'clock / All joints	
.			Cracking	Pipe broken, damage extends 10% - 25% of circumference, displaced by less than half the pipe wall thickness from 11	
.		39.39		o'clock to 1 o'clock	
.		40.49	Lateral Issue	Lateral protruding, into the pipe by more than 25% of the diameter of the pipe at 3 o'clock	
			Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
SWMH N.1	SWMH N.2	37.66		wall from 4 o'clock to 8 o'clock / Tiny rootsprotruding joint  Joint faulty, major cracking or spalling, likely through the pipe	
		48.81	Faulty Joint	wall from 4 o'clock to 8 o'clock / Roots protruding	
		40.04	Cracking	Crack longitudinal, medium, crack open but there is no	
		48.81	Obstance:	evidence that the crack extends to the outside wall at 12 o'clock	Full pipe extent has not
		58.45	Obstruction	Debris obstruction - unable to pass	undergone CCTV
SWCP J.0	Main	0.7	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe wall from 1 o'clock to 3 o'clock / Seal visable	
		2.07	Faulty Joint	Joint faulty, medium cracking or spalling, unlikely through the	
SWCP J.1	SWCP J.0	2.07 3.15	Faulty Joint	pipe wall from 8 o'clock to 12 o'clock  Joint faulty, minor cracking or spalling from 1 o'clock to 9 o'clock	
5.VC: J.1	34VC1 J.U	3.13		Joint faulty, minor cracking or spalling from 8 o'clock to 9 0 clock  Joint faulty, minor cracking or spalling from 8 o'clock to 10	
		8.67	Faulty Joint	o'clock	
		12.35	Faulty Joint	Joint faulty, minor cracking or spalling from 11 o'clock to 1 o'clock	
		47.0:	Faulty Joint	Joint faulty, major cracking or spalling, likely through the pipe	
.		17.84		wall from 1 o'clock to 3 o'clock / Seal visable Pipe holed, the hole is up to 20% of the pipe circumference and has	
			Hole		

			Cavity	Tomo, a cavity is evident outside of the pipe wall. from 11	
		19.59	Cavity	o'clock to 1 o'clock	
			Faultu laint	Joint faulty, major cracking or spalling, likely through the pipe	
	21.63 Faulty Join		raulty Joint	wall from 3 o'clock to 6 o'clock / Seal visable	
		23.38	Faulty Joint	Joint faulty, minor cracking or spalling from 7 o'clock to 9 o'clock	

Repairs required to be confirmed

Proactively Released Dy land
Proactive Dy land



Comments

CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

# Section Inspection - 28/03/2023 - MH L.0 To MH L

Section No.	Asset No.	Contract Number	Date	Time	Weather
39	MH L.0 To MH L	1	28/03/2023	12:26 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

Line Length	69.99 m	Material	Concrete pre cast	Use	Stormwater
Setup	Upstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	69.99 m	Dia/Height	900 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	900 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	ard Cleaning Status	
U/S Node	SWMH L.0		D/S Node	SWMH L	
U/S Node Type	Stormwater manhol	е	D/S Node Type	Stormwater misce	ellaneous
U/S Pipe Depth	2.24 m		D/S Pipe Depth		
U/S Location			D/S Location		

Unable to get depth from the downstream end

	1:550	m +	ос	Observation	MPEG	Photo	Score
s	WMH L.0			25019	30		
(		0.00	IS	Inspection start, node reference: MH L.0	00:00:00		
		5.32 S02	CF	Construction feature at 12 o'clock, start / Lateral connection	00:01:23	MH L.0 To MH L_bc5c82b	
		5.32 S01	PHS	Pipe holed, the hole has been repaired at 12 o'clock, start	00:01:24	MH L.0 To MH L_ccd6a42	
		12.03	CF	Construction feature from 1 o'clock to 3 o'clock / Lateral connection	00:03:51	MH L.0 To MH L_f12a781	
		14.32	GC	General comment / General condition photo	00:04:28	MH L.0 To MH L_194c1ef	
		20.60	GC	General comment / General condition photo	00:05:45	MH L.0 To MH L_0e8bd7	
		28.16	CF	Construction feature from 2 o'clock to 4 o'clock / Lateral connection	00:07:15	MH L.0 To MH L_ddd0d9	
<b>*</b>		37.13	PHL	Pipe holed, the hole is greater than 20% of the pipe circumference and has not been repaired from 12 o'clock to 3 o'clock / Hole has been fixed	00:09:13	MH L.0 To MH L_058c85e	40
		41.59	ec	General comment / Geneal condition photo	00:10:54	MH L.0 To MH L_c681fdc	
		51.27	GC	General comment / General condition photo	00:12:19	MH L.0 To MH L_8597e2	
		61.14	GC	General comment / General condition photo	00:13:57	MH L.0 To MH L_d2a1a6	
		64.43	CF	Construction feature from 2 o'clock to 4 o'clock / Lateral connection	00:14:35	MH L.0 To MH L_673f452	
		65.61	LXL	Lateral problem, large defect at 2 o'clock / Unknown water running	00:14:59	MH L.0 To MH L_1ab971	30
		68.56	CF	Construction feature from 9 o'clock to 11 o'clock / Lateral connection	00:16:05	MH L.0 To MH L_c29b95e	
		69.67	LFL	Lateral sealing faulty, evidence exist that the connection between the lateral and the main pipe is leaking at 9 o'clock / Water seeping in	00:16:35	MH L.0 To MH L_e52ca46	25




CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

### Section Inspection - 28/03/2023 - MH L.0 To MH L

Section No.	Asset No.	Contract Number	Date	Time	Weather
39	MH L.0 To MH L	1	28/03/2023	12:26 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

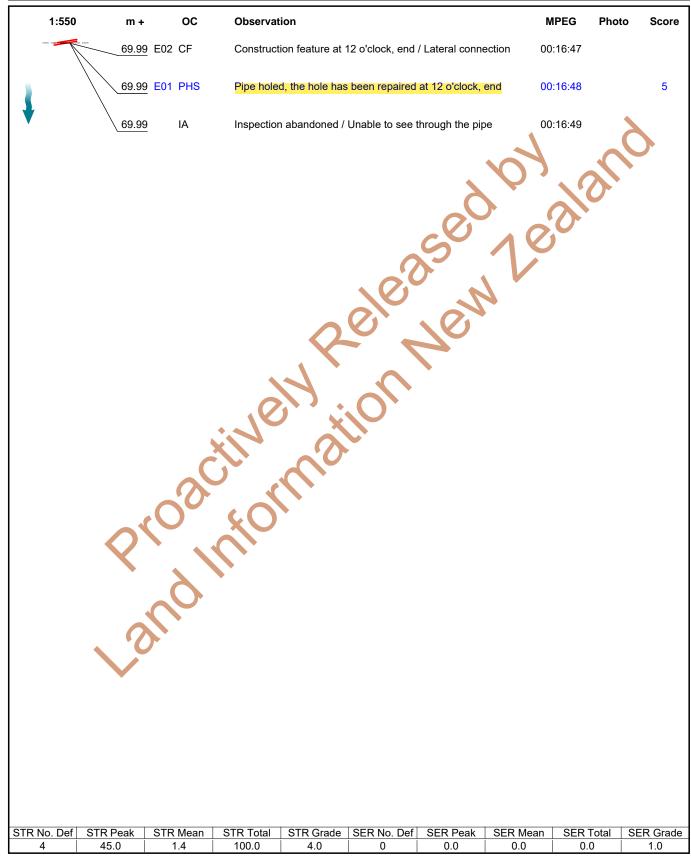





Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.0 To MH L	39




MH L.0 To MH L\_bc5c82b4-6374-44e7-a6f7-cb496a6223fa\_20230328\_1228 01\_777.jpg, 00:01:23, 5.32m




MH L.0 To MH L\_ccd6a429-5123-49b0-ae58-c01bc82ff87d\_20230328\_1228 09\_508.jpg, 00:01:24, 5.32m



MH L.0 To MH L\_f12a7810-30b6-4208-aef4-d6ce680feeeb 20230328\_12305 6\_656.jpg, 00:03:51, 12:03m

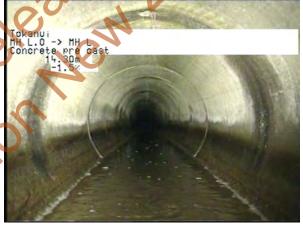

MH L.0 To MH L\_194c1efd-790c-4c0f-ac9c-e8a3ff83501b\_20230328\_123141 \_927.jpg, 00:04:28, 14:32m

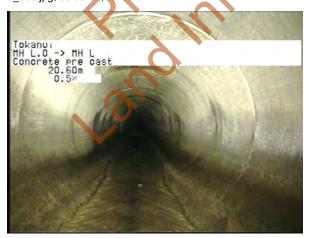

MH L.0 To MH L\_0e8bd76d-7a14-4391-8c30-2cdb63caf836\_20230328\_1233 06\_887.jpg, 00:05:45, 20.60m



MH L.0 To MH L\_ddd0d91a-fb41-455c-ab15-3b164221f884\_20230328\_1234 45\_310.jpg, 00:07:15, 28.16m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.0 To MH L	39




MH L.0 To MH L\_058c85ea-b3dd-40c2-9b21-4372abf15b57\_20230328\_1236 53\_311.jpg, 00:09:13, 37.13m




MH L.0 To MH L\_b9e0d909-04d6-43b8-a1a1-f0d21ae873c3\_20230328\_1237 32\_159 jpg, 00:09:13, 37.13m

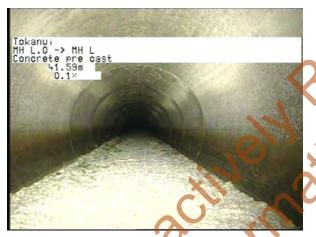

MH L.0 To MH L\_c681fdcc-d3b5-4cdf-903f-81a6f0852f94\_20230328\_123845 \_352.jpg, 00:10:54, 41.59m

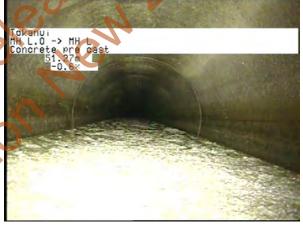

MH L.0 To MH L\_8597e2b6-2e19-4c18-8e50-f8c2c716f355\_20230328\_1240 35\_665.jpg, 00:12:19, 51.27m

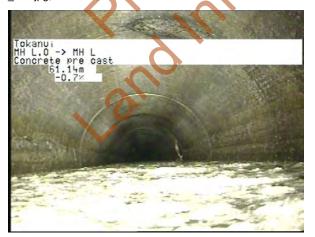

MH L.0 To MH L\_d2a1a6bf-1e08-4414-83f0-34183da806f6\_20230328\_12422 1\_712.jpg, 00:13:57, 61.14m



MH L.0 To MH L\_673f452c-867c-44e7-b695-37a5a3c08713\_20230328\_1243 07\_284.jpg, 00:14:35, 64.43m





CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.0 To MH L	39



MH L.0 To MH L\_1ab9717d-4439-4e6c-a20a-3a59d6fb6d44\_20230328\_1243  $55\_554.\rm{jpg},\,00:14:59,\,65.61m$ 



MH L.0 To MH L\_c29b95e2-5e53-4228-9a9b-15aed35940d1\_20230328\_124 515\_306.jpg, 00:16:05, 68.56m




MH L.0 To MH L\_e52ca460-30ce-4dc8-aef2-f443ef434d10\_20230328\_12463 1\_365.jpg, 00:16:35, 69.67m



# Section Inclination - 28/03/2023 - MH L.0 To MH L

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.0 To MH L	28/03/2023	12:26 pm	CST Group	Tokanui		Upstream node	67.75 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	900 mm	900 mm	SWMH L.0	SWMH L	0.000 m	1.163 m	-1.716 %

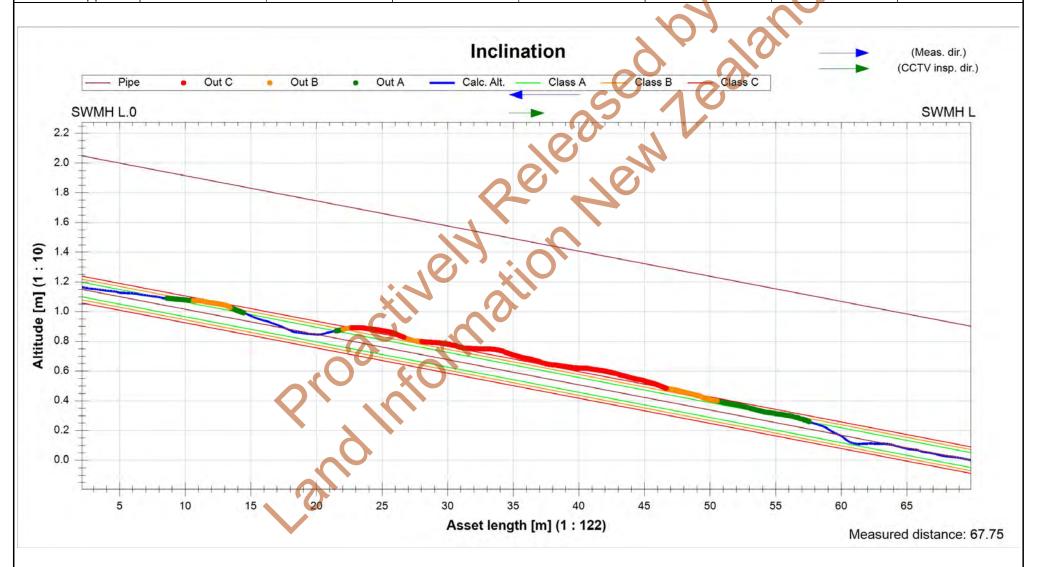




**CST Group Ltd** Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 28/03/2023 - MH L.1 To MH L.0

Section No.	Asset No.	Contract Number	Date	Time	Weather
38	MH L.1 To MH L.0	1	28/03/2023	12:17 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

Line Length	36.10 m	Material	Concrete pre cast	Use	Stormwater
Setup	Upstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	35.70 m	Dia/Height	800 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	800 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	SWMH L.1		D/S Node	SWMH L.0	
U/S Node Type	Stormwater manhol	е	D/S Node Type	Stormwater node	•
U/S Pipe Depth	2.90 m		D/S Pipe Depth	2.24 m	
U/S Location			D/S Location		
Comments			-	M 7	

oc 1:285 m + Observation

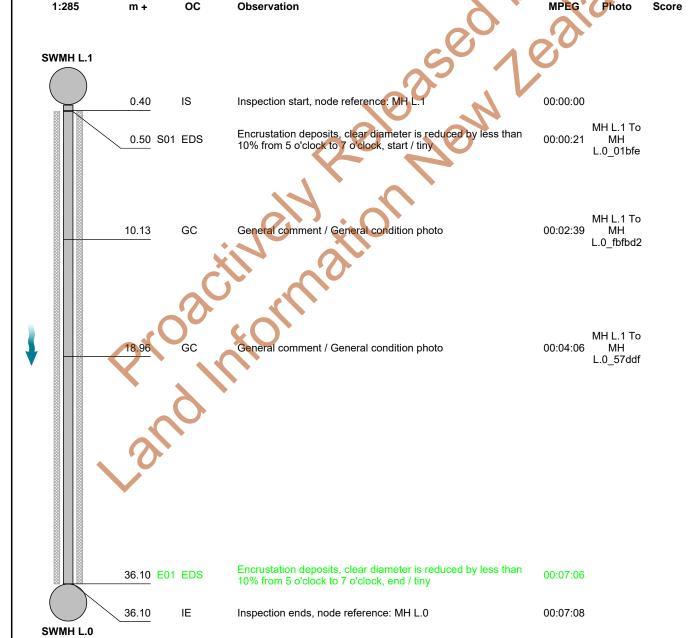

STR Grade | SER No. Def | SER Peak

0

0.0

SER Mean

0.0

SER Total

0.0

STR Mean

0.0

STR Total

1.0

0.0

STR No. Def STR Peak

SER Grade

1.0





Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.1 To MH L.0	38



MH L.1 To MH L.0\_01bfe479-5985-457c-a0fb-1c946f6e2a24\_20230328\_121 819\_172.jpg, 00:00:21, 0.50m



MH L.1 To MH L.0\_fbfbd21c-d50d-4f33-9bf1-b65d759c40e9\_20230328\_1220 48\_867 jpg, 00:02:39, 10.13m




L.0\_57ddf494-7e4a-4875-9188-35cb15678539\_20230328\_12 2222\_671.jpg, 00:04:06, 18.96m



# Section Inclination - 28/03/2023 - MH L.1 To MH L.0

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							<u> </u>
Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.1 To MH L.0	28/03/2023	12:17 pm	CST Group	Tokanui		Upstream node	31.05 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	SWMH L.1	SWMH L.0	0.000 m	0.567 m	-1.827 %

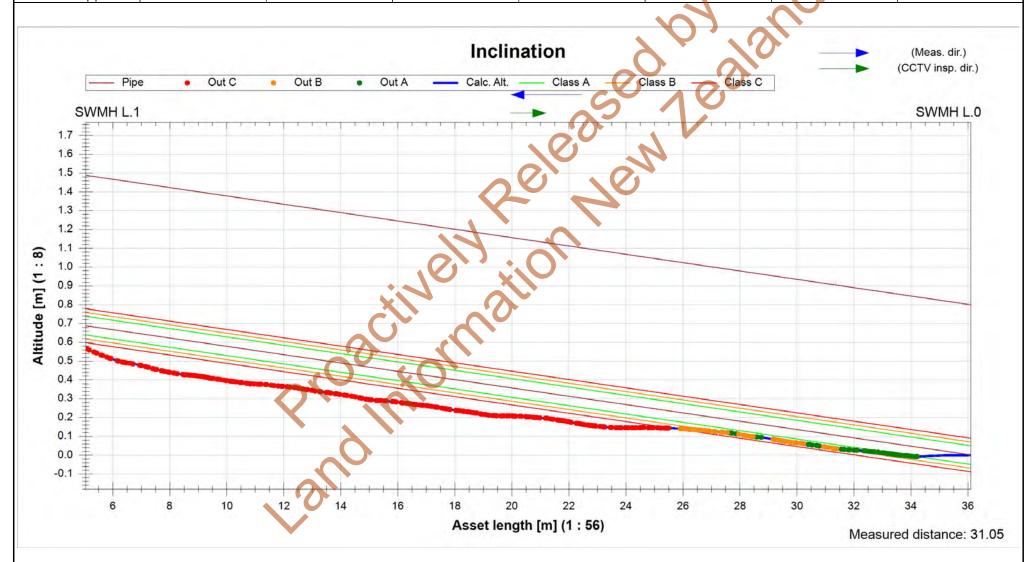



CST Group Ltd , Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 28/03/2023 - MH L.2 To MH L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
37	MH L.2 To MH L.1	1	28/03/2023	11:37 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

99.47 m	Material	Concrete pre cast	Use	Stormwater
Upstream node	Shape	Circular pipe	Pipe Status	Original condition
98.97 m	Dia/Height	800 mm	Currency	<b>Current Inspection</b>
0.00 m	Width	800 mm	Inspection	Inspection complete
	Location	Private property - ya	rc Cleaning Status	
SWMH L.2	-	D/S Node	SWMH L.1	
Stormwater manhole	)	D/S Node Type	Stormwater manhole	•
2.20 m		D/S Pipe Depth	2.90 m	
		D/S Location		
	Upstream node 98.97 m 0.00 m SWMH L.2 Stormwater manhole	Upstream node 98.97 m Dia/Height 0.00 m Width Location  SWMH L.2 Stormwater manhole	Upstream node         Shape         Circular pipe           98.97 m         Dia/Height         800 mm           0.00 m         Width         800 mm           Location         Private property - ya           SWMH L.2         D/S Node           Stormwater manhole         D/S Node Type           2.20 m         D/S Pipe Depth	Upstream node Shape Circular pipe Pipe Status  98.97 m Dia/Height 800 mm Currency  0.00 m Width 800 mm Inspection  Location Private property - yard Cleaning Status  SWMH L.2 D/S Node SWMH L.1  Stormwater manhole  2.20 m D/S Pipe Depth 2.90 m

Comments MPEG 1:577 m + OC Observation Score 00:00:00 SWMH L.2 0.50 IS Inspection start, node reference: MH L.2 MH L.2 To Construction feature at 12 o'clock, start / Lifting eye 00:00:12 0.50 S01 CF MH L.1\_bf9ab MH L.2 To Pipe holed, the hole has been repaired at 12 o'clock, start / 00:00:28 0.50 S02 PHS MH Lifting eye L.1\_20ebe MH L.2 To 10.53 GC General comment / General condition photo 00:03:55 MH L.1\_5de91 MH L.2 To Encrustation deposits, clear diameter is reduced by less than 20.26 S03 EDS 00:06:14 MH 10% from 4 o'clock to 8 o'clock, start L.1\_16023 MH L.2 To 20.26 GC General comment / General condition photo 00:06:19 MH L.1 1812c MH L.2 To 30.11 GC General comment / General condition photo 00:08:38  $\mathsf{MH}$ L.1 ecea2 MH L.2 To 41.22 General comment / General condition photo 00:11:12 MH L.1 7db50 MH L.2 To Construction feature from 8 o'clock to 10 o'clock / Lateral 48.15 00:12:53 CF  $\mathsf{MH}$ L.1 2b036 MH L.2 To Encrustation deposits, clear diameter is reduced by 10% to 25% 00:14:12 48.44 5 MH from 6 o'clock to 9 o'clock L.1\_d89c9 MH L.2 To Lateral problem, large defect at 9 o'clock / Signs of ground 49.21 00:13:47 30 MH L.1\_f1743 MH L.2 To GC General comment / General condition photo 00:15:01 50.86 MH L.1\_5c75d MH L.2 To Joint faulty, medium cracking or spalling, unlikely through the 60.78 **JFM** 00:18:10 10 MH pipe wall from 12 o'clock to 2 o'clock L.1 efb44 MH L.2 To 00:18:44 60.78 GC General comment / General condition photo MH L.1\_87119 MH L.2 To Construction feature from 11 o'clock to 1 o'clock / Lateral 62.90 CF 00:20:10 MH connection L.1\_849fa MH L.2 To 00:23:16 72.19 GC General comment / General condition photo MH

L.1\_05f56




## **CST Group Ltd**

Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

# Section Inspection - 28/03/2023 - MH L.2 To MH L.1

Section No. Asset No.		Contract Number	Date	Time	Weather
37	MH L.2 To MH L.1	1	28/03/2023	11:37 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group		-	Fraser Thomas

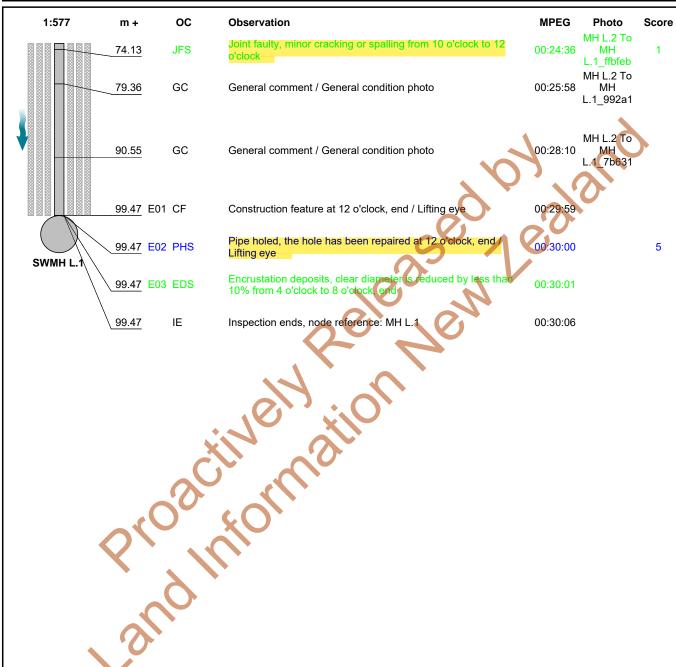

STR Peak

STR Mean

0.5

STR Total

46.0

4.0

STR Grade | SER No. Def | SER Peak

SER Mean

0.1

5.0

SER Total

5.0

STR No. Def

SER Grade

2.0






Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.2 To MH L.1	37



MH L.2 To MH L.1\_bf9ab755-a0ee-4834-9b76-2dec664be48e\_20230328\_11 3745\_386.jpg, 00:00:12, 0.50m



MH L.2 To MH L.1\_20ebec42-80a7-4b70-bc9c-0acc7b94c2ef\_20230328\_113 819\_493.jpg, 00.00:28, 0.50m

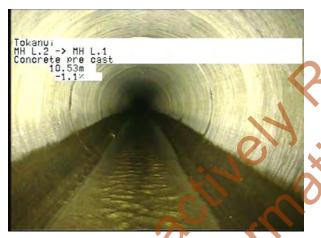


MH L.2 To MH L.1\_5de9122a-2035-4069-bf26-f079979d5ad5\_20230328\_114 157\_754.jpg, 00:03:55, 10.53m



MH L.2 To MH L.1\_16023d8f-7f34-4f61-87cd-a060305a2e5e\_20230328\_114 430\_558.jpg, 00:06:14, 20.26m



MH L.2 To MH L.1\_1812caa0-d4a0-44e8-bd95-4cbe5cc6e1a2\_20230328\_11 4454\_982.jpg, 00:06:19, 20.26m

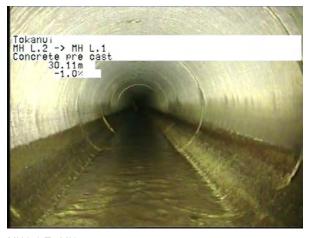


MH L.2 To MH L.1\_ecea2b43-d4e0-4411-be2f-42ea484c9973\_20230328\_11 4733\_026.jpg, 00:08:38, 30.11m





Town or Suburb	Date	Asset No.	Section No.	•
Tokanui	28/03/2023	MH L.2 To MH L.1	37	

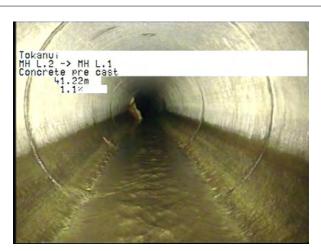

MH L.2 To MH L.1\_7db502fc-657b-4ba8-ba6f-37cb63ced641\_20230328\_115 013\_724.jpg, 00:11:12, 41.22m




MH L.2 To MH L.1\_2b036aa8-bd7c-4b10-ac49-301e16fa4047\_20230328\_11 5220\_452.jpg, 00:12:53, 48.15 m



MH L.2 To MH L.1\_d89c90f5-4912-4b08-a357-afea7510f596\_20230328\_115 456\_292.jpg, 00:14;12, 48.44m



MH L.2 To MH L.1\_f1743155-69ae-4a14-957b-195c700051c6\_20230328\_11 5338\_028.jpg, 00:13:47, 49.21m

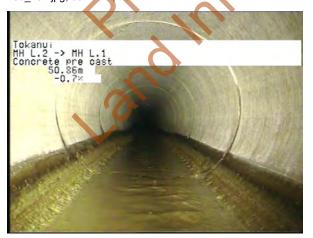

MH L.2 To MH L.1\_5c75dd65-c56b-47f9-96e8-593603864276\_20230328\_11 5552\_877.jpg, 00:15:01, 50.86m



MH L.2 To MH L.1\_efb44499-721b-4229-8c4f-42665233aa51\_20230328\_115 911\_584.jpg, 00:18:10, 60.78m






Town or Suburb	Date	Asset No.	Section No.	
Tokanui	28/03/2023	MH L.2 To MH L.1	37	



MH L.2 To MH L.1\_3a461e8f-6cd9-40f8-bed3-cd2fc278f286\_20230328\_1201 09\_510.jpg, 00:18:10, 60.78m

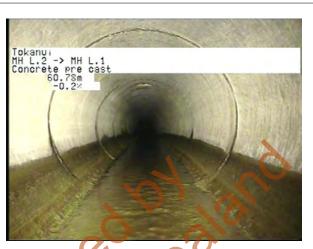


MH L.2 To MH L.1\_871192d3-4982-43f0-86ab-6d695a16e812\_20230328\_12 0028\_336.jpg, 00:18:44, 60.78m



MH L.2 To MH L.1\_849fab06-2ce5-4837-b552-7d49813f3271\_20230328\_120 204\_715.jpg, 00:20:10, 62.90m



MH L.2 To MH L.1\_68bb6ee9-5d17-4b5a-9c18-8d08dc184668\_20230328\_12 0226\_030.jpg, 00:20:10, 62.90m

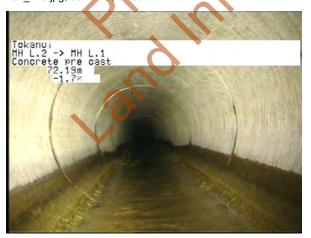

MH L.2 To MH L.1\_05f56b3c-4af3-4120-90a2-48c31bdc07a0\_20230328\_120 519\_428.jpg, 00:23:16, 72.19m




MH L.2 To MH L.1\_ffbfebbb-dd82-4ab3-be30-caf043b25dee\_20230328\_1206 45\_556.jpg, 00:24:36, 74.13m



#### **CST Group Ltd**

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.2 To MH L.1	37

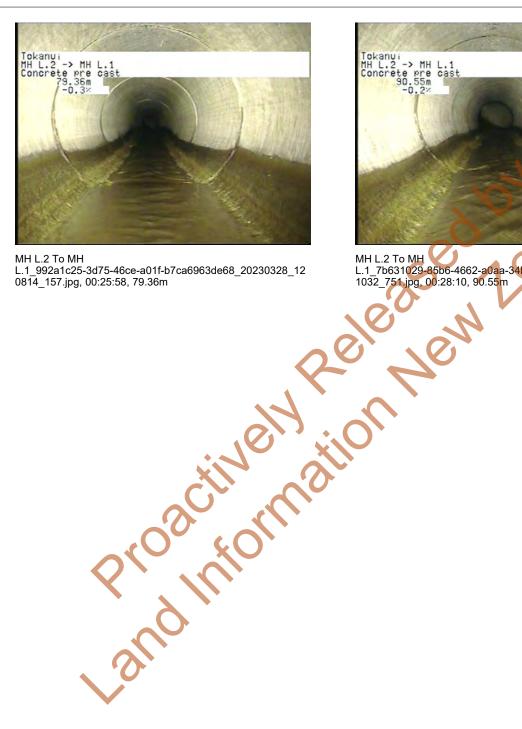

MH L.2 To MH L.1\_992a1c25-3d75-46ce-a01f-b7ca6963de68\_20230328 12 0814\_157.jpg, 00:25:58, 79.36m




MH L.2 To MH L.1\_7b631029-85b6-4662-a0aa-34b32d2fd38b\_20230328\_12



# Section Inclination - 28/03/2023 - MH L.2 To MH L.1

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.2 To MH L.1	28/03/2023	11:37 am	CST Group	Tokanui		Upstream node	97.10 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	SWMH L.2	SWMH L.1	0.000 m	1.800 m	-1.854 %

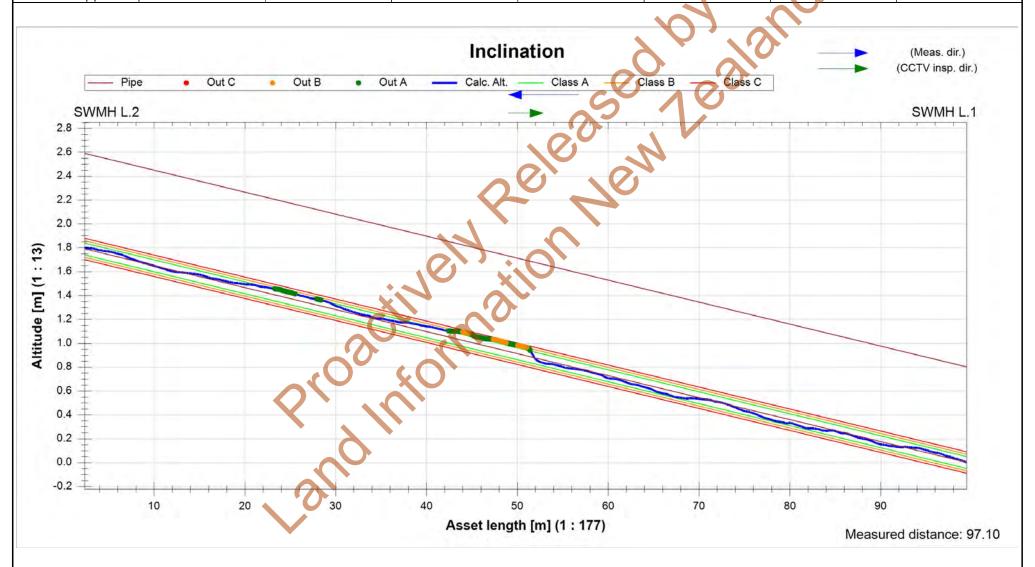



**CST Group Ltd** Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

## Section Inspection - 28/03/2023 - MH L.2 To MH L.3

Section No.	Asset No.	Contract Number	Date	Time	Weather
40	MH L.2 To MH L.3	1	28/03/2023	1:46 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group		_	Fraser Thomas
		•		•	

Line Length	61.72 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	60.92 m	Dia/Height	800 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	800 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	arc Cleaning Status	
U/S Node	SWMH L.3		D/S Node	SWMH L.2	
U/S Node Type	Stormwater manhole		D/S Node Type	Stormwater manhole	
U/S Pipe Depth	2.60 m		D/S Pipe Depth	2.20 m	
U/S Location			D/S Location		

Comments MPEG 1:424 m + OC Observation Photo Score 00:00:00 SWMH L.2 0.80 IS Inspection start, node reference: MH L.2 MH L.2 To Construction feature at 12 o'clock, start / Lifting eye 00:01:15 4.52 S02 CF MH L.3\_b5486 MH L.2 To 4.52 S01 PHS Pipe holed, the hole has been repaired at 12 o'clock, start 00:01:15 MH L.3\_f987bf MH L.2 To Encrustation deposits, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock 4.66 **EDS** 00:01:36 MH L.3\_986ca MH L.2 To General comment / General condition photo 00:03:45 9.89 GC MH L.3\_838cb MH L.2 To General comment / General condition photo 19.91 GC 00:06:49 MH L.3 4e1ad MH L.2 To 31.40 GC General comment / General condition photo 00:09:40 MH L.3 01678 MH L.2 To Encrustation deposits, clear diameter is reduced by less than 32.49 00:10:10 MH 10% from 3 o'clock to 6 o'clock L.3 56833 MH L.2 To 38.30 General comment / General condition photo 00:11:54 MH GC L.3 20816 MH L.2 To Joint faulty, minor cracking or spalling from 12 o'clock to 2 40.27 00:13:08 MH 1 o'clock / tiny chip L.3 64599 MH L.2 To Encrustation deposits, clear diameter is reduced by less than 44.68 EDS 00:14:00 MH 10% from 6 o'clock to 8 o'clock L.3\_d4aa0 MH L.2 To 49.96 GC 00:15:12 General comment / General ocndition photo MH L.3\_e372a MH L.2 To Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 6 o'clock / Roots protruding joint 50.19 **JFL** 00:16:16 25 MH L.3 7a485 MH L.2 To Root intrusion, roots restrict flow by 10% or less of full flow from 00:16:18 50.19 S03 RIS MH 3 o'clock to 7 o'clock, start L.3\_a2773 MH L.2 To 51.12 GC General comment / General condition photo 00:16:02 MH L.3\_c4df61 MH L.2 To Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 6 o'clock / Roots protruding

52.96

**JFL** 

25

00:16:55

MH

L.3\_29f25



**CST Group Ltd** , Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 28/03/2023 - MH L.2 To MH L.3

Section No.	Asset No.	Contract Number	Date	Time	Weather
40	MH L.2 To MH L.3	1	28/03/2023	1:46 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

1:424	m +	ос	Observation	MPEG	Photo	Score
	54.62	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 4 o'clock to 8 o'clock / Roots protruding	00:17:18	MH L.2 To MH L.3_50faec	25
	57.42	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 6 o'clock to 10 o'clock / Roots protruding joint	00:18:30	MH L.2 To MH L.3_03e73	25
	59.17	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 4 o'clock to 10 o'clock / Roots protruding joints	00:18:46	MH L.2 To MH L.3_8bfc96	25
SWMH L.3	61.72	E02 CF	Construction feature at 12 o'clock, end / Lifting eye	00:19:53	200	
	61.72	E01 PHS	Pipe holed, the hole has been repaired at 12 o'clock, end	00:19:54	O	5
\	61.72	E03 RIS	Root intrusion, roots restrict flow by 10% or less of full flow from 3 o'clock to 7 o'clock, end	00:19:55		5
	61.72	ΙE	Inspection ends, node reference: MH L.3	00:19:56		
	Q'					

STR Mean

STR Total

4.0

131.0

STR Grade | SER No. Def | SER Peak

5.0

STR No. Def

SER Grade

2.0

SER Total

5.0

SER Mean

0.1






Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.2 To MH L.3	40



MH L.2 To MH L.3\_b5486849-fbf5-4630-8596-273ccbec6469\_20230328\_134 815\_657.jpg, 00:01:15, 4.52m



MH L.2 To MH L.3\_f987bf23-4756-4827-ae23-684241dcd8ca\_20230328\_134 826\_521\_jpg, 00.01:15, 4.52m

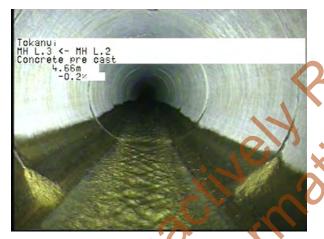

MH L.2 To MH L.3\_986ca93e-b1a9-4261-9fe1-2494c373453f\_20230328\_134 937\_188.jpg, 00:01:36, 4.66m



MH L.2 To MH L.3\_838cbd75-93b0-4437-922b-ec6b662c3dd9\_20230328\_13 5257\_735.jpg, 00:03:45, 9.89m



MH L.2 To MH L.3\_4e1ad88c-6513-485a-8ae7-f95aea91eb4e\_20230328\_13 5616\_257.jpg, 00:06:49, 19.91m



MH L.2 To MH L.3\_0167836e-dc1a-4ab9-8c15-90217fcd2ad6\_20230328\_14 0015\_663.jpg, 00:09:40, 31.40m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.2 To MH L.3	40



MH L.2 To MH L.3\_568339f8-f189-43ca-bc6b-fe03ac71797e\_20230328\_140 056\_140.jpg, 00:10:10, 32.49m




MH L.2 To MH L.3\_20816295-8f31-4580-ae7c-6c200e2ecbbd\_20230328\_14 0247\_469.jpg, 00:11:54, 38.30m



MH L.2 To MH L.3\_64599a16-9a20-4a6e-8d0f-d6710a681735\_20230328\_14 0454\_459.jpg, 00:13:08, 40.27m



MH L.2 To MH L.3\_d4aa0fbd-a310-427e-bb5c-b73b1572e744\_20230328\_14 0554\_236.jpg, 00:14:00, 44.68m

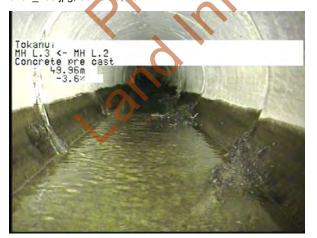

MH L.2 To MH L.3\_e372af21-6ca6-4a1f-ac4a-0894e8a8c844\_20230328\_140 718\_267.jpg, 00:15:12, 49.96m



MH L.2 To MH L.3\_7a485f99-6caa-477c-ae76-26ec77a4d9a1\_20230328\_14 0843\_916.jpg, 00:16:16, 50.19m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	28/03/2023	MH L.2 To MH L.3	40



MH L.2 To MH L.3\_a277394f-7fb6-450e-b345-6d2dd3481bd6\_20230328\_140 854\_849.jpg, 00:16:18, 50.19m



MH L.2 To MH L.3\_c4df61e2-5b78-483f-9ea5-b42eaed0fa8d\_20230328\_140 814\_580.jpg, 00:16:02, 51.12m



MH L.2 To MH L.3\_29f251b6-5a99-48cb-8bd7-bfa904795369\_20230328\_140 942\_137.jpg, 00:16:55, 52.96m



MH L.2 To MH L.3\_50faec17-9592-40c3-b72e-967ba7ed3250\_20230328\_14 1021\_428.jpg, 00:17:18, 54.62m



MH L.2 To MH L.3\_03e73cab-167b-4032-b96d-6a3dc889c008\_20230328\_14 1144\_508.jpg, 00:18:30, 57.42m




MH L.2 To MH L.3\_8bfc9669-19e9-44fe-be56-2918c2d705ac\_20230328\_141 218\_604.jpg, 00:18:46, 59.17m



# Section Inclination - 28/03/2023 - MH L.2 To MH L.3

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							<b>0</b> ,
Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.2 To MH L.3	28/03/2023	1:46 pm	CST Group	Tokanui		Downstream node	60.59 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	SWMH L.3	SWMH L.2	0.000 m	0.489 m	0.807 %

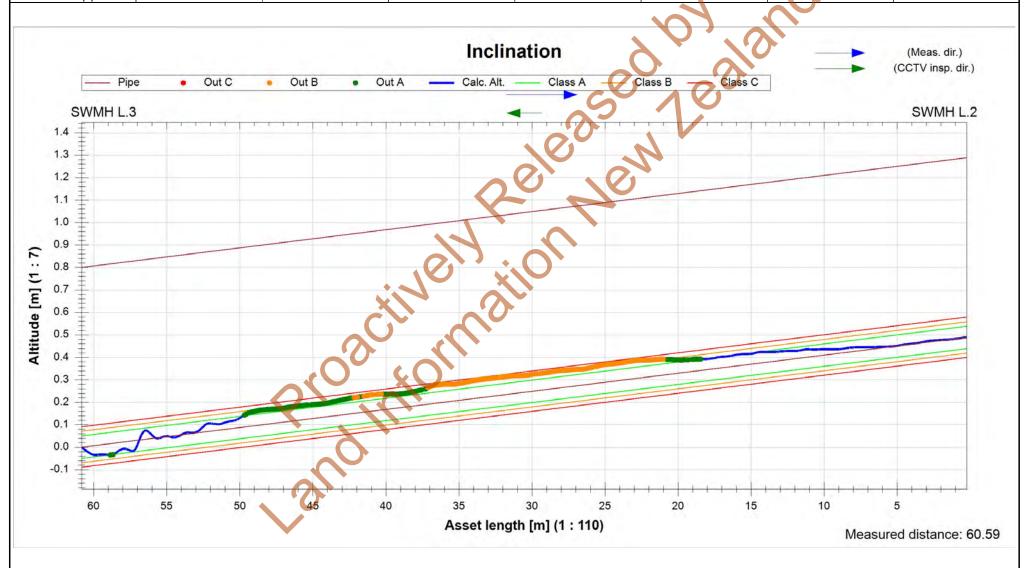



CST Group Ltd , Cambridge Tel. 07 827 9161 cctv @cstgroup.co.nz

# Section Inspection - 4/04/2023 - MH L.3 To MH L.4

Section No.	Asset No.	Contract Number	Date	Time	Weather
14	MH L.3 To MH L.4	1	4/04/2023	9:27 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	99.87 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	99.67 m	Dia/Height	800 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	800 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	SWMH L.4		D/S Node	SWMH L.3	
U/S Node Type	Stormwater manhole		D/S Node Type	Stormwater manhole	
U/S Pipe Depth	3.20 m		D/S Pipe Depth	2.60 m	
U/S Location			D/S Location		
			'	107	4

Comments						
1:420	m +	ос	Observation	MPEG	Photo	Score
SWMH L.3	0.20	IS	Inspection start, node reference: SWMH L3	00:00:00		
	0.24	JOM	Joint open, displacement is 20mm to 40mm	00:01:33	MH L.3 To MH L.4_9483e	5
	0.24	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 12 o'clock to 6 o'clock	00:01:35	MH L.3 To MH L.4_acd75	25
	1.87	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 4 o'glock to 8 o'clock / tiny roots protruding	00:02:46	MH L.3 To MH L.4_e2f87	25
	4.33 SC	)1 DGS	Debris greasy, small, clear diameter is reduced by less than 10% from 5 c'clock to 7 o'clock, start	00:03:51	MH L.3 To MH L.4_95ba2	
	11.73	GC 💃	General comment / General condition photo	00:05:15	MH L.3 To MH L.4_d6136	
	12.10	CF	Construction feature at 12 o'clock / Lifting eye	00:05:26	MH L.3 To MH L.4_4eba1	
<b>♦ H</b>	12.10	PHS	Pipe holed, the hole has been repaired at 12 o'clock	00:05:27	MH L.3 To MH L.4_03d75	5
	23.76	GC	General comment / General condition photo	00:07:46	MH L.3 To MH L.4_da1d5	
	24.94	CF	Construction feature at 12 o'clock / lifting eye	00:08:08	MH L.3 To MH L.4_c95fa5	
	24.94	PHS	Pipe holed, the hole has been repaired at 12 o'clock	00:08:19	MH L.3 To MH L.4_55d71	5
	30.99	GC	General comment / General condition photo	00:09:46	MH L.3 To MH L.4_6a7c9f	
	36.69	CF	Construction feature at 12 o'clock / Lifting eye faulty	00:10:29	MH L.3 To MH L.4_63eab	
	36.69	PHS	Pipe holed, the hole has been repaired at 12 o'clock	00:10:31	<b>.</b>	5
	38.54	GC	General comment / General condition photo	00:11:32	MH L.3 To MH L.4_c9c74	
\	48.32	GC	General comment / General condition photo	00:13:15	MH L.3 To MH L.4_f287f1	




CST Group Ltd , Cambridge Tel. 07 827 9161

Tel. 07 827 9161 cctv@cstgroup.co.nz

# Section Inspection - 4/04/2023 - MH L.3 To MH L.4

Section No.	Asset No.	Contract Number	Date	Time	Weather
14	MH L.3 To MH L.4	1	4/04/2023	9:27 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

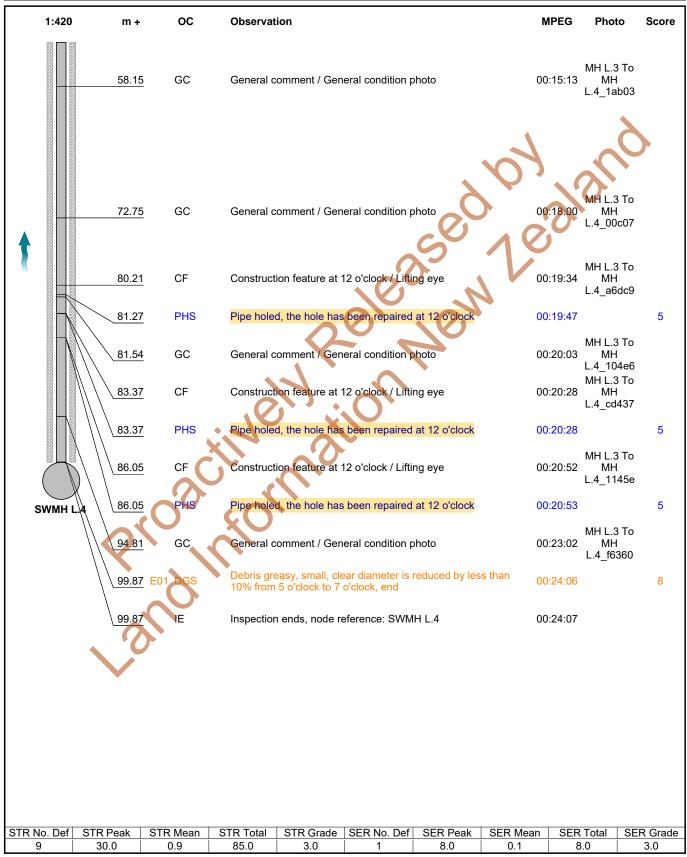





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH L.4	14



MH L.3 To MH L.4\_9483e21f-fbf2-4525-84ac-cde70fca9a8b\_20230404\_0929 22\_705.jpg, 00:01:33, 0.24m



MH L.3 To MH L.4\_acd751df-e779-47b3-9dc6-eb01e40c7129\_20230404\_09 2932\_514.jpg, 00:01:35, 0.24m



MH L.3 To MH L.4\_e2f87596-29fe-4ec1-934e-0f3ccad4d5b2\_20230404\_093 057\_865.jpg, 00:02;46, 1.87m



MH L.3 To MH L.4\_95ba27fa-0b01-46ac-bbcb-ec2fe721d773\_20230404\_093 219\_100.jpg, 00:03:51, 4.33m



MH L.3 To MH L.4\_a4b88312-16c3-479b-aef9-69c133b0f164\_20230404\_093 233\_851.jpg, 00:03:51, 4.33m



MH L.3 To MH L.4\_d6136215-d14d-4474-84f1-c046939e6261\_20230404\_09 3413\_023.jpg, 00:05:15, 11.73m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH L.4	14




MH L.3 To MH L.4\_4eba152a-e6ac-4849-9cd8-310ac2841de4\_20230404\_09 3436\_287.jpg, 00:05:26, 12.10m



MH L.3 To MH L.4\_03d758d2-c9f0-4aed-bd14-6ea585a74467\_20230404\_09 3442\_339.jpg, 00:05:27, 12.10m



MH L.3 To MH L.4\_da1d5de0-ffa4-4fbd-9279-205495244872\_20230404\_093 709\_030.jpg, 00:07:46, 23.76m

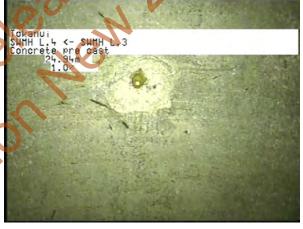

MH L.3 To MH L.4\_c95fa51e-953b-4745-a434-022365713ad3\_20230404\_09 3737\_811.jpg, 00:08:08, 24.94m



MH L.3 To MH L.4\_55d716a5-7160-45a6-b9e2-5e59cd11868a\_20230404\_09 3753\_136.jpg, 00:08:19, 24.94m



MH L.3 To MH L.4\_6a7c9fea-2cca-49db-b36a-38717db22a9c\_20230404\_093 927\_545.jpg, 00:09:46, 30.99m



Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH L.4	14




MH L.3 To MH L.4\_63eaba63-f480-494e-adec-0f2d2e46468f\_20230404\_094 020\_895.jpg, 00:10:29, 36.69m



MH L.3 To MH L.4\_c9c748e8-9ef1-4a3c-851e-9fd03abd3631\_20230404\_094 133\_210.jpg, 00.11:32, 38.54m



MH L.3 To MH L.4\_f287f16f-eca9-47be-a283-cfe61ffd1641\_20230404\_09432 3\_061.jpg, 00:13:15, 48.32m

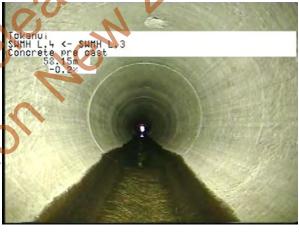

MH L.3 To MH L.4\_1ab034b0-4456-4136-93f3-79203cee5797\_20230404\_09 4533\_346.jpg, 00:15:13, 58.15m



MH L.3 To MH L.4\_00c0760c-1fa4-4709-9b65-66771ccc44d4\_20230404\_094 827\_863.jpg, 00:18:00, 72.75m




MH L.3 To MH L.4\_a6dc95f5-03b6-4d4d-9bc4-2a3672d0ecac\_20230404\_095 010\_400.jpg, 00:19:34, 80.21m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH L.4	14

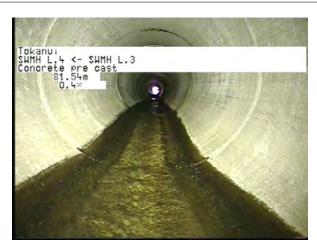

MH L.3 To MH L.4\_104e6884-0071-49e3-9eb9-a2205b0c45ce\_20230404\_09 5100\_027.jpg, 00:20:03, 81.54m



MH L.3 To MH L.4\_cd437be2-9ea3-414e-b7ee-161ba26f5424\_20230404\_09 5133\_886.jpg, 00:20:28, 83.37 m



MH L.3 To MH L.4\_1145e1e5-58c4-4518-9f96-9c7287b2e87d\_20230404\_09 5212\_284.jpg, 00:20:52, 86.05m




MH L.3 To MH L.4\_f6360997-c065-4c52-9205-3b60b91c3178\_20230404\_09 5435\_038.jpg, 00:23:02, 94.81m



### Section Inclination - 4/04/2023 - MH L.3 To MH L.4

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							0 ,
Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.3 To MH L.4	4/04/2023	9:27 am	CST Group	Tokanui		Downstream node	98.29 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	SWMH L.4	SWMH L.3	0.000 m	0.134 m	0.136 %

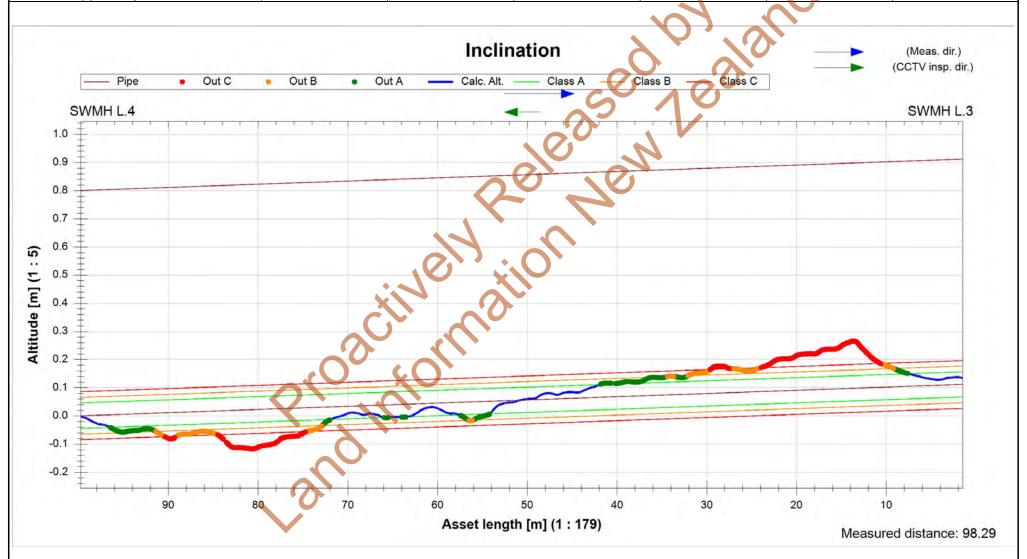



**CST Group Ltd** Cambridge


Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH L.4 To Inlet

Section No.	Asset No.	Contract Number	Date	Time	Weather
15	MH L.4 To Inlet	1	4/04/2023	9:57 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	27.68 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	27.68 m	Dia/Height	800 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	800 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	Inlet L.5		D/S Node	SWMH L.4	
U/S Node Type	Stormwater inlet		D/S Node Type	Stormwater manhole	
U/S Pipe Depth			D/S Pipe Depth	3.20 m	
U/S Location			D/S Location		
Comments					

oc 1:218 m + Observation Score SWMH L.4

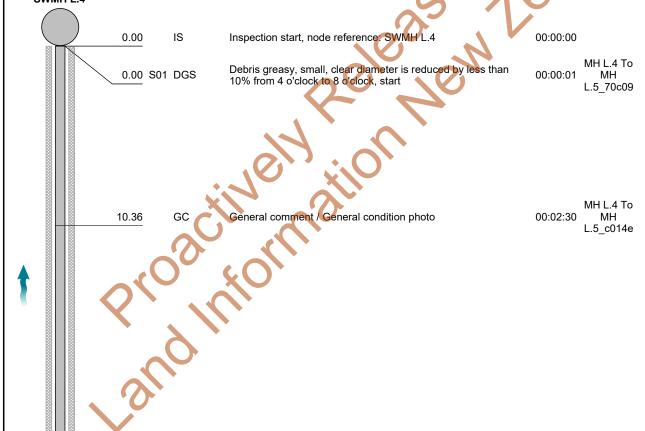

MH L.4 To МН 00:05:34 L.5\_92d46

Debris greasy, small, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, end

8.0

Inspection ends, node reference: SWMH L.5

General comment / Inlet half full

00:05:47

8

SER Grade

3.0

STR Grade | SER No. Def | SER Peak STR No. Def STR Peak STR Mean STR Total 0.0 0.0 0.0 1.0

ΙE

27.68 E01 DGS

GC

00:05:49

0.3

SER Mean SER Total 8.0

Inlet L.5

26.87

27.68





### Section Pictures - 4/04/2023 - MH L.4 To Inlet

Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.4 To Inlet	15



MH L.4 To MH L.5\_70c0984e-f9b5-458c-8f39-eecd9a836a59\_20230404\_095 710\_366.jpg, 00:00:01, 0.00m



MH L.4 To MH
L.5\_c014e1cd-ee90-404a-9d96-e6b505e72d05\_20230404\_09
5955\_739.jpg, 00:02:30, 10.36m




MH L.4 To MH L.5\_92d4635b-d2a6-45ae-8fe8-9bb89ba7f701\_20230404\_100 304\_576.jpg, 00:05:34, 26.87m



### Section Inclination - 4/04/2023 - MH L.4 To Inlet

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.4 To Inlet	4/04/2023	9:57 am	CST Group	Tokanui		Downstream node	25.68 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	Inlet L.5	SWMH L.4	0.000 m	-0.519 m	-2.020 %

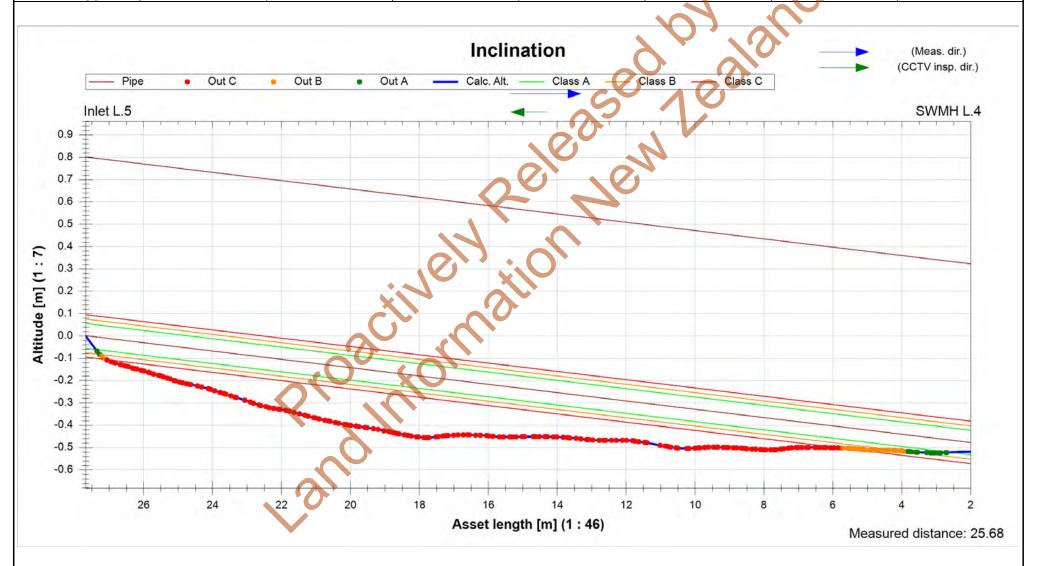



CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH L.3 To MH 1L.3

Section No.	Asset No.	Contract Number	Date	Time	Weather
16	MH L.3 To MH 1L.3	1	4/04/2023	10:27 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	110.58 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	109.88 m	Dia/Height	675 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	675 mm	Inspection	Inspection complete
Surface		Location	Private property - yar	Cleaning Status	
U/S Node	SWMH 1L.3		D/S Node	SWMH L.3	
U/S Node Type	Stormwater manhole		D/S Node Type	Stormwater manhole	
U/S Pipe Depth	2.90 m		D/S Pipe Depth	2.60 m	
U/S Location			D/S Location		

O/O LOGGIOTI			D/O Eddalon			
Comments						
1:384	m +	ОС	Observation	MPEG	Photo	Score
CWML 1 2				20)		
SWMH L.3	0.70	IS	Inspection start, node reference: MH L.3	00:00:00		
	0.70	CF	Construction feature from 8 o'clock to 10 o'clock / Lateral connection	00:00:09	MH L.3 To MH 1L.3_97d0	
	0.70	JFS	Joint faulty, minor cracking or spalling from 4 o'clock to 8 o'clock / Roots protruding joint	00:00:26	MH L.3 To MH 1L.3_69bc	1
	0.70	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 4 o'clock to 8 o'clock / Roots protruding joint	00:01:21	MH L.3 To MH 1L.3_3b63	25
	2.14	PHS	Pipe holed, the hole has been repaired at 10 o'clock	00:02:15	MH L.3 To MH 1L.3_8f31	5
	2.53	CF	Construction feature at 10 o'clock / Lifting eye	00:02:25		
	8.83	CF	Construction leature from 1 o'clock to 2 o'clock / Lifting eye	00:04:00	MH L.3 To MH 1L.3_752a	
	9.55	PHS	Pipe holed, the hole has been repaired at 1 o'clock	00:04:14	MH L.3 To MH 1L.3_0da7	5
	11.71	CF	Construction feature at 3 o'clock / Lifting eye	00:05:19	MH L.3 To MH 1L.3_fa5b	
	12.46	PHS	Pipe holed, the hole has been repaired at 3 o'clock	00:05:33	MH L.3 To MH 1L.3_0ecd	5
	14.73	GC	General comment / General condition photo	00:06:02	MH L.3 To MH 1L.3_32b6	
	17.57	S01 DGS	Debris greasy, small, clear diameter is reduced by less than 10% from 5 o'clock to 7 o'clock, start	00:06:57	MH L.3 To MH 1L.3_81ca	
	17.57	PHS	Pipe holed, the hole has been repaired at 4 o'clock	00:06:59	MH L.3 To MH 1L.3_7968	5
	20.11	PHS	Pipe holed, the hole has been repaired from 7 o'clock to 9 o'clock / Lifting eyes seeping water	00:07:37	MH L.3 To MH 1L.3_0be5	5
\	21.02	GC	General comment / General condition photo	00:07:50	MH L.3 To MH 1L.3_29ce	
	31.84	GC	General comment / General condition photo	00:10:19	MH L.3 To MH 1L.3_3f09	




CST Group Ltd , Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH L.3 To MH 1L.3

Section No.	Asset No.	Contract Number	Date	Time	Weather
16	MH L.3 To MH 1L.3	1	4/04/2023	10:27 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

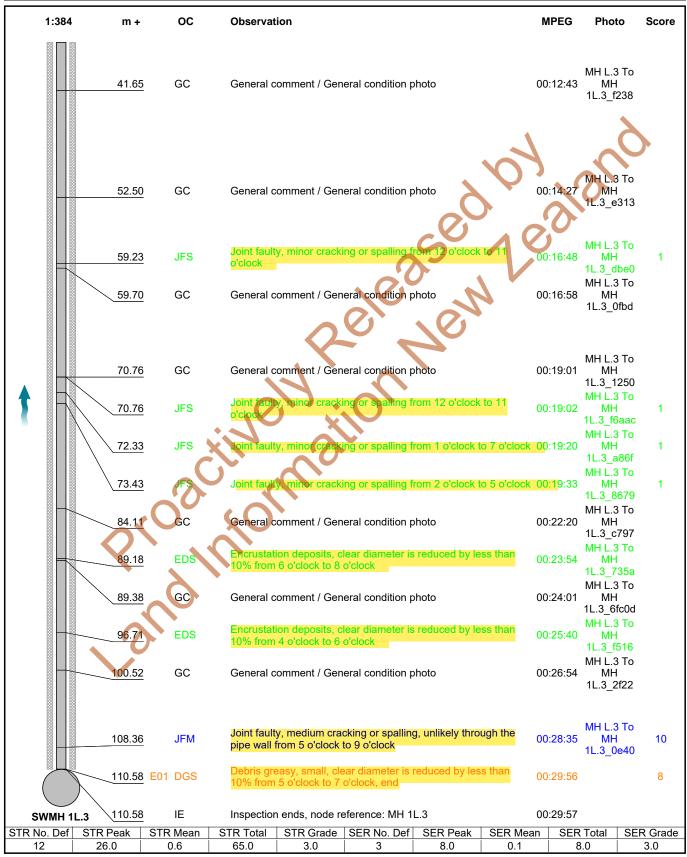





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH 1L.3	16



MH L.3 To MH 1L.3\_97d0d5ca-abb6-436f-91d0-db6672ef513a\_20230404\_10 2815\_967.jpg, 00:00:09, 0.70m



MH L.3 To MH 1L.3\_69bcc7ab-8059-4ba9-80e0-7c9783bc7058\_20230404\_1 02846\_035.jpg, 00:00:26, 0.70 m



MH L.3 To MH 1L.3\_3b63cc1a-fda2-4980-80ac-24fcff635840\_20230404\_102 957\_802.jpg, 00:01:21, 0.70m



MH L.3 To MH 1L.3\_8f3149b8-46b5-47b3-a989-f6b5b56313f4\_20230404\_10 3057\_801.jpg, 00:02:15, 2.14m



MH L.3 To MH 1L.3\_b089e72a-b609-48d1-850c-a5fc0d352078\_20230404\_1 03106\_821.jpg, 00:02:15, 2.14m



MH L.3 To MH 1L.3\_752af1d2-ad7e-493d-9bd1-af300831cc88\_20230404\_10 3303\_226.jpg, 00:04:00, 8.83m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH 1L.3	16




MH L.3 To MH 1L.3\_0da7215c-217b-462b-a9d5-e333d2ba599c\_20230404\_1 03322\_565.jpg, 00:04:14, 9.55m


Tokanui MH 1L.3 <- MH L.3 Concrete pre cast 12.46m -0.12



MH L.3 To MH 1L.3\_0ecd87f5-1820-486d-8d32-f001d87cf676\_20230404\_10 3459\_359.jpg, 00:05:33, 12.46m

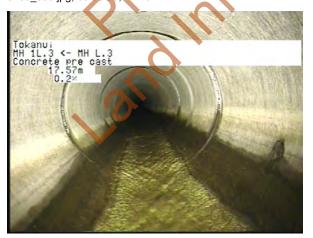

MH L.3 To MH 1L.3\_81ca6150-c54d-46d4-87ae-a1ad59e814ac\_20230404\_1 03641\_628.jpg, 00:06:57, 17.57m

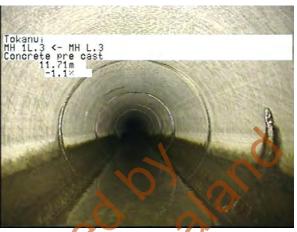

MH L.3 To MH 1L.3\_fa5b7d5d-493e-4bd6-bcd6-a91ff1d814ea\_20230404\_10 3435\_131.jpg, 00:05:19, 11.71m



MH L.3 To MH 1L.3\_32b6b64f-7446-4f41-a2b9-fb84f00ec80a\_20230404\_103 537\_441.jpg, 00:06:02, 14.73m



MH L.3 To MH 1L.3\_79684a4b-7a56-4f34-bb87-7320c1fda5e1\_20230404\_10 3648\_439.jpg, 00:06:59, 17.57m







Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH 1L.3	16



MH L.3 To MH 1L.3\_660184ce-4980-4deb-ab86-f7affadb5d2a\_20230404\_10 3703\_545.jpg, 00:06:59, 17.57m

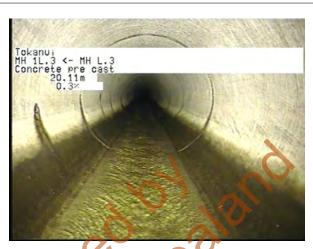

MH L.3 To MH 1L.3\_0be531a1-51f3-4133-92f4-60a50cd26c59\_20230404\_10 3749\_262.jpg, 00:07:37, 20.11m

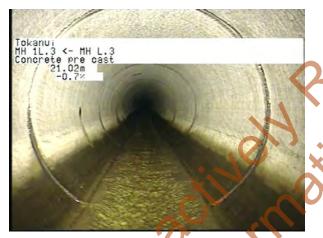

MH L.3 To MH 1L.3\_29ce032d-9b10-4b6c-b26b-c9792552ccf2\_20230404\_10 3814\_801.jpg, 00:07:50, 21.02m



MH L.3 To MH 1L.3\_3f0952e8-055a-47f2-98e7-9af1672a533b\_20230404\_10 4050\_803.jpg, 00:10:19, 31.84m



MH L.3 To MH 1L.3\_f238ae69-96ec-4b1f-b915-15ef75a6fc8c\_20230404\_104 322\_966.jpg, 00:12:43, 41.65m



MH L.3 To MH 1L.3\_e3136017-e4c8-4a80-871b-724d2b483ce9\_20230404\_1 04516\_055.jpg, 00:14:27, 52.50m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH 1L.3	16




MH L.3 To MH 1L.3\_dbe0252b-adad-401c-83c7-f555bd97aa7f\_20230404\_10 4742\_860.jpg, 00:16:48, 59.23m



MH L.3 To MH 1L.3\_0fbd45b7-3a20-4d1b-9d1a-b7a4a0d73bb5\_20230404\_1 04802\_646.jpg, 00:16:58, 59.70m

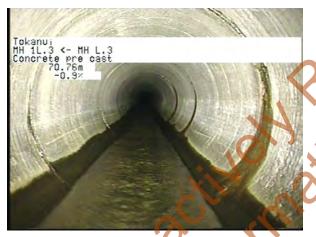

MH L.3 To MH 1L.3\_1250d530-7bdd-418a-b5fe-2f673034d37f\_20230404\_10 5017\_902.jpg, 00:19:01, 70.76m

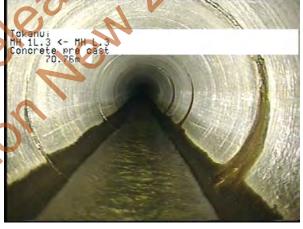

MH L.3 To MH 1L.3\_f6aac0d2-7d14-4cab-8a2d-18d16530992b\_20230404\_1 05033\_365.jpg, 00:19:02, 70.76m



MH L.3 To MH 1L.3\_a86f57e8-f424-4cfb-9c0b-d81d8fead7d5\_20230404\_105 058\_071.jpg, 00:19:20, 72.33m




MH L.3 To MH 1L.3\_86797a0e-c2d7-4d35-8631-55ad125fb115\_20230404\_1 05120\_199.jpg, 00:19:33, 73.43m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.3 To MH 1L.3	16

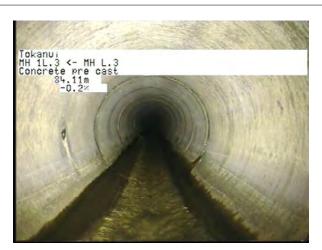

MH L.3 To MH 1L.3\_c79736d4-5661-4711-8d29-eb5952b75ddd\_20230404\_1 05417\_300.jpg, 00:22:20, 84.11m




MH L.3 To MH 1L.3\_735a4276-00cb-4f96-888d-98baefb8c386\_20230404\_10 5617\_608.jpg, 00:23:54, 89.18m



MH L.3 To MH 1L.3\_6fc0d206-46fe-4ded-84f3-3717a3a2e390 20230404\_10 5632\_934.jpg, 00:24:01, 89.38m



MH L.3 To MH 1L.3\_f5160bf1-0893-409a-93c1-d7c758f5e3a8\_20230404\_10 5820\_973.jpg, 00:25:40, 96.71m

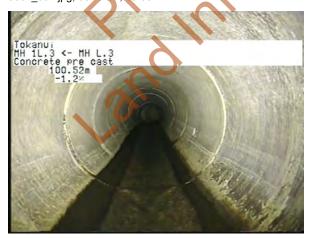

MH L.3 To MH 1L.3\_2f22ebd9-a633-4f45-98d5-41e8c925061f\_20230404\_10 5946\_440.jpg, 00:26:54, 100.52m




MH L.3 To MH 1L.3\_0e402055-9531-471c-a05a-3fd09f339a5d\_20230404\_11 0136\_057.jpg, 00:28:35, 108.36m



## Section Inclination - 4/04/2023 - MH L.3 To MH 1L.3

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							0 ,
Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.3 To MH 1L.3	4/04/2023	10:27 am	CST Group	Tokanui		Downstream node	107.09 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	675 mm	675 mm	SWMH 1L.3	SWMH L.3	0.000 m	-0.328 m	-0.306 %

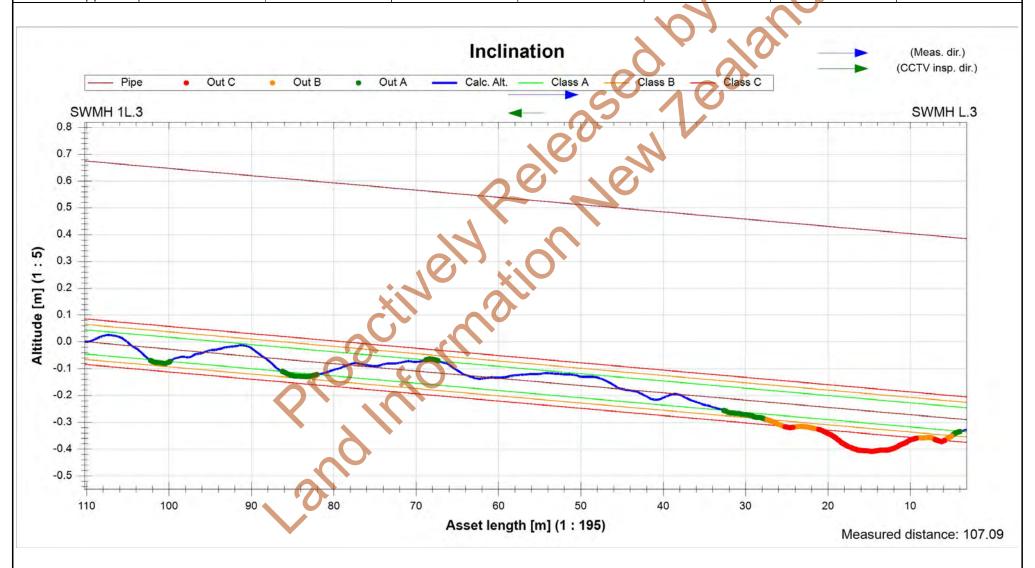



**CST Group Ltd** Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH 1L.3 To Inlet 2L.3

Section No.	Asset No.	Contract Number	Date	Time	Weather
17	MH 1L.3 To Inlet 2L.3	1	4/04/2023	11:05 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	25.68 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	25.68 m	Dia/Height	700 mm	Currency	Current Inspection
Joint Spacing	0.00 m	Width	700 mm	Inspection	Inspection complete
Surface		Location		Cleaning Status	
U/S Node	Inlet 2L.3	1	D/S Node	SWMH 1L.3	
U/S Node Type	Stormwater inlet		D/S Node Type	Stormwater manhole	•
U/S Pipe Depth			D/S Pipe Depth	2.90 m	
U/S Location			D/S Location		

Comments oc 1:203 m + Observation Score **SWMH 1L.3** 00:00:00 0.00 Inspection start, node reference: MH 11 MH 1L.3 **Encrustation deposits** 0.53 **EDS** 00:00:23 To Inlet 10% from 4 o'c 2L.3 7037 MH 1L.3 General comment / General condition photo 11.30 00:03:00 To Inlet 2L.3\_8195 MH 1L.3 Root intrusion, restrict flow by more than 25% of full flow from 3 00:05:01 22.10 S01 RIL To Inlet o'clock to 9 o'clock, start 2L.3\_9e0a Root intrusion, restrict flow by more than 25% of full flow from 3 00:05:37 25.68 E01 RIL 70 o'clock to 9 o'clock, end 25.68 ΙE 00:05:38 Inspection ends, node reference: Inlet 2L.3 Inlet 2L.3 STR Grade | SER No. Def | SER Peak

STR Mean

0.0

STR Total

0.0

STR No. Def STR Peak

SER Grade

5.0

SER Mean

2.7

70.0


SER Total

70.0





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH 1L.3 To Inlet 2L.3	17

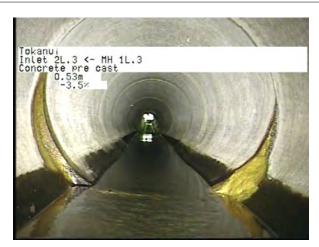

MH 1L.3 To Inlet 2L.3\_7037c356-1129-4f76-9f56-4f972d7413da\_20230404\_11 0552\_632.jpg, 00:00:23, 0.53m



MH 1L.3 To Inlet
2L.3\_8195242b-7ad1-4342-80fa-8380f7f9a542\_20230404\_11
0837\_830.jpg, 00:03:00, 11.30m




MH 1L.3 To Inlet 2L.3\_9e0a22ce-6dc6-4e69-a672-1a998b86b0ad\_20230404\_1 11056\_221.jpg, 00:05:01, 22.10m



### Section Inclination - 4/04/2023 - MH 1L.3 To Inlet

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH 1L.3 To Inlet 2L.3	4/04/2023	11:05 am	CST Group	Tokanui		Downstream node	20.76 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	700 mm	700 mm	Inlet 2L.3	SWMH 1L.3	-0.006 m	-0.042 m	-0.174 %

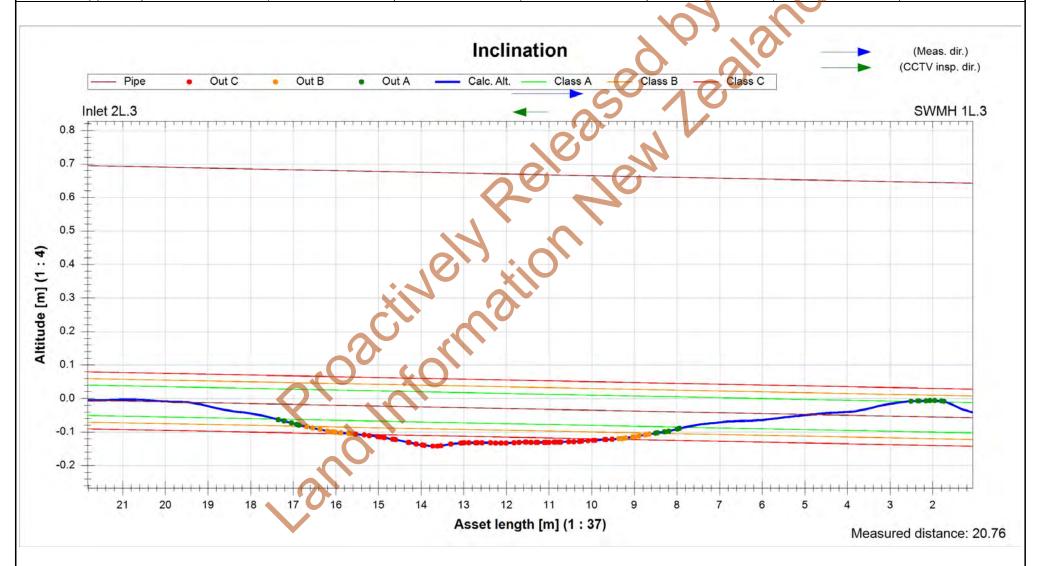



# CST Group Ltd , Cambridge Tel. 07 827 9161 cctv @cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH L.1 To MH 1L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
18	MH L.1 To MH 1L.1	1	4/04/2023	11:59 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	152.52 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	152.52 m	Dia/Height	700 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	700 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	SWMH 1L.1	1	D/S Node	SWMH L.1	
U/S Node Type	Stormwater manhole	•	D/S Node Type	Stormwater manhole	
U/S Pipe Depth	1.60 m		D/S Pipe Depth	3.00 m	
U/S Location			D/S Location		
Comments			1		

Comment	5						
1:	460	m +	ос	Observation	MPEG	Photo	Score
SWI	MH L.1	0.00	IS	Inspection start, node reference: SWMH L.1	00:00:00		
		0.45 S0	1 DGS	Debris greasy, small, clear diameter is reduced by less than 10% from 5 o'clock to 7 o'clock, start	00:01:06	MH L.1 To MH 1L.1_a891	
		5.42	EDS	Encrustation deposits, clear diameter is reduced by less than 10% from 3 o'clock to 7 o clock	00:02:27	MH L.1 To MH 1L.1_efe4 MH L.1 To	
		6.89	JFS	Joint faulty, minor cracking or spalling from 2 o'clock to 3 o'clock	00:02:55	MH 1L.1_d7dd	1
		11.88	GC	General comment / General condition photo	00:04:48	MH L.1 To MH 1L.1_a51cf	
	$\mathbb{H}$	13.68	CF	Construction feature at 12 o'clock / Lifting eye	00:05:07		
		13.68	PHS	Pipe holed, the hole has been repaired at 12 o'clock	00:05:09	MH L.1 To MH 1L.1_7328	5
<b>A</b>		15.30 \$0	2 EDS	Encrustation deposits, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, start	00:06:21	MH L.1 To MH 1L.1_ddeb	
		17.75	CF	Construction feature at 12 o'clock / Lifting eye	00:06:47	MH L.1 To MH 1L.1_f797	
		17.75	PHS	Pipe holed, the hole has been repaired at 12 o'clock	00:06:49		5
		20.39	GC	General comment / General condition photo	00:07:47	MH L.1 To MH 1L.1_4d26	
		33.30	GC	General comment / General condition photo	00:10:19	MH L.1 To MH 1L.1_04a8	
		38.99	GC	General comment / General condition photo	00:11:39	MH L.1 To MH 1L.1_5cd2	
		50.38	GC	General comment / General condition photo	00:14:08	MH L.1 To MH 1L.1_6756	
		57.08	CF	Construction feature from 11 o'clock to 1 o'clock / Lateral connection	00:15:28	MH L.1 To MH 1L.1_86a0	
		57.79	LFM	Lateral sealing faulty, gaps between the lateral pipe and the main pipe that appear open at 12 o'clock	00:15:44	MH L.1 To MH 1L.1_42f8	10




CST Group Ltd , Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH L.1 To MH 1L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather	
18	MH L.1 To MH 1L.1	1	4/04/2023	11:59 am	Dry Weather	
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client	
Tokanui	Nathan Whare	CST Group				

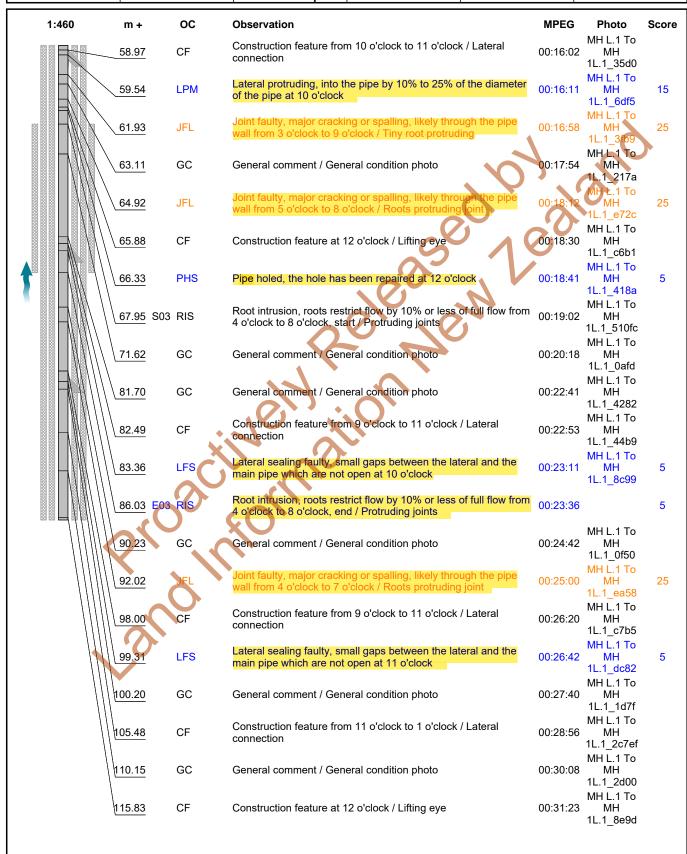




**CST Group Ltd** 

Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH L.1 To MH 1L.1

Section No. Asset No.  18 MH L.1 To MH 1L.1		Contract Number <b>1</b>	Date <b>4/04/2023</b>	Time 11:59 am	Weather  Dry Weather
Town or Suburb <b>Tokanui</b>	Camera Operator Nathan Whare	Operator CST Group	Video Reference	Drawing No.	Client

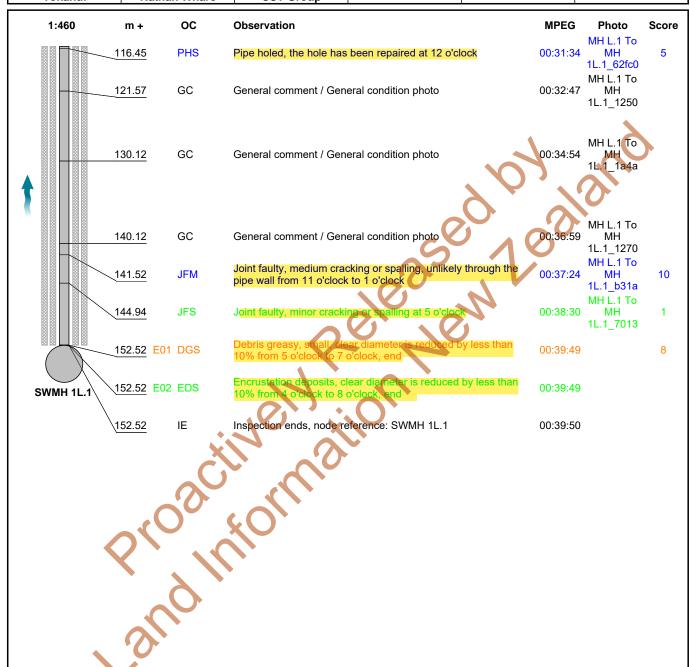

STR Peak

STR Mean

0.9

STR Total

142.0

STR Grade | SER No. Def

3

3.0

SER Peak

13.0

SER Mean

0.1

SER Total

13.0

STR No. Def

SER Grade

3.0





Town or Suburb	Date	Asset No	Section No.
T-1	4/04/2022	MUL 1 To MU 11 1	10
Iokanui	4/04/2023	│ MH L.1 To MH 1L.1	18



MH L.1 To MH 1L.1\_a891dc14-e186-4d51-89eb-a05aef7b844c\_20230404\_1 20032\_471.jpg, 00:01:06, 0.45m




MH L.1 To MH 1L.1\_efe4325f-6193-4cf5-8fae-0de62265ead3\_20230404\_120 207\_122.jpg, 00:02:27, 5.42m



MH L.1 To MH 1L.1\_d7ddc1f8-ff6b-4066-9a3e-e9ac1c07d5db\_20230404\_12 0247\_678.jpg, 00:02.55, 6.89m



MH L.1 To MH 1L.1\_06c6dd06-d60a-4796-8be9-911ed625a1db\_20230404\_1 20315\_914.jpg, 00:02:55, 6.89m

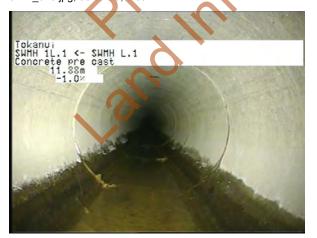

MH L.1 To MH 1L.1\_a51cfb48-c721-495d-9475-12ef7ef4b782\_20230404\_12 0451\_789.jpg, 00:04:48, 11.88m



MH L.1 To MH 1L.1\_7328faf1-e9fd-4b70-b36d-d89065e11fd0\_20230404\_120 532\_852.jpg, 00:05:09, 13.68m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.1 To MH 1L.1	18



MH L.1 To MH 1L.1\_ddeb10f3-b577-4669-8edd-7efe4b96e1f7\_20230404\_12 0653\_052.jpg, 00:06:21, 15.30m




MH L.1 To MH 1L.1\_f79701cd\_4f67-44d8-b66a-579e775648a5\_20230404\_12 0734\_042.jpg, 00:06:47, 17.75m



MH L.1 To MH 1L.1\_4d264062-72ec-4b23-9a35-fa8798e3465f\_20230404\_12 0907\_321.jpg, 00:07:47, 20.39m



MH L.1 To MH 1L.1\_04a8f97b-4bad-48b7-8a96-fea918bddee7\_20230404\_12 1146\_371.jpg, 00:10:19, 33.30m

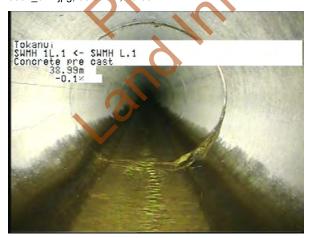

MH L.1 To MH 1L.1\_5cd2019c-ff89-4b03-994a-e4ca7ae62175\_20230404\_12 1318\_924.jpg, 00:11:39, 38.99m



MH L.1 To MH 1L.1\_67567631-e148-4c01-88fd-9c6bdd18b35a\_20230404\_1 21553\_955.jpg, 00:14:08, 50.38m





Tarring an Crobronk	Dete	Accet No	Castian Na
Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.1 To MH 1L.1	18



MH L.1 To MH 1L.1\_86a0788c-11dd-40f7-a6c0-3777bbc11132\_20230404\_1 21725\_361.jpg, 00:15:28, 57.08m



MH L.1 To MH 1L.1\_42f8a8e7-9c5f-4050-acd7-894a60ad9256\_20230404\_12 1758\_258.jpg, 00:15:44, 57.79 m



MH L.1 To MH 1L.1\_35d0d170-0f81-4417-84fc-51ead01dbb7a\_20230404\_12 1828\_648.jpg, 00:16:02, 58.97m



MH L.1 To MH 1L.1\_6df50fc2-ba82-4283-b27a-64b756c8048f\_20230404\_12 1848\_157.jpg, 00:16:11, 59.54m



MH L.1 To MH 1L.1\_3fb91a5d-147c-4c91-8f09-84a6609702d5\_20230404\_12 1955\_441.jpg, 00:16:58, 61.93m



MH L.1 To MH 1L.1\_217acfb7-81a1-48f4-9c33-f982301366d5\_20230404\_12 2102\_027.jpg, 00:17:54, 63.11m





Town or Suburb	Dat	e Asset No.	Section No.
Tokanui	4/04/2	023 MH L.1 To MH 1L	1 18



MH L.1 To MH 1L.1\_e72c306c-649a-4164-91a8-1ecba2a48658\_20230404\_1 22145\_992.jpg, 00:18:12, 64.92m



MH L.1 To MH 1L.1\_c6b15fa7\_e75e-4b7a-b2bf-da857a010b5e\_20230404\_12 2220\_625.jpg, 00:18:30, 65.88m



MH L.1 To MH 1L.1\_418a2c01-9d84-4963-b087-1e3aebd9728b\_20230404\_1 22238\_777.jpg, 00:18:41, 66.33m



MH L.1 To MH 1L.1\_510fc2ed-e598-4f17-88f0-a68e8f3b1666\_20230404\_122 316\_895.jpg, 00:19:02, 67.95m



MH L.1 To MH 1L.1\_0afddfb9-b861-45b3-8309-d383d53be967\_20230404\_12 2445\_181.jpg, 00:20:18, 71.62m



MH L.1 To MH 1L.1\_42825bdf-2533-4d78-89c6-f464772da77f\_20230404\_12 2721\_178.jpg, 00:22:41, 81.70m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.1 To MH 1L.1	18



MH L.1 To MH 1L.1\_44b9a4b4-8ea3-4557-abc0-f63d0688fcb3\_20230404\_12 2745\_592.jpg, 00:22:53, 82.49m



MH L.1 To MH 1L.1\_8c992c4c\_160a-43ed-8d8e-4f000d7d3860\_20230404\_1 22808\_826.jpg, 00:23:11, 83.36m



MH L.1 To MH 1L.1\_0f5006bf-4117-4fb8-bc62-3c18a0844030 20230404\_12 3000\_556.jpg, 00:24:42, 90.23m



MH L.1 To MH 1L.1\_ea5826bb-7cb9-4991-806a-6ca7d6780f5d\_20230404\_1 23032\_106.jpg, 00:25:00, 92.02m



MH L.1 To MH 1L.1\_c7b5bc8a-909f-4303-b4a7-2fb66a44ad2a\_20230404\_12 3203\_411.jpg, 00:26:20, 98.00m



MH L.1 To MH 1L.1\_dc82e9c0-edc4-4321-a016-a4ef2259fb45\_20230404\_12 3231\_069.jpg, 00:26:42, 99.31m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.1 To MH 1L.1	18



MH L.1 To MH 1L.1\_1d7f7522-ff45-4bc8-8e34-c083bc55e52d\_20230404\_12 3338\_682.jpg, 00:27:40, 100.20m



MH L.1 To MH 1L.1\_2c7ef29f-c7e1-41ca-ae0c-a44b80309301\_20230404\_12 3504\_608.jpg, 00:28:56, 105.48m



MH L.1 To MH 1L.1\_2d00e69a-401a-4f6c-b68f-de18bc68fec6\_20230404\_12 3625\_720.jpg, 00:30:08, 110.15m



MH L.1 To MH 1L.1\_8e9d2cae-b773-40b0-8ab7-475f3d2c9f91\_20230404\_12 3748\_125.jpg, 00:31:23, 115.83m



MH L.1 To MH 1L.1\_62fc0495-b501-4df9-b61d-762ee3180e67\_20230404\_12 3807\_495.jpg, 00:31:34, 116.45m



MH L.1 To MH 1L.1\_12508613-d3dd-4856-a07f-2026801c5e45\_20230404\_1 23927\_778.jpg, 00:32:47, 121.57m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH L.1 To MH 1L.1	18




MH L.1 To MH 1L.1\_1a4a32d8-8ee8-4e4b-9fba-48dae8734319\_20230404\_1 24204\_762.jpg, 00:34:54, 130.12m

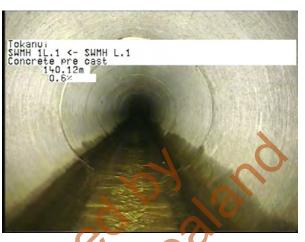

MH L.1 To MH 1L.1\_1270f635\_a8da-4348-895f-1a9997846ef4\_20230404\_12 4415\_564\_jpg, 00:36:59, 140.12m



MH L.1 To MH 1L.1\_b31ae029-cb6a-44cd-b78c-e27016cdda12\_20230404\_1 24446\_180.jpg, 00:37:24, 141.52m

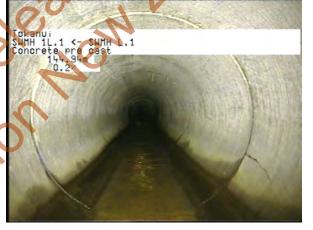


MH L.1 To MH 1L.1\_7013948b-c463-4cad-98bf-244be2a26ba7\_20230404\_1 24606\_202.jpg, 00:38:30, 144.94m



## Section Inclination - 4/04/2023 - MH L.1 To MH 1L.1

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							υ,
Asset No. Date Time Operator Town or Suburb Road						Setup	Surveyed Length
MH L.1 To MH 1L.1	4/04/2023	11:59 am	CST Group	Tokanui		Downstream node	150.46 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	700 mm	700 mm	SWMH 1L.1	SWMH L.1	0.000 m	0.276 m	0.183 %

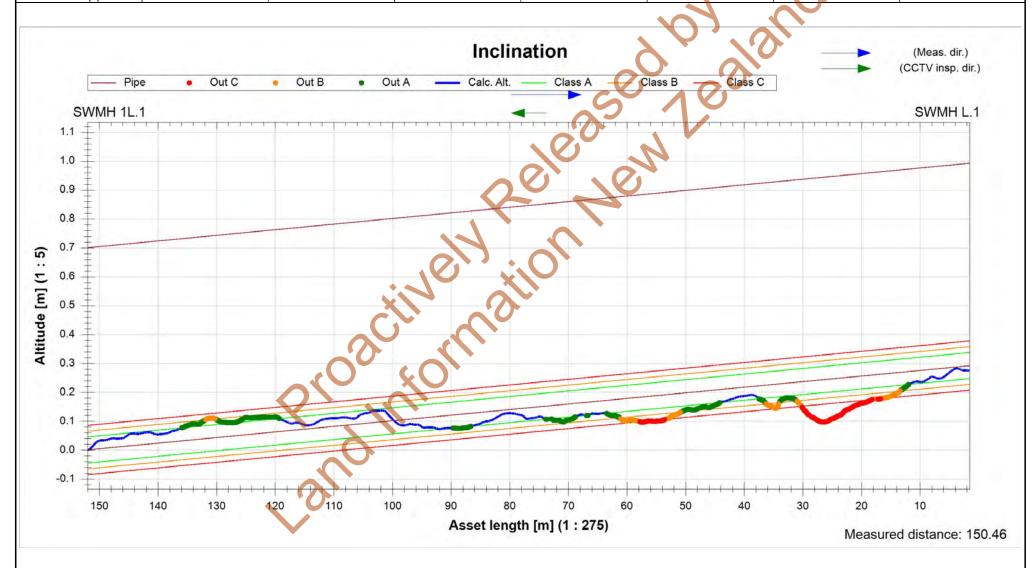



CST Group Ltd , Cambridge


Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 6/04/2023 - MH 1L.1 To MH 2L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
19	MH 1L.1 To MH 2L.1	1	6/04/2023	1:18 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	51.71 m	Material	Concrete pre cast	Use	Stormwater
Setup	Upstream node	Shape	Circular pipe	Pipe Status	
Surveyed Length	36.07 m	Dia/Height	675 mm	Currency	
Joint Spacing	0.00 m	Width	675 mm	Inspection	
Surface		Location	Private property - hardstand	Cleaning Status	
U/S Node	SWMH 2L.1		D/S Node	SWMH 1L.1	
U/S Node Type	Stormwater manhol	е	D/S Node Type	Stormwater manhole	
U/S Pipe Depth	2.62 m		D/S Pipe Depth	1.60 m	
U/S Location			D/S Location		
Comments			,		

1:408 m + OC Observation MPEG Photo Score

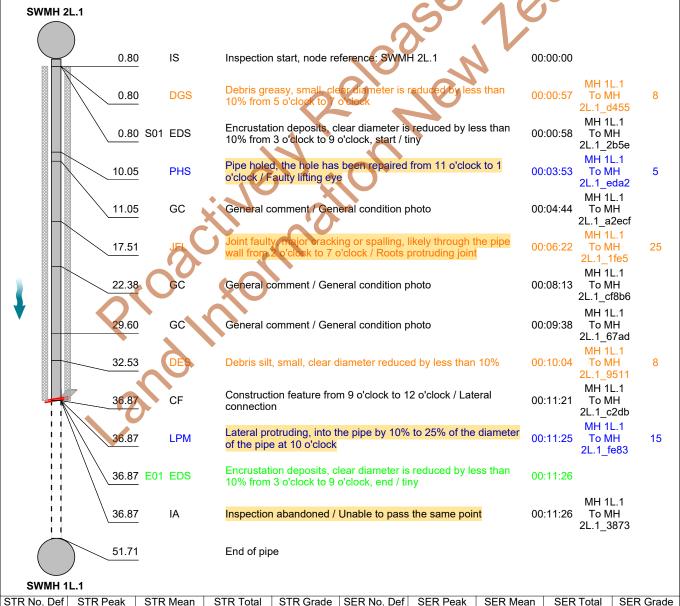

45.0

3.0

8.0

0.4

16.0

3.0





Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 1L.1 To MH 2L.1	19



MH 1L.1 To MH 2L.1\_d4559110-03d0-4742-ac00-2ab37aa6b3cb\_20230406\_1 31950\_784.jpg, 00:00:57, 0.80m



MH 1L.1 To MH 2L.1\_2b5e9f26-976e-4358-8db4-38f0ecac8e6e\_20230406\_13 2002\_561.jpg, 00:00:58, 0.80m



MH 1L.1 To MH 2L.1\_eda2b90a-1d1c-4106-9b4f-754491419473\_20230406\_1 32413\_569.jpg, 00:03:53, 10.05m



MH 1L.1 To MH 2L.1\_a2ecf20a-1bbc-4f12-b816-bc1f694962aa\_20230406\_13 2511\_680.jpg, 00:04:44, 11.05m



MH 1L.1 To MH 2L.1\_1fe58d7c-9b98-4df4-9b4c-a75e3ba0233c\_20230406\_13 2700\_939.jpg, 00:06:22, 17.51m



MH 1L.1 To MH 2L.1\_cf8b62ef-b751-4901-9600-9a2f4e4a00fd\_20230406\_132 903\_909.jpg, 00:08:13, 22.38m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 1L.1 To MH 2L.1	19



MH 1L.1 To MH 2L.1\_67ad981e-242c-4808-939b-bc1a8066da8f\_20230406\_1 33036\_044.jpg, 00:09:38, 29.60m



MH 1L.1 To MH 2L.1\_c2db88c6-bce0-402e-beac-0c8459e6653a\_20230406\_1 33236\_184.jpg, 00:11:21, 36.87m

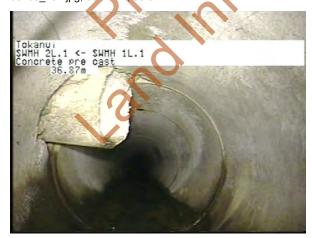

MH 1L.1 To MH 2L.1\_38738545-3add-430d-b2eb-d071fc078472\_20230406\_1 33306\_274.jpg, 00:11:26, 36.87m



MH 1L.1 To MH 2L.1\_9511c068-864d-4c84-9b94-0e42454dbf51\_20230406\_1 33107\_242.jpg, 00:10:04, 32.53m




MH 1L.1 To MH 2L.1\_fe839006-cb3a-4915-99b0-470c2130e1f0\_20230406\_13 3247\_716.jpg, 00:11:25, 36.87m



CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH 1L.1 To MH 2L.1	6/04/2023	1:18 pm	CST Group	Tokanui		Upstream node	36.87 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	675 mm	675 mm	SWMH 2L.1	SWMH 1L.1	0.016 m	0.682 m	-1.806 %

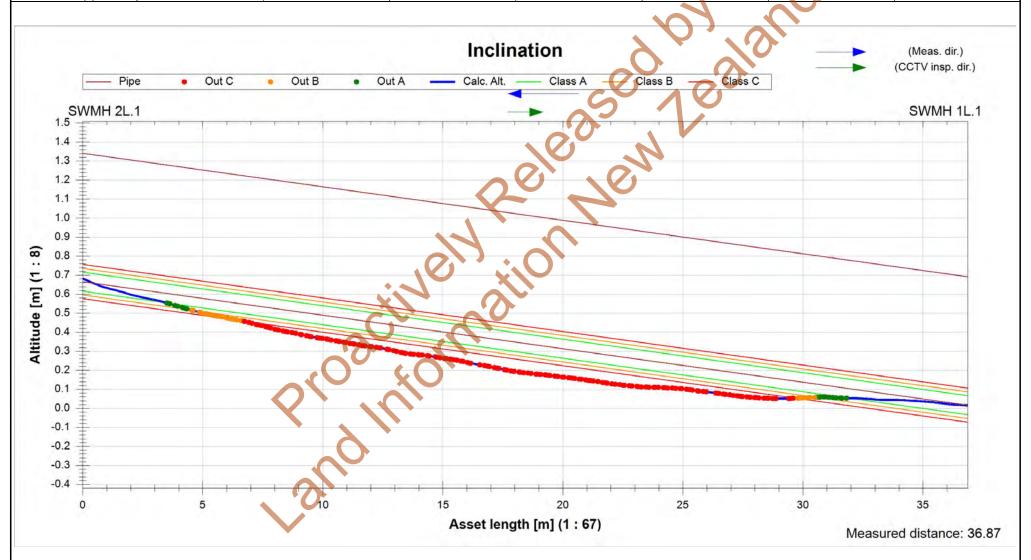



CST Group Ltd , Cambridge Tel. 07 827 9161 cctv @cstgroup.co.nz

Score

MPEG

### Section Inspection - 4/04/2023 - MH 1L.1 To MH 2L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
19	MH 1L.1 To MH 2L.1	1	4/04/2023	12:52 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			
Tokanui	Nathan Whare	CST Group			

Line Length	51.71 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	51.71 m	Dia/Height	675 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	675 mm	Inspection	Inspection complete
Surface		Location	Private property - hardstand	Cleaning Status	
U/S Node	SWMH 2L.1		D/S Node	SWMH 1L.1	
U/S Node Type	Stormwater manhole	•	D/S Node Type	Stormwater manhole	
U/S Pipe Depth	2.62 m		D/S Pipe Depth	1.60 m	
U/S Location			D/S Location		
Comments			,		

1:406	m +	OC	Observation

					20		
SWMH	<b>1L.1</b> 0.0	0	IS	Inspection start, node reference: SWMH 1L1	00:00:00		
	9.5	3_	EDS	Encrustation deposits, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock	00:02:28	MH 1L.1 To MH 2L.1_9f3b	
- 1	11.6	9	SDS	Surface damage, superficial only, cement Lining spalled from steel pipe from 11 o'clock to 1 o'clock	00:02:51	MH 1L.1 To MH 2L.1_9c73	3
- 1	11.6	9	CF	Construction feature from 2 o'clock to 3 o'clock / Lateral connection	00:03:25	MH 1L.1 To MH 2L.1_ddc7	
	12.6	2	LFL	Lateral sealing faulty, evidence exist that the connection between the lateral and the main pipe is leaking at 2 o'clock	00:03:56	MH 1L.1 To MH 2L.1_324b	25
	12.6	2	GC .	General comment / General condition photo	00:04:10	MH 1L.1 To MH 2L.1_093e	
	19.2	3 S01	EDS	Encrustation deposits, clear diameter is reduced by less than 10% from 5 o'clock to 9 o'clock, start	00:05:40	MH 1L.1 To MH 2L.1 f0e8	
<b>A</b>	21.7	6	GC	General comment / General condition photo	00:06:40	MH 1L.1 To MH 2L.1_f728	
	27.4	9 S02	DGS	Debris greasy, small, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, start	00:07:51	MH 1L.1 To MH 2L.1_8777	8
	31.0	7 E01	EDS	Encrustation deposits, clear diameter is reduced by less than 10% from 5 o'clock to 9 o'clock, end	00:08:18		
	33,1	7	GC	General comment / General condition photo	00:09:13	MH 1L.1 To MH 2L.1_75cf8	
	38.8	6	GC	General comment / General condition photo	00:10:42	MH 1L.1 To MH 2L.1_6eeb	
- 1	50.3	2	GC	General comment / General condition photo	00:13:06	MH 1L.1 To MH 2L.1_beb3	
- 1	50.7	0	CF	Construction feature from 1 o'clock to 3 o'clock / Lateral connection	00:13:14	MH 1L.1 To MH 2L.1_3463	
	50.7	0	LPM	Lateral protruding, into the pipe by 10% to 25% of the diameter of the pipe at 2 o'clock $$	00:13:15		15
	51.2	6	IA	Inspection abandoned / Unable to pass	00:14:49		




**CST Group Ltd** 

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 4/04/2023 - MH 1L.1 To MH 2L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
19	MH 1L.1 To MH 2L.1	1	4/04/2023	12:52 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

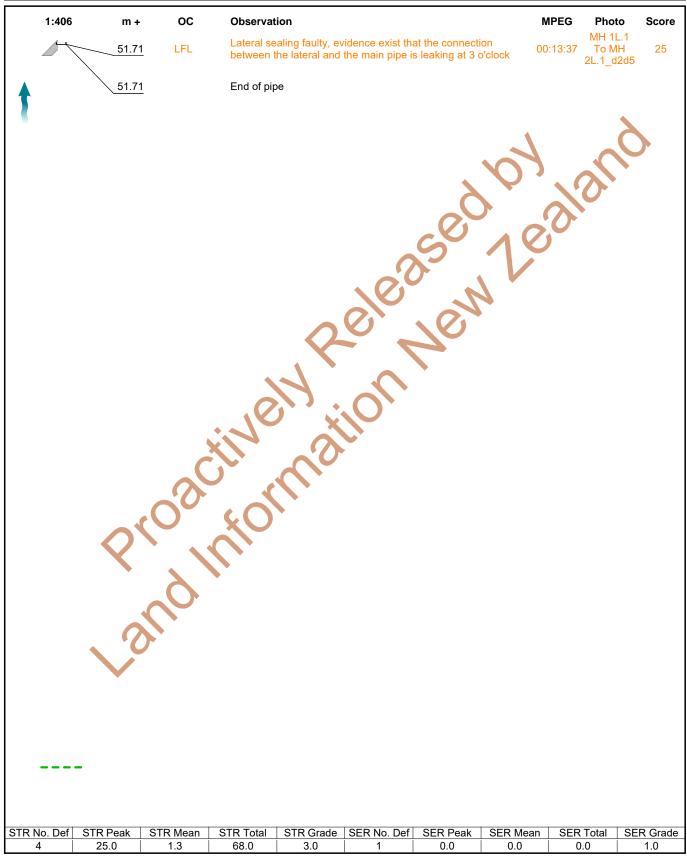





Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH 1L.1 To MH 2L.1	19



MH 1L.1 To MH 2L.1\_9f3b7746-20b1-435a-bcc7-c81218aa085a\_20230404\_1 25500\_217.jpg, 00:02:28, 9.53m



MH 1L.1 To MH 2L.1\_9c730f4d\_16b9-4017-8de4-735069fda835\_20230404\_12 5529\_719.jpg, 00:02:51, 11.69m



MH 1L.1 To MH 2L.1\_ddc7b103-169d-44bc-a0cb-142f49ae2616\_20230404\_1 25634\_590.jpg, 00:03:25, 11.69m



MH 1L.1 To MH 2L.1\_324b1f6d-28ae-4dbf-a417-5cecea7b1012\_20230404\_12 5708\_954.jpg, 00:03:56, 12.62m



MH 1L.1 To MH 2L.1\_093e2240-aeb3-44ec-962a-a4ac91c675dd\_20230404\_1 25730\_151.jpg, 00:04:10, 12.62m



MH 1L.1 To MH 2L.1\_f0e82095-1b62-4dac-8fc4-cca58a9d07c5\_20230404\_12 5904\_777.jpg, 00:05:40, 19.23m





Town or Suburb	Date	Asset No.	Section No.	-
Tokanui	4/04/2023	MH 1L.1 To MH 2L.1	19	




MH 1L.1 To MH 2L.1\_f728b9c7-2735-4eb4-8496-00f25ba1a8e7\_20230404\_13 0019\_167.jpg, 00:06:40, 21.76m



MH 1L.1 To MH 2L.1\_87774ce4-2d50-4951-b680-e12bfc90df6a\_20230404\_13 0137\_193.jpg, 00:07:51, 27.49m




MH 1L.1 To MH 2L.1\_75cf8c6b-2962-43c8-a939-98187d64e050\_20230404\_1 30311\_774.jpg, 00:09:13, 33.17m

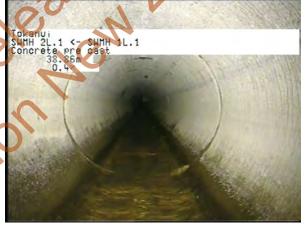

MH 1L.1 To MH 2L.1\_6eebb0b5-4458-4d8c-be4b-18553b91225f\_20230404\_1 30447\_801.jpg, 00:10:42, 38.86m



MH 1L.1 To MH 2L.1\_beb392cb-1e80-43ff-8a38-c3d941ea7b3c\_20230404\_13 0722\_377.jpg, 00:13:06, 50.32m

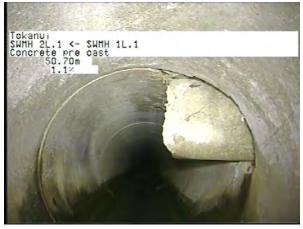

MH 1L.1 To MH 2L.1\_3463942b-ab0a-4358-b2d3-99ffe2bc20f5\_20230404\_13 0744\_889.jpg, 00:13:14, 50.70m






#### **CST Group Ltd**

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Town or Suburb	Date	Asset No.	Section No.
Tokanui	4/04/2023	MH 1L.1 To MH 2L.1	19

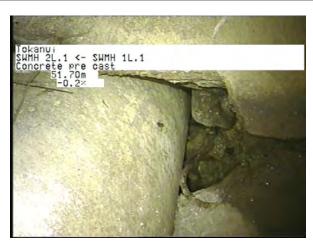

MH ...d65b-9a35-42c ..\_954jpg 00:13:37, 5 MH 1L.1 To MH 2L.1 d2d5e66b-6c21-4dc5-809b-275de36f7b36 20230404 1 30832\_089.jpg, 00:13:37, 51.71m




2L.1\_b4f8d65b-9a35-42c1-bc8c-fb426e3f6133\_20230404\_13 0841\_954.jpg, 00:13:37, 51.71m



CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							<u> </u>
Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH 1L.1 To MH 2L.1	4/04/2023	12:52 pm	CST Group	Tokanui		Downstream node	50.15 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	675 mm	675 mm	SWMH 2L.1	SWMH 1L.1	0.000 m	0.049 m	0.098 %

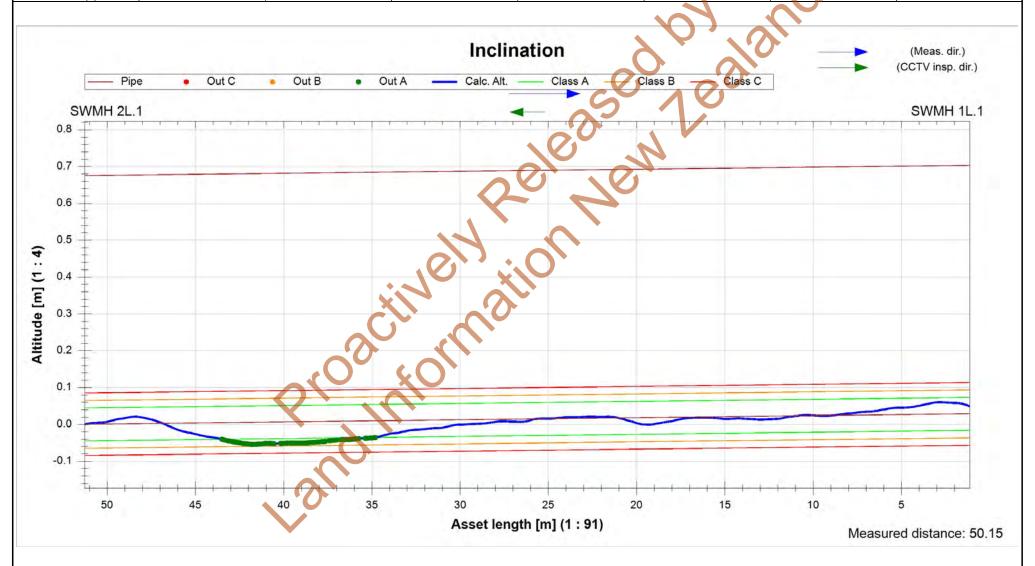



CST Group Ltd , Cambridge Tel. 07 827 9161 cctv @cstgroup.co.nz

# Section Inspection - 6/04/2023 - MH 2L.1 To MH 3L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
20	MH 2L.1 To MH 3L.1	1	6/04/2023	11:56 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

146.38 m	Material	Concrete pre cast	Use	Stormwater
Downstream node	Shape	Circular pipe	Pipe Status	Original condition
145.58 m	Dia/Height	675 mm	Currency	<b>Current Inspection</b>
0.00 m	Width	675 mm	Inspection	Inspection complete
	Location	Private property - hardstand	Cleaning Status	
SWMH 3L.1	1	D/S Node	SWMH 2L.1	
Stormwater manhole		D/S Node Type	Stormwater manhole	•
3.40 m		D/S Pipe Depth	2.62 m	
		D/S Location		
	Downstream node 145.58 m 0.00 m  SWMH 3L.1 Stormwater manhole	Downstream node 145.58 m Dia/Height 0.00 m Width Location  SWMH 3L.1  Stormwater manhole	Downstream node	Downstream node Shape Circular pipe Pipe Status  145.58 m Dia/Height 675 mm Currency  0.00 m Width 675 mm Inspection Location Private property - hardstand Cleaning Status  SWMH 3L.1 D/S Node SWMH 2L.1  Stormwater manhole  3.40 m D/S Pipe Depth 2.62 m

Comments					1	
1:459	m +	ос	Observation	MPEG	Photo	Score
SWMH 2L.1	0.80	IS	Inspection start, node reference: SWMH 2L.1	00:00:00		
	0.80	CF	Construction feature at 12 o'clock / Lifting eye	00:00:18	MH 2L.1 To MH 3L.1_b20d	
	0.80	PHS	Pipe holed, the hole has been repaired at 12 o'clock	00:00:19	MH 2L.1 To MH 3L.1_f3e5	5
	4.83 S0	1 PHS	Pipe holed, the hole has been repaired from 11 o'clock to 1 o'clock, start / Lifting eye	00:01:57	MH 2L.1 To MH 3L.1_9af4	
	5.67	JFS	Joint faulty, minor cracking or spalling from 7 o'clock to 9 o'clock	00:02:41	MH 2L.1 To MH 3L.1_e35f	1
	7.74 S02	2 DGS	Debris greasy, small, clear diameter is reduced by less than 10% from 4 o'clock to 8 o'clock, start	00:03:17	MH 2L.1 To MH 3L.1_ad2d	
	11.41	GC	General comment / General condition photo	00:04:30	MH 2L.1 To MH 3L.1_c316	
	17.74	EDS	Encrustation deposits, clear diameter is reduced by less than 10% from 7 o'clock to 9 o'clock	00:06:12	3L.1_25a9	
	21.81	GC	General comment / General condition photo	00:07:18	MH 2L.1 To MH 3L.1_e31b	
	29.99	PHM	Pipe holed, the hole is up to 20% of the pipe circumference and has not been repaired from 11 o'clock to 1 o'clock	00:09:52	MH 2L.1 To MH 3L.1_eba0	25
	31.36	GC	General comment / General condition photo	00:11:03	MH 2L.1 To MH 3L.1_e559	
	40.17	GC	General comment / General condition photo	00:13:47	MH 2L.1 To MH 3L.1_ca35	
	48.42	GC	General comment / General condition photo	00:15:29	MH 2L.1 To MH 3L.1_e554	
	51.86	RIS	Root intrusion, roots restrict flow by 10% or less of full flow from 5 o'clock to 7 o'clock	00:16:04	MH 2L.1 To MH 3L.1_14d3	5
	51.86	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall-from 4 o'clock to 8 o'clock / Roots protruding joint	00:16:05	MH 2L.1 To MH 3L.1_a3cc	25
	53.36	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall-from 2 o'clock to 7 o'clock / Roots protruding joint	00:17:02	MH 2L.1 To MH 3L.1_da89	25




CST Group Ltd , Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

## Section Inspection - 6/04/2023 - MH 2L.1 To MH 3L.1

Section No.	Asset No.	Contract Number	Date	Time	Weather
20	MH 2L.1 To MH 3L.1	1	6/04/2023	11:56 am	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

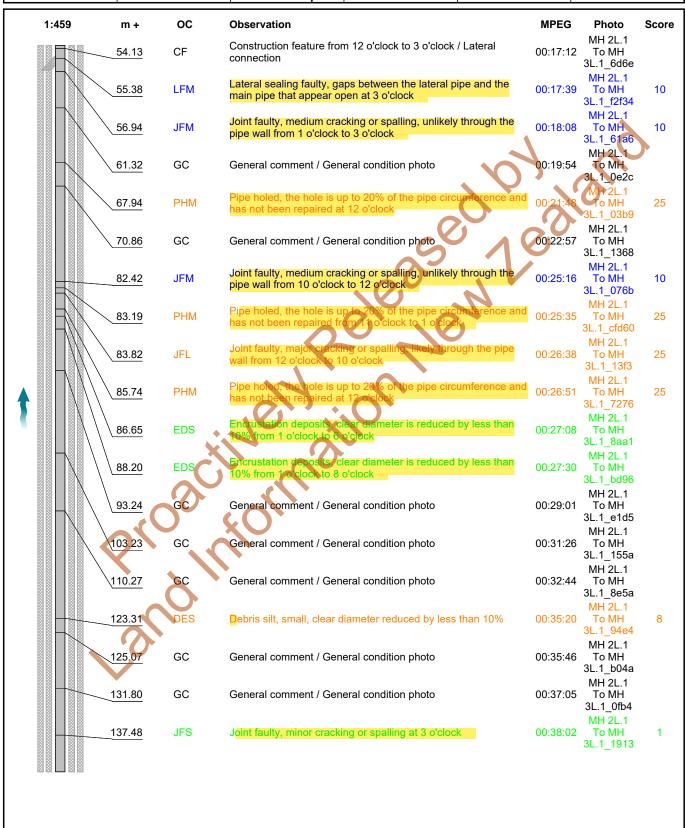




CST Group Ltd

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

## Section Inspection - 6/04/2023 - MH 2L.1 To MH 3L.1

Section No. <b>20</b>	Asset No. MH 2L.1 To MH 3L.1	Contract Number <b>1</b>	Date <b>6/04/2023</b>	Time 11:56 am	Weather  Dry Weather
Town or Suburb <b>Tokanui</b>	Camera Operator Nathan Whare	Operator CST Group	Video Reference	Drawing No.	Client

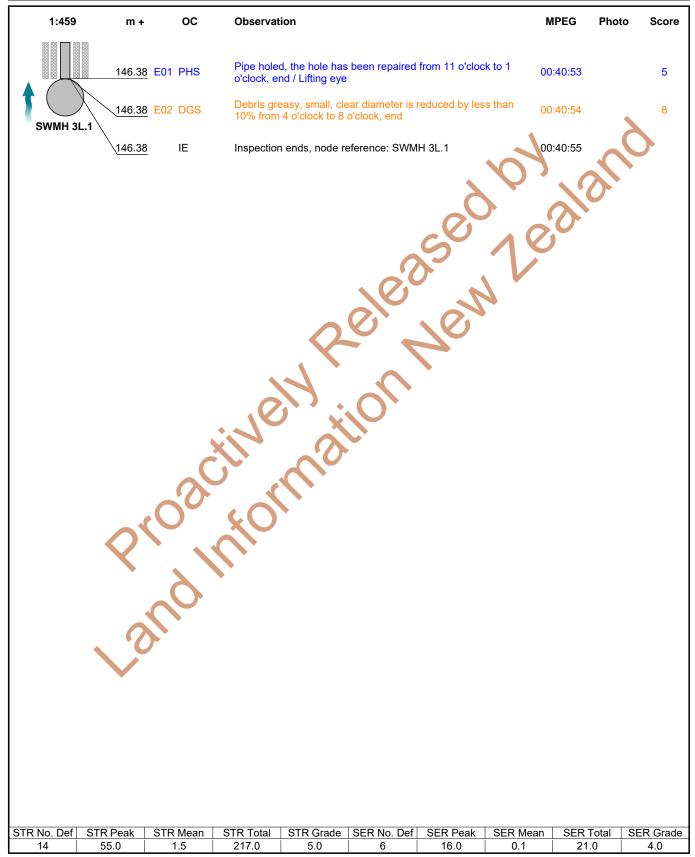





T 011		A (A)	0 " 11
Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20



MH 2L.1 To MH 3L.1\_b20df469-94c0-402b-8b8c-79a977d35bfc\_20230406\_11 5653\_807.jpg, 00:00:18, 0.80m




MH 2L.1 To MH 3L.1\_f3e577a9-28ba-4560-b89e-0da46a5d7ccd\_20230406\_1 15700\_124.jpg, 00:00:19, 0.80 m



MH 2L.1 To MH 3L.1\_9af431fd-b2b1-4d42-a45b-882d6635cdf3\_20230406\_11 5851\_257.jpg, 00:01.57, 4.83m



MH 2L.1 To MH 3L.1\_e35f5190-348a-4a58-bd9f-28573eeee306\_20230406\_11 5942\_547.jpg, 00:02:41, 5.67m

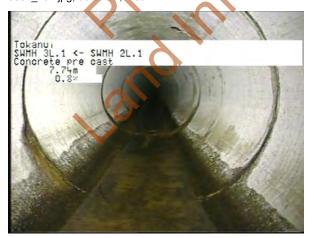

MH 2L.1 To MH 3L.1\_ad2d04a8-5c22-4e96-a7b5-048c418ce6a8\_20230406\_1 20026\_135.jpg, 00:03:17, 7.74m



MH 2L.1 To MH 3L.1\_c3161c03-8bab-4901-adc5-2b3b1994c4df\_20230406\_12 0147\_401.jpg, 00:04:30, 11.41m







Tarres an Crobronk	D-t-	Accet No	Castian Na	-
Town or Suburb	Date	Asset No.	Section No.	
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20	



MH 2L.1 To MH 3L.1\_25a9d203-42bf-4094-b32a-dc82147c3bdd\_20230406\_1 20335\_143.jpg, 00:06:12, 17.74m

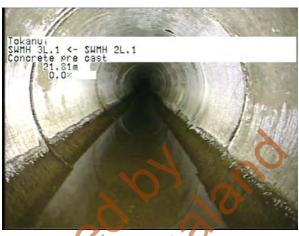


MH 2L.1 To MH 3L.1\_e31beeec-a341-4644-9dc6-b9bd917d6d67\_20230406\_1 20447\_477.jpg, 00:07:18, 21.81m

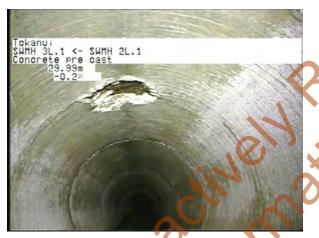


MH 2L.1 To MH 3L.1\_eba0790a-3924-4b26-907a-3cd8429df09d\_20230406\_1 20730\_087.jpg, 00:09:52, 29.99m



MH 2L.1 To MH 3L.1\_3ef362ac-0bf4-4888-a7d1-e53af14c699f\_20230406\_120 742\_982.jpg, 00:09:52, 29.99m

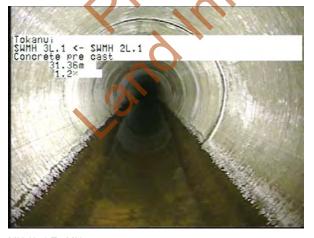

MH 2L.1 To MH 3L.1\_e5591110-9edc-4d18-84b2-f6409b4e1367\_20230406\_1 20848\_244.jpg, 00:11:03, 31.36m

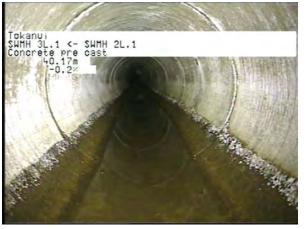

MH 2L.1 To MH 3L.1\_ca357b35-9e6c-4f01-9f87-4f16c5b942b2\_20230406\_12 1137\_810.jpg, 00:13:47, 40.17m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20



MH 2L.1 To MH 3L.1\_e554e0b9-0110-479f-99d1-f1319bec53e9\_20230406\_12 1327\_666.jpg, 00:15:29, 48.42m



MH 2L.1 To MH 3L.1\_14d392c3-017a-4779-b954-347071fcc349\_20230406\_12 1422\_414.jpg, 00:16:04, 51.86 m



MH 2L.1 To MH 3L.1\_a3cc5103-f815-4127-be36-5974781bb71f\_20230406\_12 1434\_603.jpg, 00:16:05, 51.86m



MH 2L.1 To MH 3L.1\_da89f198-a029-4dd7-9e50-f13d7dbff8b4\_20230406\_121 540\_689.jpg, 00:17:02, 53.36m



MH 2L.1 To MH 3L.1\_6d6e23aa-cbe9-48e4-a1f1-a2cdcafd09a1\_20230406\_12 1559\_281.jpg, 00:17:12, 54.13m



MH 2L.1 To MH 3L.1\_f2f34aca-72da-436c-a029-ee3f67361e9f\_20230406\_121 642\_298.jpg, 00:17:39, 55.38m





T 011		A (A)	0 " 11
Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20



MH 2L.1 To MH 3L.1\_61a6279a-f437-4444-93b9-dfcccaec0b7e\_20230406\_12 1716\_659.jpg, 00:18:08, 56.94m



MH 2L.1 To MH 3L.1\_0e2c1454-5656-4755-9c20-8dfd7c6bb14f\_20230406\_12 1910\_280.jpg, 00:19:54, 61.32 m



MH 2L.1 To MH 3L.1\_03b9ea51-5a63-4fa5-8fff-331a83bb6ca2\_20230406\_122 114\_253.jpg, 00:21:48, 67.94m



MH 2L.1 To MH 3L.1\_f8a626dc-c15d-4079-b907-47acf5c79cff\_20230406\_122 127\_184.jpg, 00:21:48, 67.94m



MH 2L.1 To MH 3L.1\_136818a2-df21-4a67-ac6d-4a4953e24792\_20230406\_1 22231\_453.jpg, 00:22:57, 70.86m



MH 2L.1 To MH 3L.1\_076b8fb5-4238-4183-b4a1-5861ccafb161\_20230406\_12 2456\_980.jpg, 00:25:16, 82.42m





Town or Suburb	Date	Asset No.	Section No.	
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20	



MH 2L.1 To MH 3L.1\_cfd606d4-2baa-4957-9a26-e42d5893397a\_20230406\_1 22520\_992.jpg, 00:25:35, 83.19m




MH 2L.1 To MH 3L.1\_3158cbc6-51db-4f0b-a441-ad166bbfff3c\_20230406\_122 533\_243\_jpg, 00:25:35, 83.19m



MH 2L.1 To MH 3L.1\_13f3426a-5d68-482f-85e6-5cdaf74485b9 20230406\_12 2629\_068.jpg, 00:26:38, 83.82m



MH 2L.1 To MH 3L.1\_72767a2a-11d7-4fb3-a775-4c123d77f17e\_20230406\_12 2646\_970.jpg, 00:26:51, 85.74m

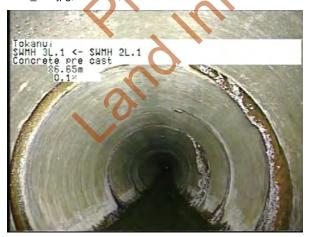

MH 2L.1 To MH 3L.1\_8aa14d2c-8d03-4b5a-885b-c75f949e1c53\_20230406\_1 22710\_190.jpg, 00:27:08, 86.65m



MH 2L.1 To MH 3L.1\_bd9683a4-d2d6-45bd-a6f7-64a7ab74fe45\_20230406\_12 2742\_049.jpg, 00:27:30, 88.20m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20



MH 2L.1 To MH 3L.1\_e1d52d70-a10c-49b9-82e1-83502db2b1e9\_20230406\_1 22921\_487.jpg, 00:29:01, 93.24m

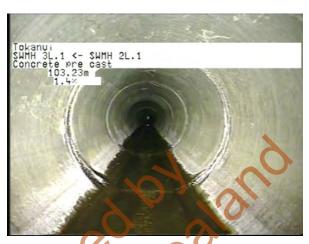


MH 2L.1 To MH 3L.1\_155a9132-91b5-4f1b-97ed-c7b638091c30\_20230406\_1 23152\_268.jpg, 00:31:26, 103.23m



MH 2L.1 To MH 3L.1\_8e5a35ef-e81f-4f5f-8d3e-c46288c65d89\_20230406\_123 319\_889.jpg, 00:32:44, 110.27m



MH 2L.1 To MH 3L.1\_94e435f8-c298-4f98-a11a-c86148ee5e35\_20230406\_12 3602\_149.jpg, 00:35:20, 123.31m

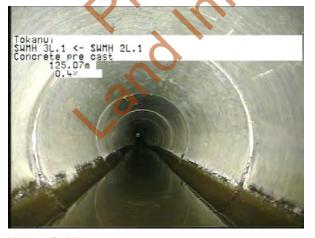

MH 2L.1 To MH 3L.1\_b04a8d02-70fb-47fd-ac87-52fbed3a7acc\_20230406\_12 3636\_380.jpg, 00:35:46, 125.07m



MH 2L.1 To MH 3L.1\_0fb4beae-e805-4480-b9f5-c4db597143a4\_20230406\_12 3805\_012.jpg, 00:37:05, 131.80m




**CST Group Ltd** 

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

#### Section Pictures - 6/04/2023 - MH 2L.1 To MH 3L.1

Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 2L.1 To MH 3L.1	20

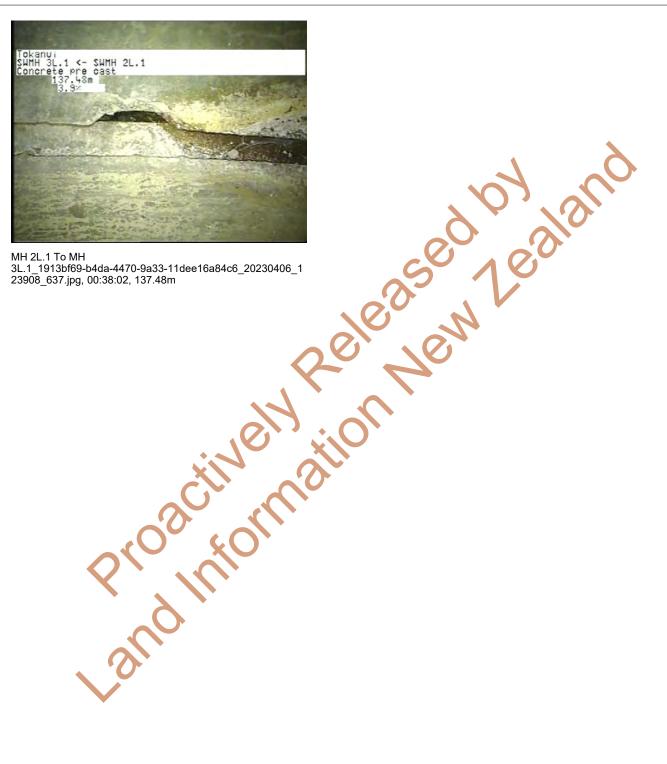

MH 2L.1 To MH 3L.1 1913bf69-b4da-4470-9a33-11dee16a84c6 20230406 1 23908\_637.jpg, 00:38:02, 137.48m


Page 10



CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH 2L.1 To MH 3L.1	6/04/2023	11:56 am	CST Group	Tokanui		Downstream node	143.45 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pine	675 mm	675 mm	SWMH 3L1	SWMH 2L 1	0 000 m	0.221 m	0 154 %

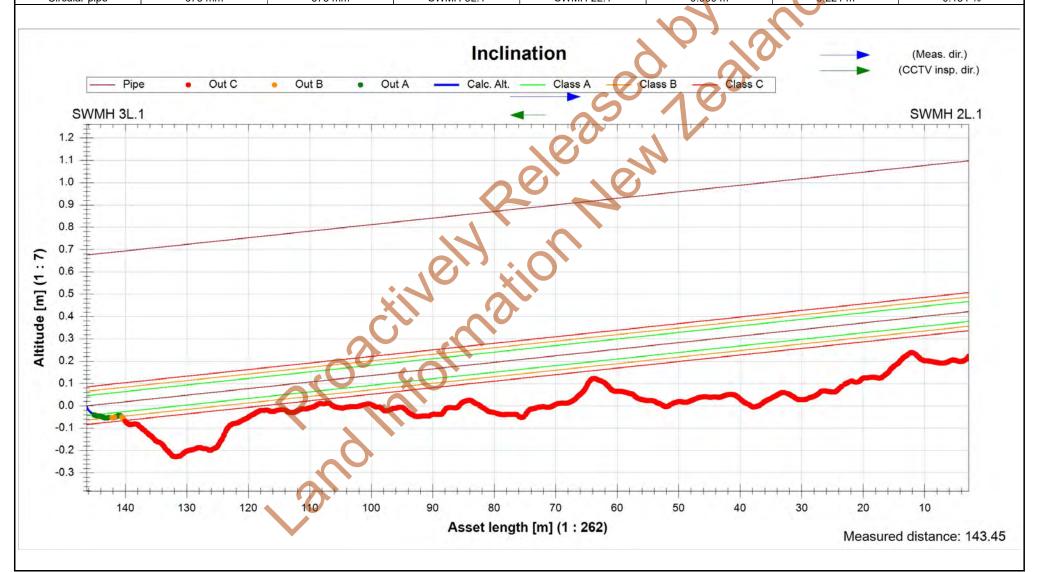



CST Group Ltd , Cambridge


Tel. 07 827 9161 cctv@cstgroup.co.nz

Section Inspection -	6/04/2023 - N	/IH 3L.1 То	Inlet 4L.1
----------------------	---------------	-------------	------------

Section No.	Asset No.	Contract Number	Date	Time	Weather
21	MH 3L.1 To Inlet 4L.1	1	6/04/2023	12:44 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	27.62 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	26.82 m	Dia/Height	675 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	675 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	Inlet 4L.1		D/S Node	SWMH 3L.1	
U/S Node Type	Stormwater inlet		D/S Node Type	Stormwater manhole	
U/S Pipe Depth			D/S Pipe Depth	3.45 m	
U/S Location			D/S Location		
Comments					

1:218 m + OC Observation MPEG Photo Score

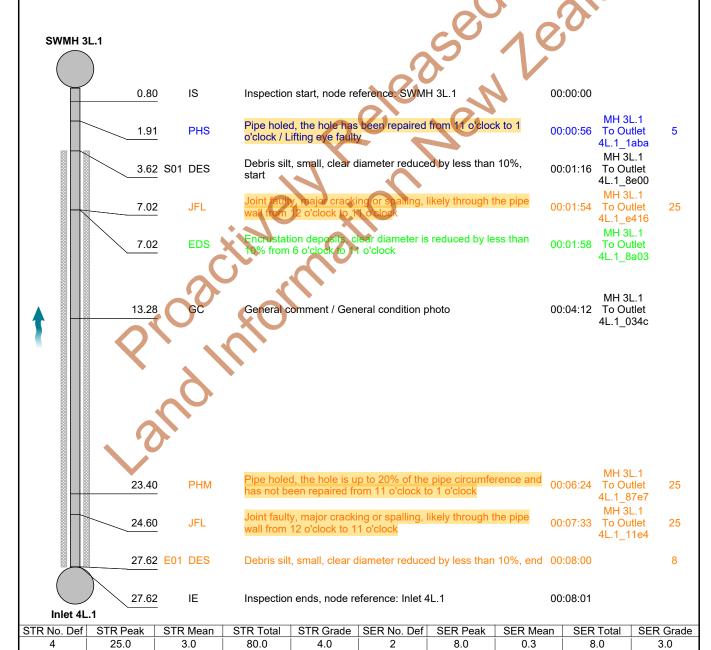






### Section Pictures - 6/04/2023 - MH 3L.1 To Inlet 4L.1

Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 3L.1 To Inlet 4L.1	21



MH 3L.1 To Outlet 4L.1\_1abac5b6-8670-4230-94b7-bd4fef31e91e\_20230406\_12 4535\_589.jpg, 00:00:56, 1.91m



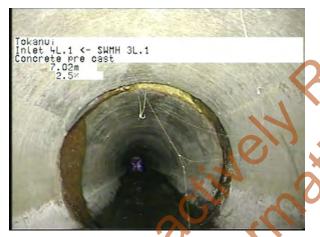

MH 3L.1 To Outlet 4L.1\_e4161afd-e948-44e2-a649-42ff507c516a\_20230406\_12 4650\_316.jpg, 00:01:54, 7.02m



MH 3L.1 To Outlet 4L.1\_8a036046-8af3-45b3-84a4-b02f39ee56aa\_20230406\_12 4659\_854.jpg, 00:01:58, 7.02m



MH 3L.1 To Outlet 4L.1\_034cb46f-8662-41f2-97a4-684fef888fe2\_20230406\_124 921\_082.jpg, 00:04:12, 13.28m



MH 3L.1 To Outlet 4L.1\_87e76c73-d798-439d-8f50-d9681a4bc55e\_20230406\_1 25138\_342.jpg, 00:06:24, 23.40m





### Section Pictures - 6/04/2023 - MH 3L.1 To Inlet 4L.1

Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 3L.1 To Inlet 4L.1	21



MH 3L.1 To Outlet 4L.1\_11e4b69d-76b0-48b6-869b-82ee541d92a4\_20230406 1 25256\_863.jpg, 00:07:33, 24.60m


Proactively Released Lealand
Landinformation
Landinformation



# Section Inclination - 6/04/2023 - MH 3L.1 To Inlet

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

							ŭ ,
Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH 3L.1 To Inlet 4L.1	6/04/2023	12:44 pm	CST Group	Tokanui		Downstream node	25.25 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	675 mm	675 mm	Inlet 4L.1	SWMH 3L.1	0.002 m	-0.219 m	-0.871 %

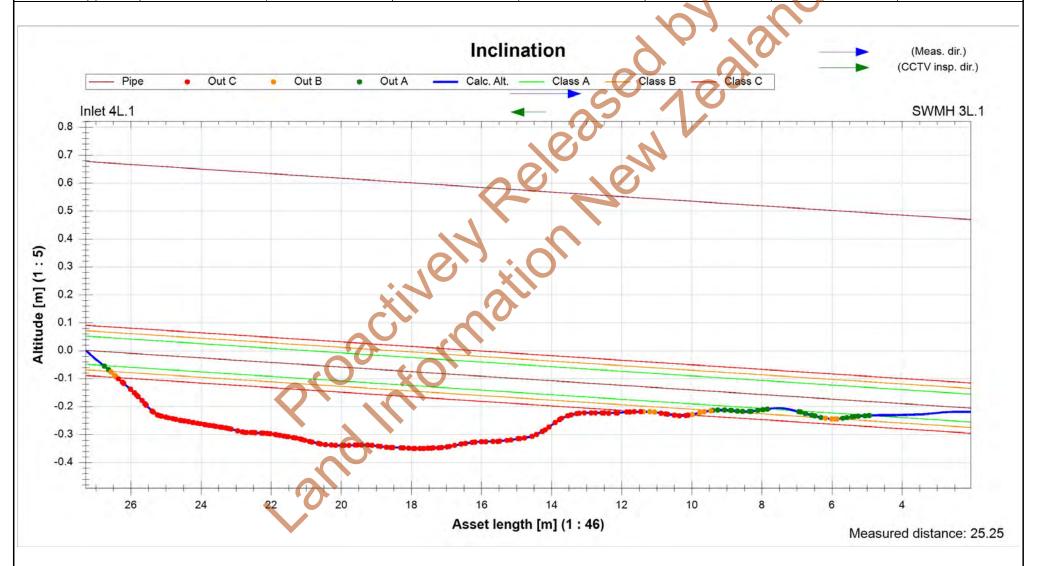



CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

# Section Inspection - 6/04/2023 - MH 3L.1 To 4L.1A Inlet

Section No.	Asset No.	Contract Number	Date	Time	Weather
30	MH 3L.1 To 4L.1A Inlet	1	6/04/2023	2:23 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

Line Length	41.66 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	40.86 m	Dia/Height	675 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	675 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	Inlet 4L.1A		D/S Node	SWMH 3L.1	
U/S Node Type	Stormwater inlet		D/S Node Type	Stormwater manhole	
U/S Pipe Depth			D/S Pipe Depth	3.45 m	
U/S Location			D/S Location		
Comments					

1:329 m + OC Observation MPEG Photo Score

	SWMH	BL.1					5	10				
		0.80	) IS	Inspection	start, node rel	erence: SWMI	H 3L.1	00	:00:00			
		0.80	JFS	Joint fault	y, minor crackii	ng or spalling a	at 11 o'clock	00	:00:36	MH 3L To 4L. Inlet_6e	1A	1
		1.40	) PHS	Pipe holed o'clock	d, the hole has	been repaired	from 11 o'cloc	k to 1 00	:01:01	MH 3L To 4L. Inlet_ff	1A 668	5
		4.03	S01 PHS		d, the hole has art / Faulty liftin		from 11 o'cloc	k to 1 00	:01:36	MH 3L To 4L. Inlet_9	1A 96a	
		9.40	JFL	Joint fault wall from	y, major cracki 6 o'clock to 9 o	ng or spalling, l clock / Rubber	likely through t r seal out	he pipe 00	:02:26	MH 3L To 4L. Inlet_4	1A 7ae	25
		10.19	g GC	General c	omment / Gene	eral condition p	photo	00	:03:16	MH 3L To 4L. Inlet_2 MH 3L	1A 7d7	
	<b>†</b>	14.37 TM	reduced b	n temporary, the temporary to the tempor	from 5 o'clock	to 7 o'clock		:03:51	To 4L. Inlet_0a	1A a5fc	20	
		20.11	JFL -	Joint fault wall from	y, major crackir 8 o'clock to 10	ng or spalling, l o'clock	likely through t	he pipe 00	:05:22	To 4L. Inlet_8	1A 7e4	25
		20.11	GC	General c	omment / Gene	eral condition p	photo	00	:05:44	To 4L. Inlet_4	1A	
		.?								MULOU		
		34.27	JDM	Joint displ	aced, 10% to 2	25% of the pipe	e diameter	00	:08:17	MH 3L To 4L. Inlet_0f MH 3L	1A 017	15
		34.27	JOS	Joint oper	ı, displacement	is less than 20	0mm	00	:08:19	To 4L.	1A	
		41.66	E01 PHS		d, the hole has nd / Faulty lifting		from 11 o'cloc	k to 1 00	:10:03			5
		41.66	S IE	Inspection	ends, node re	ference: Inlet 4	IL.1A	00	:10:04			
	Inlet 4L		STD Moon	CTD Total	STD Crode	CED No. Dof	SED Dock	SED Moon	CED	Total	SED	Crode
1	STR No. Def	STR Peak	STR Mean	STR Total	SIKGRAGE	SER No. Def	SER Peak	SER Mean	SEK	Total	SEK	Grade

76.0

4.0

20.0

0.5

20.0


4.0





### Section Pictures - 6/04/2023 - MH 3L.1 To 4L.1A Inlet

Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 3L.1 To 4L.1A Inlet	30

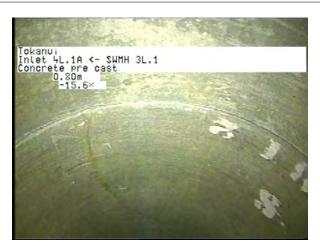

MH 3L.1 To 4L.1A Inlet\_6e2fd88e-489a-4334-925a-5ea1c237ff7c\_20230406\_14 2434\_799.jpg, 00:00:36, 0.80m



MH 3L.1 To 4L.1A Inlet\_ff668f9b-7c2e-42c4-b980-c91699fd68e9\_20230406\_142 518\_512-jpg, 00:01:01, 1.40m



MH 3L.1 To 4L.1A Inlet\_996a0ca0-0fb5-4ab1-8c77-3beade6c34b4\_20230406\_14 2602\_793.jpg, 00:01:36, 4.03m



MH 3L.1 To 4L.1A Inlet\_47aebede-4187-4981-a74e-e369e4ee9c31\_20230406\_1 42704\_666.jpg, 00:02:26, 9.40m



MH 3L.1 To 4L.1A Inlet\_27d76b44-1329-4185-a445-6a22b89150e4\_20230406\_1 42804\_766.jpg, 00:03:16, 10.19m



MH 3L.1 To 4L.1A Inlet\_0a5fc193-8175-4f24-b7fc-62fa2161c2dc\_20230406\_142 911\_003.jpg, 00:03:51, 14.37m





### Section Pictures - 6/04/2023 - MH 3L.1 To 4L.1A Inlet

Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH 3L.1 To 4L.1A Inlet	30



MH 3L.1 To 4L.1A Inlet\_87e499ee-67c2-4bf4-9c4e-d0c141d2ad9f\_20230406\_14 3037\_117.jpg, 00:05:22, 20.11m



MH 3L.1 To 4L.1A Inlet\_4b4bd8bc-6f4a-4216-86dd-b5b0e69d989f\_20230406\_14 3111\_974\_jpg, 00:05:44, 20.11m



MH 3L.1 To 4L.1A Inlet\_0f017929-4dd3-4872-8303-7d38d6cd798e\_20230406\_1 43407\_948.jpg, 00:08:17, 34.27m




MH 3L.1 To 4L.1A Inlet\_daa24287-8527-4576-af81-8c6700fd4912\_20230406\_14 3419\_252.jpg, 00:08:19, 34.27m



# Section Inclination - 6/04/2023 - MH 3L.1 To 4L.1A

CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH 3L.1 To 4L.1A Inlet	6/04/2023	2:23 pm	CST Group	Tokanui		Downstream node	41.02 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	675 mm	675 mm	Inlet 4L.1A	SWMH 3L.1	0.000 m	-0.704 m	-1.717 %

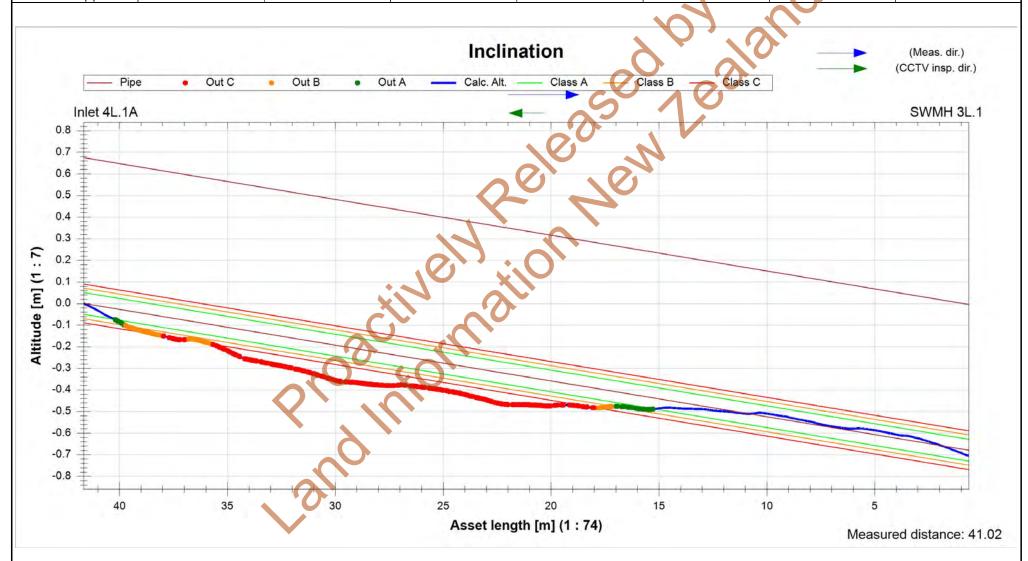



CST Group Ltd , Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 6/04/2023 - MH L.0 To MH N.0

Section No.	Asset No.	Contract Number	Date	Time	Weather
31	MH L.0 To MH N.0	1	6/04/2023	3:24 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			

	CO. C.Cup		
110.52 m	Material	Concrete pre cast	Use Stormwater
Downstream node	Shape	Circular pipe	Pipe Status Original condition
109.72 m	Dia/Height	800 mm	Currency Current Inspection
0.00 m	Width	800 mm	Inspection Inspection complete
	Location	Private property - hardstand	Cleaning Status
SWMH N.0	1	D/S Node	SWMH L.0
Stormwater manhole		D/S Node Type	Stormwater miscellaneous
		D/S Pipe Depth	2.24 m
		D/S Location	7 70.
	Downstream node 109.72 m 0.00 m	110.52 m Material  Downstream node Shape 109.72 m Dia/Height 0.00 m Width Location	110.52 m Material Concrete pre cast  Downstream node Shape Circular pipe  109.72 m Dia/Height 800 mm  0.00 m Width 800 mm  Location Private property - hardstand  SWMH N.0 Stormwater manhole D/S Node D/S Node Type D/S Pipe Depth

Comments MPEG 1:611 m + OC Observation Photo Score 00:00:00 SWMH L.0 0.80 IS Inspection start, node reference: SWMH L.0 MH L.0 To Pipe holed, the hole has been repaired at 12 o'clock, start / 00:00:25 0.99 S01 PHS MH Lifting eyes faulty, seeping water N.0\_d86cd MH L.0 To Debris greasy, small, clear diameter is reduced by less than 00:01:39 2.82 S02 DGS МН 10% from 5 o'clock to 7 o'clock, start N.0\_bcd2d MH L.0 To 9.97 GC General comment / General condition photo 00:03:00 MH N.0\_7dc38 MH L.0 To Construction feature from 10 o'clock to 12 o'clock / Lateral CF 00:03:12 10.85 MH connection N.0\_75dd4 MH L.0 To General comment / General condition photo 20.49 GC 00:05:17 MH N.0 d65ad MH L.0 To 28.08 MHN.0 84f4b MH L.0 To 29.15 General comment / General condition photo 00:06:34 MH N.0 c4d85 MH L.0 To 43.31 General comment / General condition photo 00:08:08 MH N.0 fe6ef8 MH L.0 To Joint faulty, minor cracking or spalling from 12 o'clock to 2 48.84 00:08:37 MH N.0 bdf7b MH L.0 To Joint faulty, minor cracking or spalling from 11 o'clock to 1 52.42 ĴFS 00:09:21 MH N.0\_f1a43 MH L.0 To GC 00:09:23 52.42 General comment / General condition photo MH N.0\_beed4 MH L.0 To 65.91 GC General comment / General condition photo 00:11:02 MH N.0\_755d8 MH L.0 To Construction feature from 1 o'clock to 3 o'clock / Lateral 65.91 00:11:02 CF MH connection N.0\_7fcaf3 MH L.0 To Lateral problem, medium defect at 2 o'clock / Constant water 67.43 LXM 00:11:18 20 N.0\_8ef91 MH L.0 To 70.64 GC General comment / General condition photo 00:12:16 MH

N.0\_6219b



CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

# Section Inspection - 6/04/2023 - MH L.0 To MH N.0

Section No. Asset No.		Contract Number	Date	Time	Weather	
31	MH L.0 To MH N.0	1	6/04/2023	3:24 pm	Dry Weather	
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client	
Tokanui	Nathan Whare	CST Group				

Tokanui		nan Whare	CST Group	Video Reference	Drawing i	NO.	Cileii	
1:611	m +	ос	Observation			MPEG	Photo	Score
	84.52	CF	Construction feature from connection	m 9 o'clock to 11 o'clock	/ Lateral	00:14:06	MH L.0 To	
	85.93	LFM		aps between the lateral p pen at 10 o'clock / Water		00:14:26	N.0_c8ce0 MH L.0 To MH N.0_e4918	10
	85.93	DGS	Debris greasy, small, cle 10% from 6 o'clock to 8	ear diameter is reduced b o'clock	y less than	00:14:48	MH L.0 To MH N.0 788a8	8
	90.33	GC	General comment / Gen	eral condition photo	7	00:15:45	MH L.0 To MH N.0_69e20	
	95.94	RIS	Root intrusion, roots res 11 o'clock to 1 o'clock / I	trict flow by 10% or less Roots coming through lift	of full flow from ing eye	00:16:14	MH L.0 To MH N.0_5621b	5
	01.36	GC	General comment / Gen	eral condition photo	NV	00:17:13	N.0_64ca1	
SWMH NO	07.69	CF	Construction feature from connection	m 2 o'clock to 4 o'clock /	Lateral	00:17:47	MH L.0 To MH N.0_06c0a	
\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	08.68	LXL	Lateral problem, large descepting through lateral	efect at 3 o'clock / Groun	d water	00:18:04	MH L.0 To MH N.0_1c3a9	30
\\\\1	10.52 E	01 PHS	Pipe holed, the hole has Lifting eyes faulty, seepi	been repaired at 12 o'cl ng water	ock, end /	00:18:51		5
\\1	10.52 E	02 DGS	Debris greasy, small, cle 10% from 5 o'clock to 7	ear diameter is reduced b o'clock, end	y less than	00:18:52		8
1	10.52	IE	Inspection ends, node re	eference: SWMH N.0		00:18:53		
		~ O						
	25							
		7//						
	<b>(</b>	0						
	0	6						

STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mean	SER Total	SER Grade
7	35.0	0.6	68.0	4.0	3	16.0	0.2	21.0	4.0





Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH L.0 To MH N.0	31



MH L.0 To MH N.0\_d86cde5e-42e8-4368-8579-a99ad8755ca5\_20230406\_15 2537\_334.jpg, 00:00:25, 0.99m




MH L.0 To MH N.0\_bcd2da46-5308-4325-944e-bce3e7c063da\_20230406\_15 2657\_067.jpg, 00:01:39, 2.82m



MH L.0 To MH N.0\_7dc38427-e264-4876-8582-31f10e6f1f74\_20230406\_152 828\_461.jpg, 00:03:00, 9.97m



MH L.0 To MH N.0\_75dd4cbc-cf68-4eb8-bd10-85fa86fa8054\_20230406\_152 853\_132.jpg, 00:03:12, 10.85m

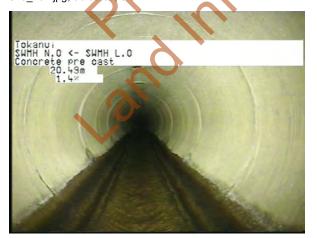

MH L.0 To MH N.0\_d65ad6a2-e3ab-4f0f-81eb-6eaac14ceb03\_20230406\_15 3109\_779.jpg, 00:05:17, 20.49m




MH L.0 To MH N.0\_84f4b8db-3f8a-488a-96d1-36db2789082d\_20230406\_15 3157\_560.jpg, 00:05:59, 28.08m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH L.0 To MH N.0	31

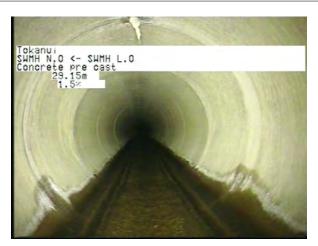

MH L.0 To MH N.0\_c4d854e7-7c40-4eaf-a0d4-cc1a2f796d6c\_20230406\_153 239\_211.jpg, 00:06:34, 29.15m




MH L.0 To MH N.0\_fe6ef8c5-7a24-4f63-95e3-03998bf35ef8\_20230406\_1534 17\_459 jpg, 00:08:08, 43.31m



MH L.0 To MH N.0\_bdf7bd39-fd77-4658-863c-e918b1a400a8\_20230406\_15 3452\_225.jpg, 00:08:37, 48.84m



MH L.0 To MH N.0\_f1a43aad-f720-4bba-89eb-06cf6aa0544d\_20230406\_153 541\_152.jpg, 00:09:21, 52.42m

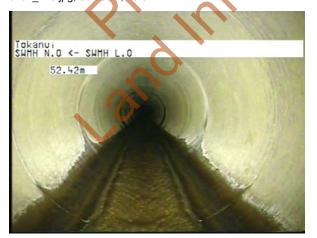

MH L.0 To MH N.0\_beed4716-67b9-4cb7-8f97-55b4515aa116\_20230406\_15 3547\_675.jpg, 00:09:23, 52.42m




MH L.0 To MH N.0\_755d8516-0426-4715-a277-cf488cb6289d\_20230406\_15 3730\_932.jpg, 00:11:02, 65.91m





Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH L.0 To MH N.0	31

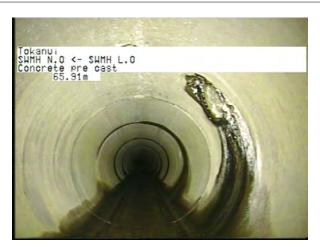

MH L.0 To MH N.0\_7fcaf3ab-4819-4c10-8afe-1e61be001199\_20230406\_153 741\_167.jpg, 00:11:02, 65.91m



MH L.0 To MH N.0\_8ef91109-dd1e-48f5-b4a7-1bee298a1b75\_20230406\_15 3811\_012.jpg, 00:11:18, 67.43m



MH L.0 To MH N.0\_6219bdfe-dab6-4dde-a1e5-6f34164f0dbe\_20230406\_153 916\_073.jpg, 00:12:16, 70.64m



MH L.0 To MH N.0\_c8ce0c33-58b0-487e-8ed6-a217ba6b1107\_20230406\_15 4114\_388.jpg, 00:14:06, 84.52m



MH L.0 To MH N.0\_e4918654-d695-4254-a153-06d53a8b685d\_20230406\_1 54149\_638.jpg, 00:14:26, 85.93m



MH L.0 To MH N.0\_788a8711-d5b1-4c5f-aaa8-4dbfa7651d49\_20230406\_15 4224\_533.jpg, 00:14:48, 85.93m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH L.0 To MH N.0	31



MH L.0 To MH N.0\_69e208ac-ab81-40d5-bae9-4e431ffb17ef\_20230406\_154 329\_172.jpg, 00:15:45, 90.33m



MH L.0 To MH N.0\_5621bd13-0c32-42b2-a720-e078e0422212\_20230406\_1 54407\_660.jpg, 00:16:14, 95.94m

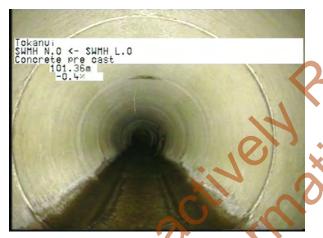

MH L.0 To MH N.0\_64ca1a11-fbb4-4cfc-bda9-5df4a1b661a4\_20230406\_154 533\_385.jpg, 00:17:13, 101.36m



MH L.0 To MH N.0\_06c0ac44-61fe-4108-831f-b021c789ebf6\_20230406\_154 615\_108.jpg, 00:17:47, 107.69m



MH L.0 To MH N.0\_1c3a9508-21c5-4743-abf8-5b709a7b9879\_20230406\_15 4647\_322.jpg, 00:18:04, 108.68m



# Section Inclination - 6/04/2023 - MH L.0 To MH N.0

CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH L.0 To MH N.0	6/04/2023	3:24 pm	CST Group	Tokanui		Downstream node	109.52 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	SWMH N.0	SWMH L.0	0.000 m	-0.484 m	-0.442 %





CST Group Ltd , Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

Section Inspection - 6/04/2023 - M	MH N.0 To MH N.1
------------------------------------	------------------

- 144 d
m Dry Weather
No. Client
ן נ

Line Length	40.49 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	40.45 m	Dia/Height	800 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	800 mm	Inspection	Inspection complete
Surface		Location		Cleaning Status	
U/S Node	SWMH N.1		D/S Node	SWMH N.0	
U/S Node Type	Stormwater miscella	neous	D/S Node Type	Stormwater manhole	
U/S Pipe Depth			D/S Pipe Depth		
U/S Location			D/S Location		

Comments	Unable to locate N.1 for pipe depth
----------	-------------------------------------

	1:301	m +	ОС	Observation	MPEG	Photo	Score
					0		
SV	VMH N.0	0.04	IS	Inspection start, node reference: SWMH N.0	00:00:00		
(		2.41	JDL	Joint displaced, more than 25% of pipe diameter	00:18:55	MH N.0 To MH N.1_259ab	45
		2.41	JOL	Joint open, displacement is greater than 40mm	00:18:55	MH N.0 To MH N.1_9e2e3	25
		3.43 S01	DGS	Debris greasy, small, clear diameter is reduced by less than 10% from 5 o'clock to 7 o'clock, start	00:01:25	MH N.0 To MH N.1_221ee	
		5.05	JDS	Joint displaced, less than 10% of pipe diameter	00:01:40	MH N.0 To MH N.1_ac7cb	
	7.19 JFL Joint faulty, major wall from 3 o'clo	Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 7 o'clock / Roots protruding joint	00:01:59	MH N.0 To MH N.1_c7232	25		
		10.87	JFL O	Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 6 o'clock / Roots protruding joint	00:03:01	MH N.0 To MH N.1_11209	25
<b>A</b>	13.84 GC	ec	General comment / General condition photo	00:03:58	MH N.0 To MH N.1_2457e		
		17.91	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 5 o'clock / Roots protruding joint	00:04:59	MH N.0 To MH N.1_3eac6	25
		21.26	CF	Construction feature from 1 o'clock to 2 o'clock / Lateral connection	00:05:46	MH N.0 To MH N.1_21630	
	22.31 CMS 26.33 GC 28.55 JFS	CMS	Cracks multiple, small, visible but not open from 11 o'clock to 1 o'clock	00:06:08	MH N.0 To MH N.1 33e43	10	
		GC	General comment / General condition photo	00:07:12	MH N.0 To MH N.1 e287c		
		JFS	Joint faulty, minor cracking or spalling from 12 o'clock to 11 o'clock / All joints	00:07:27	MH N.0 To MH N.1_d9756	1	
		31.96	CLS	Crack longitudinal, small, visible but not open at 12 o'clock	00:07:54	MH N.0 To MH N.1_30d38	3
		33.73	GC	General comment / General condition photo	00:08:41	MH N.0 To MH N.1 84117	
		37.00	JFS	Joint faulty, minor cracking or spalling from 12 o'clock to 11 o'clock / All joints	00:09:07	MH N.0 To MH N.1_b35e9	1




#### **CST Group Ltd**

, Cambridge Tel. 07 827 9161 cctv @cstgroup.co.nz

### Section Inspection - 6/04/2023 - MH N.0 To MH N.1


Section No.	Asset No.	Contract Number	Date	Time	Weather
32	MH N.0 To MH N.1	1	6/04/2023	3:50 pm	Dry Weather
Town or Suburb	Camera Operator	Operator CST Group	Video Reference	Drawing No.	Client

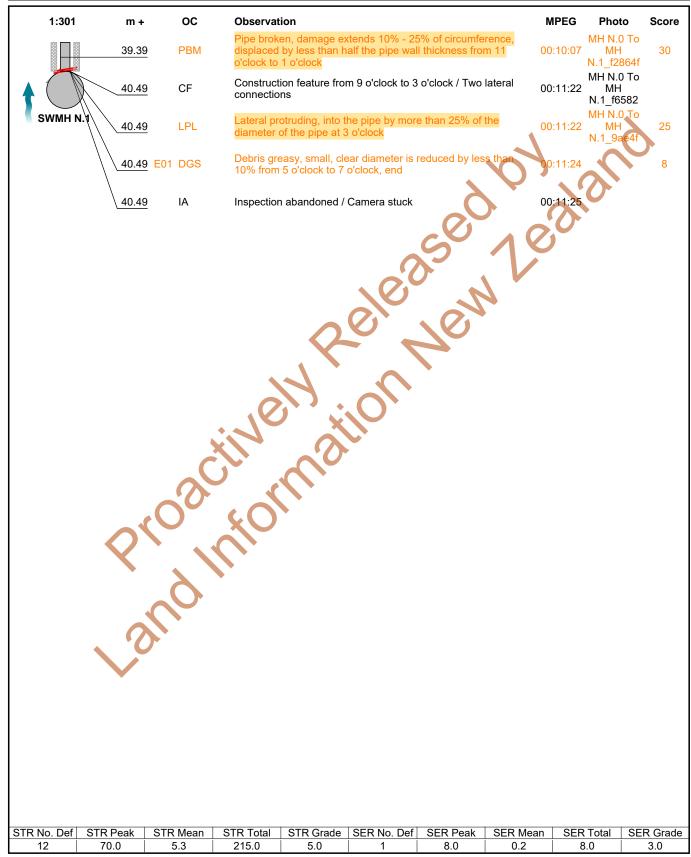






Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH N.0 To MH N.1	32

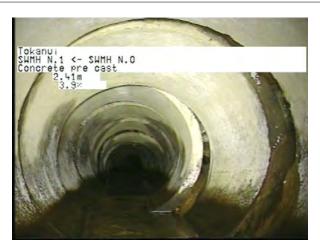


MH N.0 To MH N.1\_259abef6-3357-417a-b6b1-21ff3703d394\_20230406\_154 853\_590.jpg, 00:18:55, 2.41m

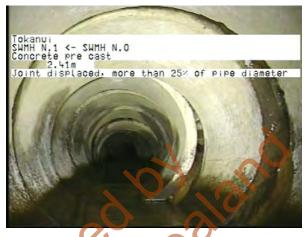

MH N.0 To MH N.1\_9e2e3a4f-5139-4ab2-9f2f-71c516adb67e\_20230406\_154 858\_249.jpg, 00.18:55, 2.41m



MH N.0 To MH N.1\_221eed31-167c-4f08-826e-db48a05f480a\_20230406\_15 5157\_256.jpg, 00:01:25, 3.43m

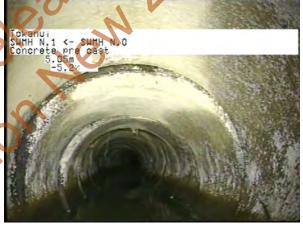

MH N.0 To MH N.1\_ac7cb133-4512-45c0-a01b-6bd7c186c8b3\_20230406\_15 5218\_080.jpg, 00:01:40, 5.05m



MH N.0 To MH N.1\_c7232d6d-8ca5-4339-b763-ab7e100d83d2\_20230406\_15 5248\_798.jpg, 00:01:59, 7.19m




MH N.0 To MH N.1\_11209ceb-76f4-48d7-87bc-2711dad56384\_20230406\_15 5403\_423.jpg, 00:03:01, 10.87m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH N.0 To MH N.1	32

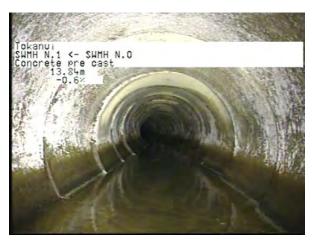

MH N.0 To MH N.1\_2457edcf-bf72-4670-a094-92838979a6aa\_20230406\_15 5507\_840.jpg, 00:03:58, 13.84m



MH N.0 To MH N.1\_3eac6d58-c56f-4066-8242-dc9fa803d092\_20230406\_155 620\_357\_jpg, 00.04:59, 17.91m

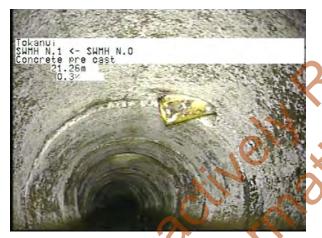

MH N.0 To MH N.1\_21630247-33fe-4858-a748-056b93b7cd26\_20230406\_15 5716\_905.jpg, 00:05:46, 21.26m



MH N.0 To MH N.1\_33e4370a-b819-4c5e-9fc3-591f345c4d96\_20230406\_155 748\_522.jpg, 00:06:08, 22.31m



MH N.0 To MH N.1\_e287cf9b-b63c-4d09-9c9e-0598a1d7223b\_20230406\_15 5906\_831.jpg, 00:07:12, 26.33m



MH N.0 To MH N.1\_d975649e-4ba4-4fbc-9259-76ecd8d5261e\_20230406\_15 5927\_210.jpg, 00:07:27, 28.55m






Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH N.0 To MH N.1	32



MH N.0 To MH N.1\_30d3853e-2439-4199-8db5-d60147d27aa8\_20230406\_1 60002\_120.jpg, 00:07:54, 31.96m



MH N.0 To MH N.1\_8411798e-72cc-457d-aa6f-8cf4f8be5c3e\_20230406\_160 056\_090.jpg, 00:08:41, 33.73m

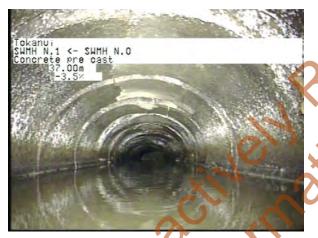


MH N.0 To MH N.1\_b35e9991-e497-44ad-afd6-10aac7df1d05\_20230406\_16 0131\_447.jpg, 00:09:07, 37.00m



MH N.0 To MH N.1\_f2864fbd-5ed4-43ba-949d-37f8b8cb9dbd\_20230406\_160 238\_511.jpg, 00:10:07, 39.39m



MH N.0 To MH N.1\_f9fb307b-237d-47c4-a331-6183db07786c\_20230406\_16 0245\_276.jpg, 00:10:07, 39.39m

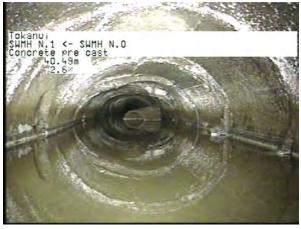

MH N.0 To MH N.1\_f65822e3-23f9-4c1c-b0bf-5ee59af7f06b\_20230406\_1604 04\_490.jpg, 00:11:22, 40.49m



**CST Group Ltd** 

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Pictures - 6/04/2023 - MH N.0 To MH N.1

Town or Suburb	Date	Asset No.	Section No.
Tokanui	6/04/2023	MH N.0 To MH N.1	32




MH N 0 To MH N.1 9ae4f51b-189a-4bab-be16-10cb53b7fe75 20230406 16 0413\_898.jpg, 00:11:22, 40.49m

Page 6



# Section Inclination - 6/04/2023 - MH N.0 To MH N.1

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH N.0 To MH N.1	6/04/2023	3:50 pm	CST Group	Tokanui		Downstream node	39.90 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	800 mm	800 mm	SWMH N.1	SWMH N.0	0.000 m	0.429 m	1.074 %

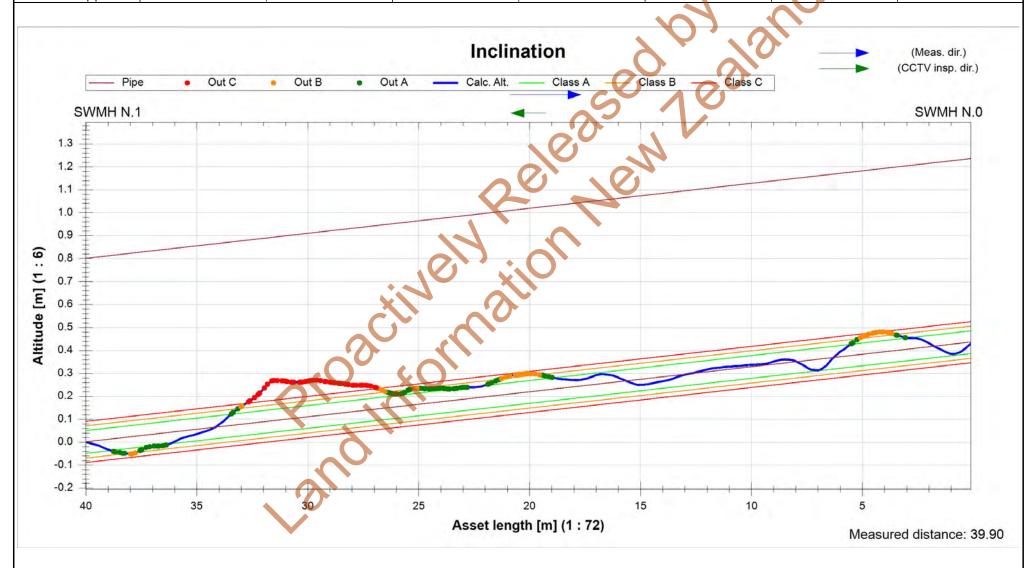



Comments

Section No.	Asset No.	Contract Number	Date	Time	Weather
34	MH N.1 To MH N.2	1	24/04/2023	9:46 am	
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group		_	Fraser Thomas
	·				

Line Length	58.45 m	Material	Concrete pre cast	Use	Stormwater
Setup	Downstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	57.65 m	Dia/Height	750 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	750 mm	Inspection	Inspection complete
Surface		Location	Council road - hardstand	Cleaning Status	
U/S Node	SWMH N.2		D/S Node	SWMH N.1	
U/S Node Type	Stormwater manhole		D/S Node Type	Stormwater manhole	
U/S Pipe Depth			D/S Pipe Depth	2.60 m	
U/S Location			D/S Location		

Unable to locate and get	depth for upstream
--------------------------	--------------------


1:461	m +	ОС	Observat	ion			•	MPEG	Photo	Score
SWMH	<b>l.1</b> 0.80	IS	Inspection	start node re	ference: SWMI	-N1	) 1	00:00:00		
	0.00	10	Пэрссион	r start, riode re	icicioc. Ovvivi			00.00.00		
	1.19	S01 DGS		easy, small, cle 5 o'clock to 7	ear diameter is o'clock, start	reduced by les	s than	00:00:59	MH N.1 T MH N.2_9edf	
	16.82	GC	General c	omment / Gen	eral condition p	photo		00:04:16	MH N.1 T MH N.2_f7bf9	
	31.09	GC	General c	omment / Gen	eral condition p	hoto		00:07:43	MH N.1 T MH N.2_c63e	
	37.66	JFL	Joint fault wall from	y, major cracki 4 o'clock to 8 o	ng or spalling, l o'clock / Tiny ro	likely through t otsprotruding j	he pipe oint	00:10:47	MH N.1 T MH N.2_df2c	25 df
	41.44	GC	General c	omment / Gen	eral condition p	photo		00:11:24	MH N.1 T MH N.2_86ac	13
	45.25	S02 RIS		sion, roots rest o 8 o'clock, sta	trict flow by 109 art	% or less of ful	I flow from	00:11:57	MH N.1 T MH N.2_dafb	а
	48.81	O <sup>PL</sup>			ng or spalling, l o'clock / Roots լ		he pipe	00:12:40	MH N.1 T MH N.2_7414	25 4f
	48.81	CLM			um, crack oper extends to the o			00:12:48	MH N.1 T MH N.2_5871	15  1
	55.17	S03 EDM		on deposits, cl lock to 8 o'cloc	lear diameter is k, start	reduced by 10	0% to 25%	00:14:32	MH N.1 T MH N.2_c59c	12
	58.45	DEL	Debris silt	, large, pipe di	ameter reduced	d more than 25	5%	00:16:04	MH N.1 T MH N.2_a55a	40 ne
	58.45	EDM		on deposits, cl lock to 8 o'cloc	lear diameter is k	reduced by 10	0% to 25%	00:16:05	MH N.1 T MH N.2_b8ee	5
	58.45	E01 DGS		easy, small, cle 5 o'clock to 7	ear diameter is lo'clock, end	reduced by les	s than	00:16:06		8
	58.45	E02 RIS		sion, roots rest to 8 o'clock, en	trict flow by 109 d	% or less of ful	I flow from	00:16:07		5
	58.45	E03 EDM		on deposits, cl lock to 8 o'cloc	lear diameter is k, end	reduced by 10	0% to 25%	00:16:08	MLINI 1 T	5
SWMH N	58.45	IA	Inspection	abandoned /	Unable to pass			00:16:10	MH N.1 T MH	
STR No. Def	STR Peak	STR Mean	STR Total	STR Grade	SER No. Def	SER Peak	SER Mea	n SER	N.2 d399 Total	of SER Grade
3	40.0	1.1	65.0	4.0	5	45.0	1.1		3.0	5.0






#### Section Pictures - 24/04/2023 - MH N.1 To MH N.2


Town or Suburb	Date	Asset No.	Section No.
Tokanui	24/04/2023	MH N.1 To MH N.2	34

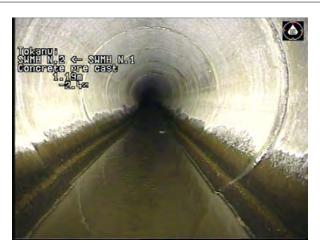

MH N.1 To MH N.2\_9edf6547-a75e-42dc-a5a2-5c82b3edac54\_20230424\_09 4747\_653.jpg, 00:00:59, 1.19m

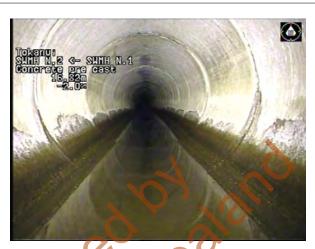

MH N.1 To MH N.2\_f7bf92ff-eb2b-42e4-9436-32cb18c6aa52\_20230424\_095 111\_092\_jpg, 00.04:16, 16.82m

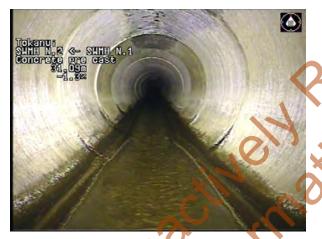

MH N.1 To MH N.2\_c63ee5a0-3c23-4d9f-844f-a11509564c3e\_20230424\_095 446\_091.jpg, 00:07:43, 31.09m



MH N.1 To MH N.2\_df2cdf52-89b8-443e-a250-bfb9ad9ce134\_20230424\_095 759\_488.jpg, 00:10:47, 37.66m



MH N.1 To MH N.2\_86ad3450-3e9e-4312-abf6-b71885a288ad\_20230424\_09 5844\_517.jpg, 00:11:24, 41.44m




MH N.1 To MH N.2\_dafba99f-01b1-49da-984f-d7ac430ea192\_20230424\_095 921\_998.jpg, 00:11:57, 45.25m





### Section Pictures - 24/04/2023 - MH N.1 To MH N.2

Town or Suburb	Date	Asset No.	Section No.
Tokanui	24/04/2023	MH N.1 To MH N.2	34

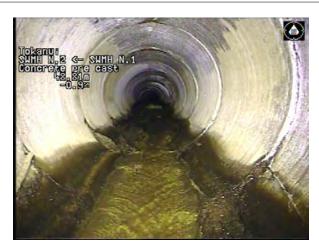

MH N.1 To MH N.2\_7414f722-c10b-4872-ae14-51277d6b977b\_20230424\_10 0020\_389.jpg, 00:12:40, 48.81m



MH N.1 To MH N.2\_5871115d\_83dd-4e24-b180-30adad29c29d\_20230424\_1 00033\_719.jpg, 00:12:48, 48.81m



MH N.1 To MH N.2\_c59d25d8-64b4-491b-9dcb-9b197f4d4d8b\_20230424\_10 0225\_951.jpg, 00:14:32, 55.17m



MH N.1 To MH N.2\_a55ae409-c745-4899-89f7-bbce7466703d\_20230424\_10 0412\_241.jpg, 00:16:04, 58.45m




MH N.1 To MH N.2\_b8ee1645-0d80-4422-b222-ed19e8726faa\_20230424\_10 0422\_729.jpg, 00:16:05, 58.45m



MH N.1 To MH N.2\_d399f190-451f-4809-bac6-876092910497\_20230424\_10 0440\_532.jpg, 00:16:10, 58.45m



Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
MH N.1 To MH N.2	24/04/2023	9:46 am	CST Group	Tokanui		Downstream node	54.24 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	750 mm	750 mm	SWMH N.2	SWMH N.1	0.004 m	0.860 m	1.578 %

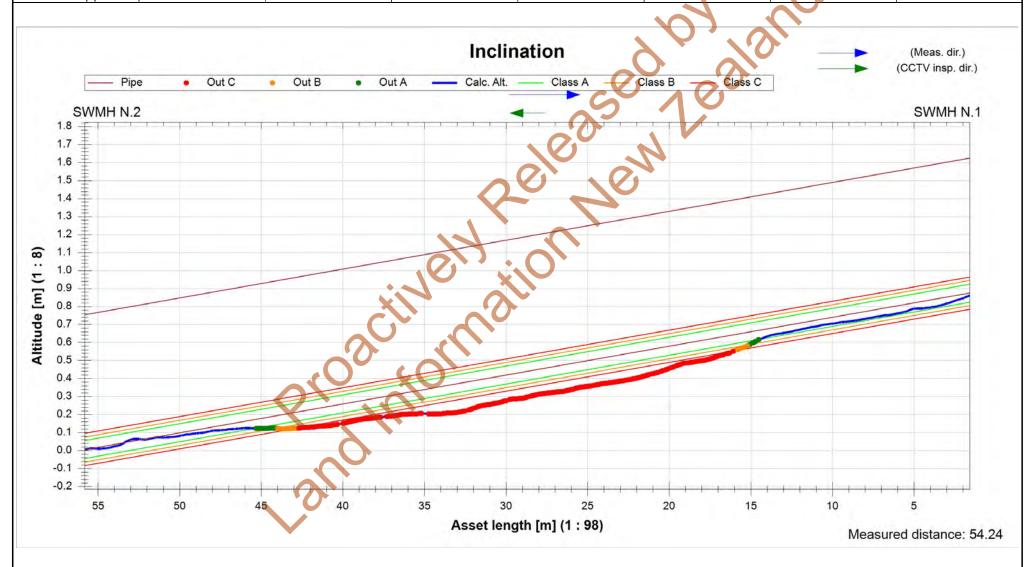



**CST Group Ltd** Cambridge

Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 27/03/2023 - CP J.0 To Main

Section No.	Asset No.	Contract Number	Date	Time	Weather
34	CP J.0 To Main	1	27/03/2023	1:35 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

Line Length	6.17 m	Material	Concrete pre cast	Use	Stormwater
Setup	Upstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	5.47 m	Dia/Height	225 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	225 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	arc Cleaning Status	
U/S Node	SWCP J.0		D/S Node	Main	
U/S Node Type	Stormwater node		D/S Node Type	Stormwater misce	ellaneous
U/S Pipe Depth	0.40 m		D/S Pipe Depth	•	
U/S Location			D/S Location		

Comments Unable to get pipe depth where is drops into main

oc 1:50 m + Observation Score



Inspection ends, node reference: Main

5.0

STR Grade | SER No. Def

0

SER Peak

0.0

25.0 6.4 Stormwater Inspections - Tokanui Hospital

STR Peak

Main

STR No. Def

6.17

ΙE

STR Mean

STR Total

35.0

SER Grade

1.0

00:02:53

SER Total

0.0

SER Mean

0.0



#### **CST Group Ltd**

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

#### Section Pictures - 27/03/2023 - CP J.0 To Main

Town or Suburb	D	ate Asset	No. Section No.	
Tokanui	27/03	3/2023 CP J.0 T	o Main 34	



J/4936-455c-450 J936 Jpg. 00:01:30,1 CP J.0 To Main\_4ca91f64-afc5-4da9-9724-3b39ad6651b7 20230327 1 33602\_285.jpg, 00:00:20, 0.70m




Main\_7587a93c-4c5c-4505-bc90-22155f335ad2\_20230327\_1



# Section Inclination - 27/03/2023 - CP J.0 To Main

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
CP J.0 To Main	27/03/2023	1:35 pm	CST Group	Tokanui		Upstream node	5.31 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	225 mm	225 mm	SWCP J.0	Main	0.000 m	0.222 m	-4.174 %

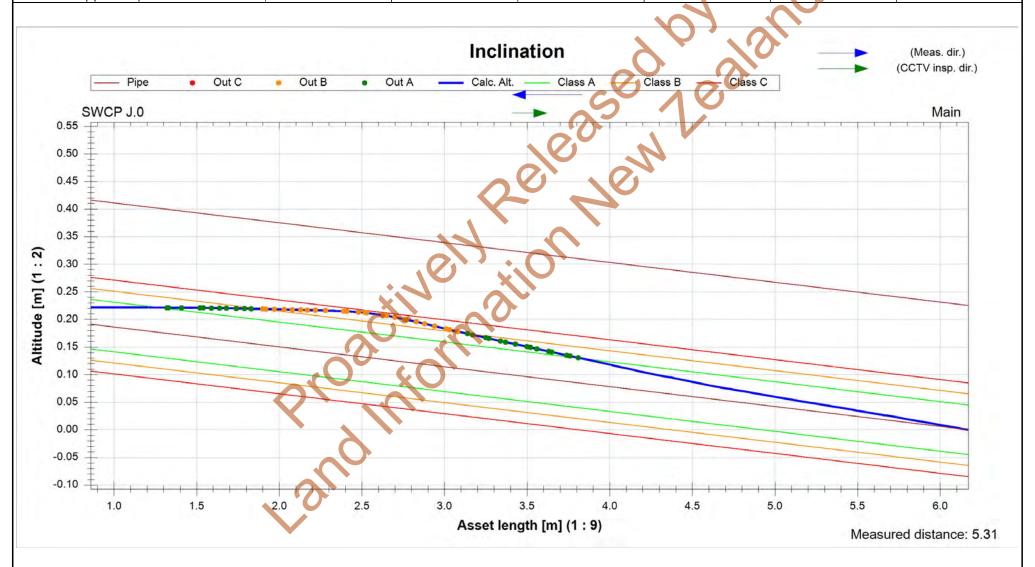



CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

# Section Inspection - 27/03/2023 - CP J.1 To CP J,0

		Contract Number	Date	Time	Weather
33 CP	J.1 To CP J,0	1	27/03/2023	12:56 pm	Dry Weather
Town or Suburb Ca	mera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui Na	athan Whare	CST Group		-	Fraser Thomas

Line Length	32.99 m	Material	Concrete pre cast	Use	Stormwater
Setup	Upstream node	Shape	Circular pipe	Pipe Status	Original condition
Surveyed Length	32.29 m	Dia/Height	225 mm	Currency	<b>Current Inspection</b>
Joint Spacing	0.00 m	Width	225 mm	Inspection	Inspection complete
Surface		Location	Private property - ya	rc Cleaning Status	
U/S Node	SWCP J.1	-	D/S Node	SWCP J.0	
U/S Node Type	Stormwater node		D/S Node Type	Stormwater node	•
U/S Pipe Depth	0.40 m		D/S Pipe Depth	0.40 m	
U/S Location			D/S Location		
Comments					

1:222	m +	ОС	Observation MPEG Photo Score	÷
SWCP J.1	0.70	IS	Inspection start, node reference: CP J.1 00:00:00	
	0.70 S	01 DES	Debris silt, small, clear diameter reduced by less than 10%, start CP J.1 To 00:00:18 Main_d403 3b3c-ad8c	

8					SDSC-adoc	
	3.15	E01 DES	Debris silt, small, clear diameter reduced by less than 10%, end	00:00:56		8
88			V N		CP J.1 To	
	3.15	JFS	Joint faulty, minor cracking or spalling from 1 o'clock to 9 o'clock	00:00:57	Main_12aa 38e7-de58	1
	8.67	JFS	Joint faulty, minor cracking or spalling from 8 o'clock to 10 o'clock	00:03:06	CP J.1 To Main_5be2 1a3c-ac2a	1
	10.19	GC .	General comment / General condition photo	00:03:35	CP J.1 To Main_3de1	
					eed8-d761 CP J.1 To	
	12.35	JFS	Joint faulty, minor cracking or spalling from 11 o'clock to 1 o'clock	00:04:35	Main_04e5 28a1-f5c8-	1
	17.67	S02 DES	Debris silt, small, clear diameter reduced by less than 10%, start	00:05:26	CP J.1 To Main_e8c7 3de5-c97d	
₹	17.84	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 1 o'clock to 3 o'clock / Seal visable	00:05:38	CP J.1 To Main_43ea 1813-f2e4-	25

17.67 \$02	DES	Debris silt, small, clear diameter reduced by less than 10%, start	00:05:26	CP J.1 To Main_e8c7 3de5-c97d	
17.84	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 1 o'clock to 3 o'clock / Seal visable	00:05:38	CP J.1 To Main_43ea 1813-f2e4-	25
19.59	PHM	Pipe holed, the hole is up to 20% of the pipe circumference and has not been repaired from 11 o'clock to 1 o'clock	00:06:33	CP J.1 To Main_26ed 628b-415c	25
19.59	TML	Tomo, a cavity is evident outside of the pipe wall. from 11 o'clock to 1 o'clock	00:06:34	CP J.1 To Main_6f84 0b69-f4d9-	40
19.96	DEM	Debris silt, medium, clear diameter is reduced by 10% - 25%	00:07:16	CP J.1 To Main_f083 82c1-dc73	20
19.96	GC	General comment / General condition photo	00:07:18	CP J.1 To Main_2371 c38a-bcb7	
21.63 E02	DES	Debris silt, small, clear diameter reduced by less than 10%, end $/\!\setminus$	00:07:37		8
21.63	JFL	Joint faulty, major cracking or spalling, likely through the pipe wall from 3 o'clock to 6 o'clock / Seal visable	00:07:42	CP J.1 To Main_be7a 1704-4782	25
23.38	JFS	Joint faulty, minor cracking or spalling from 7 o'clock to 9 o'clock	00:08:32	CP J.1 To Main_d7b5	1

f459-51b5-




**CST Group Ltd** 

, Cambridge Tel. 07 827 9161 cctv@cstgroup.co.nz

### Section Inspection - 27/03/2023 - CP J.1 To CP J,0

Section No.	Asset No.	Asset No. Contract Number		Time	Weather
33	CP J.1 To CP J,0	1	27/03/2023	12:56 pm	Dry Weather
Town or Suburb	Camera Operator	Operator	Video Reference	Drawing No.	Client
Tokanui	Nathan Whare	CST Group			Fraser Thomas

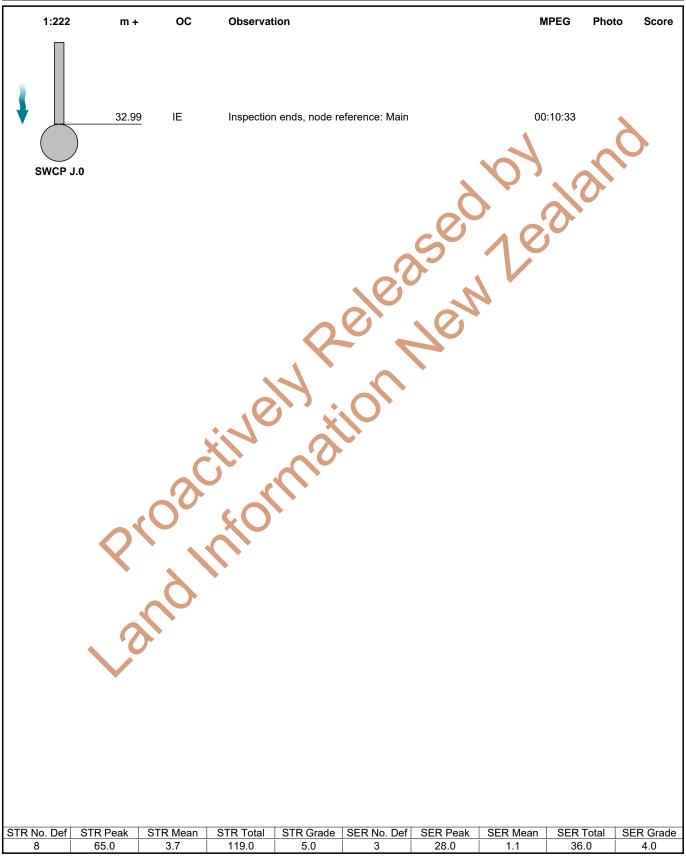





# Section Pictures - 27/03/2023 - CP J.1 To CP J,0

Town or Suburb	Date	Asset No.	Section No.	_
Tokanui	27/03/2023	CP J.1 To CP J.0	33	



CP J.1 To Main\_d4033b3c-ad8c-4d5a-ab4d-ad89e06926d9\_20230327\_ 125649\_207.jpg, 00:00:18, 0.70m



CP J.1 To Main\_12aa38e7-de58-49df-8560-95b462b03d59\_20230327\_1 25738\_184.jpg, 00:00:57, 3.15 m



CP J.1 To Main\_5be21a3c-ac2a-4955-96c5-c1514c1df63f\_20230327\_12 5954\_613.jpg, 00:03:06, 8.67m



CP J.1 To Main\_3de1eed8-d761-4e8e-adcf-faf82f32b9b9\_20230327\_13 0033\_000.jpg, 00:03:35, 10.19m



CP J.1 To Main\_04e528a1-f5c8-42f0-929d-68fad9dbd7fa\_20230327\_13 0139\_352.jpg, 00:04:35, 12.35m



CP J.1 To Main\_e8c73de5-c97d-4ac5-845e-dbbb266924dd\_20230327\_1 30234\_562.jpg, 00:05:26, 17.67m





# Section Pictures - 27/03/2023 - CP J.1 To CP J,0

Town or Suburb	Date	Asset No.	Section No.	
Tokanui	27/03/2023	CP J.1 To CP J.0	33	



CP J.1 To Main\_43ea1813-f2e4-433a-a272-e674b921a434\_20230327\_1 30251\_161.jpg, 00:05:38, 17.84m





CP J.1 To Main\_26ed628b-415c-43c6-8de6-75aa20e6f7b0\_20230327\_1 30356\_181.jpg, 00:06:33, 19.59m



CP J.1 To Main\_6f840b69-f4d9-46ae-9b25-b124606bd218\_20230327\_1 30409\_342.jpg, 00:06:34, 19.59m



CP J.1 To Main\_f894179b-4af2-4376-b3b8-867c0209bb19\_20230327\_1 30440\_545.jpg, 00:06:34, 19.59m



CP J.1 To Main\_f08382c1-dc73-4f6b-a21d-86737853ee7a\_20230327\_1 30456\_695.jpg, 00:07:16, 19.96m





# Section Pictures - 27/03/2023 - CP J.1 To CP J,0

Town or Suburb	Date	Asset No.	Section No.
Tokanui	27/03/2023	CP J.1 To CP J.0	33



Main\_2371c38a-bcb7-4626-a41b-950699dc0b05\_20230327\_1 30504\_662.jpg, 00:07:18, 19.96m



CP J.1 To Main\_be7a1704-4782-4de7-878e-bddef75a6674\_20230327\_1 30558\_456.jpg, 00:07:42, 21.63m



Main\_d7b5f459-51b5-438e-8b58-3e1d4f671a4d\_20230327\_1 30837\_353.jpg, 00:08:32, 23.38m




# Section Inclination - 27/03/2023 - CP J.1 To CP J,0

CST Group Ltd , Cambridge Tel. 07 827 9161

cctv@cstgroup.co.nz

Asset No.	Date	Time	Operator	Town or Suburb	Road	Setup	Surveyed Length
CP J.1 To CP J,0	27/03/2023	12:56 pm	CST Group	Tokanui		Upstream node	31.05 m
Shape	Dia/Height	Width	U/S Node	D/S Node	Start altitude	End altitude	Measured Inc
Circular pipe	225 mm	225 mm	SWCP J.1	SWCP J.0	0.000 m	0.876 m	-2.822 %

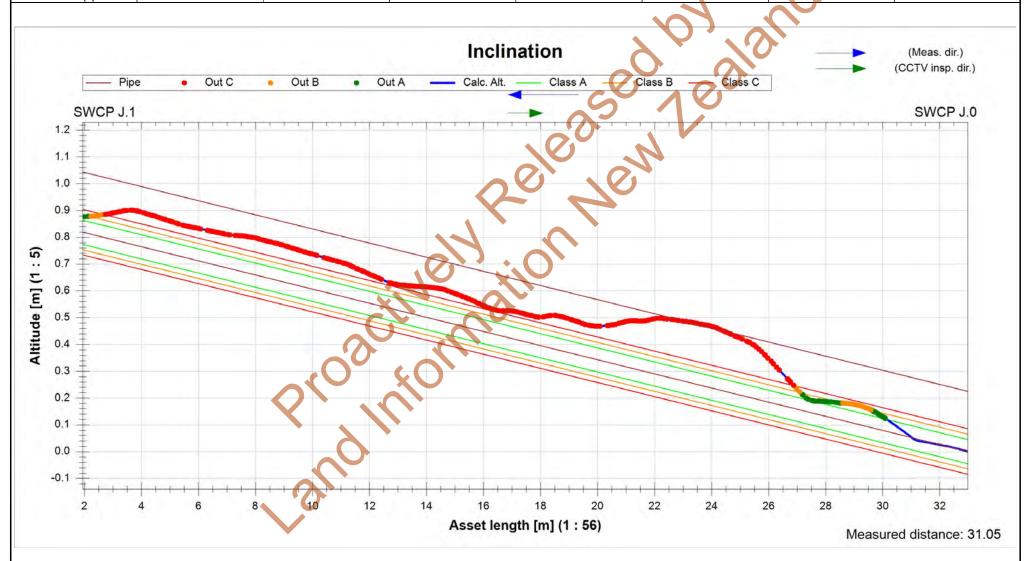



### **RE: Tokanui Hospital Remediation Works Support Letter**

10 March 2025

To whom this may concern,

We are aware that LINZ are seeking resource consents regarding the remediation works for the Tokanui Hospital as set out in Part 9 of the Property Redress Schedule of the Maniapoto Deed of Settlement.

Waipā District Council applications LU/0231/24: Removal of horizontal infrastructure, building foundations and culvert 2, repair trunk stormwater pipe, and remediate contaminated land at the former Tokanui Psychiatric Hospital

LU/0232/24: Utilise the closed landfill at the former Tokanui Psychiatric Hospital to dispose of contaminated soil from remediation works on-site and repair and upgrade the landfill Waikato Regional Council application APP146952.

On behalf of Te Nehenehenui, we would like to offer this letter of support to the project and resource consents however this is not formal written approval and TNN wants to reserve the ability to make a formal submission and appear at any hearing.

LINZ have actively engaged with Te Nehenehenui throughout this process which involved a visit onsite, and the development of a cultural impact assessment developed by Tangata Whenua roopu TAR.

We look forward to the continued engagement and working relationship with LINZ on this project.

Nāku noa nā 🎙

Sam Mikaere Group CEO Te Nehenehenui Trust

• 49 Taupiri Street, Te Kūiti 3910

PO Box 36, Te Kūiti 3910

https://www.tenehenehenui.iwi.nz