

Record of Survey - DP 568983

Survey Number	DP 568983
Surveyor Reference	E20106 Sabys Estate Definition
Surveyor	Nicholas Johan Jagvik
Survey Firm	Davie Lovell-Smith Ltd
Surveyor Declaration	I Nicholas Johan Jagvik, being a licensed cadastral surveyor, certify that-- (a) this dataset provided by me and its related survey are accurate, correct and in accordance with the Cadastral Survey Act 2002 and Cadastral Survey Rules 2021; and (b) the survey was undertaken by me or under my personal direction. Declared on 01 Jun 2022 02:17 PM

Survey Details

Dataset Description	Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256		
Purpose	LT Subdivision		
Status	Deposited	Type	Survey
Land District	Canterbury	Survey Class	Class A
Meridional Circuit	Mount Pleasant 2000	Vertical Datum	None

Survey Dates

Surveyed Date	07/12/2021	Certified Date	01/06/2022
Submitted Date	01/06/2022 14:17:00	Survey Approval Date	02/06/2022
Deposit Date	03/05/2022		

Referenced Surveys

Survey Number	Land District	Bearing Correction
A 9897	Canterbury	0°00'30"
SO 7975	Canterbury	0°00'30"
DP 68573	Canterbury	0°00'30"
DP 8256	Canterbury	0°00'30"
DP 79515	Canterbury	0°00'00"
DP 82666	Canterbury	0°00'00"
DP 451611	Canterbury	0°00'00"
DP 512367	Canterbury	0°00'00"
DP 549897	Canterbury	0°00'00"
DP 551683	Canterbury	0°00'00"

Territorial Authorities

Christchurch City

Comprised In

RT CB393/112
RT CB45C/766
RT CB47D/277



Record of Survey - DP 568983

Created Parcels

Parcels	Parcel Intent	Area	RT Reference
Lot 1 Deposited Plan 568983	Fee Simple Title	3.5509 Ha	1035413
Lot 2 Deposited Plan 568983	Fee Simple Title	4.2571 Ha	1035414
Lot 3 Deposited Plan 568983	Fee Simple Title	4.8853 Ha	1035415
Total Area		12.6933 Ha	

Mark and Vector

Survey Number DP 568983

Meridional Circuit Mount Pleasant 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IR 1 DP 568983	IT Ref DP 53992	ob0	120°59'00" M			32.32 M		
IR 1 DP 568983	IT IV DP 79515	ob1	301°24'40" M			250.54 M		
IR 1 DP 568983	IR 6 DP 549897	ob2	316°46'00" M			79.67 M		
IR 1 DP 568983	IR 2 DP 568983	ob3	241°10'45" M			290.91 M		
IR 1 DP 568983	IT III DP 68573	ob4	240°40'10" M			306.27 M		
IR 1 DP 568983	IR 5 DP 568983	ob5	261°51'10" M			467.02 M		
IR 1 DP 568983	IT V DP 79515	ob6	297°56'40" M			418.09 M		
IR 1 DP 568983	IT I DP 82755	ob7	297°38'00" M			444.73 M		
IR 1 DP 568983	IS II SO 7975	ob8	232°14'30" M			196.64 M		
IR 1 DP 568983	IR 3 DP 568983	ob9	232°04'25" M			209.40 M		
IR 1 DP 568983	IS 4 DP 568983	ob10	251°30'35" M			460.07 M		
IR 1 DP 568983	IT III DP 79515	ob11	266°38'10" M			500.01 M		
IR 1 DP 568983	IT 5 DP 549897	ob12	303°00'10" M			190.70 M		
IT V DP 79515	IT XVIII DP 28856	ob51	292°47'00" M			226.04 M		
IT XVIII DP 28856	IS 12 DP 568983	ob84	129°15'00" M			1.98 M		
IT IV DP 79515	IT 5 DP 549897	ob35	116°21'40" M			60.15 M		
IT IV DP 79515	IR 10 DP 568983	ob36	204°48'00" M			5.87 M		
IR 10 DP 568983	IT 5 DP 549897	ob157	110°46'20" M			60.28 M		
IT 5 DP 549897	IR 6 DP 549897	ob82	113°30'30" A	DP 549897	0°00'00"	114.89 A	DP 549897	
IR 6 DP 549897	IS VII DP 16651	ob16	94°21'30" A	DP 549897	0°00'00"	19.85 A	DP 549897	
IS VII DP 16651	IS VI DP 16651	ob105	113°30'00" A	DP 451611	0°00'00"	20.80 A	DP 451611	
IS VI DP 16651	IT IV DP 16651	ob106	113°30'00" A	DP 451611	0°00'00"	66.34 A	DP 451611	
IT IV DP 16651	IS I DP 17266	ob101	204°21'30" A	DP 451611	0°00'00"	16.18 A	DP 451611	
IS I DP 17266	IS II DP 17266	ob103	204°21'30" A	DP 451611	0°00'00"	1.59 A	DP 451611	
IS II DP 17266	IT Ref DP 53992	ob104	204°21'45" A	DP 451611	0°00'00"	24.42 A	DP 451611	
IT IV DP 16651	IS I DP 8256	ob102	143°42'30" A	DP 8256	0°00'30"	16.58 A	DP 8256	
IS I DP 8256	PEG (22) DP 8256	ob89	278°32'30" A	DP 8256	0°00'30"	15.65 A	DP 8256	
IT IV DP 79515	PEG 29 DP 568983	ob37	216°21'00" A	DP 79515	0°00'00"	9.38 A	DP 79515	
IT IV DP 79515	PEG 30 DP 568983	ob38	193°05'00" A	DP 79515	0°00'00"	9.29 A	DP 79515	
IT III DP 79515	PEG (1) DP 82666	ob63	77°39'40" A	DP 82666	0°00'00"	42.95 A	DP 82666	
IT III DP 79515	PEG 45 DP 568983	ob64	95°27'00" M			17.57 M		
IS 4 DP 568983	PEG 104 DP 568983	ob57	131°31'00" M			7.79 M		
IT III DP 79515	IT III DP 44298	ob65	336°31'05" M			424.09 M		
IT XVIII DP 28856	IT 9 DP 568983	ob85	310°11'00" M			25.26 M		

Mark and Vector

Survey Number DP 568983

Meridional Circuit Mount Pleasant 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT XVIII DP 28856	IT I DP 69146	ob86	310°07'30"	A DP 512367	0°00'00"	25.26 A	DP 512367	
IT I DP 69146	PEG XX DP 8256	ob113	310°07'30"	A DP 512367	0°00'00"	1.51 C		
PEG XX DP 8256	IT I DP 44298	ob114	310°07'30"	A DP 512367	0°00'00"	85.04 C		
IT I DP 44298	IT III DP 44298	ob133	310°07'30"	A DP 551683	0°00'00"	6.36 A	DP 551683	
PEG XX DP 8256	PEG (26) DP 8256	ob115	148°21'30"	A DP 8256	0°00'30"	21.42 A	DP 8256	
PEG (26) DP 8256	PEG 92 DP 568983	ob39	113°27'00"	C		215.67 C		
PEG 92 DP 568983	PEG 29 DP 568983	ob111	113°27'00"	C		185.03 C		Class A
PEG (1) DP 82666	PEG 30 DP 568983	ob43	59°34'30"	C		279.79 C		Class A
PEG 104 DP 568983	PEG (1) DP 82666	ob98	348°28'15"	C		133.61 C		Class A
PEG (22) DP 8256	PEG (24) DP 8256	ob90	293°27'00"	A DP 8256	0°00'30"	3.40 A	DP 8256	
PEG (22) DP 8256	PEG (23) DP 8256	ob91	238°32'00"	A DP 8256	0°00'30"	6.06 A	DP 8256	
PEG (23) DP 8256	PEG 55 DP 568983	ob49	238°32'00"	A DP 8256	0°00'30"	8.03 C		
IS II SO 7975	BD 65 DP 568983	ob56	328°32'00"	A SO 7975	0°00'30"	10.06 A	SO 7975	
BD 65 DP 568983	PEG 55 DP 568983	ob50	58°31'00"	C		220.63 C		Class A
IT V DP 79515	IT I DP 82755	ob52	292°45'00"	M		26.75 M		
IT V DP 79515	IT IV DP 79515	ob53	112°47'30"	M		168.69 M		
IT V DP 79515	IT 8 DP 568983	ob54	252°41'00"	M		14.68 M		
IT 8 DP 568983	IT IV DP 79515	ob94	109°47'00"	M		180.16 M		
IT V DP 79515	IR 6 DP 568983	ob55	240°57'40"	M		193.24 M		
IR 6 DP 568983	IT 8 DP 568983	ob92	60°00'20"	M		178.89 M		
IR 1 DP 568983	IR 6 DP 568983	ob13	280°44'30"	M		547.90 M		
IS 4 DP 568983	IR 7 DP 568983	ob58	160°23'00"	M		105.72 M		
IR 7 DP 568983	IT III DP 68573	ob74	54°29'40"	M		164.39 M		
IR 2 DP 568983	PEG IV DP 8256	ob18	169°34'00"	M		5.78 M		
PEG IV DP 8256	IR 7 DP 568983	ob109	235°53'10"	M		177.56 M		
IR 2 DP 568983	IT VI DP 8256	ob19	226°47'30"	M		92.16 M		
IT VI DP 8256	IR 7 DP 568983	ob107	241°50'40"	M		89.36 M		
IR 7 DP 568983	IT (1) DB 3/116	ob75	223°24'40"	M		72.51 M		
PEG IV DP 8256	PEG 19 DP 568983	ob110	332°33'30"	C		10.14 C		
IT VI DP 8256	PEG 17 DP 568983	ob108	318°42'00"	C		10.10 C		
IR 7 DP 568983	IR 2 DP 568983	ob76	54°12'10"	M		179.96 M		

Mark and Vector

Survey Number DP 568983

Meridional Circuit Mount Pleasant 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT 8 DP 568983	IT I DP 82755	ob95	324°06'00" M			18.17 M		
IS 4 DP 568983	IT III DP 79515	ob59	331°40'30" M			132.42 M		
IS 4 DP 568983	IR 5 DP 568983	ob60	341°57'00" M			83.85 M		
PEG (24) DP 8256	PEG 95 DP 568983	ob48	293°27'00" A	DP 8256	0°00'30"	8.67 C		
PEG 95 DP 568983	PEG 98 DP 568983	ob162	293°27'00" C			117.93 C		Class A
PEG 98 DP 568983	PEG 30 DP 568983	ob164	293°27'00" C			148.37 C		Class A
IR 1 DP 568983	IT XVIII DP 28856	ob14	296°08'00" M			643.54 M		
PEG 95 DP 568983	PEG 55 DP 568983	ob163	184°23'30" C			12.19 C		Class A
PEG 29 DP 568983	PEG 30 DP 568983	ob42	113°27'00" A	A 9897	0°00'30"	3.76 A	A 9897	
IR 2 DP 568983	IR 3 DP 568983	ob20	82°40'40" M			90.43 M		
IR 2 DP 568983	IS II SO 7975	ob21	78°43'20" M			101.36 M		
IT XVIII DP 28856	IT IV DP 79515	ob87	112°47'10" M			394.73 M		
IT XVIII DP 28856	IT I DP 82755	ob88	112°47'10" M			199.29 M		
PEG 17 DP 568983	PEG 27 DP 568983	ob116	43°19'00" C			40.47 C		Class A
PEG 27 DP 568983	PEG 19 DP 568983	ob41	55°19'00" C			51.62 C		Class A
PEG 19 DP 568983	PEG 32 DP 568983	ob97	69°41'00" C			34.72 C		Class A
PEG 32 DP 568983	PEG 33 DP 568983	ob117	101°59'00" C			11.26 C		Class A
PEG 33 DP 568983	BD 65 DP 568983	ob118	74°09'40" C			56.35 C		Class A
IR 1 DP 568983	IS 12 DP 568983	ob15	296°05'40" M			641.60 M		
PEG 104 DP 568983	PEG 98 DP 568983	ob99	58°39'30" C			410.59 C		Class A
IR 7 DP 568983	IT (2) DB 3/116	ob77	184°41'00" M			20.14 M		
IR 7 DP 568983	IT III DP 7766	ob78	199°25'00" M			21.32 M		
IT III DP 7766	IR 2 DP 568983	ob119	50°40'40" M			197.84 M		
IT III DP 7766	IT (2) DB 3/116	ob120	89°41'00" M			5.45 M		
IT III DP 7766	IT (1) DB 3/116	ob121	232°41'20" M			53.74 M		
IT III DP 7766	UNMK (6) DP 8256	ob122	295°55'20" C			17.99 C		
UNMK (6) DP 8256	UNMK (5) DP 8256	ob145	295°55'20" C			8.05 C		
UNMK (5) DP 8256	UNMK (4) DP 8256	ob143	295°55'20" C			12.07 C		
UNMK (4) DP 8256	UNMK (3) DP 8256	ob142	295°55'20" C			7.04 C		

Mark and Vector

Survey Number DP 568983

Meridional Circuit Mount Pleasant 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK (3) DP 8256	UNMK (2) DP 8256	ob140	295°55'20"	C		7.04 C		
UNMK (2) DP 8256	UNMK (1) DP 8256	ob139	295°55'20"	C		15.09 C		
UNMK (1) DP 8256	IS VII DP 8256	ob137	295°55'20"	C		14.08 C		
IS VII DP 8256	UNMK (10) DP 8256	ob125	25°03'30"	C		20.42 C		
UNMK (10) DP 8256	UNMK (9) DP 8256	ob152	25°03'30"	C		13.08 C		
UNMK (9) DP 8256	UNMK (8) DP 8256	ob151	25°03'30"	C		12.07 C		
UNMK (8) DP 8256	UNMK (7) DP 8256	ob149	25°03'30"	C		16.09 C		
UNMK (7) DP 8256	IS VI DP 8256	ob147	25°03'30"	C		7.04 C		
IS VI DP 8256	PEG V A 9897	ob127	58°38'40"	C		444.70 C		
PEG V A 9897	IS I DP 8256	ob129	113°27'10"	C		138.62 C		
IR 7 DP 568983	IT I DP 68573	ob79	228°18'40"	M		83.80 M		
IT I DP 68573	IT III DP 7766	ob130	57°17'20"	M		65.95 M		
IT III DP 7766	PEG 48 DP 568983	ob123	325°07'30"	A DP 8256	0°00'30"	10.06 A DP 8256		
PEG 48 DP 568983	PEG 17 DP 568983	ob46	54°03'10"	C		104.94 C		Class A
IR 7 DP 568983	IS II DP 7766	ob80	142°55'20"	M		61.65 M		
IS II DP 7766	IT III DP 7766	ob132	303°19'00"	M		52.96 M		
IT III DP 7766	IT VI DP 8256	ob124	54°03'10"	M		106.08 M		
IR 2 DP 568983	IT III DP 68573	ob22	231°06'00"	M		15.59 M		
IT III DP 79515	IR 5 DP 568983	ob66	135°00'00"	M		52.11 M		
IT III DP 79515	IR 6 DP 568983	ob67	343°25'00"	M		137.17 M		
IT III DP 79515	PEG 13 DP 568983	ob68	102°52'00"	M		19.45 M		
IT III DP 79515	IT 5 DP 549897	ob69	68°33'40"	M		364.44 M		
IT III DP 79515	IT IV DP 79515	ob70	60°43'50"	M		327.08 M		
IT III DP 79515	IT XVIII DP 28856	ob71	345°53'45"	M		322.52 M		
IT III DP 79515	IT 9 DP 568983	ob72	343°26'00"	M		343.34 M		
PEG 45 DP 568983	PEG 13 DP 568983	ob44	151°05'00"	C		3.04 C		
PEG 45 DP 568983	PEG 29 DP 568983	ob45	59°34'30"	C		304.16 C		Class A
IT 9 DP 568983	IT I DP 69146	ob112	225°00'00"	C		0.03 C		
PEG (26) DP 8256	PEG 16 DP 568983	ob40	161°57'30"	A DP 8256	0°00'30"	176.83 A DP 8256		
PEG 16 DP 568983	PEG 18 DP 568983	ob134	162°17'00"	A DP 79515	0°00'00"	154.72 A DP 79515		Class A

Mark and Vector

Survey Number DP 568983

Meridional Circuit Mount Pleasant 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
PEG 18 DP 568983	PEG 45 DP 568983	ob136	59°34'00"	A DP 79515	0°00'00"	4.01 A	DP 79515	Class A
PEG 16 DP 568983	PEG 92 DP 568983	ob135	60°05'20"	C		165.06 C		Class A
IR 6 DP 568983	PEG 16 DP 568983	ob93	26°28'00"	M		13.65 M		
UNMK (6) DP 8256	UNMK (11) DP 8256	ob146	25°55'20"	C		2.41 A	DP 8256	
UNMK (5) DP 8256	UNMK (12) DP 8256	ob144	25°55'20"	C		2.41 A	DP 8256	
UNMK (3) DP 8256	UNMK (13) DP 8256	ob141	205°55'20"	C		1.01 A	DP 8256	
UNMK (1) DP 8256	UNMK (14) DP 8256	ob138	25°55'20"	C		6.44 A	DP 8256	
UNMK (7) DP 8256	UNMK (15) DP 8256	ob148	295°03'30"	C		4.83 A	DP 8256	
UNMK (8) DP 8256	UNMK (16) DP 8256	ob150	295°03'30"	C		8.05 A	DP 8256	
UNMK (10) DP 8256	UNMK (17) DP 8256	ob153	115°03'30"	C		9.66 A	DP 8256	
IS VII DP 8256	UNMK (18) DP 8256	ob126	70°29'25"	C		17.10 A	DP 8256	
IT I DP 68573	PEG (1) DP 68573	ob131	165°09'00"	A DP 68573	0°00'30"	12.12 A	DP 68573	
PEG (1) DP 68573	PEG (29) DP 8256	ob154	324°46'30"	A DP 68573	0°00'30"	20.13 A	DP 68573	
PEG 48 DP 568983	UNMK (19) DP 8256	ob47	236°05'00"	C		4.43 C		Class AD
IS VI DP 8256	UNMK (20) DP 8256	ob128	238°38'40"	C		10.86 A	DP 8256	
IT 5 DP 549897	MA 7 DP 549897	ob83	99°16'40"	M		39.12 M		
MA 7 DP 549897	IR 6 DP 549897	ob156	120°37'30"	A DP 549897	0°00'00"	77.56 A	DP 549897	
IR 5 DP 568983	IT 11 DP 568983	ob29	354°42'40"	M		40.35 M		
IT 11 DP 568983	IT III DP 79515	ob160	264°15'00"	M		33.29 M		
IT 11 DP 568983	PEG (1) DP 82666	ob161	56°31'00"	M		10.60 M		
IT 8 DP 568983	PEG 92 DP 568983	ob96	311°27'00"	M		7.70 M		
PEG 104 DP 568983	PEG 31 DP 568983	ob100	238°39'00"	A DP 82666	0°00'00"	27.07 A	DP 82666	Class A
PEG 31 DP 568983	UNMK (25) DP 8256	ob165	238°39'00"	A DP 8256	0°00'30"	1.61 A	DP 8256	Class AD
IT Ref DP 53992	PEG 95 DP 568983	ob32	1°12'00"	M		32.20 M		
IT Ref DP 53992	PEG 55 DP 568983	ob33	359°14'00"	M		20.04 M		

Mark and Vector

Survey Number DP 568983

Meridional Circuit Mount Pleasant 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT Ref DP 53992	PEG 98 DP 568983	ob34	306°21'00" M			133.49 M		
IR 10 DP 568983	PEG 30 DP 568983	ob158	174°29'00" M			3.74 M		
IR 10 DP 568983	PEG 29 DP 568983	ob159	234°17'00" M			3.81 M		
IR 2 DP 568983	BD 65 DP 568983	ob23	73°12'40" M			98.35 M		
IR 2 DP 568983	PEG 33 DP 568983	ob24	71°56'00" M			42.02 M		
IR 2 DP 568983	PEG 32 DP 568983	ob25	62°01'00" M			32.76 M		
IR 2 DP 568983	PEG 19 DP 568983	ob26	312°26'00" M			4.91 M		
IR 2 DP 568983	PEG 27 DP 568983	ob27	240°30'20" M			52.93 M		
IR 2 DP 568983	PEG 17 DP 568983	ob28	233°04'00" M			92.37 M		
IR 7 DP 568983	PEG 48 DP 568983	ob81	227°17'00" M			17.48 M		
IS 4 DP 568983	PEG 31 DP 568983	ob61	221°56'00" M			25.87 M		
IT III DP 79515	PEG 18 DP 568983	ob73	104°46'00" M			14.51 M		
IR 2 DP 568983	IS 4 DP 568983	ob17	268°12'40" M			181.53 M		
IT Ref DP 53992	MA 7 DP 549897	ob30	307°27'50" M			187.75 M		
IT Ref DP 53992	IR 3 DP 568983	ob31	239°50'35" M			223.08 M		
UNMK (19) DP 8256	PEG (29) DP 8256	ob155	236°05'00" C			65.75 C		
IS 4 DP 568983	IS VI DP 8256	ob62	215°36'00" C			26.93 C		

Mark Name	Mark Condition	Description
BD 65 DP 568983		in post PEG III SO 7975 reinstated
IR 1 DP 568983		d0.3 in paddock
IR 10 DP 568983		d0.2 in berm
IR 2 DP 568983		d0.4 in berm
IR 3 DP 568983		d0.2 in berm
IR 5 DP 568983		d0.3 in grass paddock
IR 6 DP 549897		d0.2 in berm
IR 6 DP 568983		d0.3 in grass paddock
IR 7 DP 568983		d0.3 in paddock
IS 12 DP 568983		d0.3 PEG XIX DP 8256 renewed
IS 4 DP 568983		d0.3 in grass paddock

Mark and Vector

Survey Number DP 568983
Meridional Circuit Mount Pleasant 2000

Mark Name	Mark Condition	Description
IS II DP 7766		d0.05 in seal
IS II SO 7975		d0.2 in berm
IT (1) DB 3/116		d0.2 in berm
IT (2) DB 3/116		top bent d0.05 in seal
IT 11 DP 568983		d0.2 near drain
IT 5 DP 549897		d0.2 in berm
IT 8 DP 568983		d0.3
IT 9 DP 568983		d0.2 IT I DP 69146 disturbed
IT I DP 68573		fl in seal
IT I DP 82755		fl in seal
IT III DP 44298		fl in seal
IT III DP 68573		d0.3 in berm
IT III DP 7766		d0.5 in seal
IT III DP 79515		d0.5 in grass bank
IT IV DP 79515		fl in seal
IT Ref DP 53992		capped in berm
IT V DP 79515		fl in seal
IT VI DP 8256		d0.2 in berm
IT XVIII DP 28856		d0.5 in berm
MA 7 DP 549897		fl in channel
PEG 104 DP 568983		PEG (2) DP 82666 renewed
PEG 13 DP 568983		PEG (1) DP 79515 reinstated
PEG 16 DP 568983		PEG (1) A 9897 reinstated
PEG 17 DP 568983		PEG (35) DP 8256 reinstated
PEG 18 DP 568983		UNMK (2) A 9897 reinstated
PEG 19 DP 568983		PEG (33) DP 8256 reinstated
PEG 27 DP 568983		PEG (32) DP 8256 reinstated
PEG 29 DP 568983		PEG (3) DP 79515 reinstated
PEG 30 DP 568983		PEG (4) DP 79515 reinstated
PEG 31 DP 568983		PEG (30) DP 8256 reinstated
PEG 32 DP 568983		PEG (34) DP 8256 reinstated
PEG 33 DP 568983		PEG VII SO 7975 reinstated
PEG 45 DP 568983		PEG (2) DP 79515 reinstated
PEG 48 DP 568983		PEG (31) DP 8256 reinstated
PEG 55 DP 568983		UNMK (1) T 306742 reinstated


Mark and Vector

Survey Number DP 568983
Meridional Circuit Mount Pleasant 2000

Mark Name	Mark Condition	Description
PEG 92 DP 568983		PEG XVII A 9897 reinstated
PEG 95 DP 568983		UNMK (2) T 306742 reinstated
PEG 98 DP 568983		PEG (36) DP 8256 reinstated
PEG IV DP 8256		d0.3 in berm
IS VI DP 8256	Searched For and Not Found	
IT IV DP 16651	Searched For and Not Found	
PEG (26) DP 8256	Searched For and Not Found	
PEG (29) DP 8256	Searched For and Not Found	
PEG V A 9897	Searched For and Not Found	

***** End of Report *****

Sheet 1 of 2

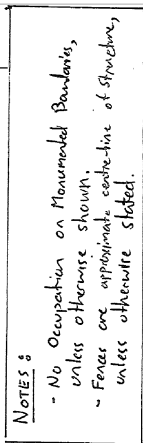

E20106

$Q^{1/2}$

Land District: Canterbury


Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256

Surveyor: Nicholas Johan Jagvik
Firm: Davie Lovell-Smith Ltd
Date of Survey: 7/12/2021

Record of Survey
LT 568983
DRAFT


Digitally Generated Plan
Generated on: 12/04/2022 1:09pm Page 21 of 21

Occupation Diagram

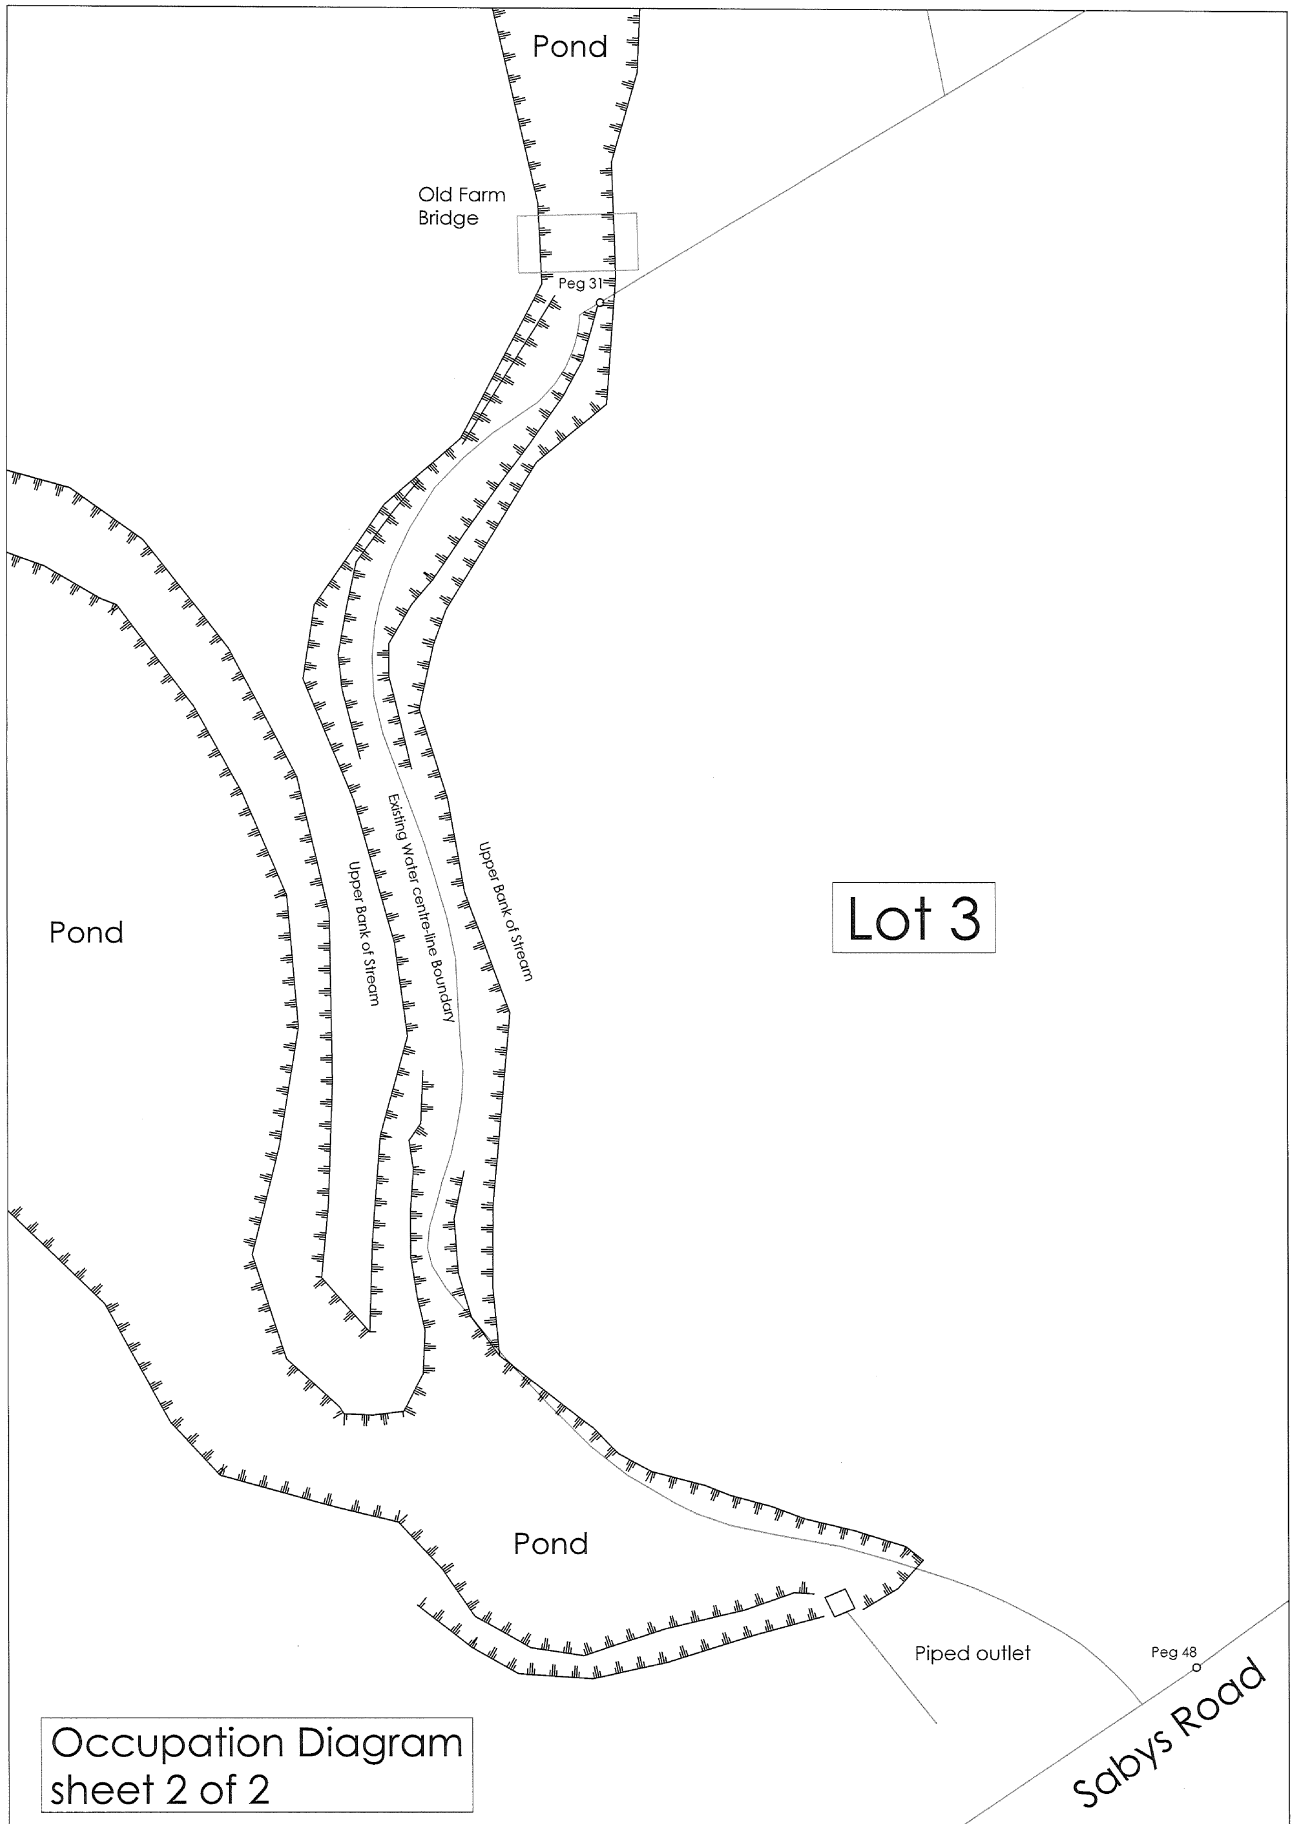



Diag. A

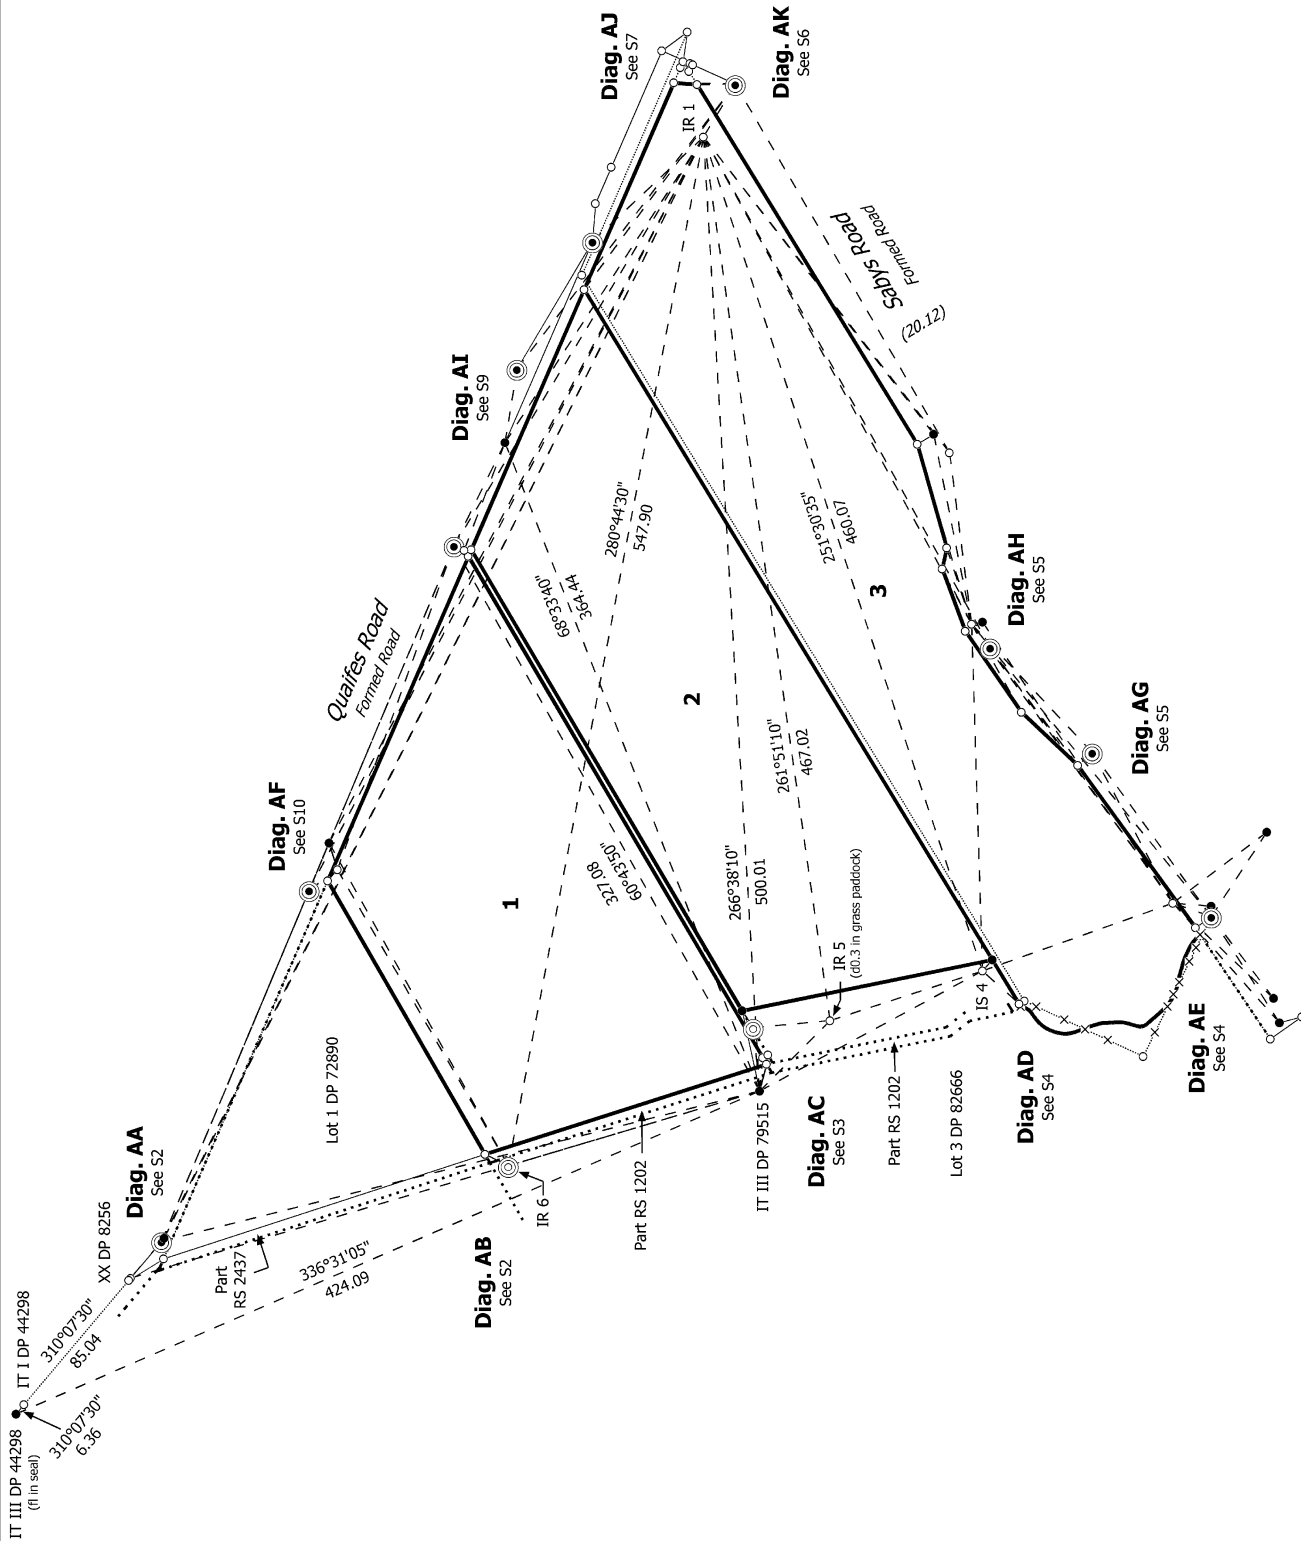

S 1/10

Land District: Canterbury

Digitally Generated Plan

Generated on: 02/06/2022 10:56am Page 13 of 23


Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256

Surveyor: Nicholas Johan Jagvik
Firm: Davie Lovell-Smith Ltd

Date of Survey: 7/12/2021

Record of Survey
DP 568983

Deposited on: 3/05/2022

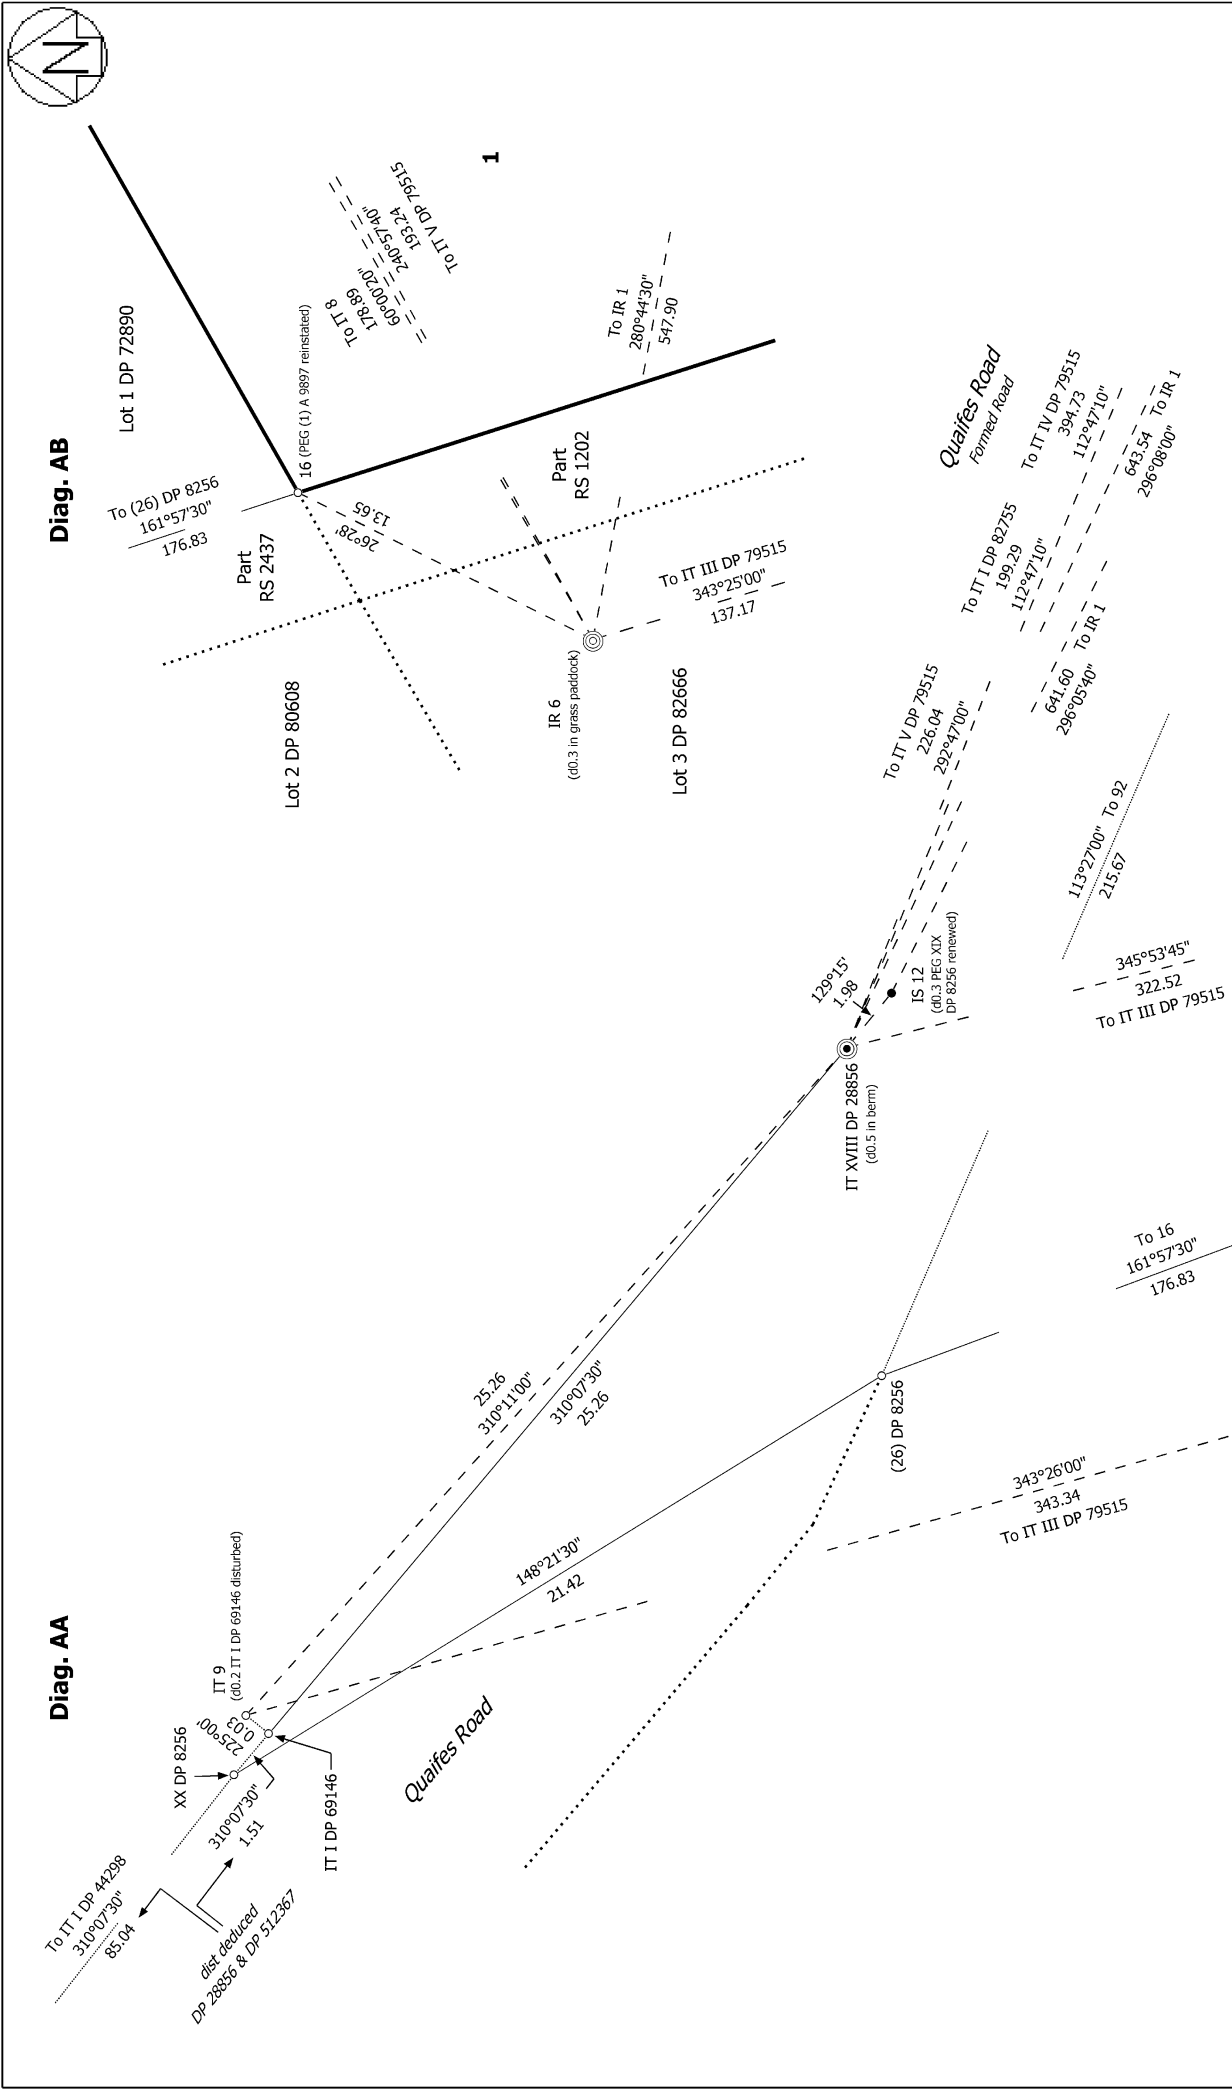

S 2/10	Land District: Canterbury Digitally Generated Plan Generated on: 02/06/2022 10:58am Page 14 of 23	Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256	Surveyor: Nicholas Johan Jagvik Firm: Davie Lovell-Smith Ltd Date of Survey: 7/12/2021 Record of Survey DP 568983 Deposited on: 3/05/2022
--------	---	--	--



Land District: Canterbury

Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256

Surveyor: Nicholas Johan Jagvik
Firm: Davie Lovell-Smith Ltd
Date of Survey: 7/12/2021

Record of Survey
DP 568983

Digitally Generated Plan
Generated on: 02/06/2022 10:56am Page 15 of 23

Deposited on: 3/05/2022




Land District: Canterbury

Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256

Surveyor: Nicholas Johan Jagvik
Firm: Davie Lovell-Smith Ltd
Date of Survey: 7/12/2021


Record of Survey
DP 568983

Digitally Generated Plan
Generated on: 02/06/2022 10:56am Page 18 of 23

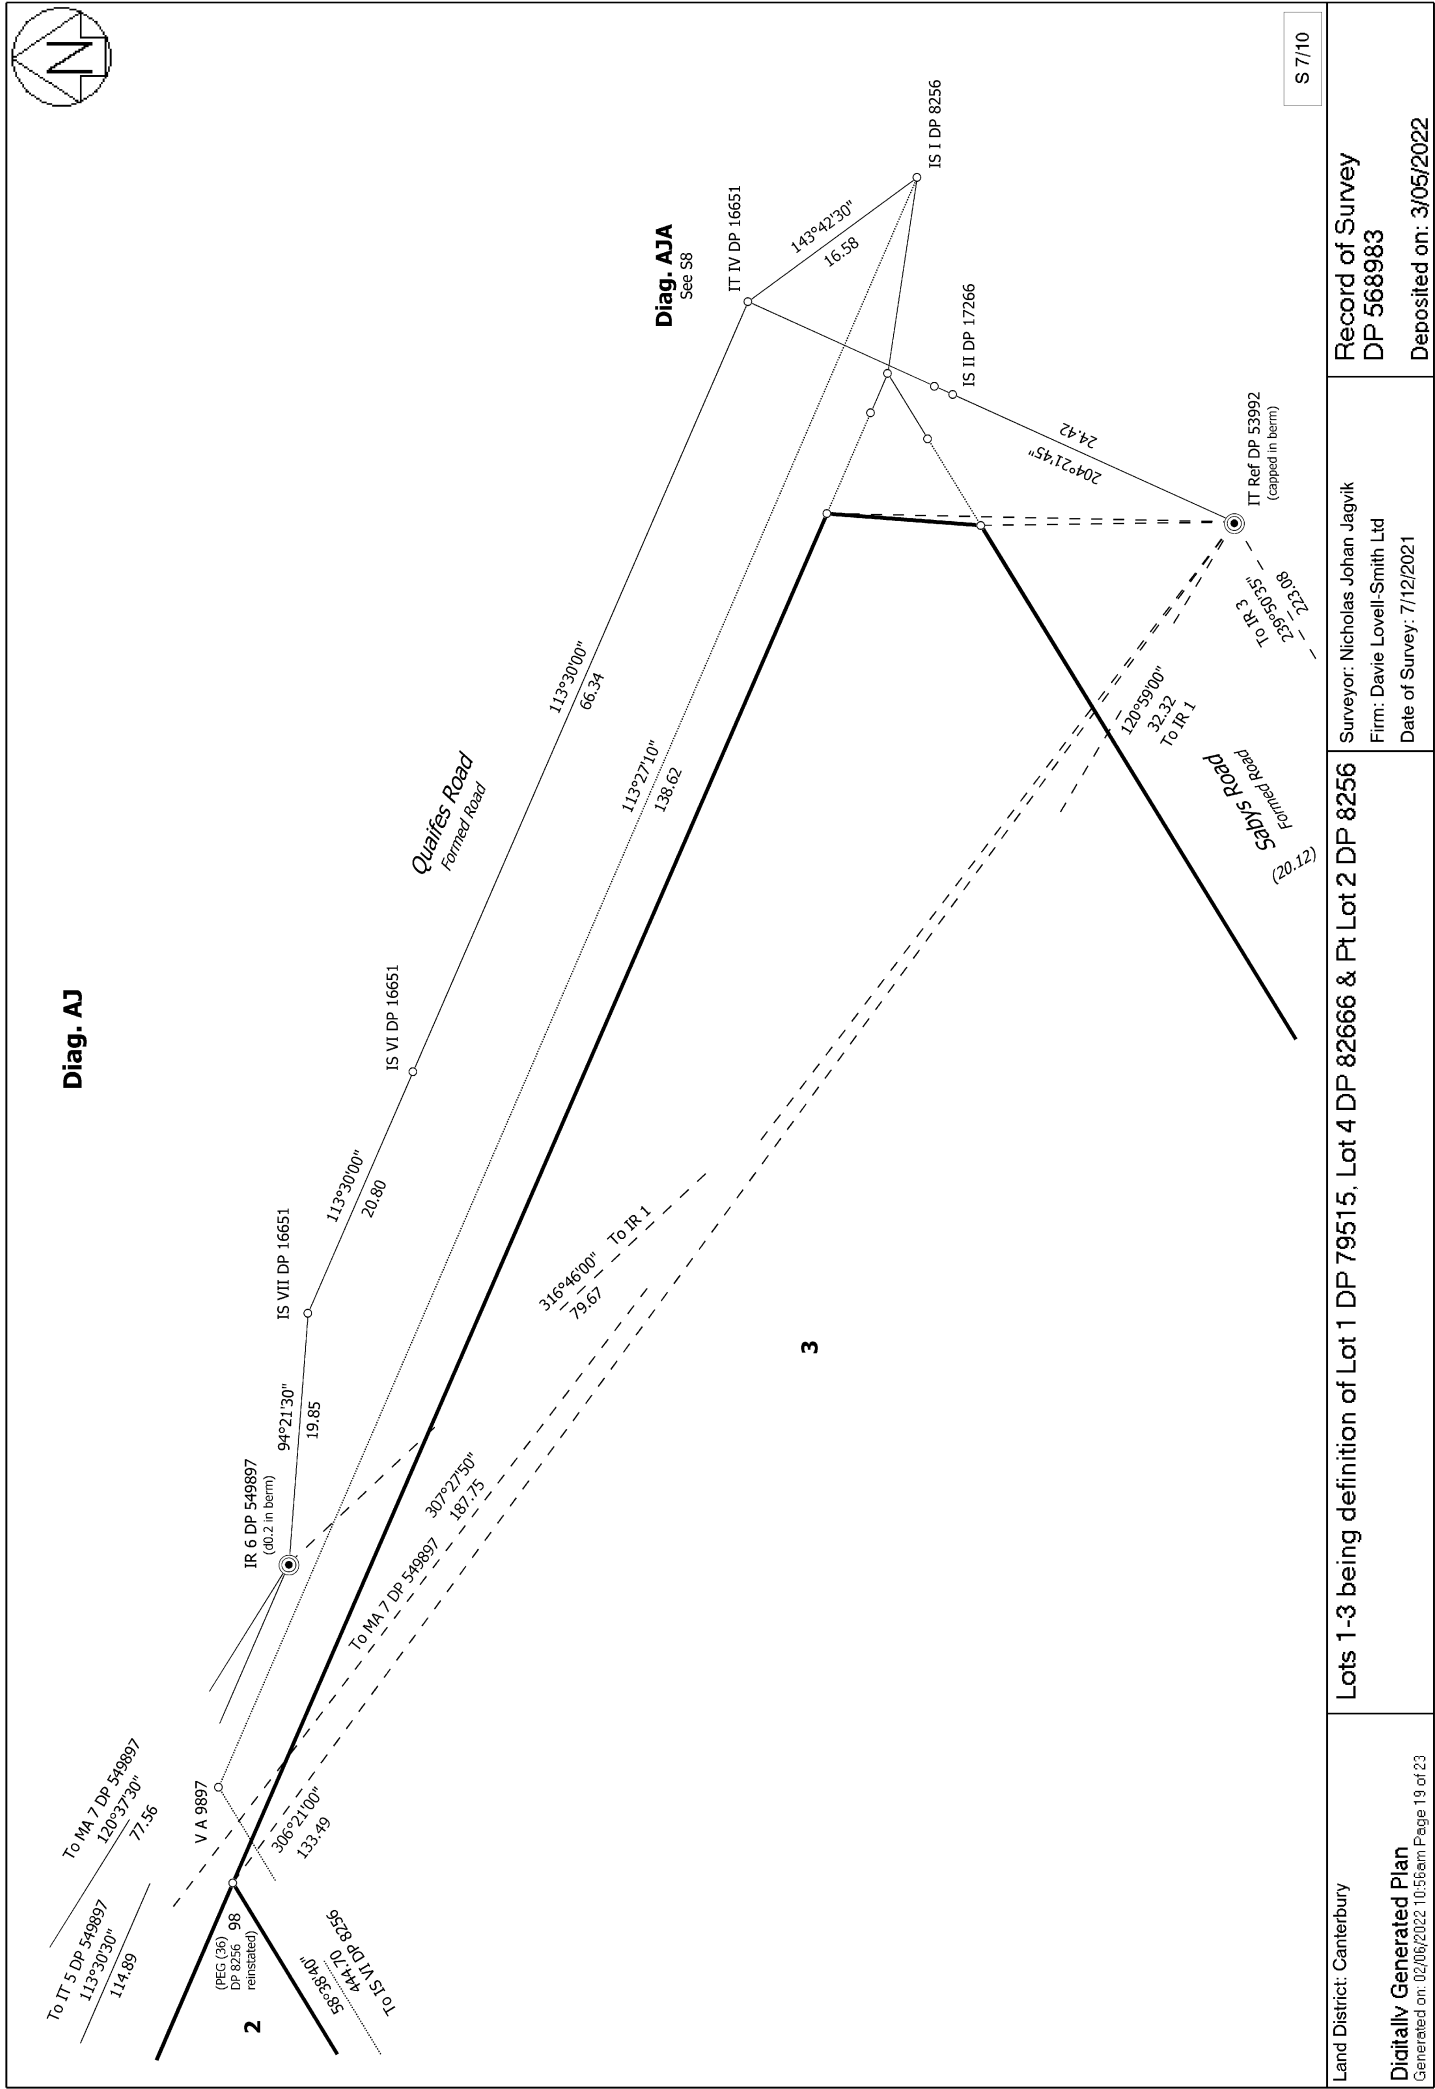



Diag. AJA

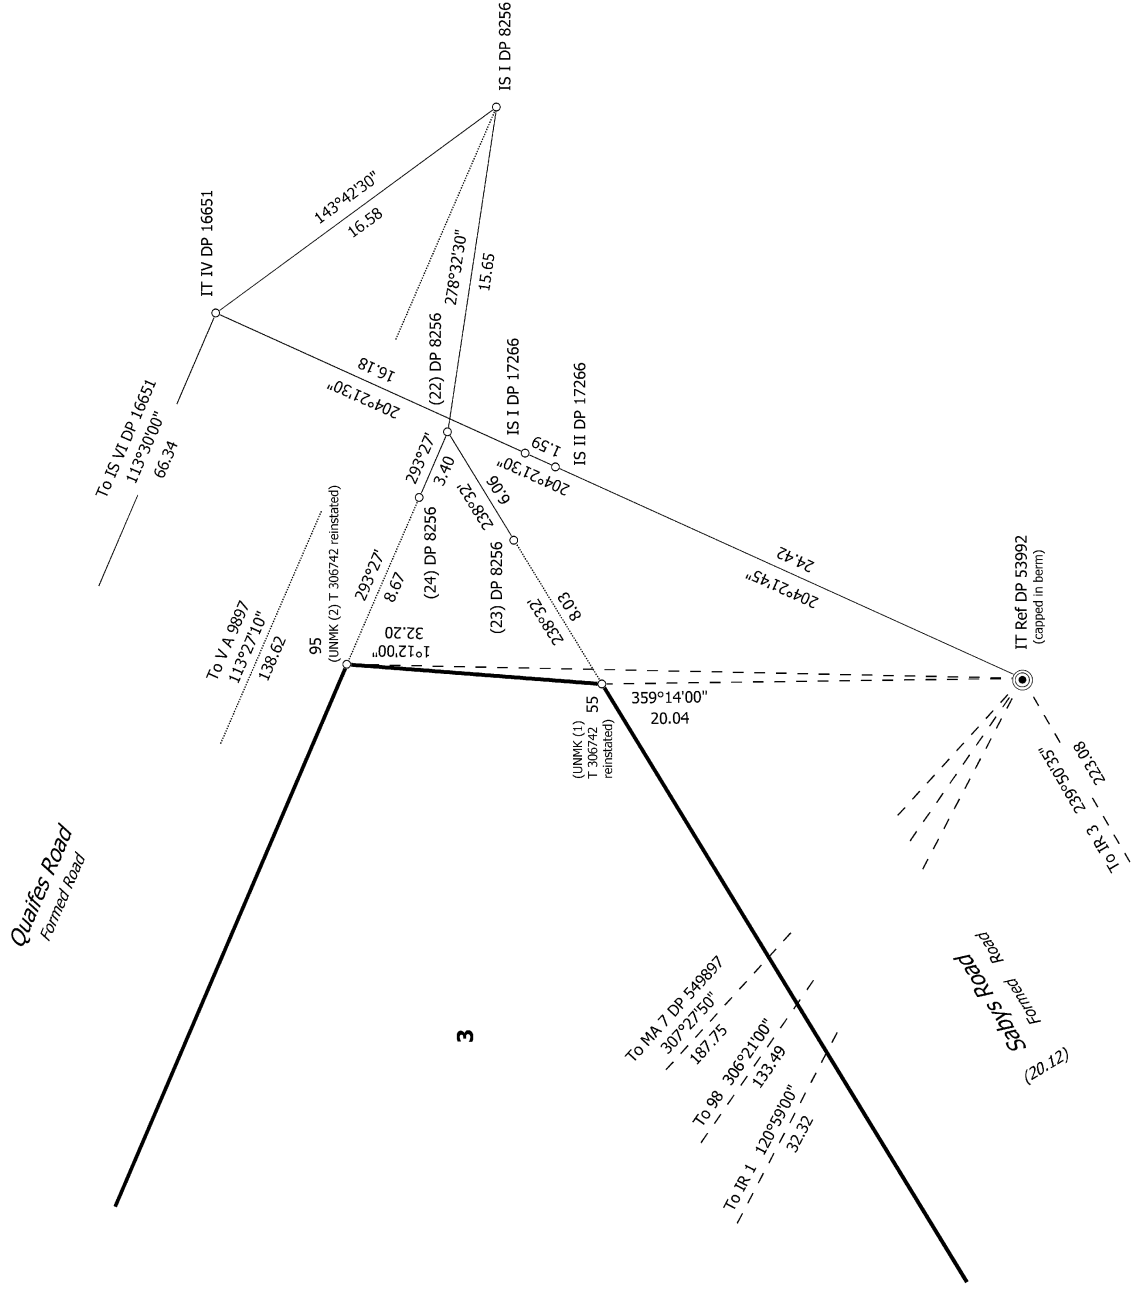


S 8/10

Land District: Canterbury	Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256	Surveyor: Nicholas Johan Jagvik Firm: Davie Lovell-Smith Ltd Date of Survey: 7/12/2021	Record of Survey DP 568983 Deposited on: 3/05/2022
Digitally Generated Plan Generated on: 02/06/2022 10:56am Page 20 of 23			





Diag. AI

Diag. AIA
See S10

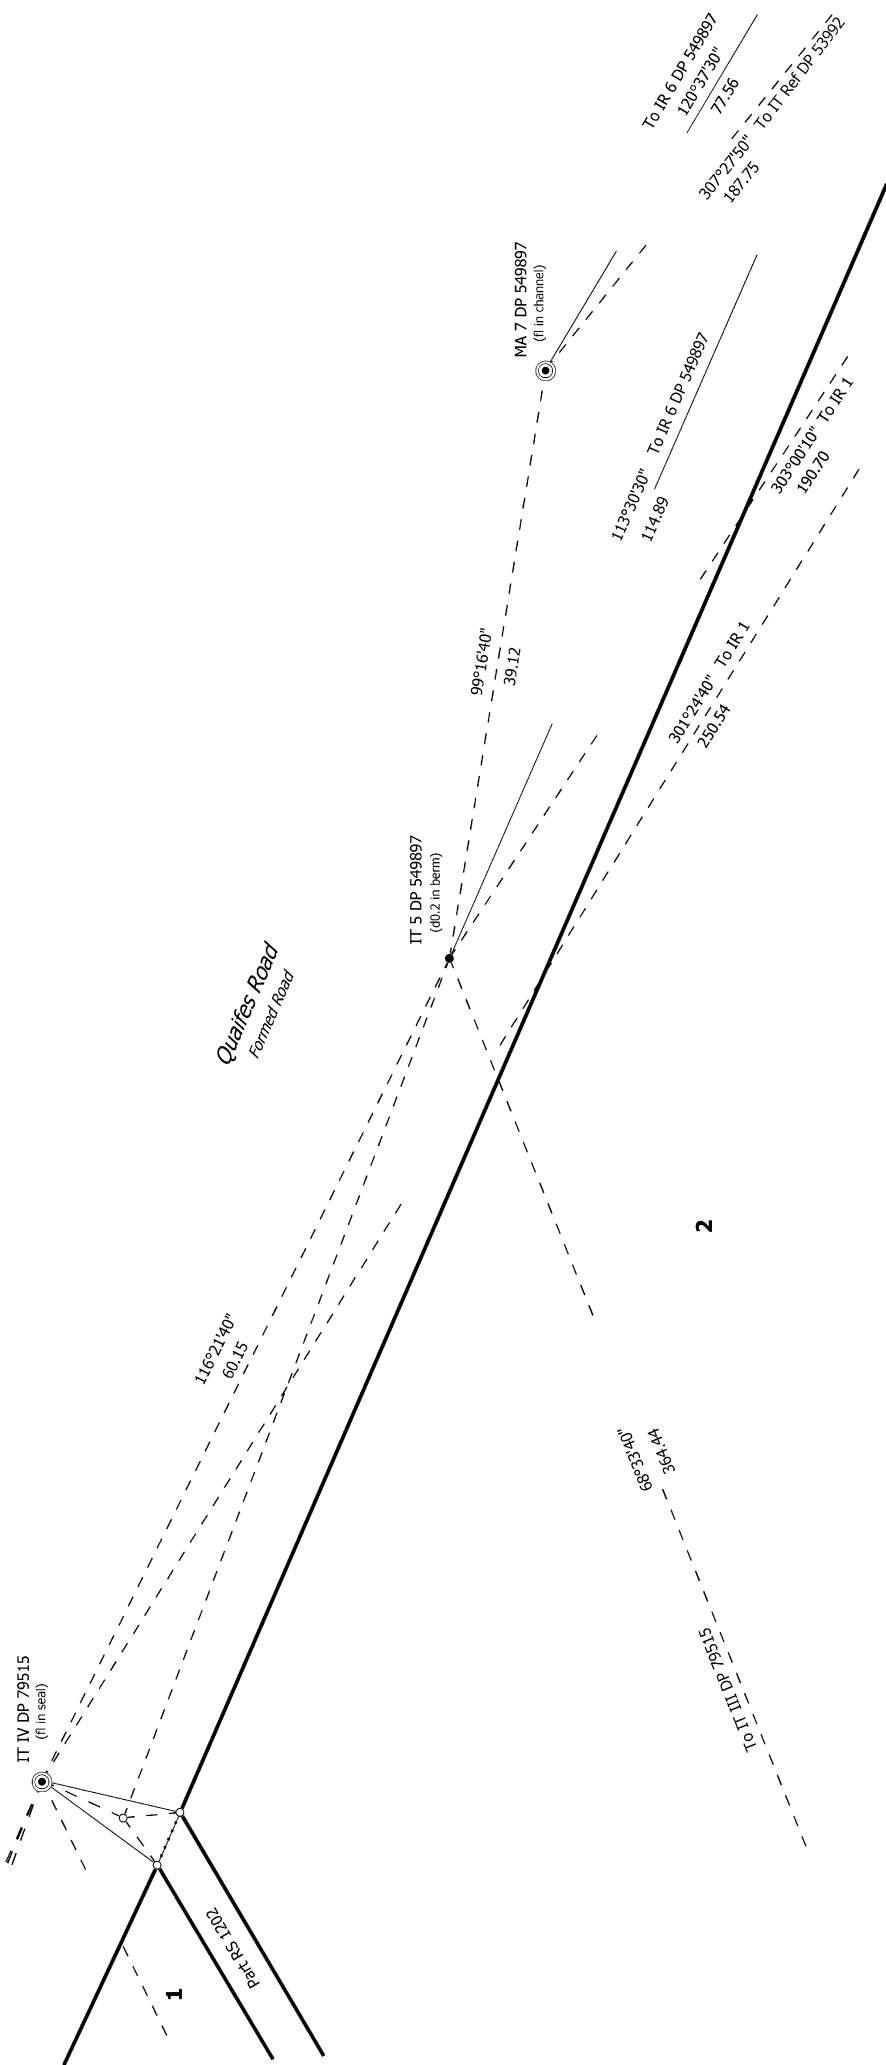


S 9/10	
Land District: Canterbury	Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256
Digitally Generated Plan Generated on: 02/06/2022 10:56am Page 21 of 23	Surveyor: Nicholas Johan Jagvik Firm: Davie Lovell-Smith Ltd Date of Survey: 7/12/2021
Record of Survey DP 568983 Deposited on: 3/05/2022	

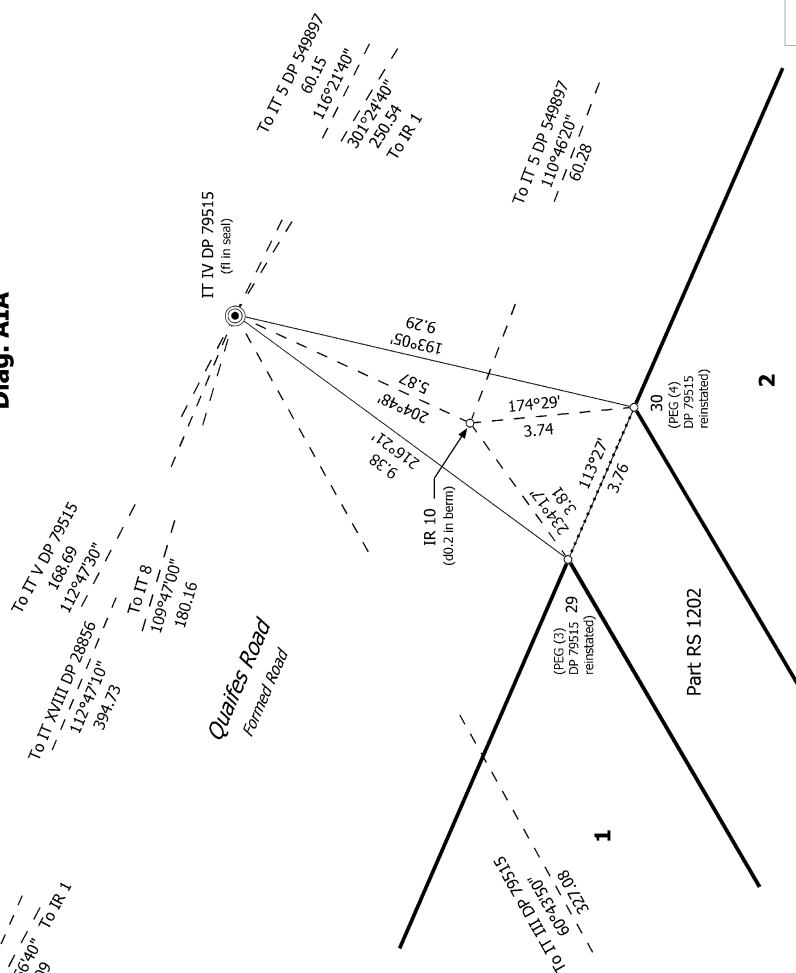


S 10/10

Land District: Canterbury	Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256	Surveyor: Nicholas Johan Jagvik Firm: Davie Lovell-Smith Ltd Date of Survey: 7/12/2021	Record of Survey DP 568983 Deposited on: 3/05/2022
---------------------------	--	--	--



Diag. A

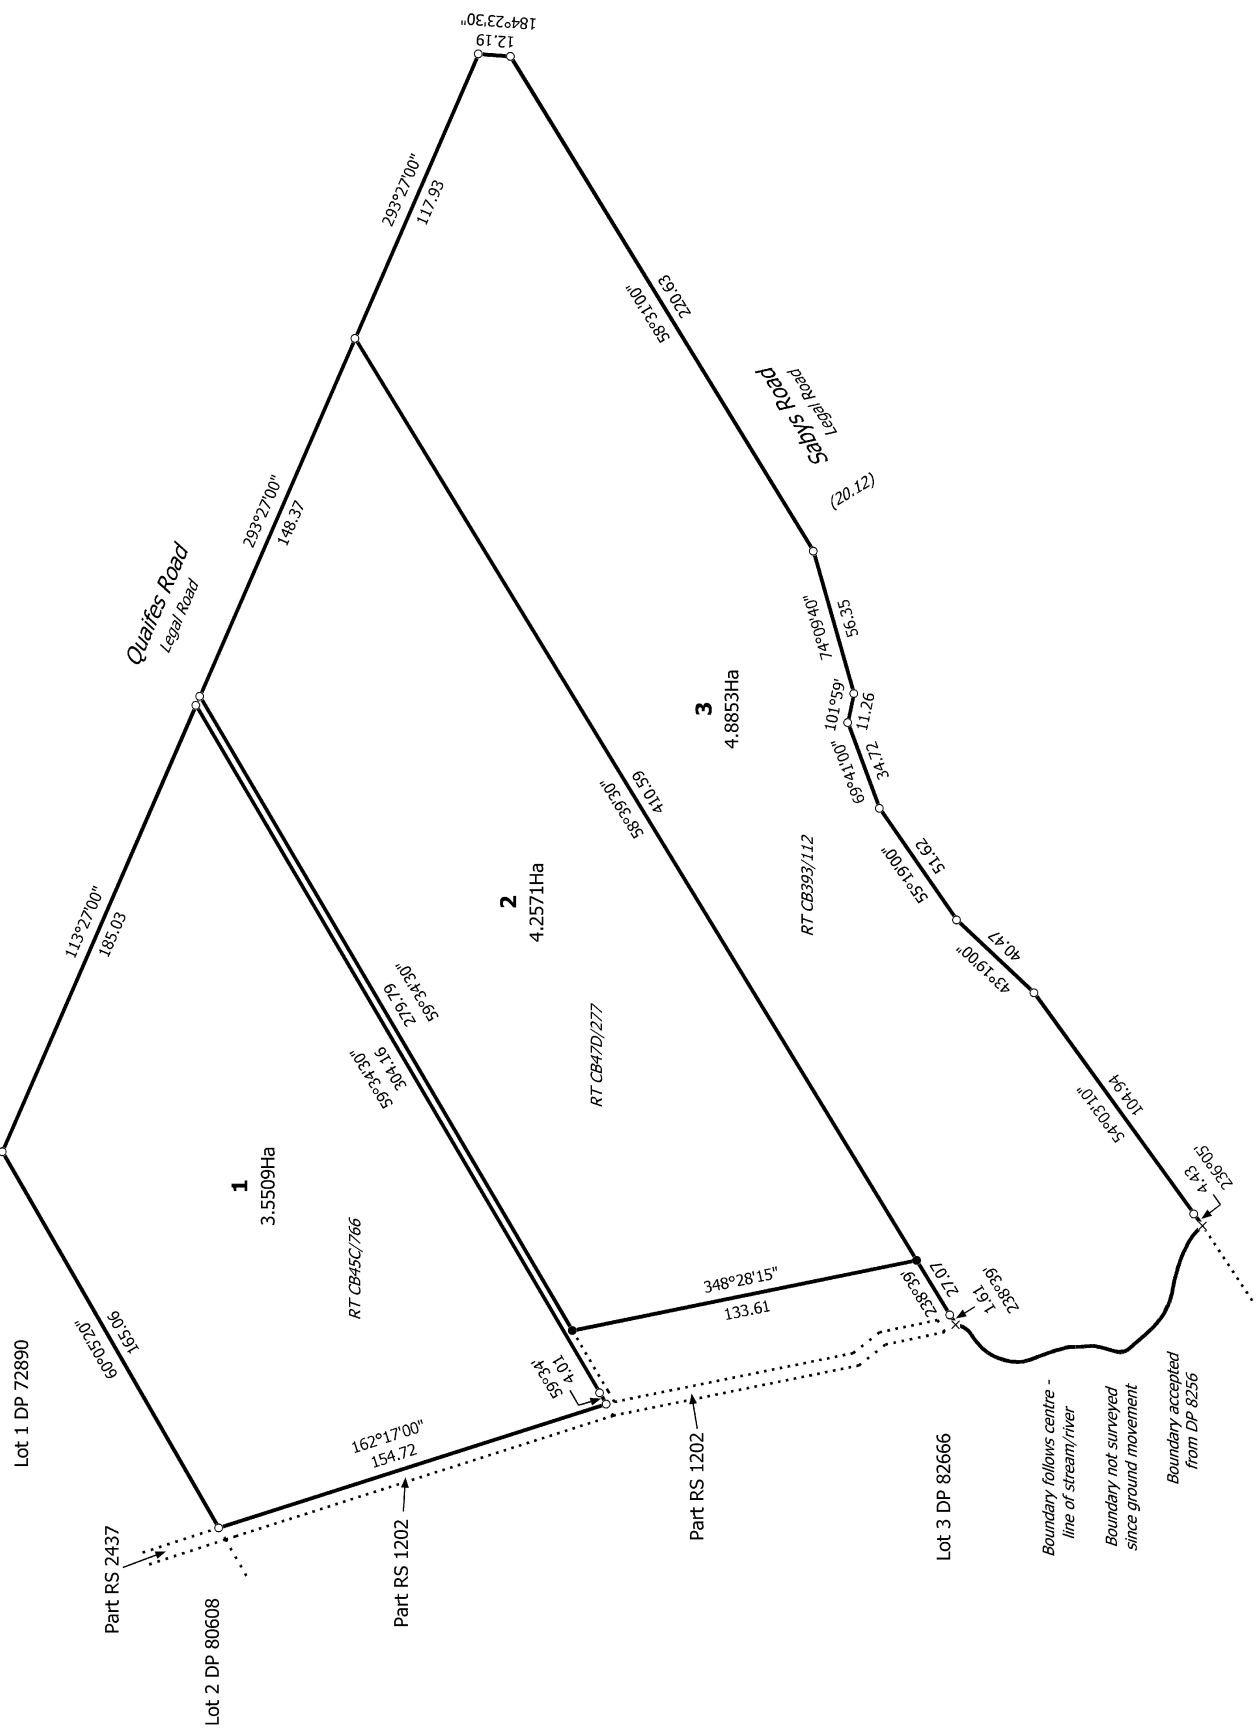

E20106

T 1/1

Land District: Canterbury	Lots 1-3 being definition of Lot 1 DP 79515, Lot 4 DP 82666 & Pt Lot 2 DP 8256	Surveyor: Nicholas Johan Jagvik Firm: Davie Lovell-Smith Ltd Date of Survey: 7/12/2021	Record of Survey DP 568983 Deposited on: 3/05/2022
Digitally Generated Plan Generated on: 02/06/2022 10:56am Page 23 of 23			