

Record of Survey - DP 582996

Survey Number	DP 582996
Surveyor Reference	7874 - Sinclair
Surveyor	Christopher Francis Walker
Survey Firm	Bonisch Consultants Ltd
Surveyor Declaration	I Christopher Francis Walker, being a licensed cadastral surveyor, certify that-- (a) this dataset provided by me and its related survey are accurate, correct and in accordance with the Cadastral Survey Act 2002 and Cadastral Survey Rules 2021; and (b) the survey was undertaken by me or under my personal direction. Declared on 22 Dec 2022 02:13 PM

Survey Details

Dataset Description	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred		
Purpose	LT Subdivision		
Status	Deposited	Type	Survey
Land District	Southland	Survey Class	Class B
Meridional Circuit	Bluff 2000	Vertical Datum	None

Survey Dates

Surveyed Date	29/09/2022	Certified Date	22/12/2022
Submitted Date	22/12/2022 14:13:51	Survey Approval Date	23/12/2022
Deposit Date	01/12/2022		

Referenced Surveys

Survey Number	Land District	Bearing Correction
SO 7553	Southland	-0°06'00"
SO 7542	Southland	-0°00'14"
DP 459645	Southland	0°00'00"

Territorial Authorities

Southland District

Comprised In

RT SLA4/141

Created Parcels

Parcels	Parcel Intent	Area	RT Reference
Lot 1 Deposited Plan 582996	Fee Simple Title	28.9750 Ha	1092778
Lot 2 Deposited Plan 582996	Fee Simple Title	11.4780 Ha	1092779
Area B Deposited Plan 582996	Covenant - Land		
Area C Deposited Plan 582996	Covenant - Land		
Total Area		40.4530 Ha	

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT III SO 7541	IT II SO 7541	ob0	142°45'10" M			174.90 M		
IT II SO 7541	TITIPUA NO 2	ob2	136°53'00" M			1,979.38 M		
IT II SO 7541	IT SO 7542	ob3	316°51'44" M			1,590.45 M		
IT II SO 7541	IT XI SO 7516	ob4	321°50'13" M			1,688.84 M		
IT II SO 7541	IT X SO 7516	ob5	332°59'50" M			1,654.82 M		
IT II SO 7541	IT IV SO 7541	ob6	336°41'58" M			529.46 M		
IT II SO 7541	IT 2 DP 459645	ob7	337°45'02" M			952.82 M		
IT II SO 7541	IT 1 DP 459645	ob8	341°31'46" M			911.91 M		
IT II SO 7541	IT XXI SO 7553	ob9	25°42'15" M			989.29 M		
IT II SO 7541	IT XX SO 7553	ob10	28°21'40" M			964.41 M		
IT II SO 7541	IT I DP 325992	ob11	331°13'42" M			1,365.40 M		
IT II SO 7541	IT 3 DP 582996	ob12	4°09'27" M			761.95 M		
IT II SO 7541	IT 1 DP 582996	ob13	322°28'29" M			877.47 M		
IT SO 7542	IT XI SO 7516	ob14	14°43'00" M			172.96 M		
IT SO 7542	PEG IV SO 7542	ob15	84°23'16" A	SO 7542	-0°00'14"	7.19 A	SO 7542	
PEG IV SO 7542	IB IIIA SO 7542	ob23	12°26'46" A	SO 7542	-0°00'14"	80.68 A	SO 7542	
IB IIIA SO 7542	IT XI SO 7516	ob25	12°26'46" A	SO 7542	-0°00'14"	89.91 A	SO 7542	
IT XI SO 7516	IT X SO 7516	ob16	63°21'46" M			326.93 M		
IT X SO 7516	IT I DP 325992	ob17	161°15'40" M			293.11 M		
PEG IV SO 7542	PEG VI SO 7542	ob24	135°34'46" A	SO 7542	-0°00'14"	73.53 A	SO 7542	
PEG VI SO 7542	IB VII SO 7542	ob26	46°05'46" A	SO 7542	-0°00'14"	10.42 A	SO 7542	
IB VII SO 7542	PEG VIIA SO 7542	ob27	46°05'46" A	SO 7542	-0°00'14"	13.08 A	SO 7542	
PEG VIIA SO 7542	PEG VIIIA SO 7542	ob28	46°05'46" A	SO 7542	-0°00'14"	52.97 A	SO 7542	Class B
PEG VIIIA SO 7542	IB VIII SO 7542	ob30	46°05'46" A	SO 7542	-0°00'14"	22.93 A	SO 7542	
IB VIII SO 7542	PEG IX SO 7542	ob31	46°05'46" A	SO 7542	-0°00'14"	3.60 A	SO 7542	
PEG IX SO 7542	PEG X SO 7542	ob32	46°05'46" A	SO 7542	-0°00'14"	33.04 A	SO 7542	
PEG X SO 7542	IT III SO 7542	ob33	290°23'46" A	SO 7542	-0°00'14"	55.63 A	SO 7542	
IT III SO 7542	IB IIIA SO 7542	ob34	282°23'16" A	SO 7542	-0°00'14"	81.85 A	SO 7542	
IT III SO 7541	IT IV SO 7541	ob1	343°22'55" M			362.18 M		
IT IV SO 7541	IT XXI SO 7553	ob18	57°36'20" M			756.18 M		
IT XXI SO 7553	IT XX SO 7553	ob22	145°49'30" M			51.68 M		
IT IV SO 7541	PEG XXXV SO 7553	ob19	315°31'25" A	SO 7553	-0°06'00"	29.07 A	SO 7553	
PEG XXXV SO 7553	PEG V SO 7541	ob35	315°31'25" A	SO 7553	-0°06'00"	12.74 A	SO 7553	
PEG V SO 7541	IB XXVIII SO 7553	ob36	55°05'10" A	SO 7553	-0°06'00"	114.14 A	SO 7553	
IB XXVIII SO 7553	PEG XXVII SO 7553	ob38	57°47'20" A	SO 7553	-0°06'00"	218.06 A	SO 7553	
PEG XXVII SO 7553	PEG XXVI SO 7553	ob39	58°18'10" A	SO 7553	-0°06'00"	82.28 A	SO 7553	

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
PEG XXVI SO 7553	PEG XXV SO 7553	ob40	59°56'00"	A SO 7553	-0°06'00"	89.93 A	SO 7553	
PEG XXV SO 7553	PEG XXIV SO 7553	ob41	36°34'00"	A SO 7553	-0°06'00"	99.57 A	SO 7553	
PEG XXIV SO 7553	PEG XXIII SO 7553	ob42	60°17'30"	A SO 7553	-0°06'00"	121.76 A	SO 7553	
PEG XXIII SO 7553	PEG XXII SO 7553	ob44	114°25'20"	A SO 7553	-0°06'00"	17.36 A	SO 7553	
PEG XXII SO 7553	IT XXI SO 7553	ob46	114°25'20"	A SO 7553	-0°06'00"	66.98 A	SO 7553	
PEG V SO 7541	IB XXIX SO 7553	ob37	229°56'40"	A SO 7553	-0°06'00"	60.98 A	SO 7553	
IB XXIX SO 7553	PEG XXX SO 7553	ob47	323°02'20"	A SO 7553	-0°06'00"	43.13 A	SO 7553	
PEG XXX SO 7553	IB XXXII SO 7553	ob48	90°10'00"	A SO 7553	-0°06'00"	11.53 A	SO 7553	
IB XXXII SO 7553	IB XXXIII SO 7553	ob49	92°31'00"	A SO 7553	-0°06'00"	15.66 A	SO 7553	
IB XXXIII SO 7553	IB XXXIV SO 7553	ob50	58°36'00"	A SO 7553	-0°06'00"	40.33 A	SO 7553	
IB XXXIV SO 7553	PEG V SO 7541	ob52	144°37'00"	A SO 7553	-0°06'00"	19.01 A	SO 7553	
IB XXXIII SO 7553	PEG (1) SO 7553	ob51	115°43'00"	A SO 7553	-0°06'00"	2.90 A	SO 7553	
PEG XXIII SO 7553	PEG (2) SO 7553	ob45	46°58'30"	A SO 7553	-0°06'00"	38.51 A	SO 7553	
PEG (1) SO 7553	PEG XXXIVA SO 7553	ob53	46°10'00"	A SO 7553	-0°06'00"	39.26 A	SO 7553	Class B
PEG XXXIVA SO 7553	PEG XXVIII SO 7553	ob55	54°32'00"	A SO 7553	-0°06'00"	115.28 A	SO 7553	Class B
PEG XXVIII SO 7553	PEG XXVII SO 7553	ob56	57°06'10"	A SO 7553	-0°06'00"	218.03 A	SO 7553	Class B
PEG XXVII SO 7553	PEG XXIV SO 7553	ob57	57°06'10"	A SO 7553	-0°06'00"	265.34 A	SO 7553	Class B
PEG XXIV SO 7553	PEG (2) SO 7553	ob43	57°06'10"	A SO 7553	-0°06'00"	159.48 A	SO 7553	Class B
PEG (2) SO 7553	PEG SO 435	ob54	320°11'15"	A SO 7553	-0°06'00"	68.55 A	SO 7553	Class B
IT 2 DP 459645	IT 1 DP 459645	ob20	103°16'15"	M		73.82 M		
IT 1 DP 459645	POST 3 DP 459645	ob21	91°28'00"	A DP 459645	0°00'00"	28.07 A	DP 459645	
POST 3 DP 459645	PEG 18 DP 582996	ob59	95°43'00"	A DP 459645	0°00'00"	14.20 A	DP 459645	Class B
PEG 18 DP 582996	PEG 19 DP 582996	ob60	199°06'00"	A DP 459645	0°00'00"	16.85 A	DP 459645	Class B
PEG 19 DP 582996	PEG 20 DP 582996	ob61	217°59'00"	A DP 459645	0°00'00"	5.20 A	DP 459645	Class B
PEG 20 DP 582996	POST 29 DP 459645	ob62	248°38'00"	A DP 459645	0°00'00"	15.74 A	DP 459645	Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
POST 29 DP 459645	POST 28 DP 459645	ob63	251°56'00"	A DP 459645	0°00'00"	3.16 A	DP 459645	Class B
POST 28 DP 459645	POST 27 DP 459645	ob64	245°32'00"	A DP 459645	0°00'00"	39.61 A	DP 459645	Class B
POST 27 DP 459645	POST 26 DP 459645	ob65	265°59'00"	A DP 459645	0°00'00"	10.37 A	DP 459645	Class B
POST 26 DP 459645	POST 25 DP 459645	ob66	249°43'00"	A DP 459645	0°00'00"	4.39 A	DP 459645	Class B
POST 25 DP 459645	POST 24 DP 459645	ob67	216°47'00"	A DP 459645	0°00'00"	3.37 A	DP 459645	Class B
POST 24 DP 459645	POST 23 DP 459645	ob68	190°02'00"	A DP 459645	0°00'00"	15.16 A	DP 459645	Class B
POST 23 DP 459645	POST 22 DP 459645	ob69	222°09'00"	A DP 459645	0°00'00"	4.53 A	DP 459645	Class B
POST 22 DP 459645	POST 21 DP 459645	ob70	279°03'00"	A DP 459645	0°00'00"	10.15 A	DP 459645	Class B
POST 21 DP 459645	POST 20 DP 459645	ob71	287°50'00"	A DP 459645	0°00'00"	12.55 A	DP 459645	Class B
POST 20 DP 459645	POST 19 DP 459645	ob72	281°48'00"	A DP 459645	0°00'00"	6.10 A	DP 459645	Class B
POST 19 DP 459645	POST 18 DP 459645	ob73	265°13'00"	A DP 459645	0°00'00"	4.59 A	DP 459645	Class B
POST 18 DP 459645	PEG 21 DP 582996	ob74	244°19'00"	A DP 459645	0°00'00"	18.98 A	DP 459645	Class B
PEG 21 DP 582996	PEG 22 DP 582996	ob75	260°28'00"	A DP 459645	0°00'00"	4.75 A	DP 459645	Class B
PEG 22 DP 582996	PEG 23 DP 582996	ob76	289°51'00"	A DP 459645	0°00'00"	5.02 A	DP 459645	Class B
PEG 23 DP 582996	PEG 24 DP 582996	ob77	301°31'00"	A DP 459645	0°00'00"	25.84 A	DP 459645	Class B
PEG 24 DP 582996	PEG 25 DP 582996	ob78	306°58'00"	A DP 459645	0°00'00"	8.94 A	DP 459645	Class B
PEG 25 DP 582996	PEG 26 DP 582996	ob79	306°58'00"	A DP 459645	0°00'00"	7.00 A	DP 459645	Class B
PEG 26 DP 582996	POST 11 DP 459645	ob80	31°49'00"	A DP 459645	0°00'00"	14.22 A	DP 459645	Class B
POST 11 DP 459645	POST 10 DP 459645	ob82	25°34'00"	A DP 459645	0°00'00"	31.67 A	DP 459645	Class B
POST 10 DP 459645	POST 9 DP 459645	ob83	15°48'00"	A DP 459645	0°00'00"	15.90 A	DP 459645	Class B
POST 9 DP 459645	IT 2 DP 459645	ob84	79°12'00"	A DP 459645	0°00'00"	39.55 A	DP 459645	
POST 9 DP 459645	POST 8 DP 459645	ob85	0°58'00"	A DP 459645	0°00'00"	40.45 A	DP 459645	Class B
POST 8 DP 459645	UNMK 7 DP 459645	ob86	338°42'00"	A DP 459645	0°00'00"	19.66 A	DP 459645	Class B
UNMK 7 DP 459645	POST 6 DP 459645	ob87	100°49'00"	A DP 459645	0°00'00"	13.18 A	DP 459645	Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
POST 6 DP 459645	POST 5 DP 459645	ob88	100°49'00"	A DP 459645	0°00'00"	71.71 A	DP 459645	Class B
POST 5 DP 459645	UNMK 4 DP 459645	ob89	115°01'00"	A DP 459645	0°00'00"	15.35 A	DP 459645	Class B
UNMK 4 DP 459645	POST 3 DP 459645	ob90	134°11'20"	A DP 459645	0°00'00"	66.84 A	DP 459645	Class B
IT 1 DP 582996	IT 2 DP 582996	ob111	23°47'00"	M		106.42 M		
IT 2 DP 582996	IT 3 DP 582996	ob125	93°29'20"	M		547.81 M		
IT 2 DP 582996	IS 5 DP 582996	ob126	88°25'10"	M		67.21 M		
IS 5 DP 582996	IT 1 DP 582996	ob137	227°58'10"	M		148.22 M		
IT 3 DP 582996	IT 4 DP 582996	ob91	282°12'15"	M		274.45 M		
IT 4 DP 582996	IT 1 DP 459645	ob99	301°45'00"	M		89.26 M		
IT 3 DP 582996	PEG 9 DP 582996	ob92	46°46'35"	M		117.15 M		
IT 3 DP 582996	POST 10 DP 582996	ob93	43°57'40"	M		76.10 M		
IT 3 DP 582996	POST 11 DP 582996	ob94	36°11'40"	M		41.89 M		
IT 3 DP 582996	POST 12 DP 582996	ob95	352°47'00"	M		16.90 M		
IT 3 DP 582996	POST 13 DP 582996	ob96	302°02'20"	M		127.98 M		
IT 3 DP 582996	POST 14 DP 582996	ob97	302°36'45"	M		141.69 M		
IT 3 DP 582996	POST 15 DP 582996	ob98	302°19'50"	M		149.03 M		
IT 4 DP 582996	POST 16 DP 582996	ob100	74°35'55"	M		110.83 M		
IT 4 DP 582996	POST 17 DP 582996	ob101	69°42'40"	M		90.71 M		
IT 4 DP 582996	PEG 18 DP 582996	ob102	323°03'30"	M		56.10 M		
IT 4 DP 582996	PEG 19 DP 582996	ob103	306°23'40"	M		48.73 M		
IT 4 DP 582996	PEG 20 DP 582996	ob104	300°19'20"	M		49.15 M		
IT 4 DP 582996	POST 29 DP 459645	ob105	288°28'50"	M		60.19 M		
IT 4 DP 582996	POST 28 DP 459645	ob106	286°45'50"	M		62.76 M		
IT 4 DP 582996	POST 27 DP 459645	ob107	271°00'40"	M		96.16 M		
IT 4 DP 582996	POST 26 DP 459645	ob108	270°31'20"	M		106.50 M		
IT 4 DP 582996	POST 25 DP 459645	ob109	269°42'50"	M		110.61 M		

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT 4 DP 582996	POST 24 DP 459645	ob110	268°20'45" M			112.68 M		
IS 5 DP 582996	POST 23 DP 459645	ob138	87°14'10" M			96.21 M		
IS 5 DP 582996	POST 22 DP 459645	ob139	89°12'40" M			93.07 M		
IS 5 DP 582996	POST 21 DP 459645	ob140	88°00'50" M			83.09 M		
IS 5 DP 582996	POST 20 DP 459645	ob141	84°35'50" M			71.41 M		
IS 5 DP 582996	POST 19 DP 459645	ob142	83°01'20" M			65.60 M		
IS 5 DP 582996	POST 18 DP 459645	ob143	82°51'30" M			61.02 M		
IS 5 DP 582996	PEG 21 DP 582996	ob144	90°50'40" M			43.44 M		
IS 5 DP 582996	PEG 22 DP 582996	ob145	92°06'20" M			38.78 M		
IS 5 DP 582996	PEG 23 DP 582996	ob146	89°32'00" M			34.03 M		
IS 5 DP 582996	PEG 24 DP 582996	ob147	41°02'00" M			18.28 M		
IS 5 DP 582996	PEG 25 DP 582996	ob148	14°13'00" M			19.77 M		
IS 5 DP 582996	PEG 26 DP 582996	ob149	358°12'00" M			23.38 M		
IS 5 DP 582996	POST 27 DP 582996	ob150	333°00'00" M			15.21 M		
IS 5 DP 582996	POST 28 DP 582996	ob151	279°39'00" M			14.23 M		
IS 5 DP 582996	POST 29 DP 582996	ob152	277°54'00" M			19.87 M		
IS 5 DP 582996	POST 30 DP 582996	ob153	277°20'00" M			27.56 M		
IT 2 DP 582996	POST 31 DP 582996	ob127	65°42'00" M			22.43 M		
IT 2 DP 582996	POST 32 DP 582996	ob128	55°09'00" M			15.12 M		
IT 2 DP 582996	POST 33 DP 582996	ob129	41°34'00" M			6.91 M		
IT 2 DP 582996	POST 34 DP 582996	ob130	287°00'00" M			1.68 M		
IT 2 DP 582996	POST 35 DP 582996	ob131	226°19'00" M			12.12 M		
IT 2 DP 582996	POST 36 DP 582996	ob132	220°45'00" M			23.89 M		
IT 2 DP 582996	POST 37 DP 582996	ob133	223°40'40" M			31.04 M		

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT 2 DP 582996	POST 38 DP 582996	ob134	227°17'00" M			37.14 M		
IT 2 DP 582996	POST 39 DP 582996	ob135	227°14'00" M			44.17 M		
IT 2 DP 582996	POST 40 DP 582996	ob136	219°51'20" M			48.58 M		
IT 1 DP 582996	POST 41 DP 582996	ob112	15°27'50" M			55.11 M		
IT 1 DP 582996	POST 42 DP 582996	ob113	18°49'40" M			48.74 M		
IT 1 DP 582996	POST 43 DP 582996	ob114	19°08'20" M			45.16 M		
IT 1 DP 582996	POST 44 DP 582996	ob115	15°00'20" M			38.46 M		
IT 1 DP 582996	POST 45 DP 582996	ob116	5°44'40" M			34.91 M		
IT 1 DP 582996	POST 46 DP 582996	ob117	356°37'00" M			29.85 M		
IT 1 DP 582996	POST 47 DP 582996	ob118	340°54'00" M			16.45 M		
IT 1 DP 582996	POST 48 DP 582996	ob119	309°07'00" M			6.15 M		
IT 1 DP 582996	POST 49 DP 582996	ob120	206°36'00" M			7.32 M		
IT 1 DP 582996	POST 50 DP 582996	ob121	181°32'00" M			21.56 M		
IT 1 DP 582996	POST 51 DP 582996	ob122	183°12'00" M			26.83 M		
IT 1 DP 582996	POST 52 DP 582996	ob123	177°58'00" M			29.35 M		
IT 1 DP 582996	DISK 53 DP 582996	ob124	166°10'00" M			30.13 M		
PEG 9 DP 582996	POST 10 DP 582996	ob154	231°58'00" C			41.31 C		Class B
POST 10 DP 582996	POST 11 DP 582996	ob156	233°15'20" C			35.05 C		Class B
POST 11 DP 582996	POST 12 DP 582996	ob291	237°36'40" C			31.81 C		Class B
POST 12 DP 582996	POST 13 DP 582996	ob157	295°40'20" C			118.01 C		Class B
POST 13 DP 582996	POST 14 DP 582996	ob158	307°57'00" C			13.78 C		Class B
POST 14 DP 582996	POST 15 DP 582996	ob159	296°54'00" C			7.37 C		Class B
POST 15 DP 582996	POST 16 DP 582996	ob160	282°19'40" C			36.31 C		Class B
POST 16 DP 582996	POST 17 DP 582996	ob161	275°18'00" C			21.86 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
POST 17 DP 582996	PEG 18 DP 582996	ob162	276°25'40"	C		119.55 C		Class B
PEG 26 DP 582996	POST 27 DP 582996	ob81	212°08'00"	C		11.60 C		Class B
POST 27 DP 582996	POST 28 DP 582996	ob163	212°32'00"	C		13.25 C		Class B
POST 28 DP 582996	POST 29 DP 582996	ob164	273°30'00"	C		5.66 C		Class B
POST 29 DP 582996	POST 30 DP 582996	ob165	275°52'00"	C		7.69 C		Class B
POST 30 DP 582996	POST 31 DP 582996	ob166	281°15'00"	C		19.78 C		Class B
POST 31 DP 582996	POST 32 DP 582996	ob167	265°48'00"	C		8.06 C		Class B
POST 32 DP 582996	POST 33 DP 582996	ob168	246°05'00"	C		8.56 C		Class B
POST 33 DP 582996	POST 34 DP 582996	ob169	232°55'00"	C		7.76 C		Class B
POST 34 DP 582996	POST 35 DP 582996	ob170	218°56'00"	C		11.39 C		Class B
POST 35 DP 582996	POST 36 DP 582996	ob171	215°04'00"	C		11.89 C		Class B
POST 36 DP 582996	POST 37 DP 582996	ob172	233°19'00"	C		7.28 C		Class B
POST 37 DP 582996	POST 38 DP 582996	ob173	244°52'00"	C		6.46 C		Class B
POST 38 DP 582996	POST 39 DP 582996	ob174	226°58'00"	C		7.03 C		Class B
POST 39 DP 582996	POST 40 DP 582996	ob175	169°57'00"	C		7.41 C		Class B
POST 40 DP 582996	POST 41 DP 582996	ob176	157°21'00"	C		7.56 C		Class B
POST 41 DP 582996	POST 42 DP 582996	ob182	171°34'00"	C		7.06 C		Class B
POST 42 DP 582996	POST 43 DP 582996	ob183	194°55'00"	C		3.59 C		Class B
POST 43 DP 582996	POST 44 DP 582996	ob184	221°19'00"	C		7.34 C		Class B
POST 44 DP 582996	POST 45 DP 582996	ob185	249°31'00"	C		6.90 C		Class B
POST 45 DP 582996	POST 46 DP 582996	ob186	226°48'00"	C		7.21 C		Class B
POST 46 DP 582996	POST 47 DP 582996	ob177	194°15'00"	C		14.71 C		Class B
POST 47 DP 582996	POST 48 DP 582996	ob178	177°00'00"	C		11.68 C		Class B
POST 48 DP 582996	POST 49 DP 582996	ob179	171°51'00"	C		10.53 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
POST 49 DP 582996	POST 50 DP 582996	ob180	169°48'00" C			15.25 C		Class B
POST 50 DP 582996	POST 51 DP 582996	ob181	189°58'00" C			5.32 C		Class B
POST 51 DP 582996	POST 52 DP 582996	ob187	135°03'00" C			3.59 C		Class B
POST 52 DP 582996	DISK 53 DP 582996	ob188	89°18'00" C			6.16 C		Class B
PEG SO 435	UNMK 91 DP 582996	ob58	159°57'00" C			23.92 C		Class B
UNMK 91 DP 582996	UNMK 92 DP 582996	ob190	196°33'00" C			12.60 C		Class B
UNMK 92 DP 582996	UNMK 116 DP 582996	ob191	223°12'00" C			25.01 C		Class B
UNMK 116 DP 582996	UNMK 117 DP 582996	ob192	243°59'20" C			30.48 C		Class B
UNMK 117 DP 582996	UNMK 118 DP 582996	ob193	263°15'00" C			44.89 C		Class B
UNMK 118 DP 582996	UNMK 119 DP 582996	ob194	254°25'00" C			22.59 C		Class B
UNMK 119 DP 582996	UNMK 120 DP 582996	ob195	235°27'20" C			30.44 C		Class B
UNMK 120 DP 582996	UNMK 121 DP 582996	ob196	217°03'00" C			30.75 C		Class B
UNMK 121 DP 582996	UNMK 122 DP 582996	ob197	218°13'00" C			35.92 C		Class B
UNMK 122 DP 582996	PEG 9 DP 582996	ob198	233°45'00" C			29.61 C		Class B
PEG 9 DP 582996	UNMK 123 DP 582996	ob155	245°47'00" C			23.79 C		Class B
UNMK 123 DP 582996	UNMK 124 DP 582996	ob199	277°41'00" C			28.99 C		Class B
UNMK 124 DP 582996	UNMK 125 DP 582996	ob200	306°38'40" C			37.40 C		Class B
UNMK 125 DP 582996	UNMK 126 DP 582996	ob201	335°10'00" C			27.02 C		Class B
UNMK 126 DP 582996	UNMK 127 DP 582996	ob202	7°48'00" C			31.00 C		Class B
UNMK 127 DP 582996	UNMK 128 DP 582996	ob203	17°53'40" C			43.48 C		Class B
UNMK 128 DP 582996	UNMK 129 DP 582996	ob204	342°15'00" C			19.21 C		Class B
UNMK 129 DP 582996	UNMK 130 DP 582996	ob205	310°50'00" C			28.54 C		Class B
UNMK 130 DP 582996	UNMK 131 DP 582996	ob206	275°51'20" C			43.04 C		Class B
UNMK 131 DP 582996	UNMK 132 DP 582996	ob207	269°36'50" C			56.37 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 132 DP 582996	UNMK 133 DP 582996	ob208	303°59'00"	C		26.05 C		Class B
UNMK 133 DP 582996	UNMK 134 DP 582996	ob209	313°26'30"	C		80.24 C		Class B
UNMK 134 DP 582996	UNMK 135 DP 582996	ob210	309°18'20"	C		48.56 C		Class B
UNMK 135 DP 582996	UNMK 136 DP 582996	ob211	295°48'40"	C		37.19 C		Class B
UNMK 136 DP 582996	UNMK 137 DP 582996	ob212	279°42'20"	C		36.28 C		Class B
UNMK 137 DP 582996	UNMK 138 DP 582996	ob213	250°16'00"	C		20.45 C		Class B
UNMK 138 DP 582996	UNMK 139 DP 582996	ob214	227°40'40"	C		31.70 C		Class B
UNMK 139 DP 582996	UNMK 140 DP 582996	ob215	213°12'40"	C		34.76 C		Class B
UNMK 140 DP 582996	UNMK 141 DP 582996	ob216	220°56'00"	C		29.83 C		Class B
UNMK 141 DP 582996	UNMK 142 DP 582996	ob217	247°52'00"	C		26.29 C		Class B
UNMK 142 DP 582996	UNMK 143 DP 582996	ob218	273°08'20"	C		30.17 C		Class B
UNMK 143 DP 582996	UNMK 144 DP 582996	ob219	291°01'00"	C		48.55 C		Class B
UNMK 144 DP 582996	UNMK 145 DP 582996	ob220	319°25'20"	C		43.49 C		Class B
UNMK 145 DP 582996	UNMK 146 DP 582996	ob221	332°12'00"	C		29.78 C		Class B
UNMK 146 DP 582996	UNMK 147 DP 582996	ob222	324°23'20"	C		47.47 C		Class B
UNMK 147 DP 582996	UNMK 148 DP 582996	ob224	314°16'20"	C		46.30 C		Class B
UNMK 148 DP 582996	UNMK 149 DP 582996	ob225	287°43'00"	C		20.80 C		Class B
UNMK 149 DP 582996	UNMK 150 DP 582996	ob226	268°11'00"	C		21.61 C		Class B
UNMK 150 DP 582996	UNMK 151 DP 582996	ob227	237°03'00"	C		26.95 C		Class B
UNMK 151 DP 582996	UNMK 152 DP 582996	ob228	215°53'40"	C		40.01 C		Class B
UNMK 152 DP 582996	UNMK 153 DP 582996	ob229	212°47'00"	C		45.12 C		Class B
UNMK 153 DP 582996	UNMK 154 DP 582996	ob230	205°25'30"	C		53.54 C		Class B
UNMK 154 DP 582996	UNMK 155 DP 582996	ob231	211°15'00"	C		27.05 C		Class B
UNMK 155 DP 582996	UNMK 156 DP 582996	ob232	237°36'00"	C		16.68 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 156 DP 582996	UNMK 157 DP 582996	ob233	238°37'00"	C		14.60 C		Class B
UNMK 157 DP 582996	UNMK 158 DP 582996	ob234	266°54'00"	C		20.51 C		Class B
UNMK 158 DP 582996	UNMK 159 DP 582996	ob235	299°07'00"	C		22.17 C		Class B
UNMK 159 DP 582996	UNMK 160 DP 582996	ob237	325°43'00"	C		28.17 C		Class B
UNMK 160 DP 582996	UNMK 161 DP 582996	ob238	325°03'50"	C		52.79 C		Class B
UNMK 161 DP 582996	UNMK 162 DP 582996	ob239	309°26'40"	C		32.55 C		Class B
UNMK 162 DP 582996	UNMK 163 DP 582996	ob240	295°12'00"	C		35.87 C		Class B
UNMK 163 DP 582996	UNMK 164 DP 582996	ob241	296°40'00"	C		28.81 C		Class B
UNMK 164 DP 582996	UNMK 165 DP 582996	ob242	300°09'20"	C		33.48 C		Class B
UNMK 165 DP 582996	UNMK 166 DP 582996	ob243	279°32'00"	C		17.44 C		Class B
UNMK 166 DP 582996	UNMK 167 DP 582996	ob244	266°59'00"	C		11.38 C		Class B
UNMK 167 DP 582996	UNMK 168 DP 582996	ob245	289°19'00"	C		21.72 C		Class B
UNMK 168 DP 582996	PEG VIIIA SO 7542	ob246	273°24'00"	C		20.06 C		Class B
PEG VIIA SO 7542	UNMK 169 DP 582996	ob29	133°13'00"	C		19.05 C		Class B
UNMK 169 DP 582996	UNMK 170 DP 582996	ob247	164°33'00"	C		49.37 C		Class B
UNMK 170 DP 582996	UNMK 171 DP 582996	ob248	177°31'00"	C		34.11 C		Class B
UNMK 171 DP 582996	UNMK 172 DP 582996	ob249	156°45'00"	C		19.54 C		Class B
UNMK 172 DP 582996	UNMK 173 DP 582996	ob250	125°54'00"	C		17.44 C		Class B
UNMK 173 DP 582996	UNMK 174 DP 582996	ob251	83°57'20"	C		33.60 C		Class B
UNMK 174 DP 582996	UNMK 175 DP 582996	ob252	86°12'40"	C		35.58 C		Class B
UNMK 175 DP 582996	UNMK 176 DP 582996	ob253	99°07'50"	C		52.48 C		Class B
UNMK 176 DP 582996	UNMK 177 DP 582996	ob254	127°18'40"	C		39.86 C		Class B
UNMK 177 DP 582996	UNMK 178 DP 582996	ob255	139°32'00"	C		27.40 C		Class B
UNMK 178 DP 582996	UNMK 179 DP 582996	ob256	145°54'20"	C		31.36 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 179 DP 582996	UNMK 180 DP 582996	ob257	176°39'40"	C		33.75 C		Class B
UNMK 180 DP 582996	UNMK 181 DP 582996	ob258	196°50'00"	C		41.13 C		Class B
UNMK 181 DP 582996	UNMK 182 DP 582996	ob259	206°53'30"	C		54.34 C		Class B
UNMK 182 DP 582996	UNMK 183 DP 582996	ob260	206°35'40"	C		44.62 C		Class B
UNMK 183 DP 582996	UNMK 184 DP 582996	ob261	202°14'00"	C		10.15 C		Class B
UNMK 184 DP 582996	UNMK 185 DP 582996	ob262	161°15'00"	C		17.28 C		Class B
UNMK 185 DP 582996	UNMK 186 DP 582996	ob263	151°33'40"	C		37.48 C		Class B
UNMK 186 DP 582996	UNMK 187 DP 582996	ob264	153°47'00"	C		27.08 C		Class B
UNMK 187 DP 582996	UNMK 188 DP 582996	ob265	175°45'00"	C		25.81 C		Class B
UNMK 188 DP 582996	UNMK 189 DP 582996	ob266	182°25'30"	C		54.64 C		Class B
UNMK 189 DP 582996	UNMK 190 DP 582996	ob267	156°35'00"	C		10.03 C		Class B
UNMK 190 DP 582996	UNMK 191 DP 582996	ob268	81°40'00"	C		13.11 C		Class B
UNMK 191 DP 582996	UNMK 192 DP 582996	ob269	62°53'00"	C		72.04 C		Class B
UNMK 192 DP 582996	UNMK 193 DP 582996	ob270	68°48'40"	C		50.80 C		Class B
UNMK 193 DP 582996	UNMK 194 DP 582996	ob271	91°59'10"	C		86.38 C		Class B
UNMK 194 DP 582996	UNMK 195 DP 582996	ob272	76°52'20"	C		34.41 C		Class B
UNMK 195 DP 582996	DISK 53 DP 582996	ob273	57°09'00"	C		25.70 C		Class B
DISK 53 DP 582996	UNMK 219 DP 582996	ob189	40°32'00"	C		17.30 C		Class B
UNMK 219 DP 582996	UNMK 196 DP 582996	ob292	40°32'00"	C		10.37 C		Class B
UNMK 196 DP 582996	UNMK 197 DP 582996	ob274	47°07'00"	C		33.51 C		Class B
UNMK 197 DP 582996	UNMK 198 DP 582996	ob275	66°26'00"	C		30.18 C		Class B
UNMK 198 DP 582996	UNMK 199 DP 582996	ob276	84°13'20"	C		33.77 C		Class B
UNMK 199 DP 582996	UNMK 221 DP 582996	ob277	115°50'40"	C		16.13 C		Class B
UNMK 221 DP 582996	UNMK 200 DP 582996	ob295	125°09'20"	C		45.34 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 200 DP 582996	UNMK 222 DP 582996	ob278	134°21'20"	C		40.49 C		Class B
UNMK 222 DP 582996	UNMK 203 DP 582996	ob296	160°17'30"	C		52.26 C		Class B
UNMK 203 DP 582996	UNMK 204 DP 582996	ob279	165°58'00"	C		24.84 C		Class B
UNMK 204 DP 582996	UNMK 205 DP 582996	ob280	167°16'00"	C		10.15 C		Class B
UNMK 205 DP 582996	UNMK 206 DP 582996	ob281	131°00'20"	C		41.88 C		Class B
UNMK 206 DP 582996	UNMK 220 DP 582996	ob282	146°59'00"	C		7.67 C		Class B
UNMK 220 DP 582996	UNMK 207 DP 582996	ob294	146°59'00"	C		7.20 C		Class B
UNMK 207 DP 582996	UNMK 208 DP 582996	ob283	146°59'00"	C		12.45 C		Class B
UNMK 208 DP 582996	PEG (1) SO 7553	ob284	206°57'00"	C		24.21 C		Class B
UNMK 219 DP 582996	UNMK 223 DP 582996	ob293	334°42'00"	C		4.94 C		Class B
UNMK 223 DP 582996	UNMK 224 DP 582996	ob297	353°49'00"	C		4.25 C		Class B
UNMK 224 DP 582996	UNMK 225 DP 582996	ob298	1°37'00"	C		4.03 C		Class B
UNMK 225 DP 582996	UNMK 226 DP 582996	ob299	8°01'00"	C		4.09 C		Class B
UNMK 226 DP 582996	UNMK 227 DP 582996	ob300	15°57'00"	C		8.49 C		Class B
UNMK 227 DP 582996	UNMK 228 DP 582996	ob301	30°01'00"	C		8.46 C		Class B
UNMK 228 DP 582996	UNMK 229 DP 582996	ob302	43°11'00"	C		7.82 C		Class B
UNMK 229 DP 582996	UNMK 230 DP 582996	ob303	56°55'00"	C		12.58 C		Class B
UNMK 230 DP 582996	UNMK 231 DP 582996	ob304	64°42'00"	C		12.50 C		Class B
UNMK 231 DP 582996	UNMK 232 DP 582996	ob305	76°31'40"	C		38.38 C		Class B
UNMK 232 DP 582996	UNMK 233 DP 582996	ob306	93°24'00"	C		11.98 C		Class B
UNMK 233 DP 582996	UNMK 234 DP 582996	ob307	115°28'00"	C		4.24 C		Class B
UNMK 234 DP 582996	UNMK 250 DP 582996	ob308	126°18'00"	C		28.48 C		Class B
UNMK 250 DP 582996	UNMK 251 DP 582996	ob309	126°00'00"	C		4.08 C		Class B
UNMK 251 DP 582996	UNMK 253 DP 582996	ob310	126°00'00"	C		27.92 C		Class B

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 253 DP 582996	UNMK 254 DP 582996	ob311	123°02'40" C			45.39 C		Class B
UNMK 254 DP 582996	UNMK 255 DP 582996	ob312	99°52'20" C			33.36 C		Class B
UNMK 255 DP 582996	UNMK 256 DP 582996	ob313	57°45'00" C			30.21 C		Class B
UNMK 256 DP 582996	UNMK 257 DP 582996	ob314	85°05'00" C			11.16 C		Class B
UNMK 257 DP 582996	UNMK 258 DP 582996	ob315	91°49'00" C			8.56 C		Class B
UNMK 258 DP 582996	UNMK 259 DP 582996	ob316	98°16'00" C			3.98 C		Class B
UNMK 259 DP 582996	UNMK 260 DP 582996	ob317	102°09'00" C			27.36 C		Class B
UNMK 260 DP 582996	UNMK 261 DP 582996	ob318	137°41'00" C			9.14 C		Class B
UNMK 261 DP 582996	UNMK 262 DP 582996	ob319	171°11'00" C			16.47 C		Class B
UNMK 262 DP 582996	UNMK 263 DP 582996	ob320	172°03'00" C			11.77 C		Class B
UNMK 263 DP 582996	UNMK 264 DP 582996	ob321	183°49'00" C			24.85 C		Class B
UNMK 264 DP 582996	UNMK 265 DP 582996	ob322	188°21'00" C			17.23 C		Class B
UNMK 265 DP 582996	UNMK 266 DP 582996	ob323	204°29'00" C			2.70 C		Class B
UNMK 266 DP 582996	UNMK 267 DP 582996	ob324	220°49'40" C			31.98 C		Class B
UNMK 267 DP 582996	UNMK 268 DP 582996	ob325	225°02'00" C			27.49 C		Class B
UNMK 268 DP 582996	UNMK 220 DP 582996	ob326	224°38'00" C			15.03 C		Class B

Mark Name	Mark Condition	Description
IS 5 DP 582996		D0.2 AT EDGE OF TRACK
IT 1 DP 459645		D0.4
IT 1 DP 582996		D0.2 IN Paddock
IT 2 DP 459645		D0.3
IT 2 DP 582996		D0.3 IN Paddock
IT 3 DP 582996		D0.3 IN Paddock
IT 4 DP 582996		D0.3 IN Paddock
IT I DP 325992		D0.2M IN GRASS
IT II SO 7541		D0.2 ON TOP OF BANK
IT IV SO 7541		D0.4 IN Paddock

Mark and Vector

Survey Number DP 582996

Meridional Circuit Bluff 2000

Mark Name	Mark Condition	Description
IT SO 7542		D0.1 IN GRAVEL
IT X SO 7516		D0.1 IN GRAVEL
IT XI SO 7516		D0.5 IN BERM
IT XX SO 7553		D0.4 IN Paddock
IT XXI SO 7553		D0.3 IN Paddock
IB VII SO 7542	Searched For and Not Found	
IB VIII SO 7542	Searched For and Not Found	

*** End of Report ***

SCHEDULE – DP 582996

Lots 1 and 2 being a Subdivision of Pt Section 29 Block V Mabel Hundred.


AMALGAMATION CONDITION

That Lot 2 hereon and Section 332 Forest Hill Hundred (RT 173278) and Section 19 Forest Hill Hundred (RT 173277) be transferred to the owners of Lot 1 Deposited Plan 7731 and Section 13 Block V Mabel Hundred and Part Section 23 Block V and Part Section 24 Block V Mabel Hundred and Lot 1 Deposited Plan 7303 and Part Section 85, 213 Block II Forest Hill Hundred (RT SLA3/1325) and that one Record of Title be issued to contain all parcels.

(CSN:1798251)


Occupation Diagram

20m
OF
RY PEG

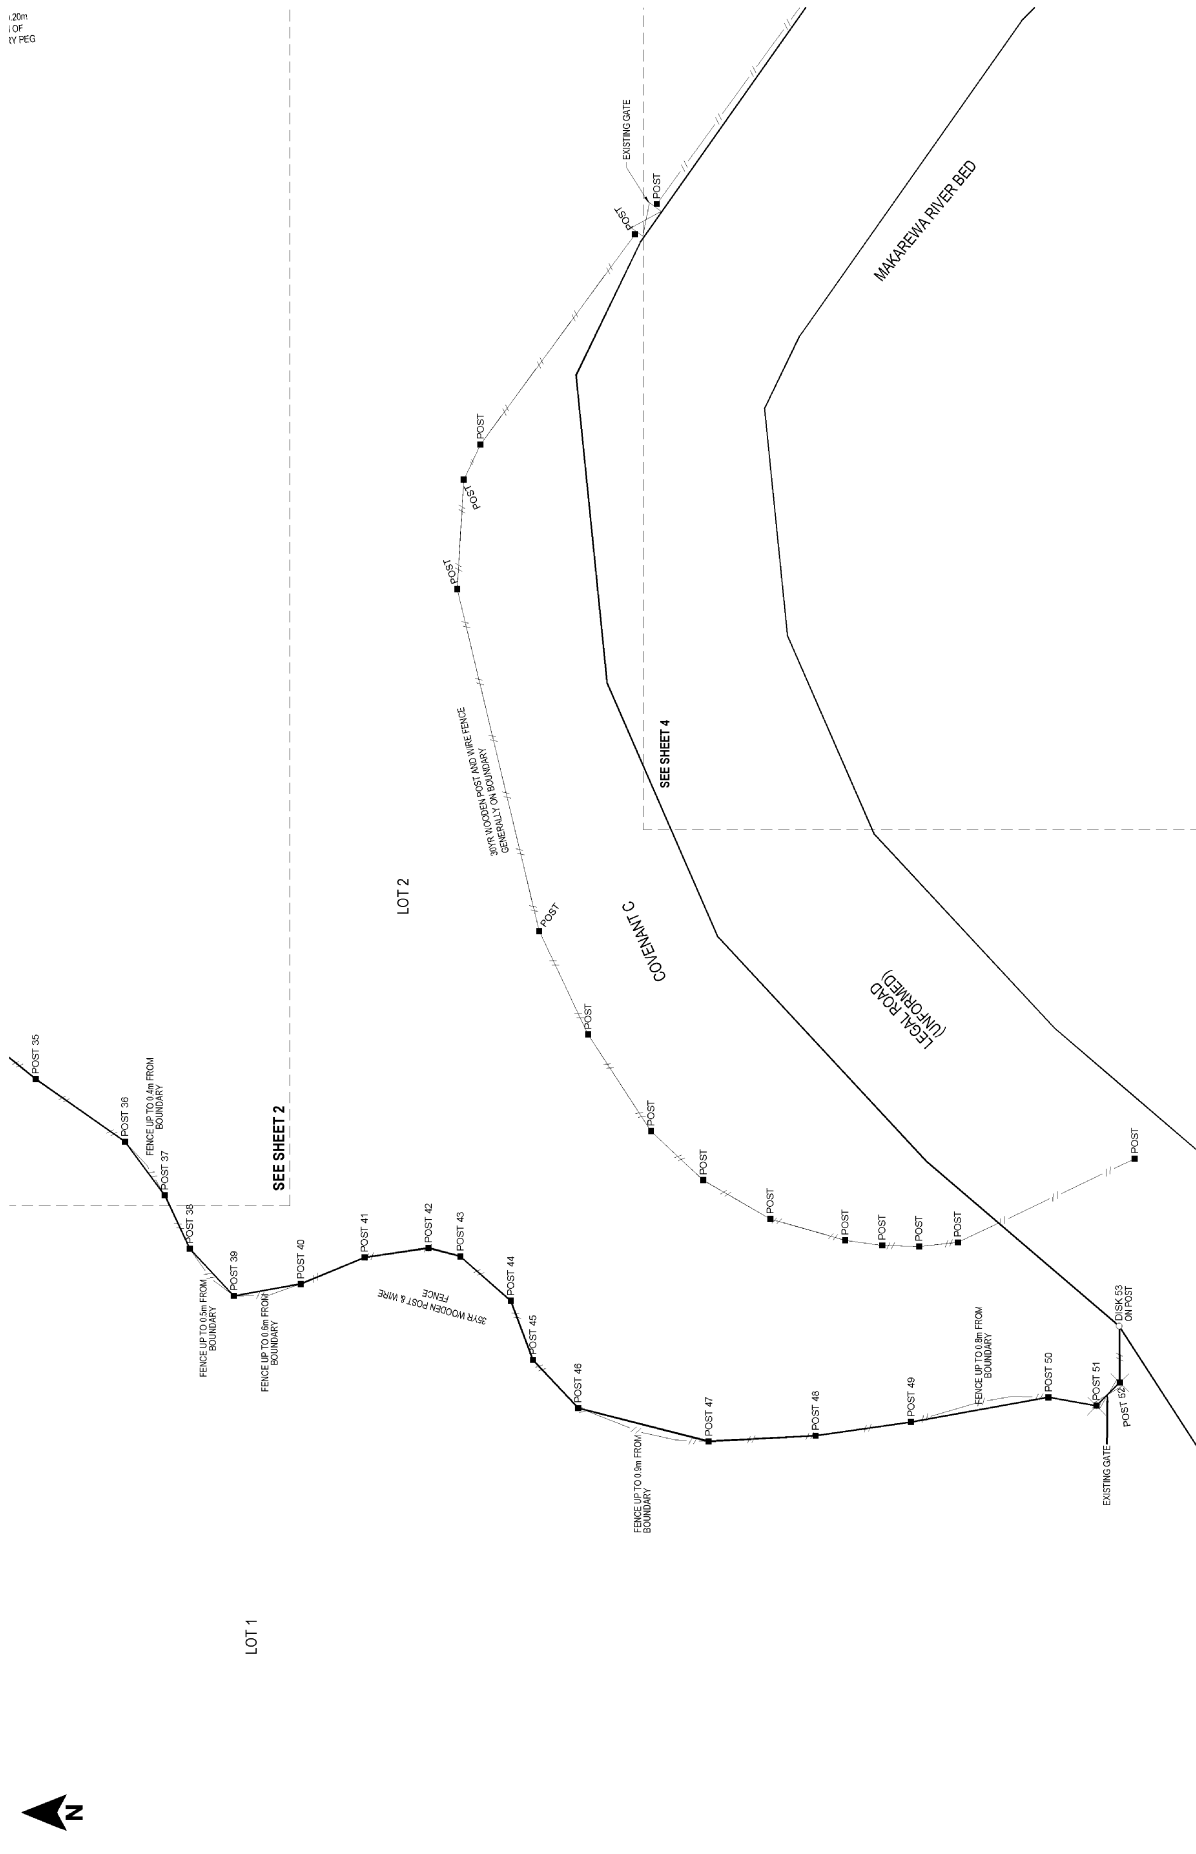


CLIENT	PROJECT	SHEET TITLE	REV	REVISION DETAILS	DATE	SURVEYED	DATE	DESIGNED	DATE	DRAWN	DATE	CHECKED	DATE	APPROVED	DATE	SCALE	SHEET	OF	REVISION
ROD & NAN SINCLAIR	2 LOT SUBDIVISION, 222A CHANNEL ROAD, WINTON, SOUTHLAND	OCCUPATION DIAGRAM PLAN	A	FOR LIT PLAN	20/09/2022	20/09/2022	20/09/2022	JH	20/09/2022	JH	20/09/2022	KJH	20/09/2022	20/09/2022	20/09/2022	1:250	7874	1 OF 4	A

Occupation Diagram

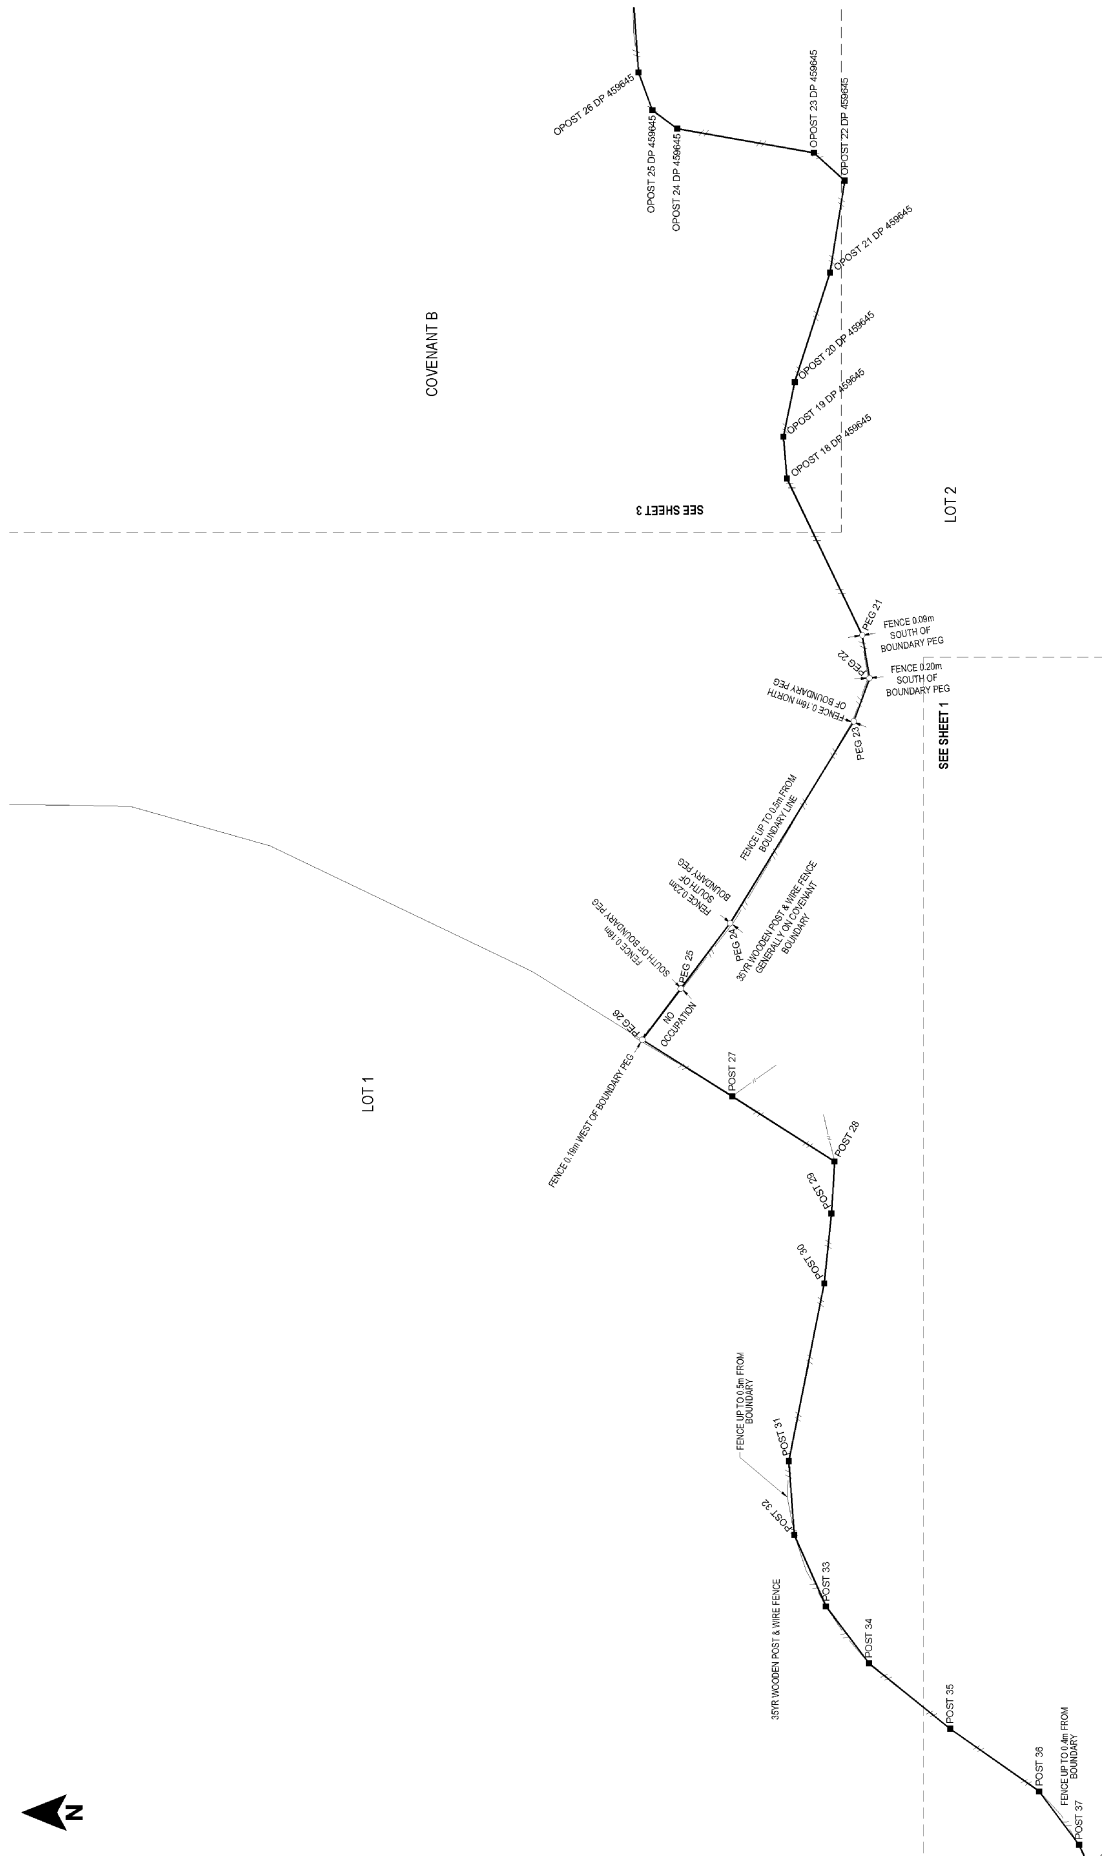


SEE SHEET 2	PROJECT	SHEET TITLE	REV	DATE	SURVEYED	DRAWN	CHECKED	APPROVED
ROD & NAN SINCLAIR	2 LOT SUBDIVISION, 222A CHANNEL ROAD, WINTON, SOUTHLAND	OCCUPATION DIAGRAM PLAN	A		27/09/2022	JH	KJH	2 of 4
								A
								1,250

Occupation Diagram

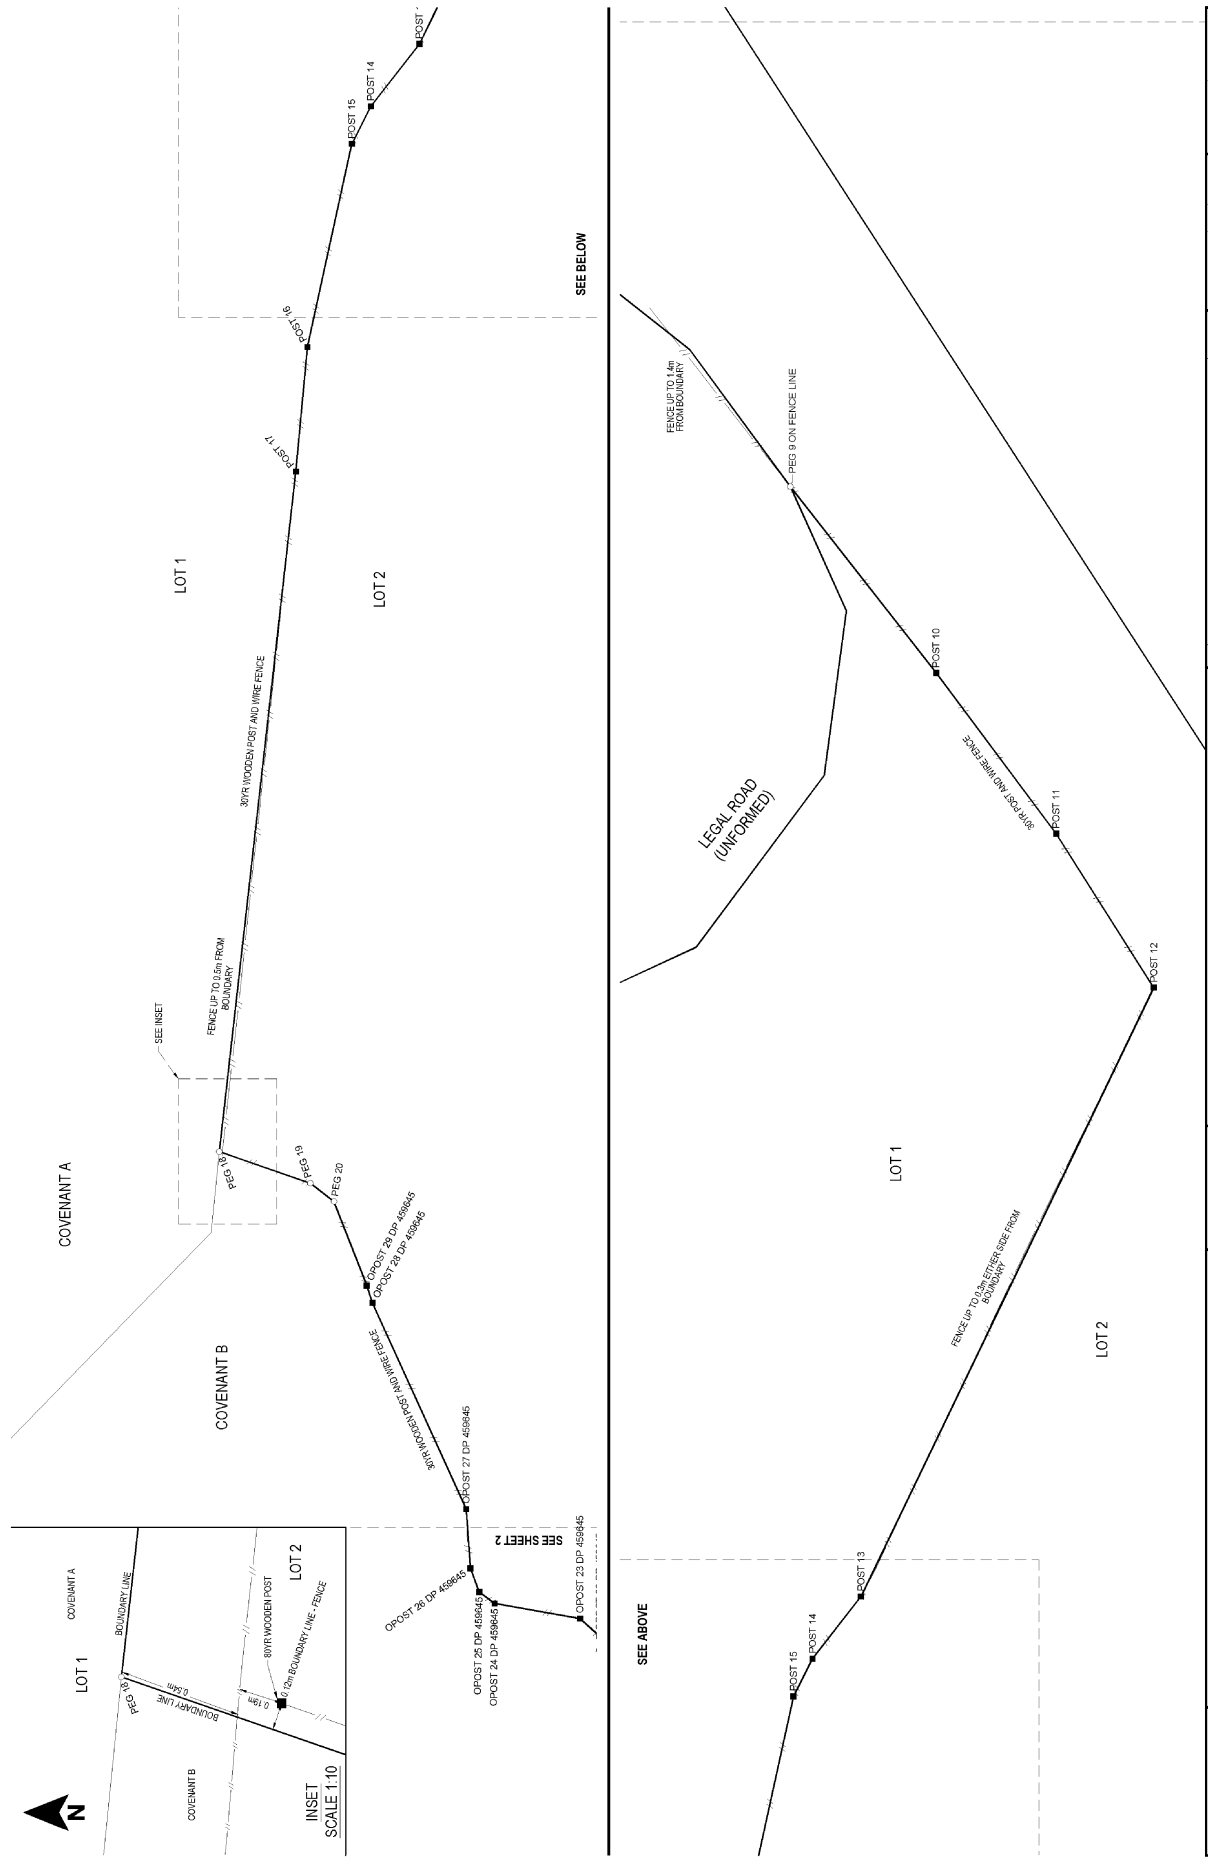

CLIENT:		FROM:		SHEET TITLE:		REV		REVISION DETAILS		DATE		DESIGNED:		JHI		30/09/2022		SURVEYED:		LFW		21/09/2022		JOB NUMBER:		7874		1:400		SCALE TO 1:41	
ROD & NAN SINCLAIR		2 LOT SUBDIVISION, 222A CHANNEL ROAD, WINTON, SOUTHLAND		OCCUPATION DIAGRAM PLAN								BRAINN		BRAINN		BRAINN		BRAINN		BRAINN		BRAINN		BRAINN		BRAINN		BRAINN		BRAINN	

Occupation Diagram

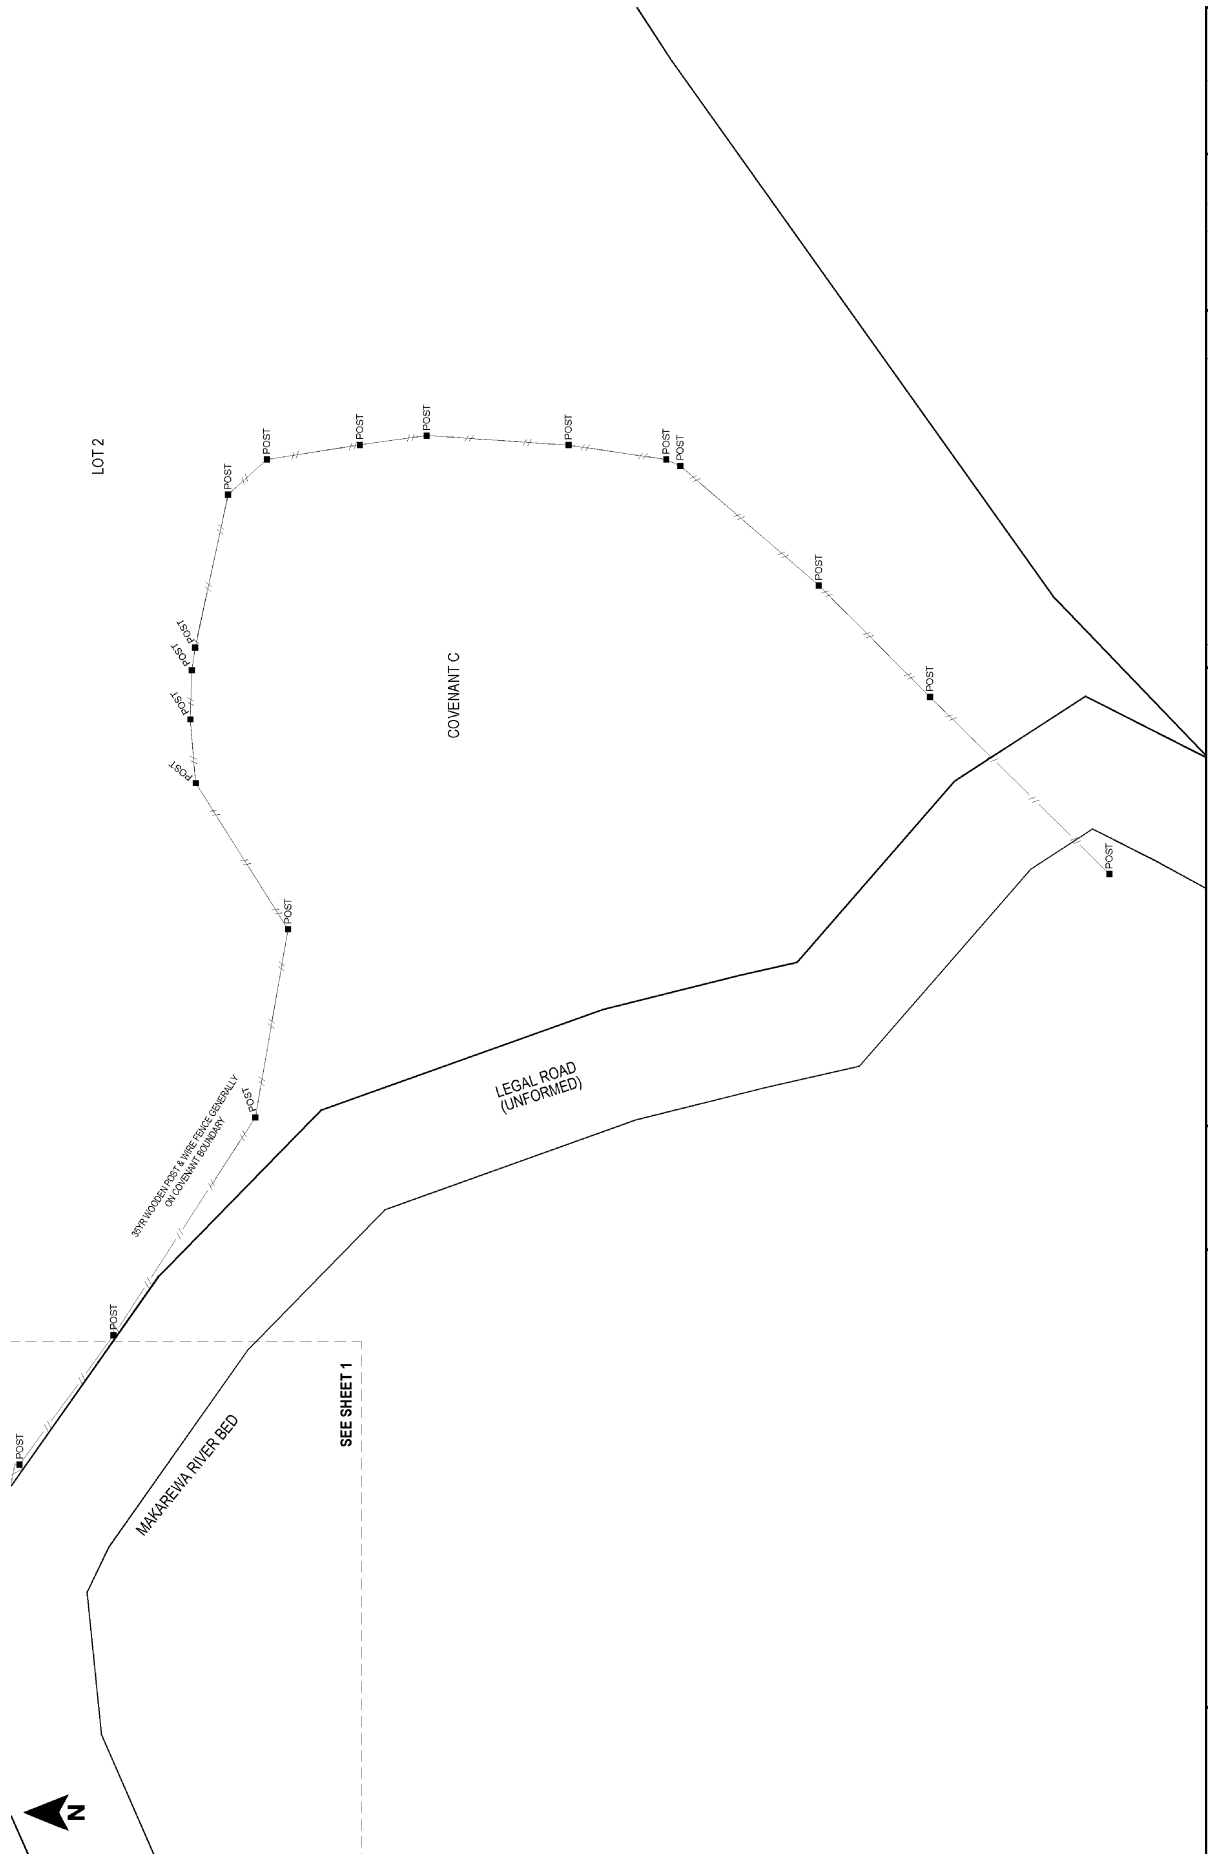




Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred

Record of Survey
DP 582996

Deposited on: 1/12/2022




Diag. AL

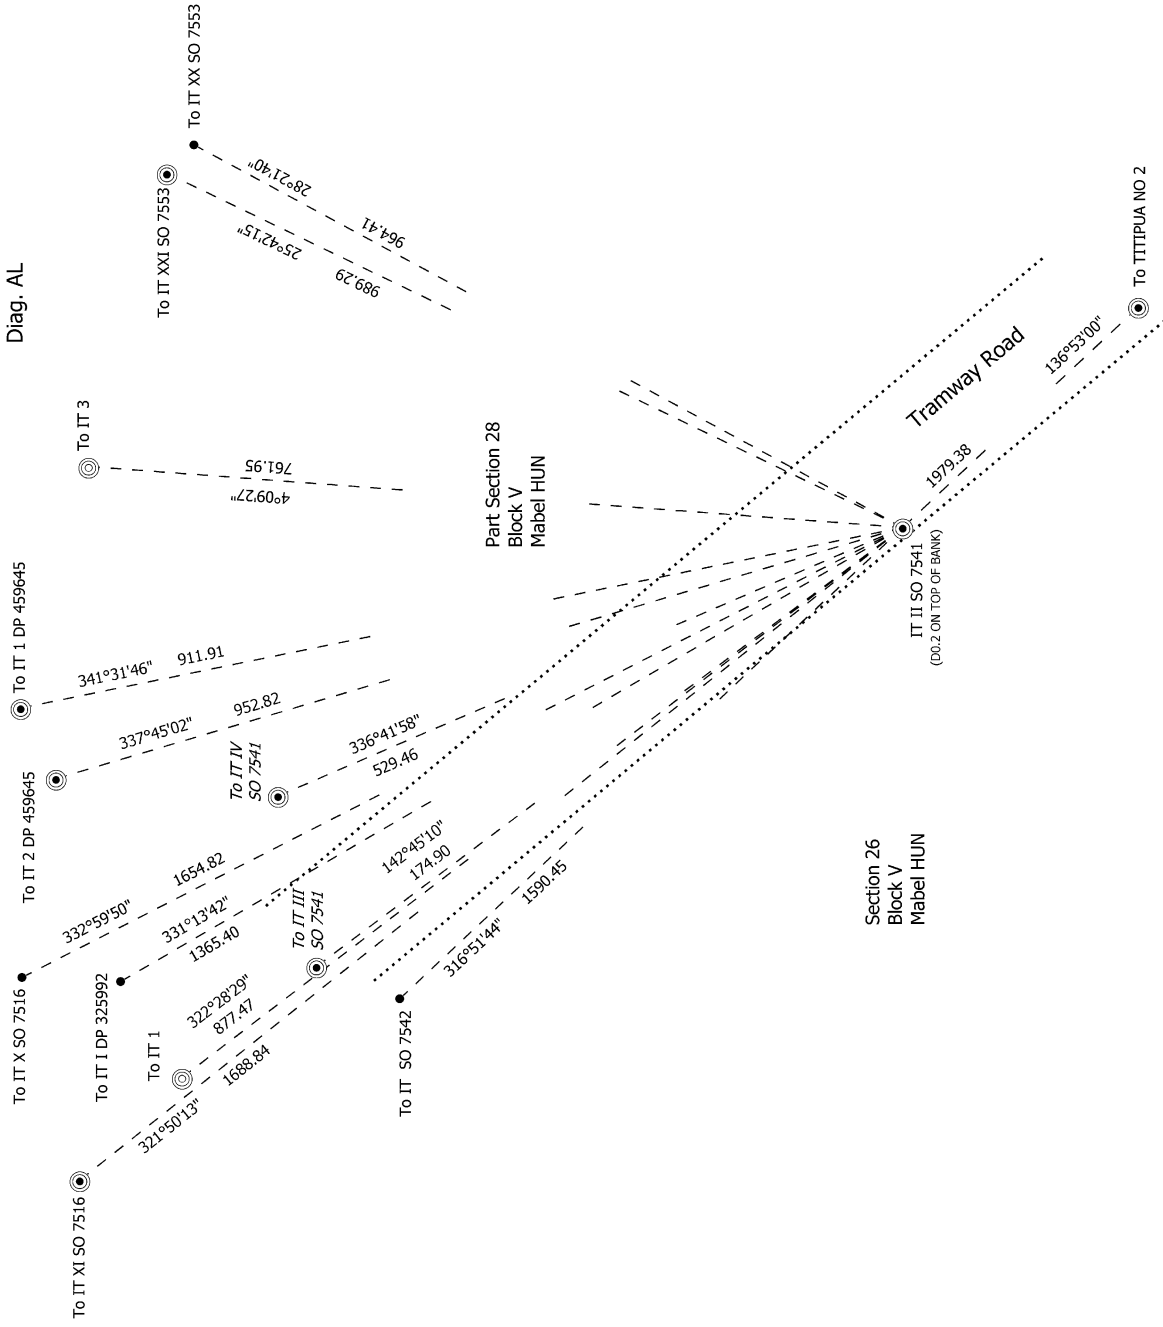

S 2/13


Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 28/01/2023 12:31pm Page 22 of 49			

Diag. A/J

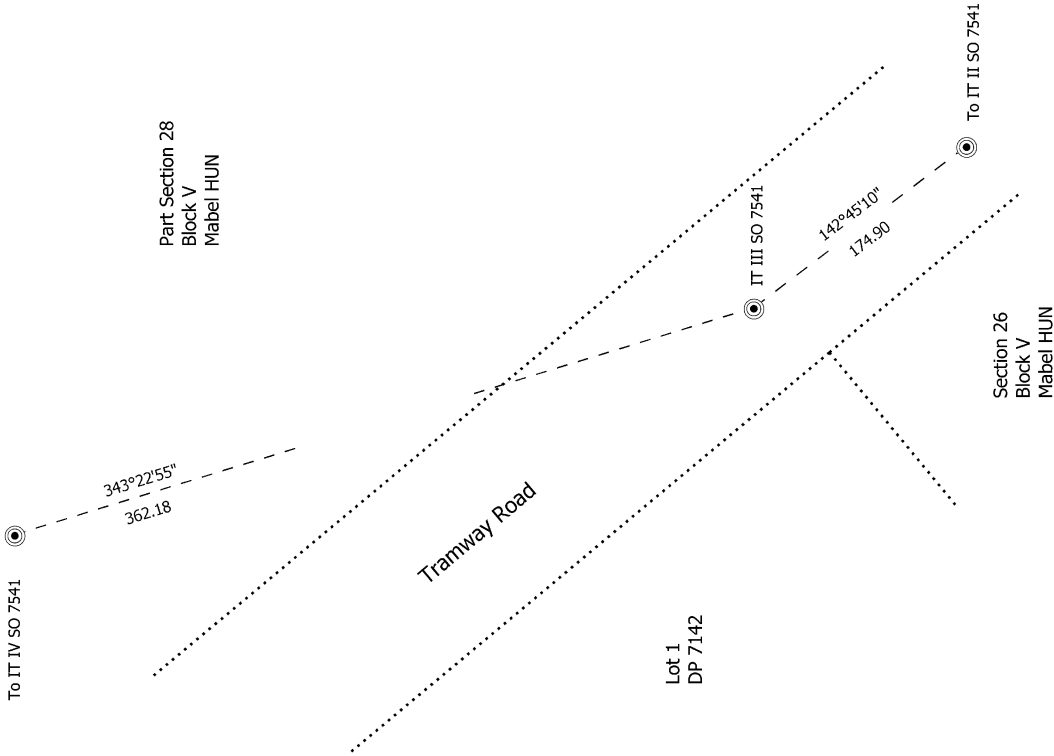

S 3/13


Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 23 of 49			

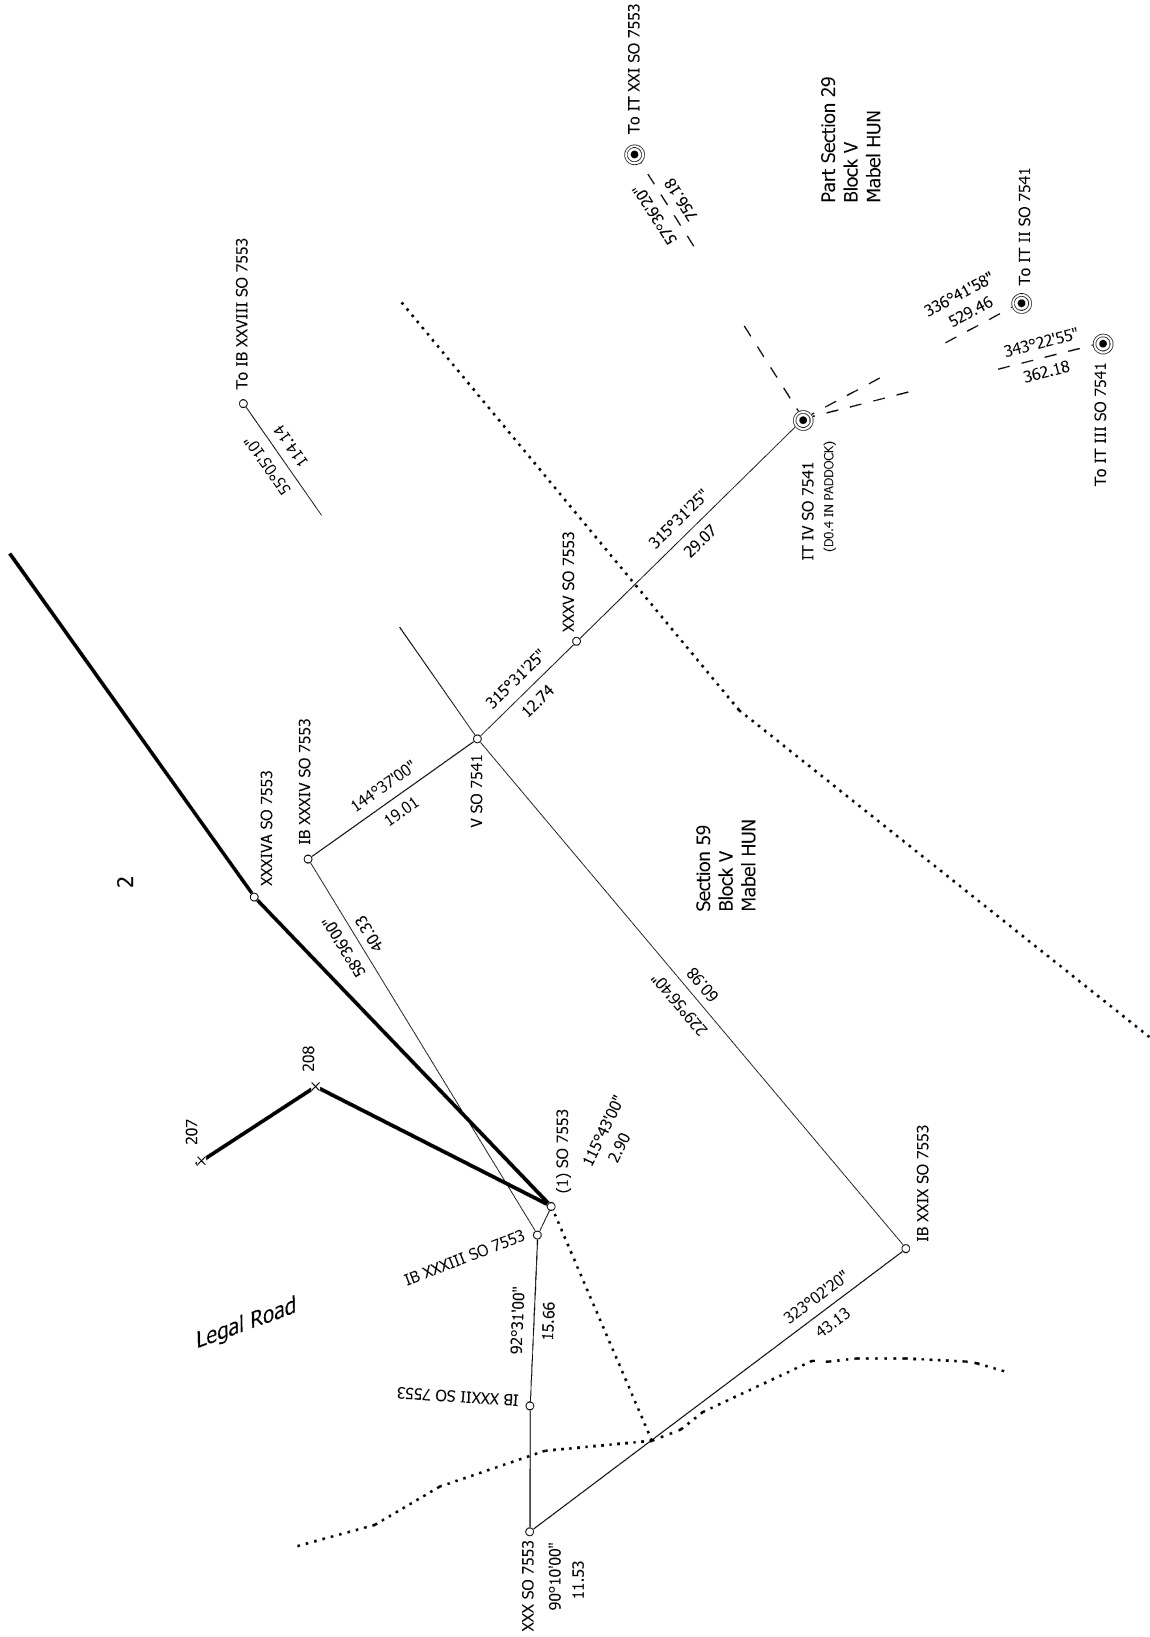


S 4/13

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred		Record of Survey DP 582996
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 24 of 49	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Deposited on: 1/12/2022	


Diag. AI

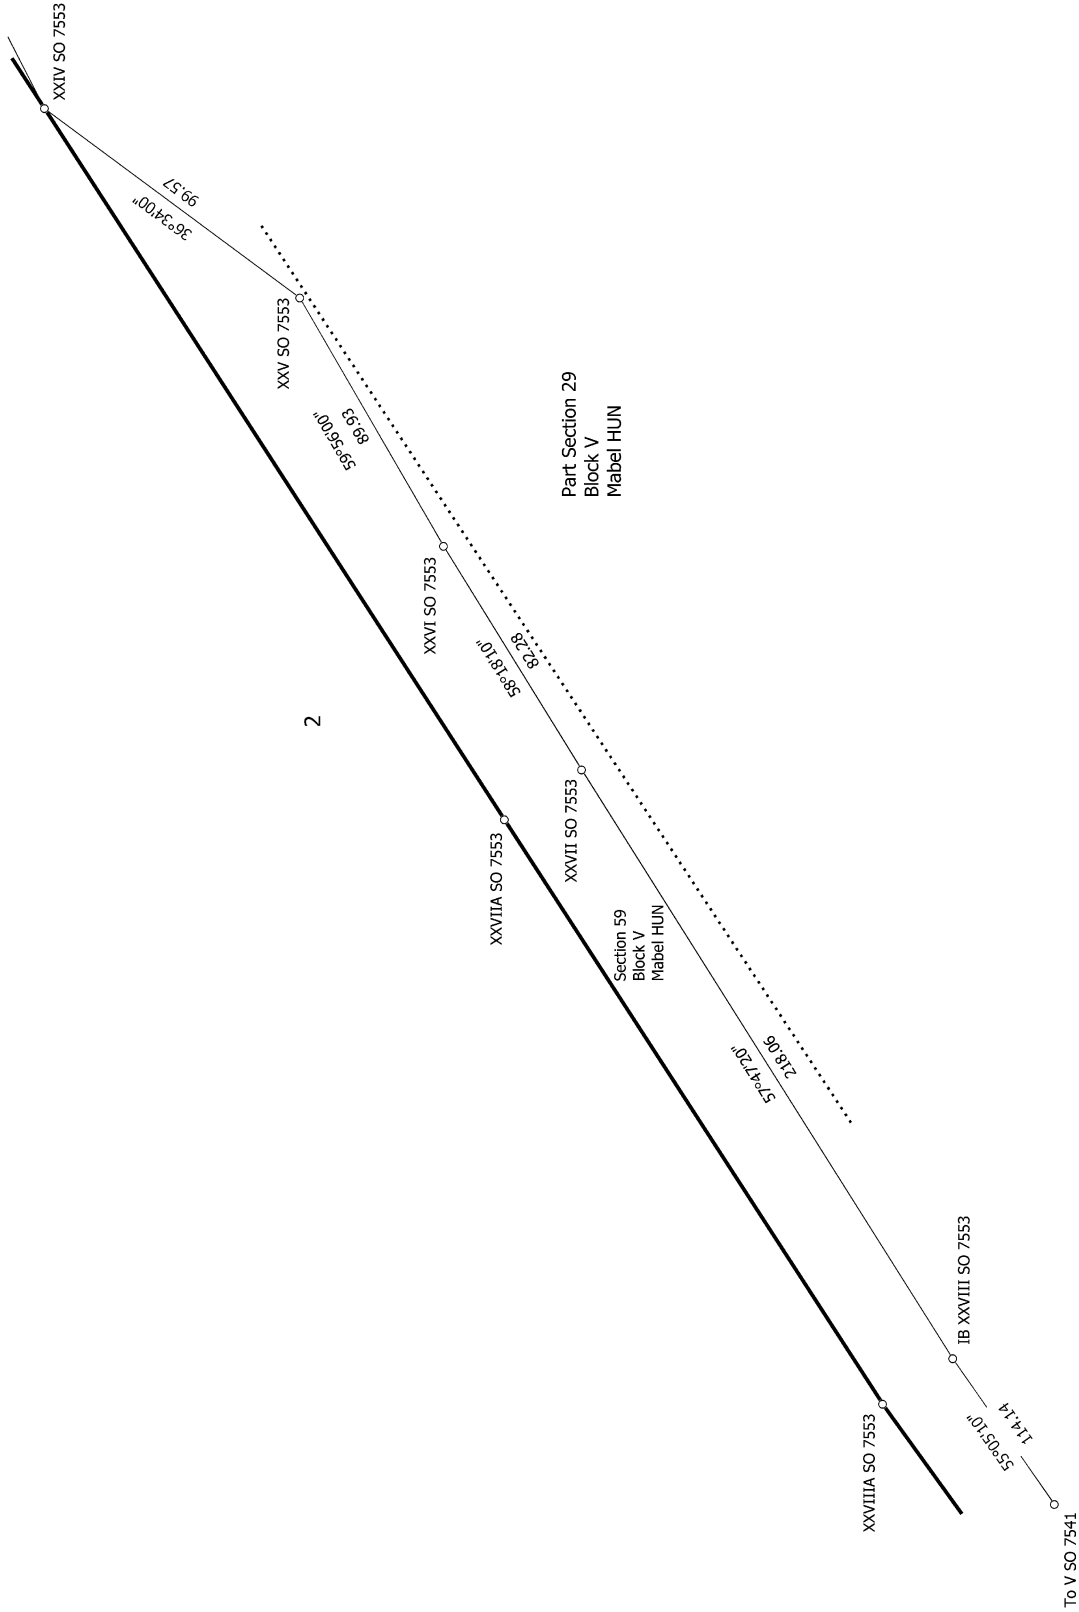

S 5/13		Record of Survey DP 582996 Deposited on: 1/12/2022	
Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred		Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 25 of 49			





Diag. AM

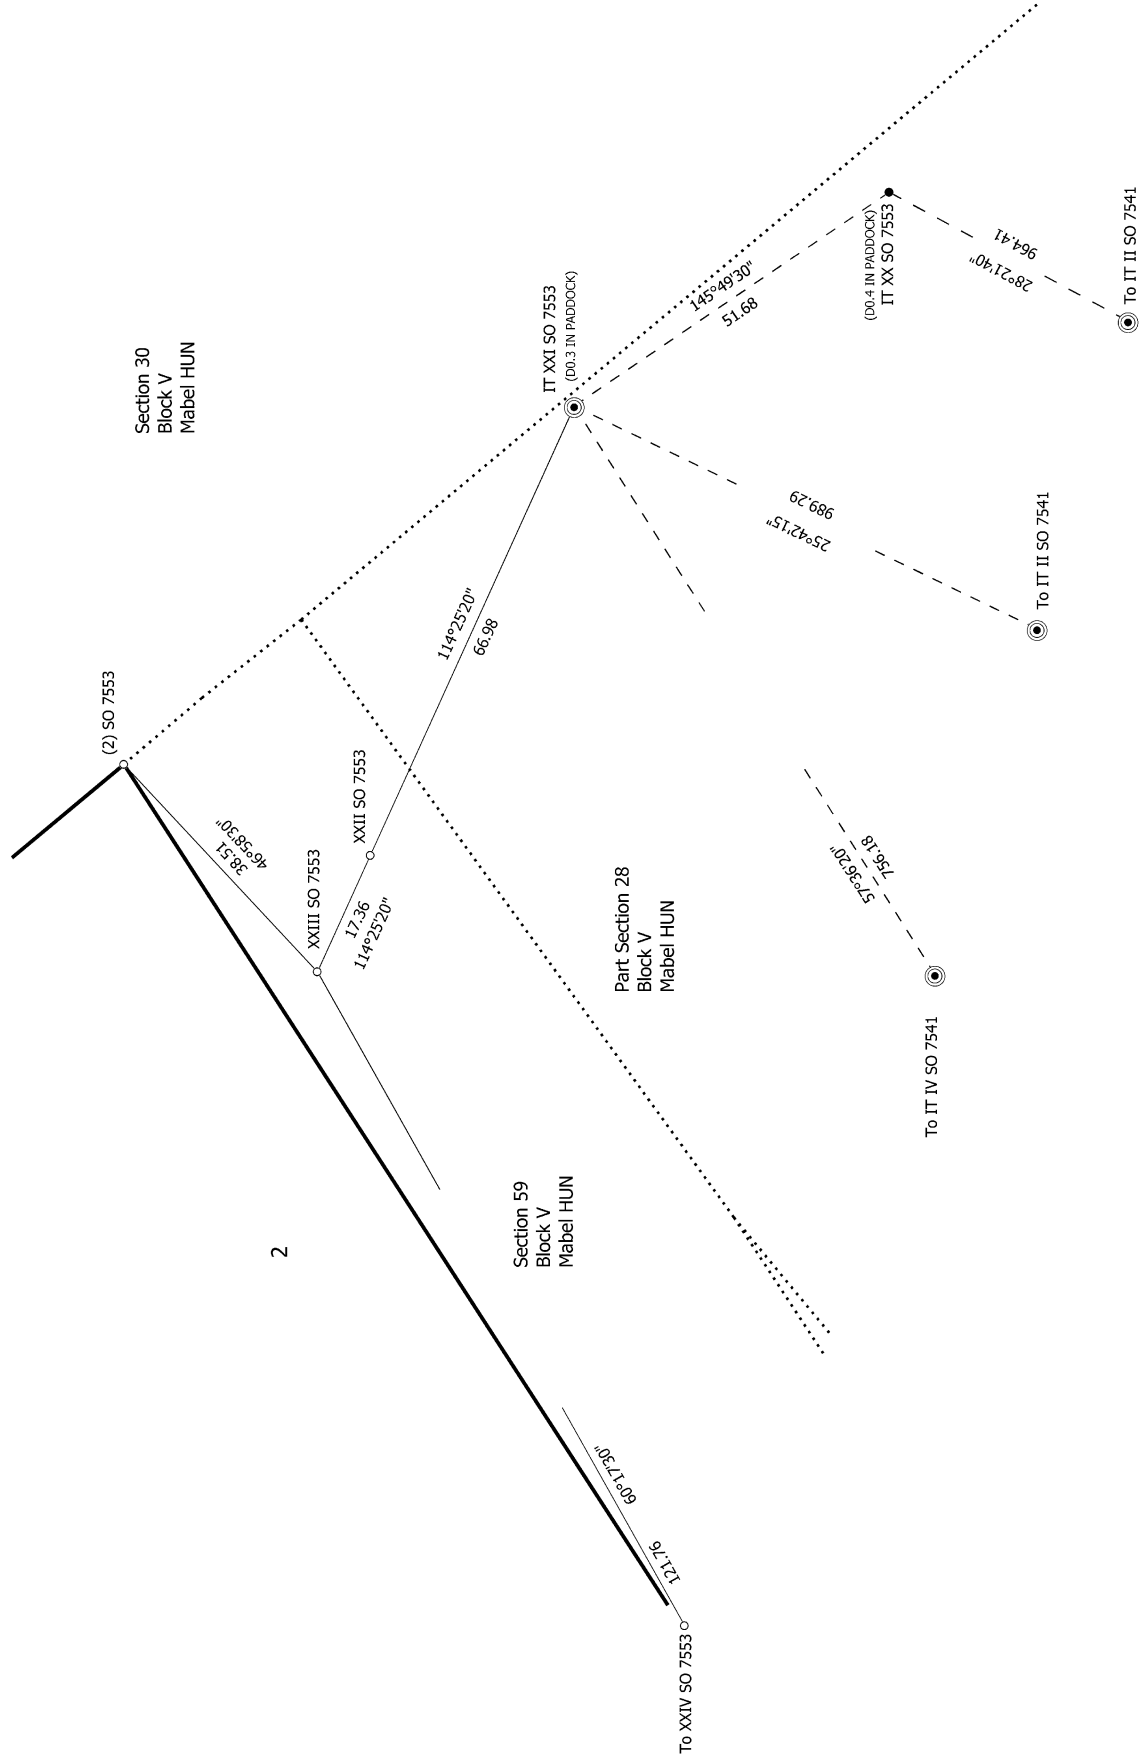

S 6/13

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 26 of 49			

Diag. AK

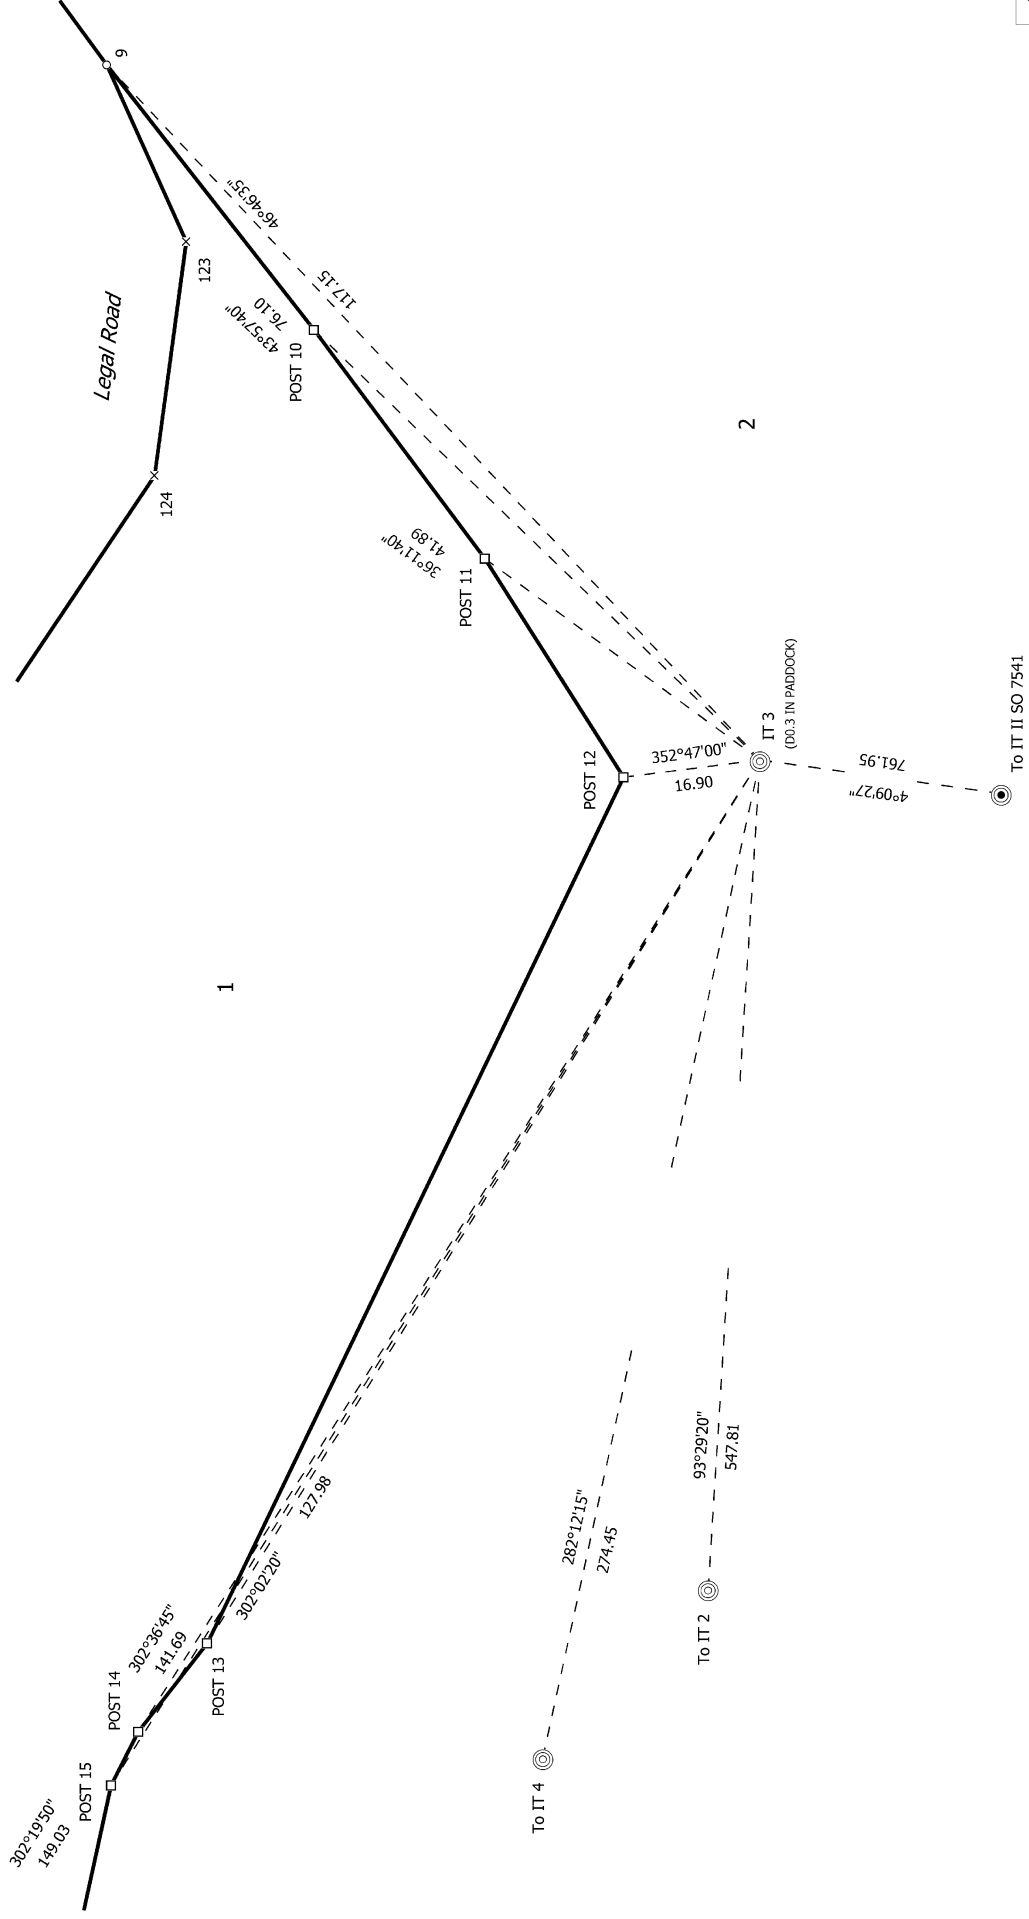

S 7/13

Land District: Southland


Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred

Surveyor: Christopher Francis Walker
Firm: Bonisch Consultants Ltd
Date of Survey: 29/09/2022


Record of Survey
DP 582996

Digitally Generated Plan
Generated on: 28/01/2023 12:31pm Page 27 of 49


Deposited on: 1/12/2022

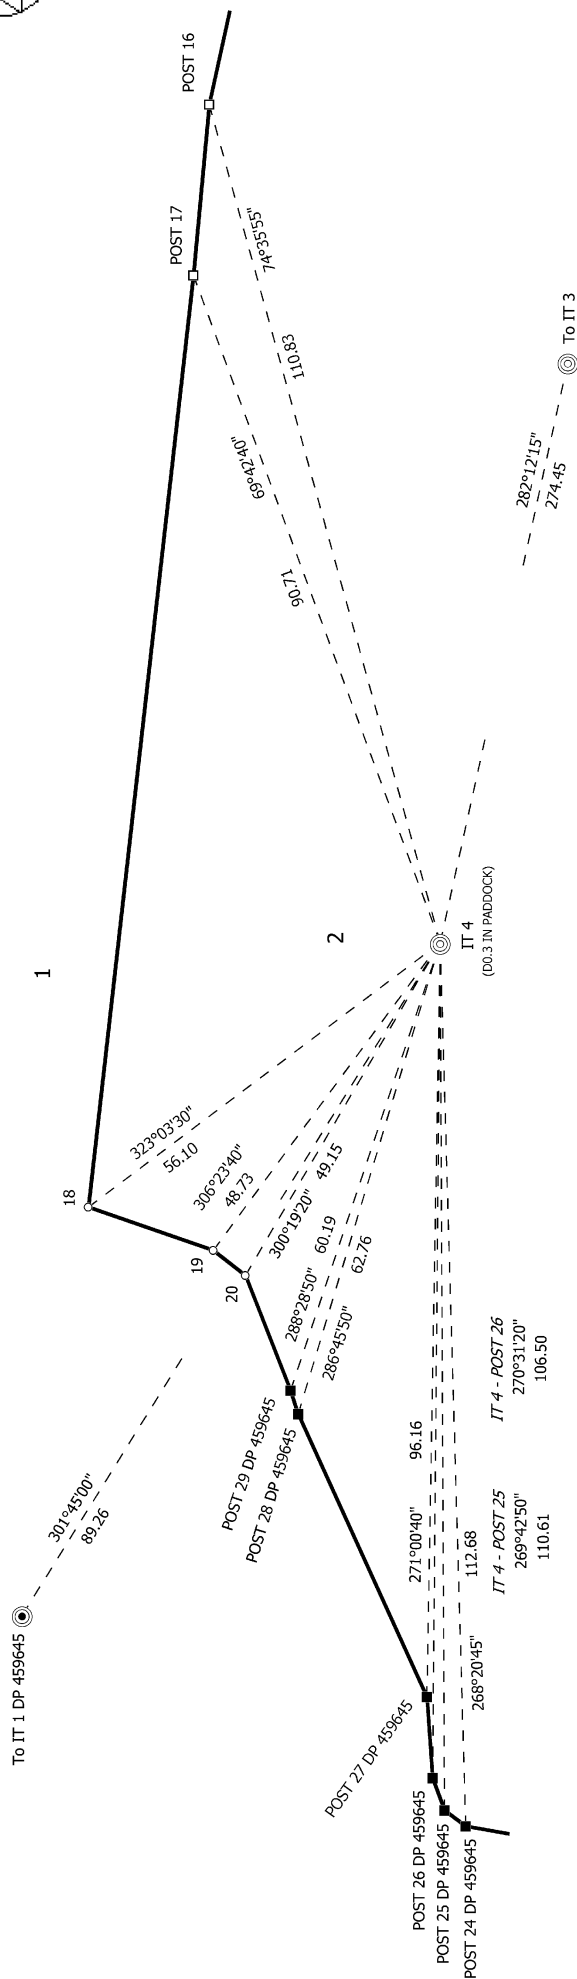

Diag. AF

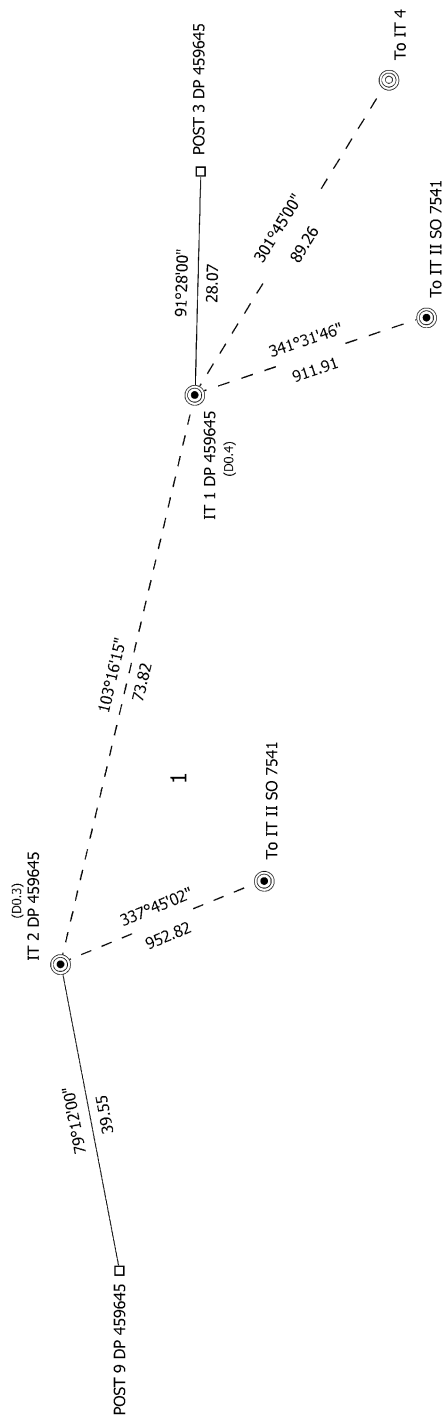

Diag. AE

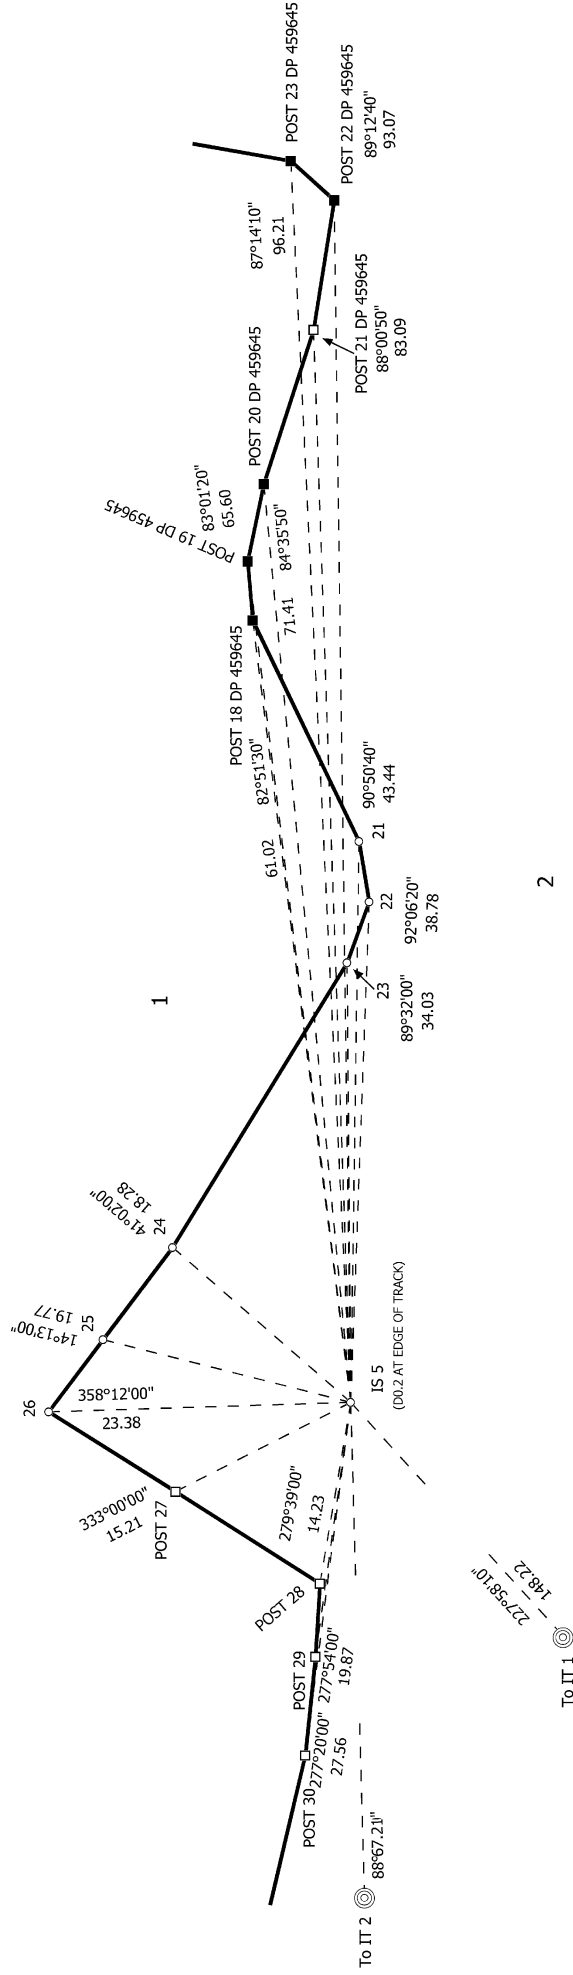


2

S 9/13

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 29 of 49			


Diag. AD

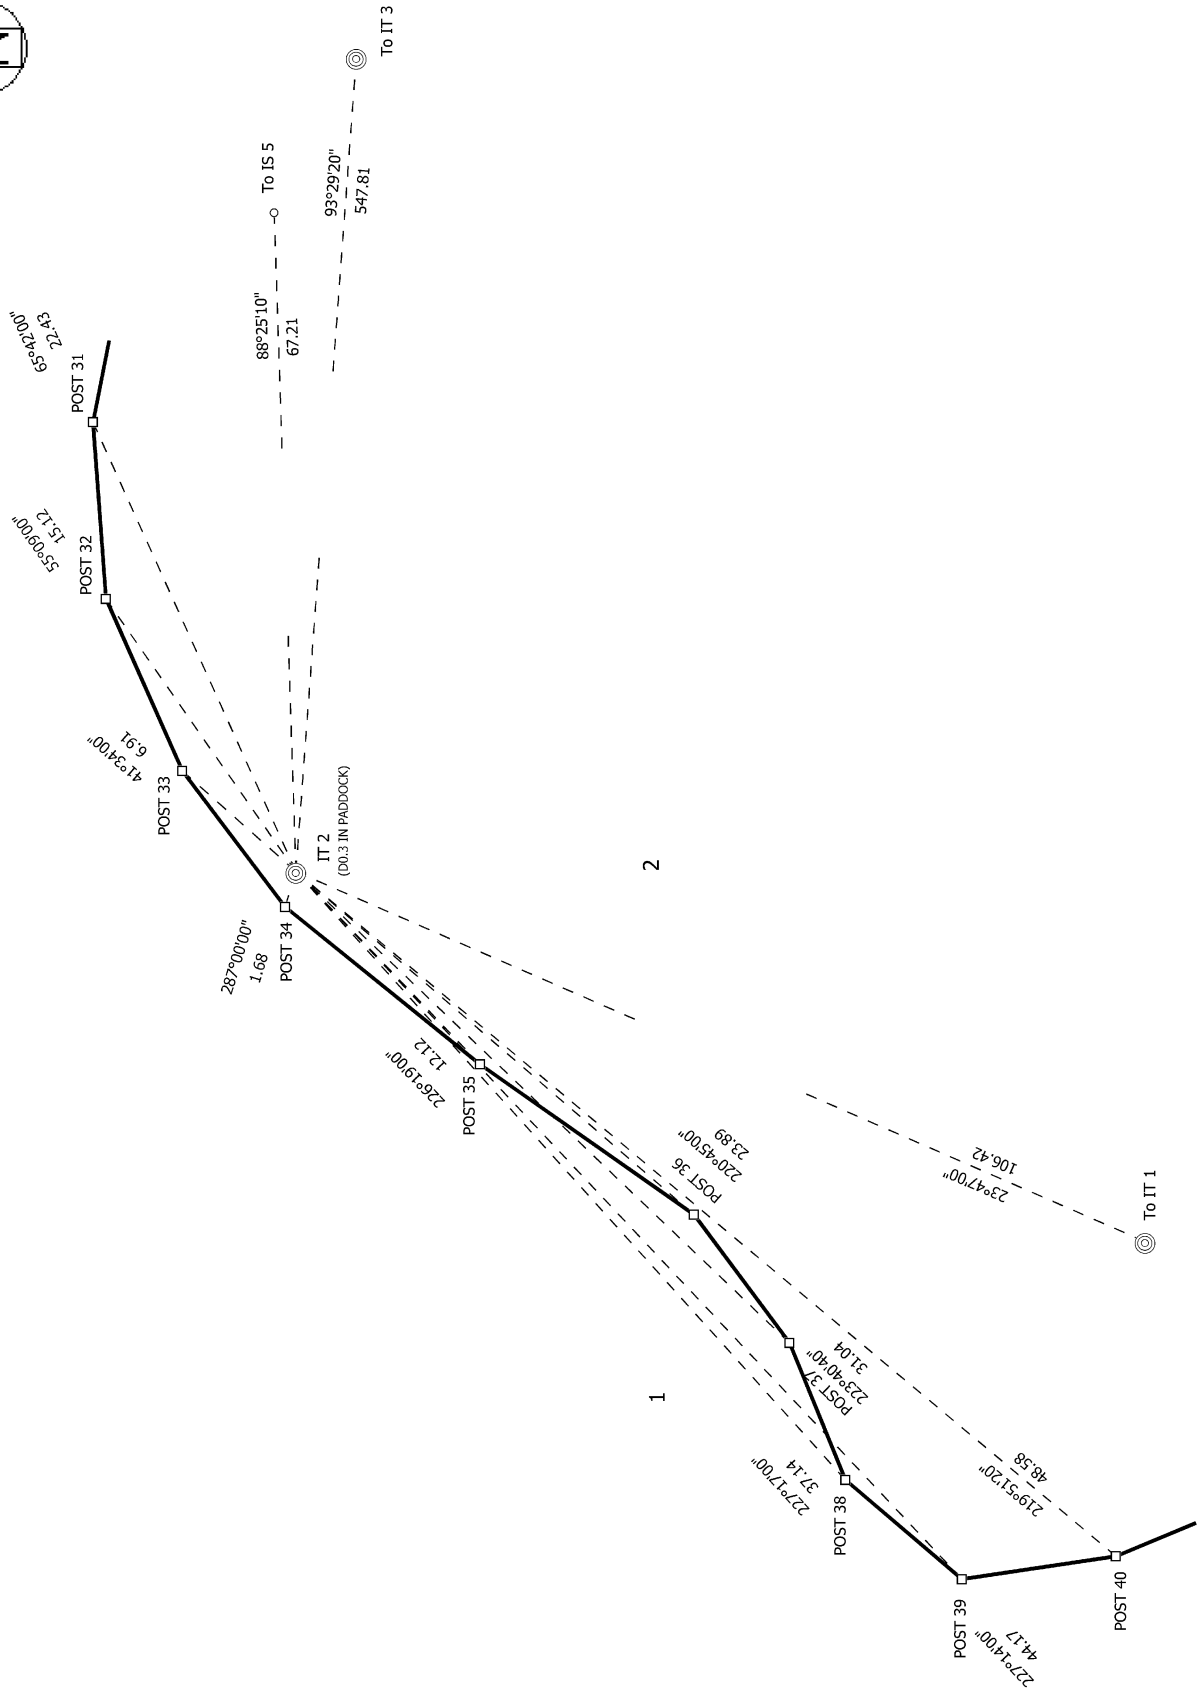

S 10/13


Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 30 of 49			

Diag. AC

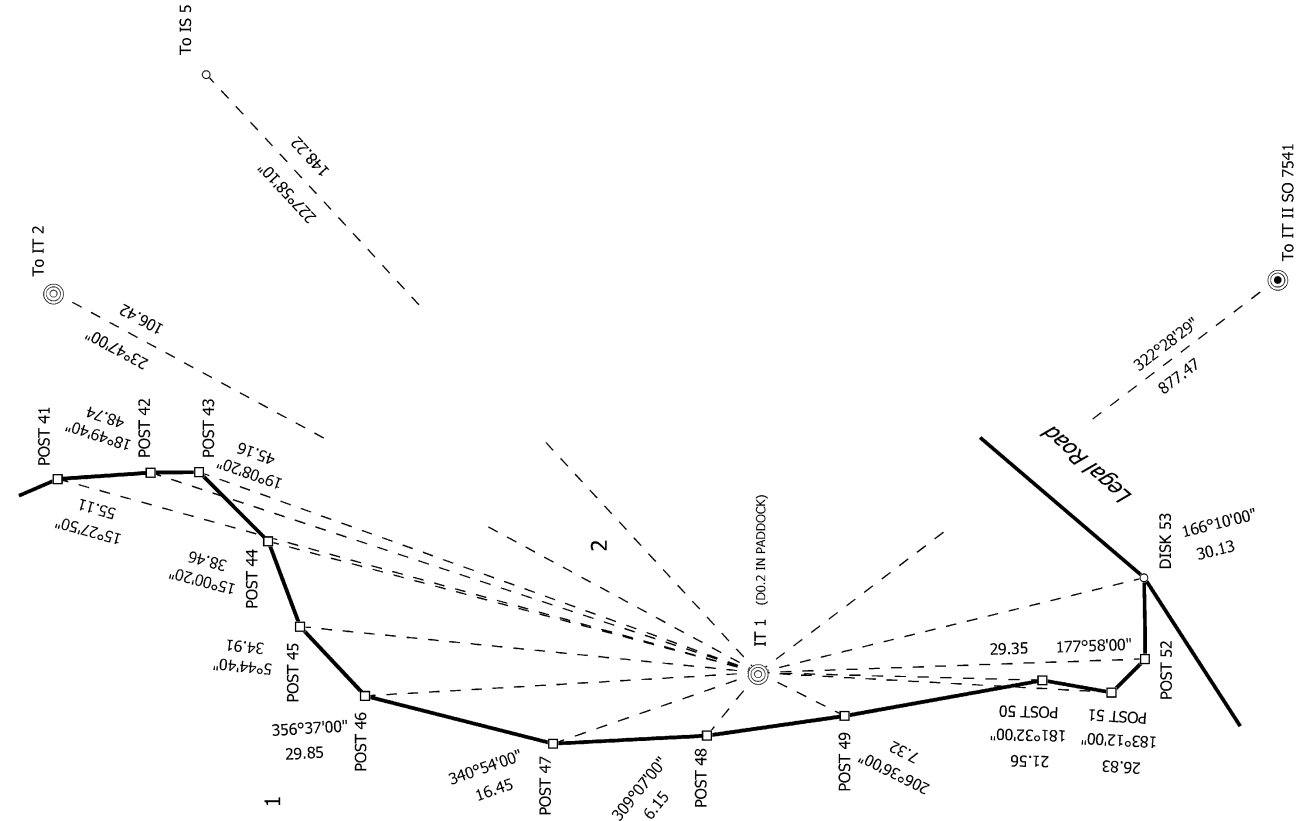


S 11/13


Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 31 of 49			




Diag. AB

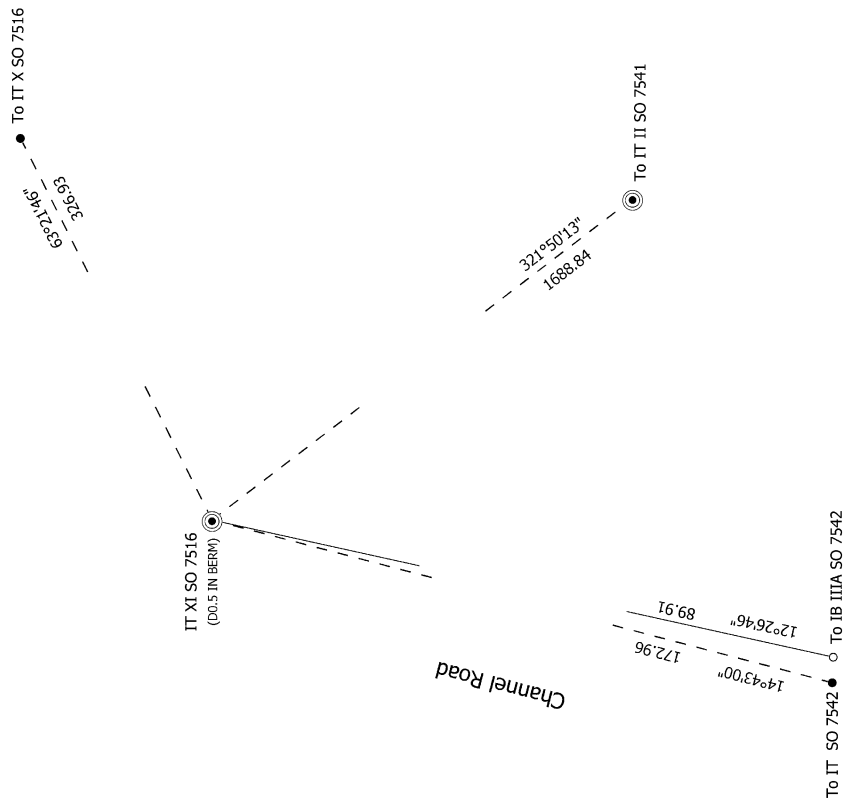

S 13/13			
Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 33 of 49			




Diag. A

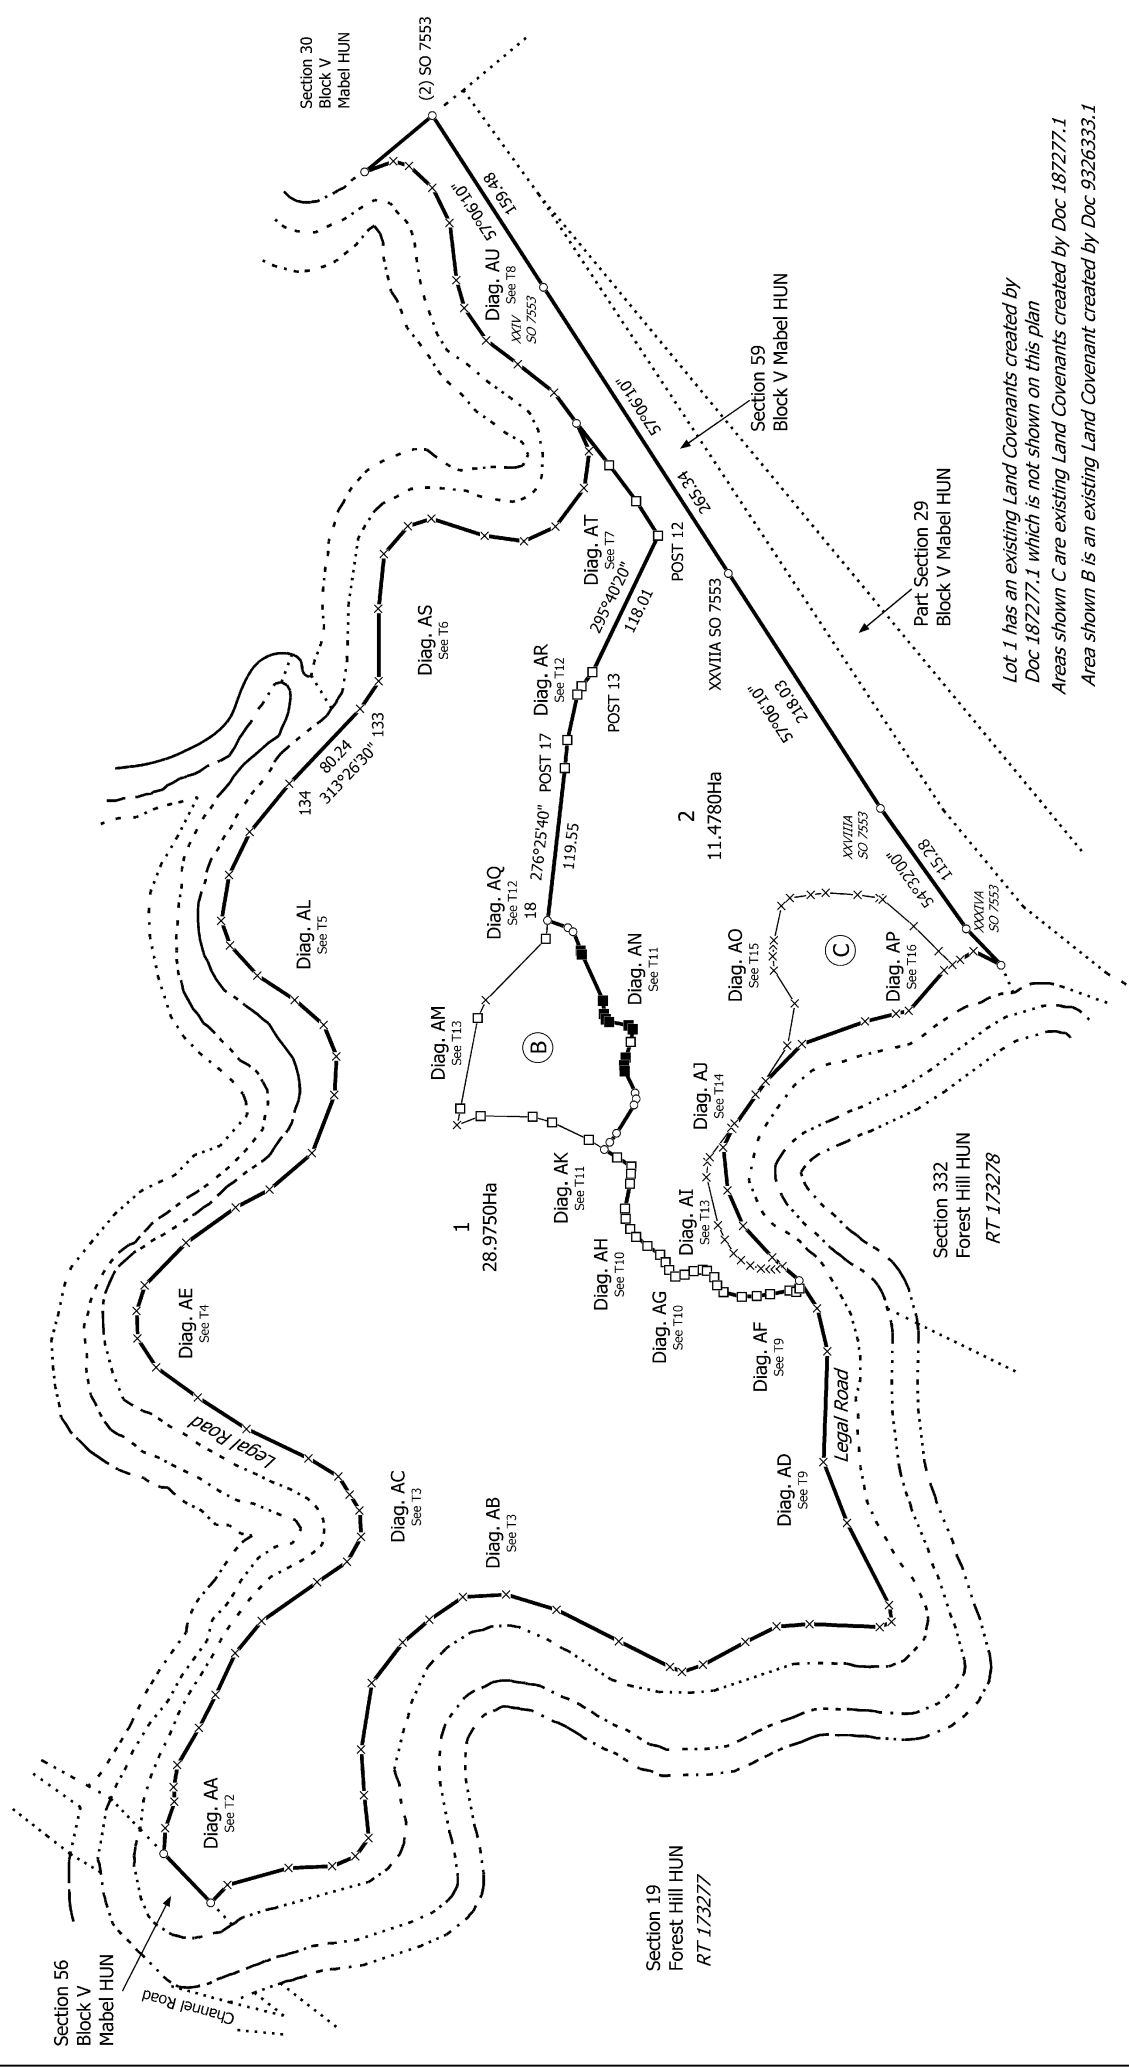


T 1/16

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 28/01/2023 12:31:01 PM Page 34 of 49			



Diag. AA

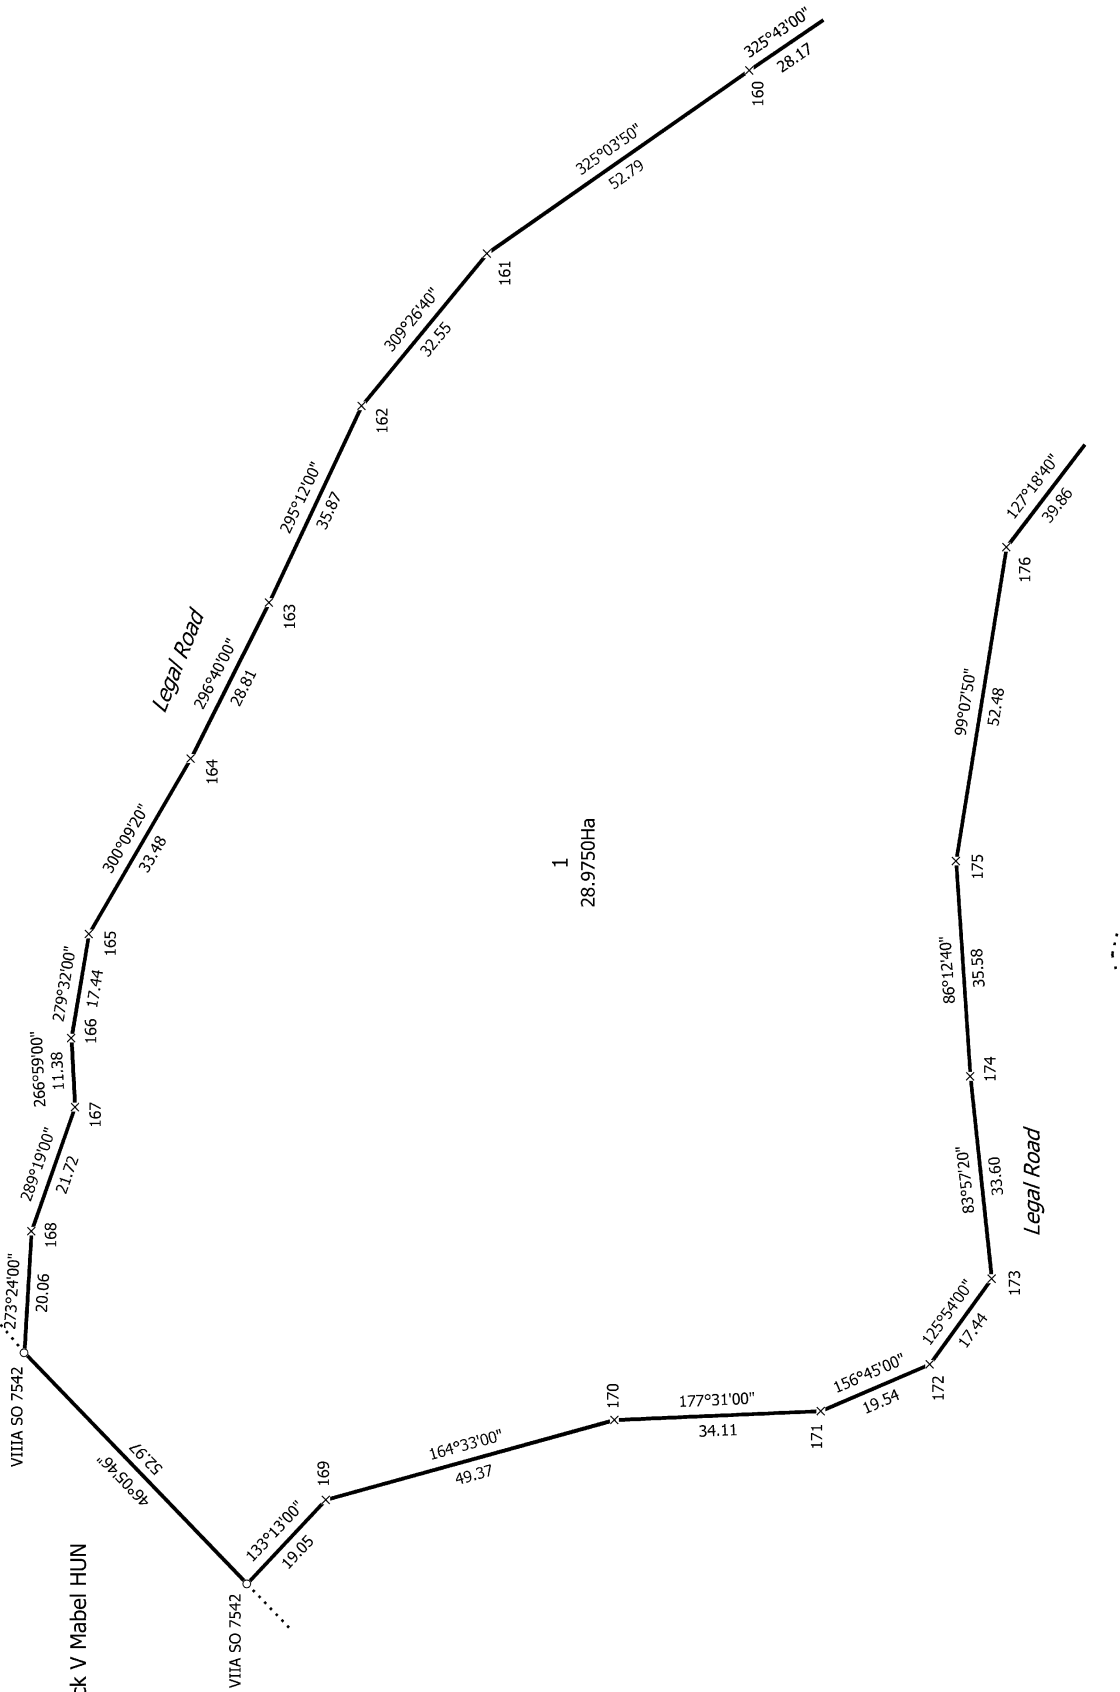


T 2/16

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 35 of 49			




Diag. AE

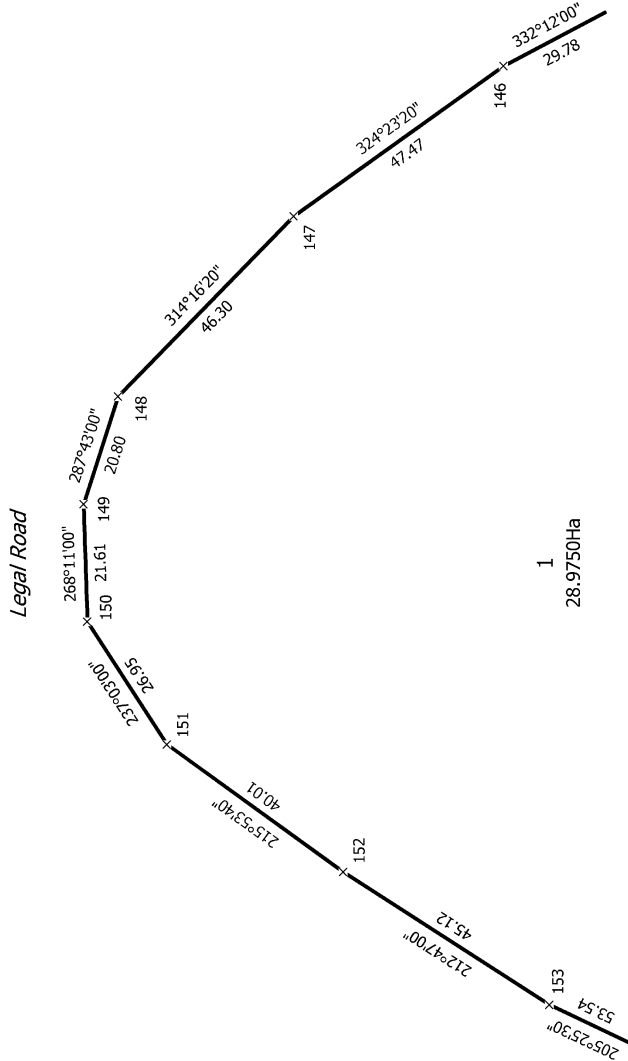


T 4/16			
Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 37 of 49			

Diag. AL

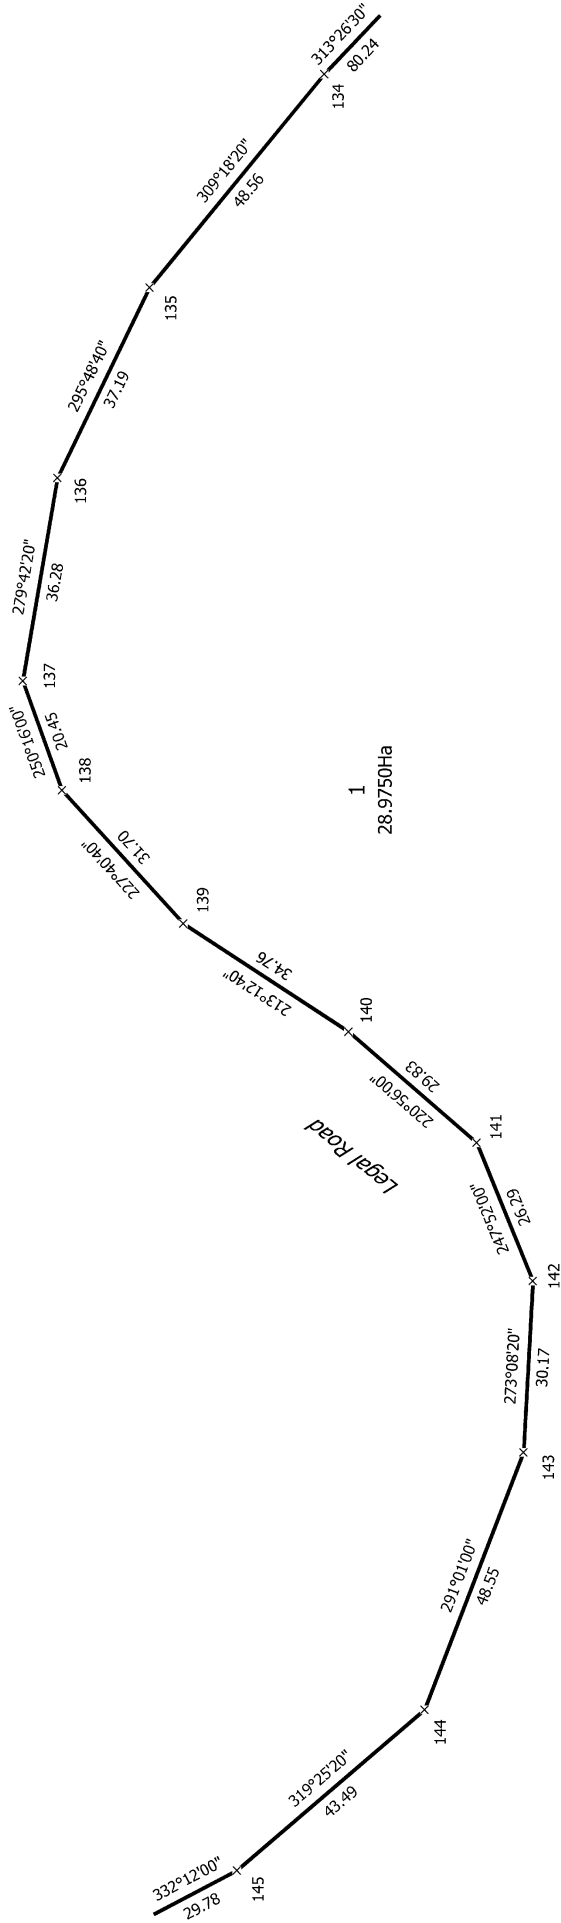


T 5/16			
Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 26/01/2023 12:31pm Page 38 of 49			


Diag. AS

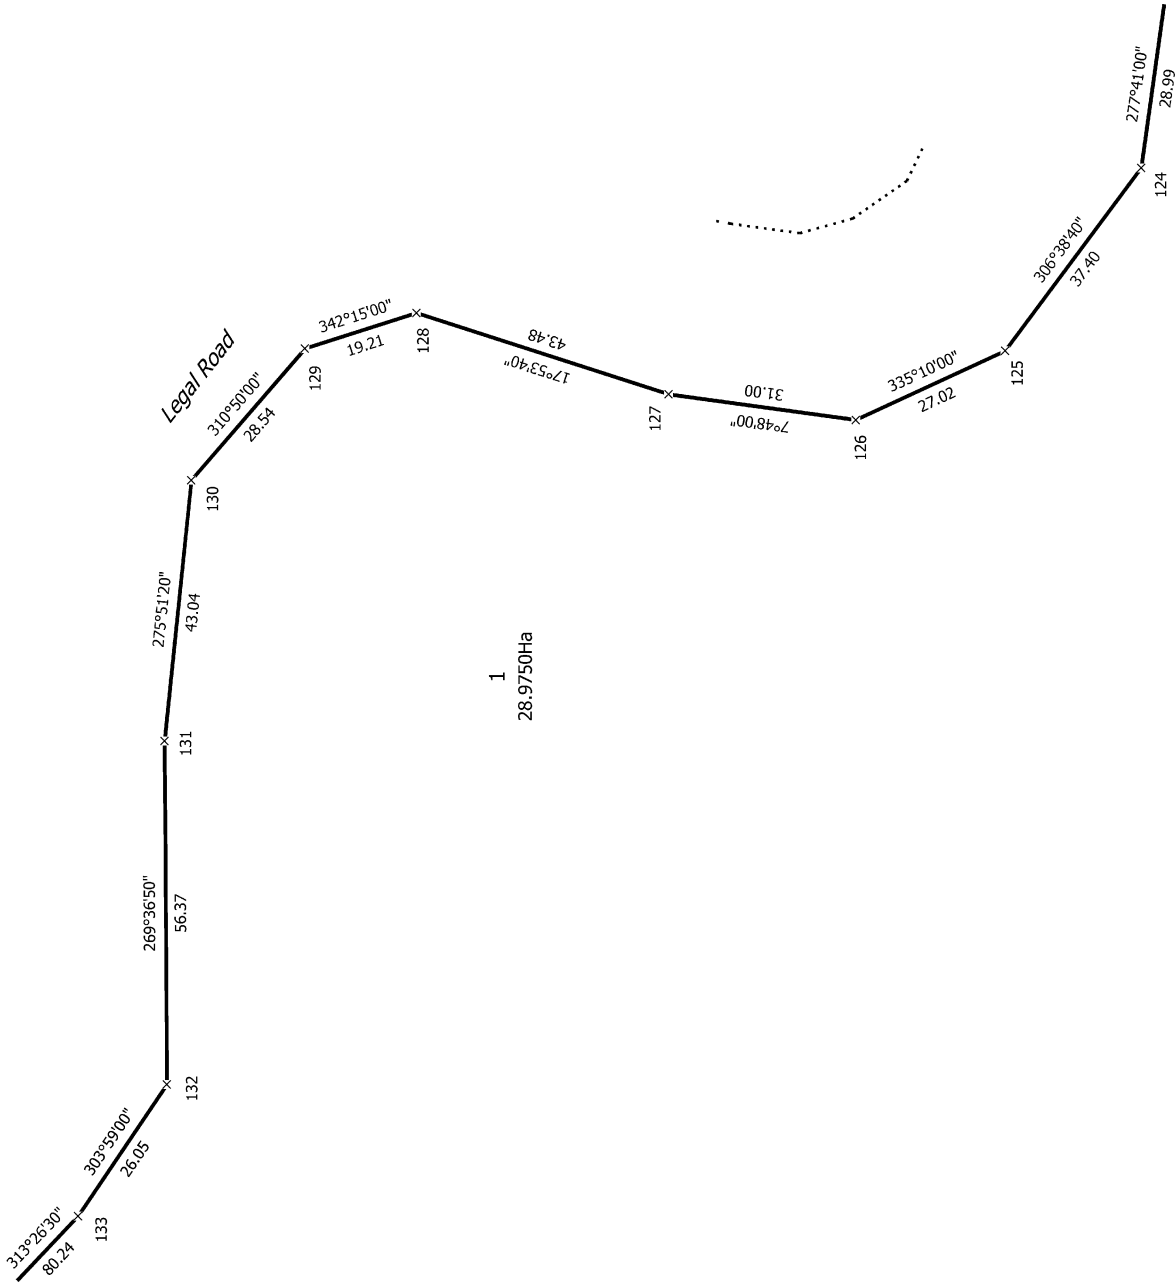

T 6/16		
Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 26/01/2023 12:31pm Page 39 of 49		
Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022		



Diag. AT

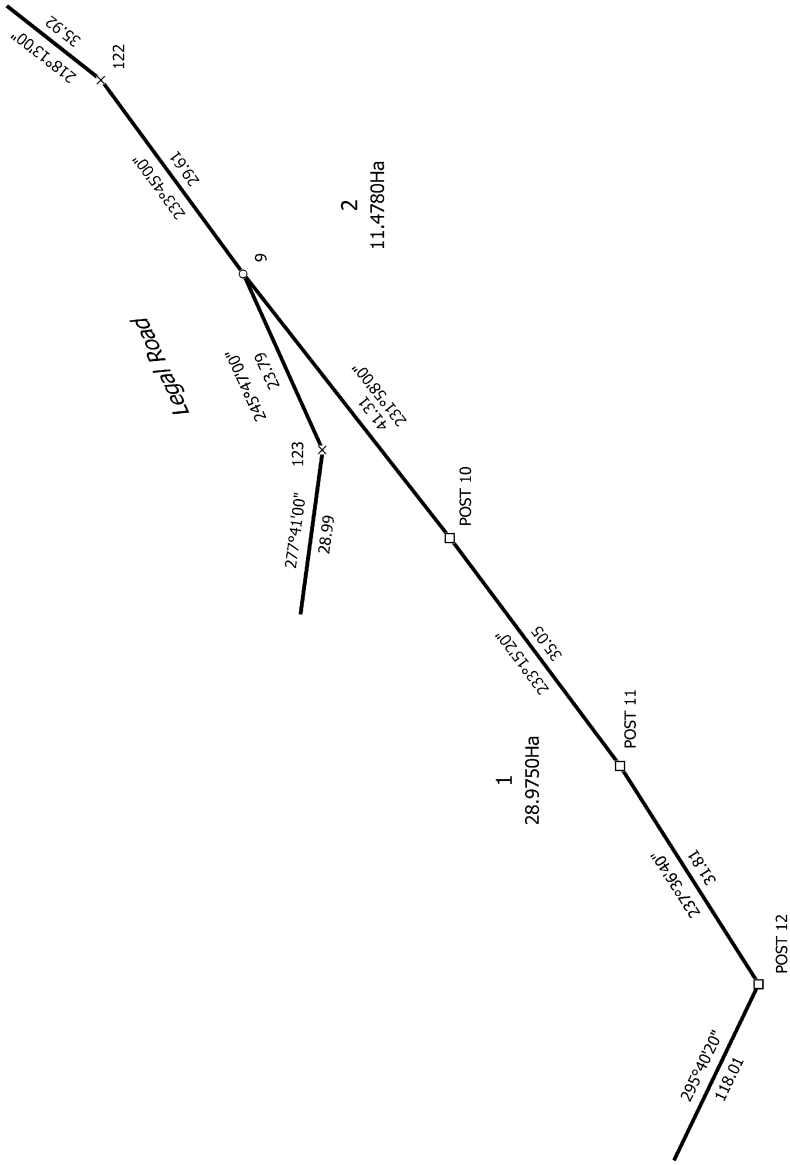

T 7/16			
Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 26/01/2023 12:31pm Page 40 of 49			



Section 30 Block V Mabel HUN

Section 59 Block V Mabel HUN

Legal Road

2
11.4780Ha

T 8/16



Land District: Southland

Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred

Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd	Record of Survey DP 582996
---	-------------------------------

Digitally Generated Plan
Generated on: 26/01/2023 12:31am Page 41 of 49

Deposited on: 1/12/2022

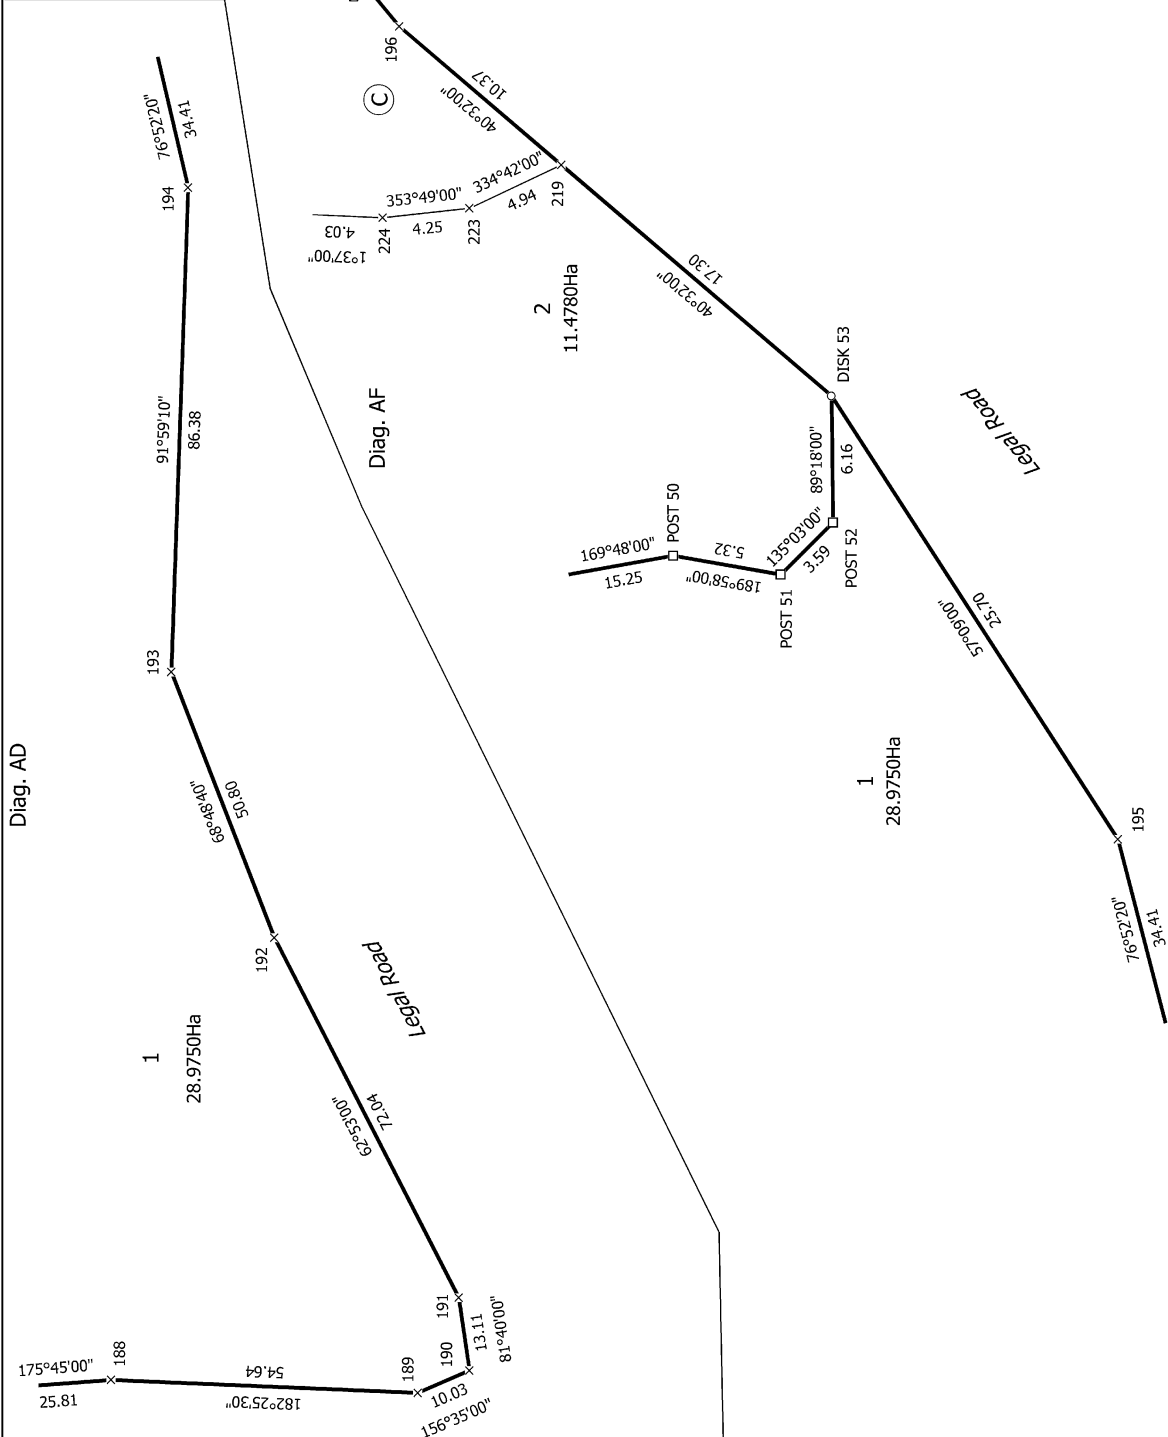



T 9/16

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Record of Survey DP 582996
Digitally Generated Plan Generated on: 28/01/2023 12:31pm Page 42 of 49	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Deposited on: 1/12/2022


Diag. AH

Diag. AG

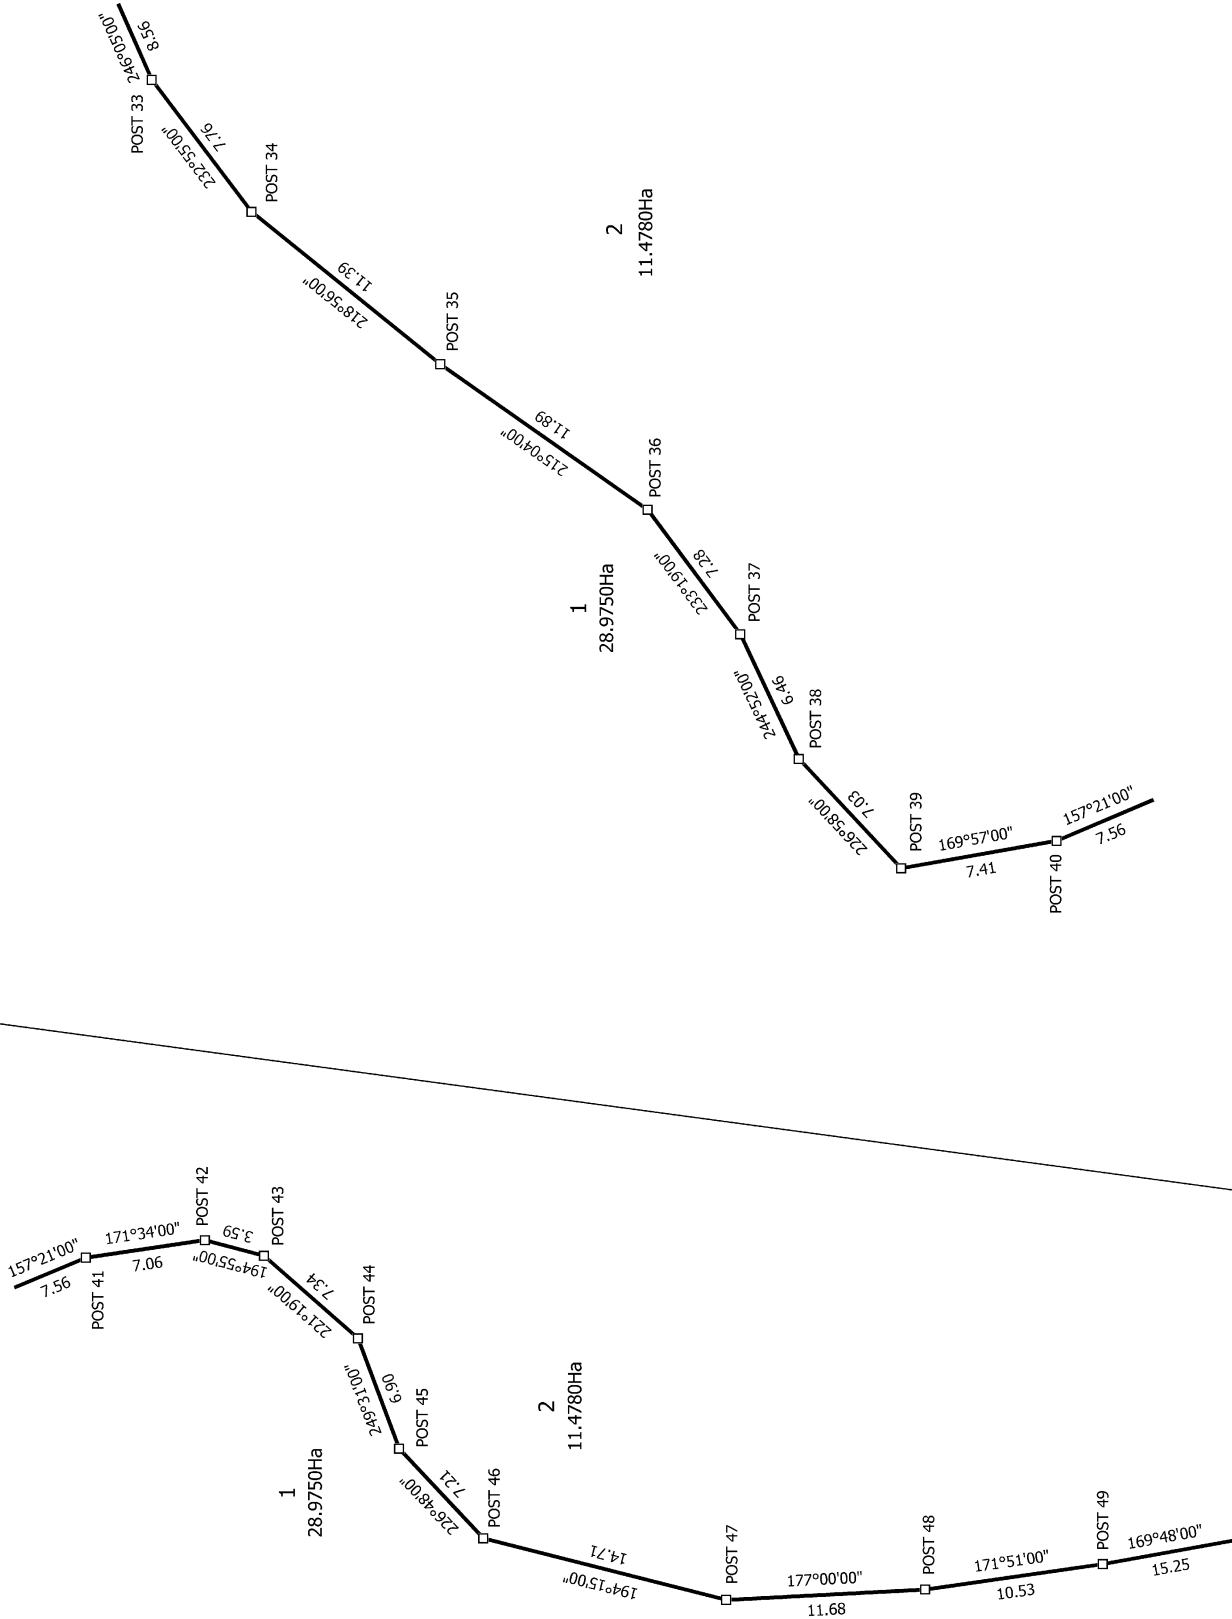


T 10/16


Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Record of Survey DP 582996
Digitally Generated Plan Generated on: 28/01/2023 12:31pm Page 43 of 49	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Deposited on: 1/12/2022



Diag. AK

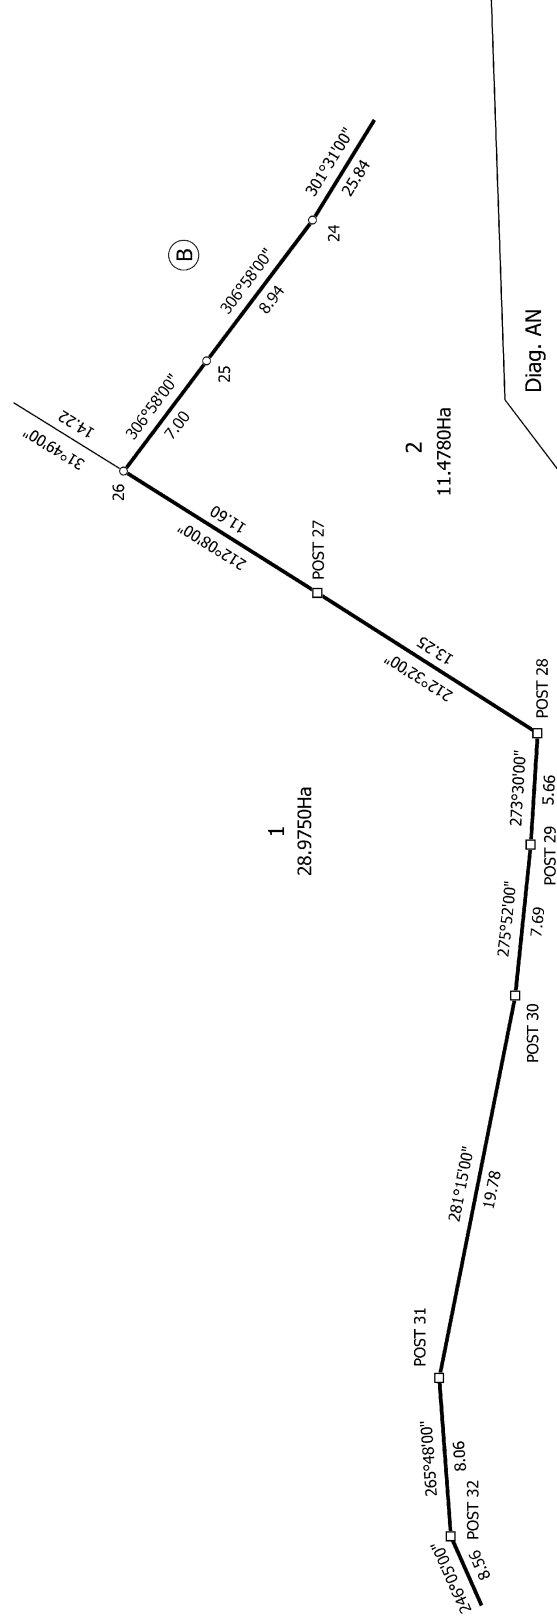


Diag. AN

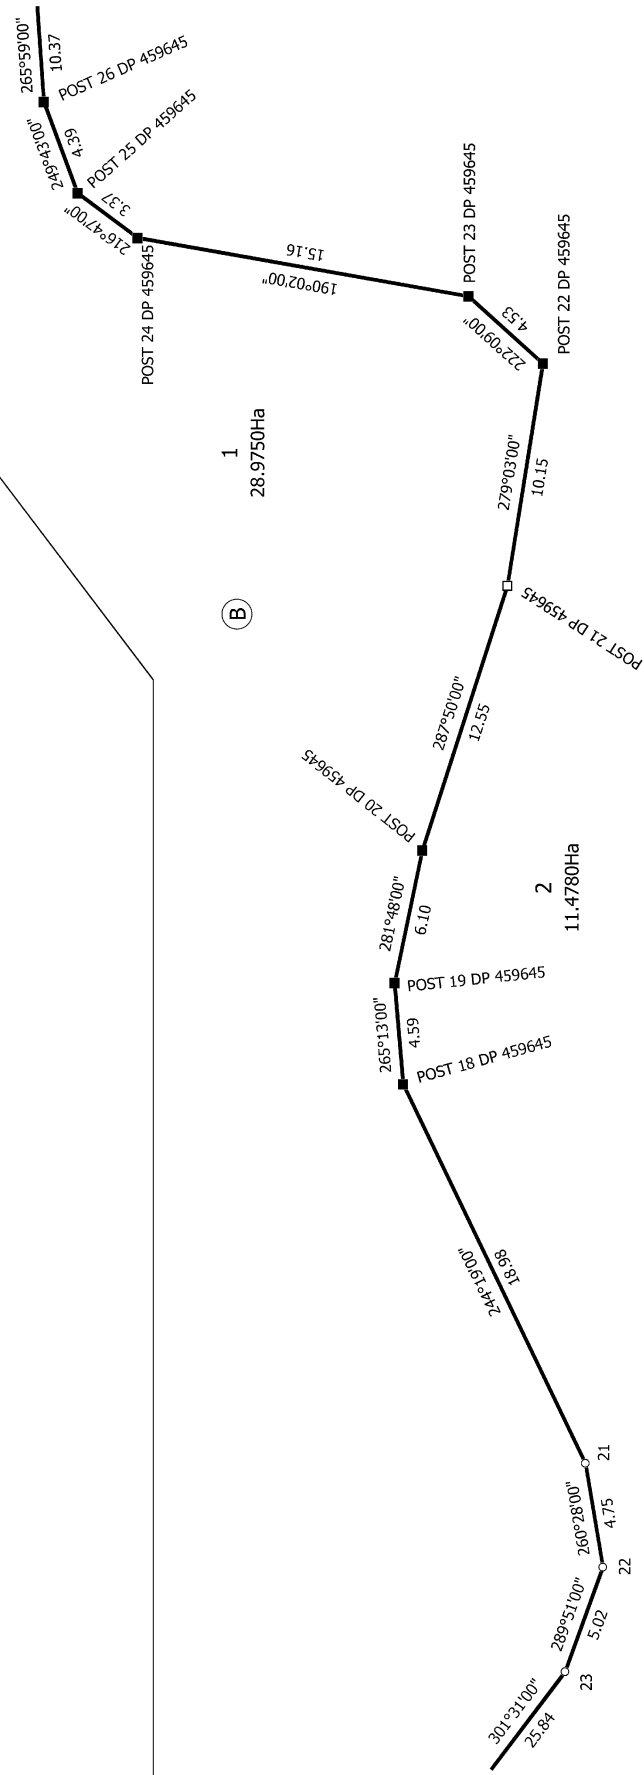


T 11/16


Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred		Record of Survey DP 582996
Digitally Generated Plan Generated on: 28/01/2023 12:31pm Page 44 of 49		Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Deposited on: 1/12/2022



Diag. AR

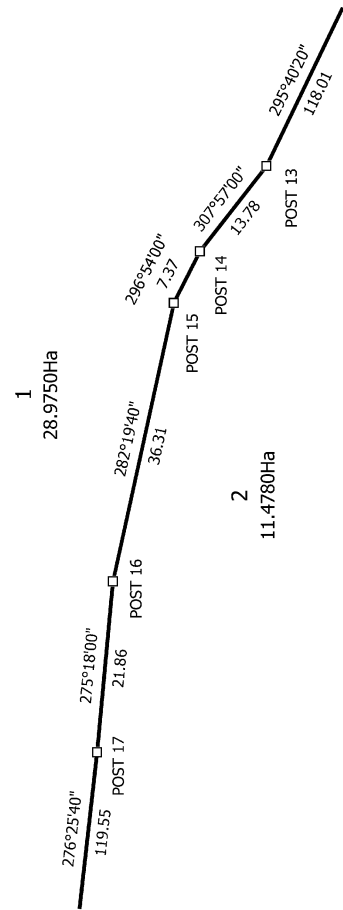

Diag. AQ

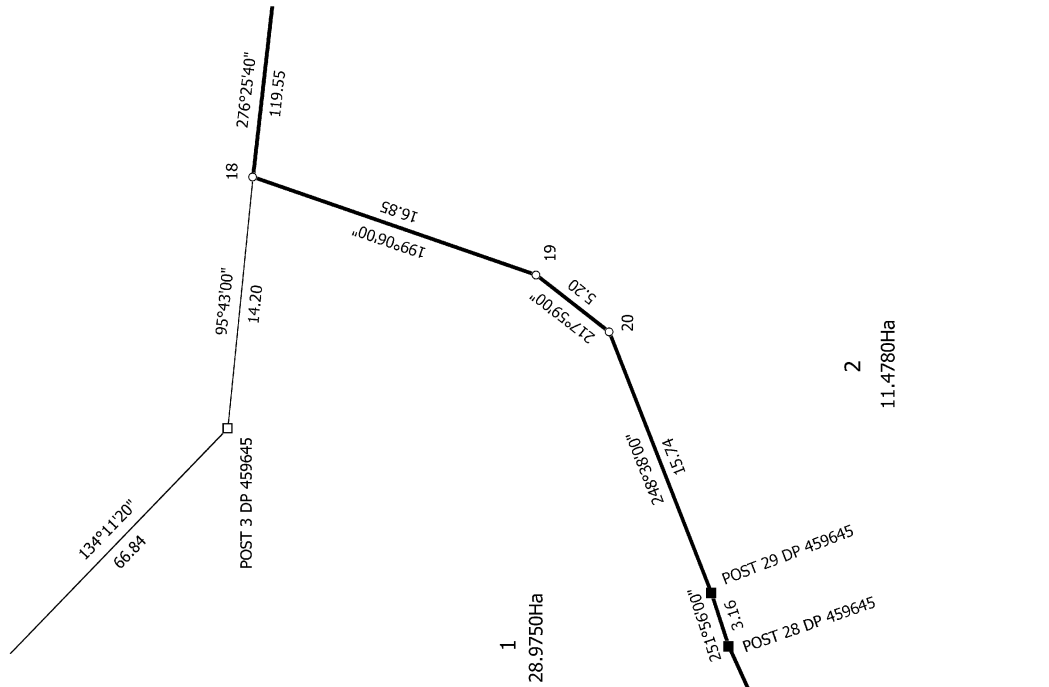

Land District: Southland

Digitally Generated Plan

Generated on: 28/01/2023 12:31pm Page 45 of 49


Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred

Surveyor: Christopher Francis Walker
Firm: Bonisch Consultants Ltd
Date of Survey: 29/09/2022

Record of Survey
DP 582996

Deposited on: 1/12/2022

T 12/16



Diag. AM

1

28.9750Ha

7 DP 459645

100°49'00"

13.18

POST 6 DP 459645

100°49'00"

71.71

POST 5 DP 459645

115°01'00"

15.35

4 DP 459645

134°11'20"

66.84

POST 8 DP 459645

100°42'38"

99.99

POST 9 DP 459645

15°48'00"

15.90

POST 10 DP 459645

25°34'00"

31.67

POST 11 DP 459645

31°49'00"

14.22

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38

228

43°11'00"

7.82

227

30°01'00"

8.46

226

15°57'00"

8.49

4.03

225

4.09

15°57'00"

8°01'00"

8°01'00"

1°37'00"

11.4780Ha

2

(C)

Diag. AI

76°31'40"

38.38

232

93°24'00"

11.98

231

64°42'00"

12.50

230

56°55'00"

12.38


228

43°11'00"


7.82

227

30°01'00




Diag. AJ

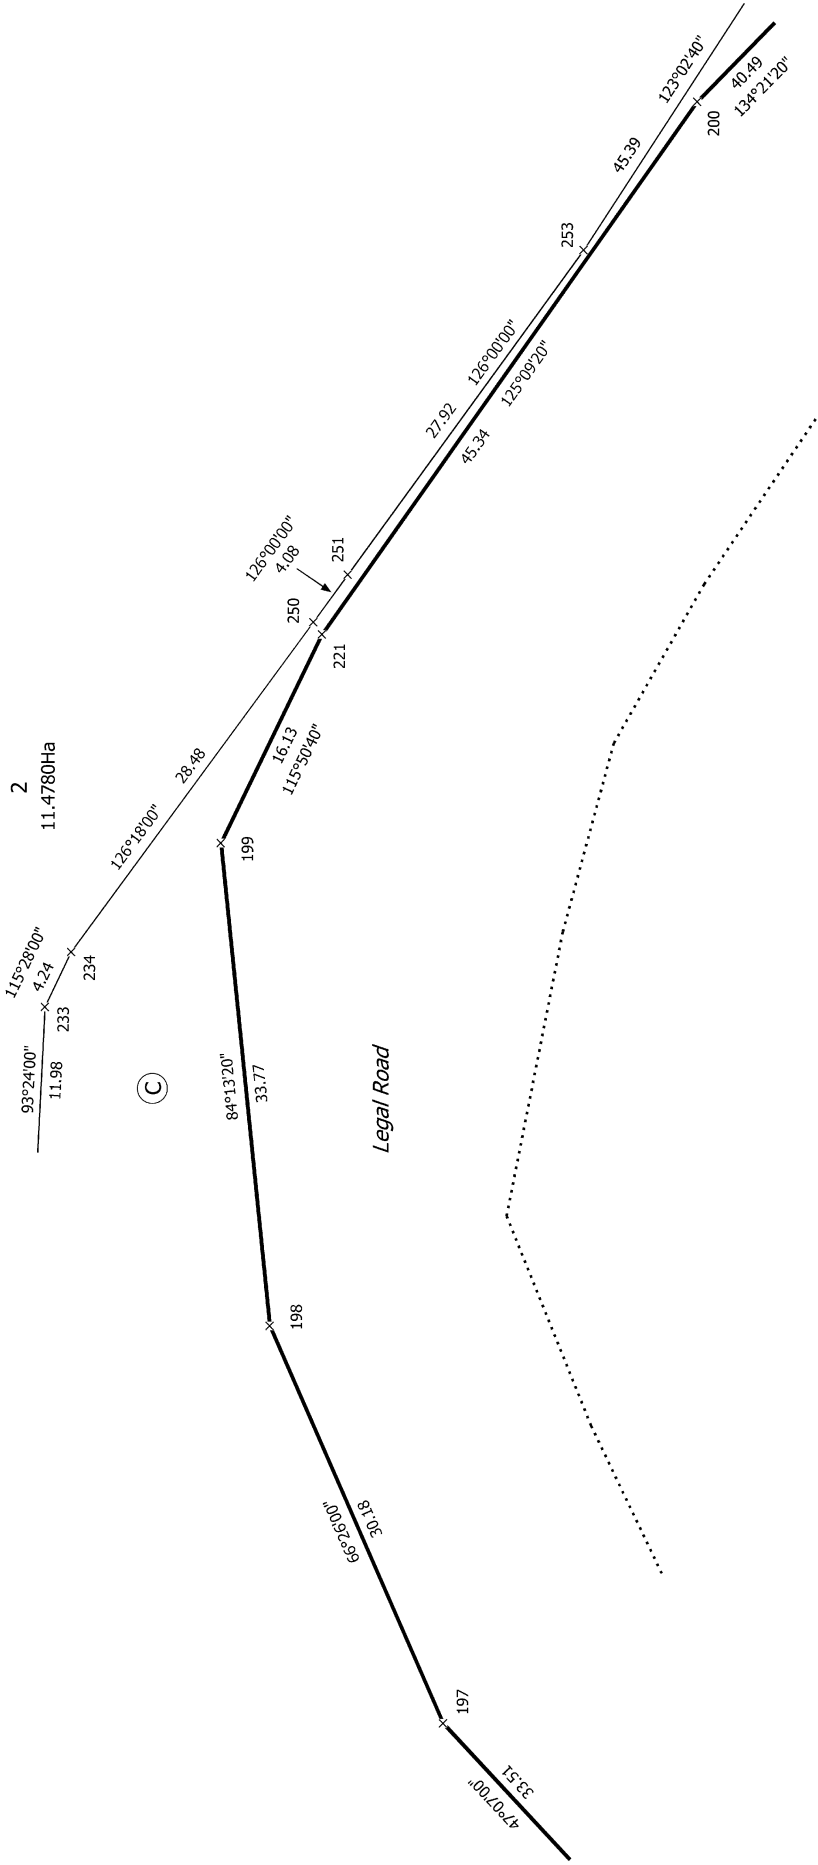

T 14/16		Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	
Land District: Southland	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022		Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 47 of 49			



Diag. AO

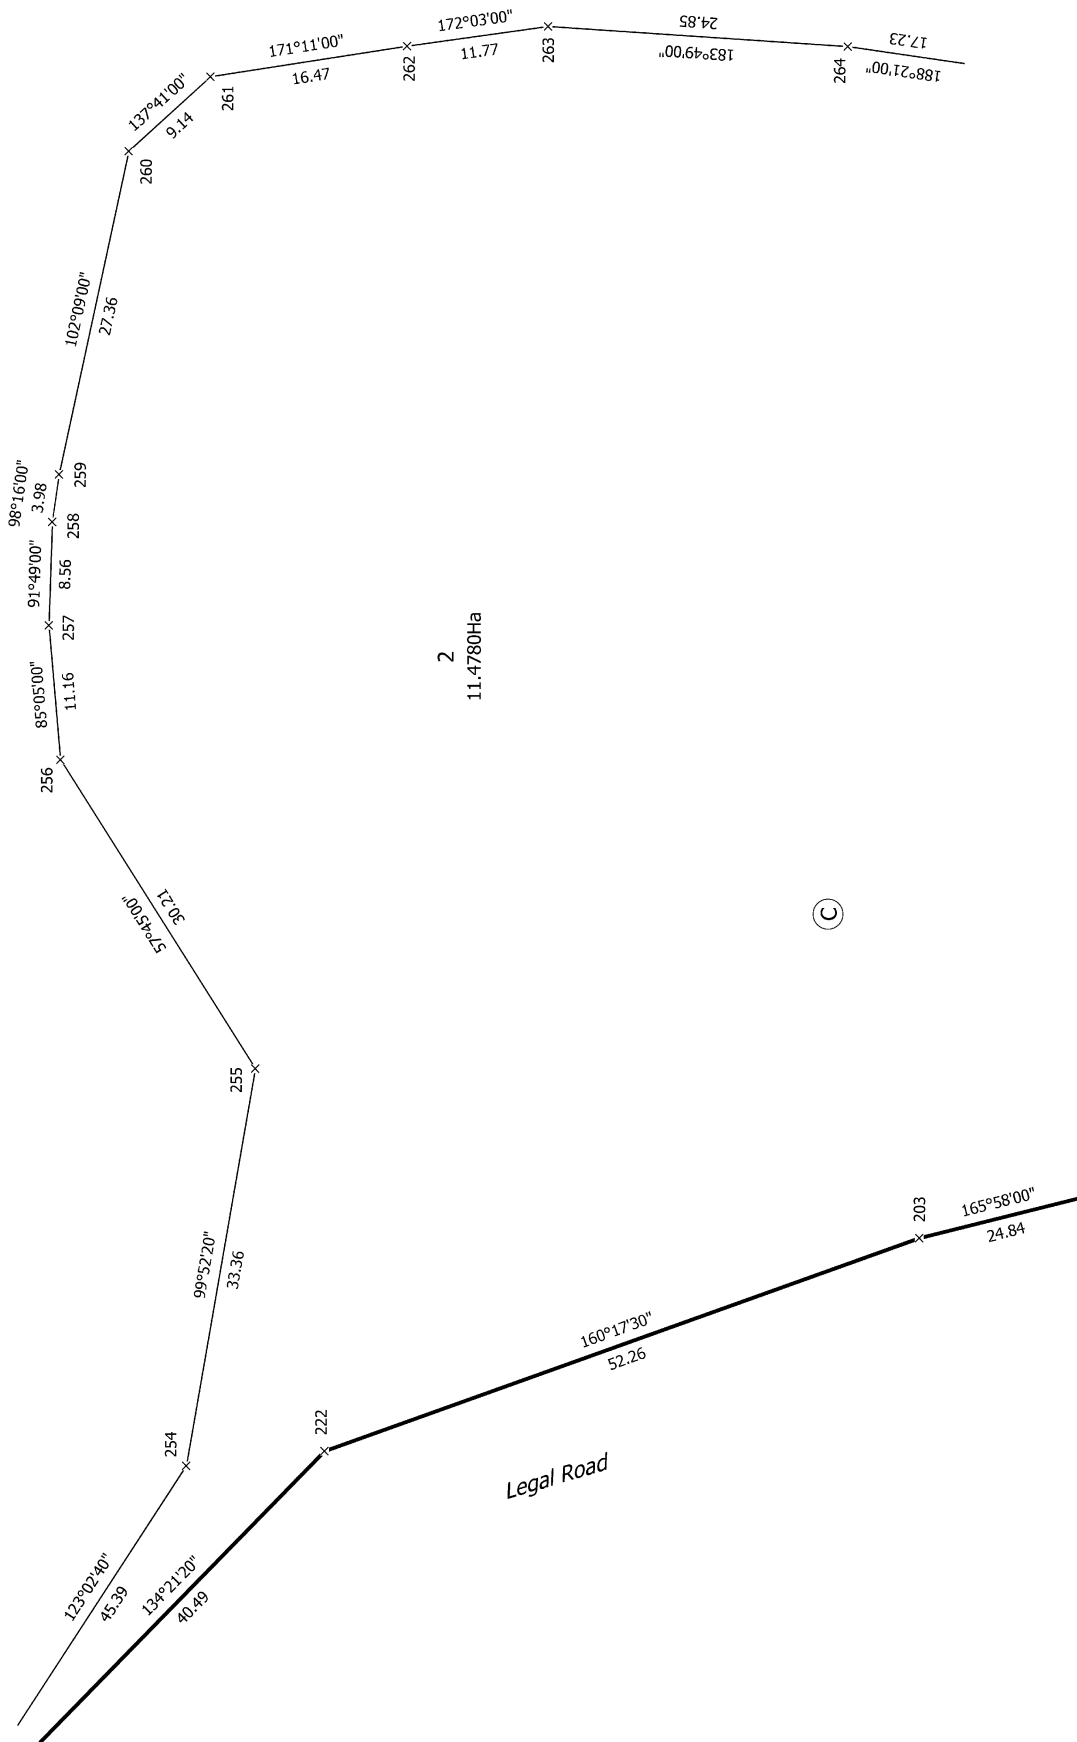


T 15/16

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 48 of 49			



Diag. AP

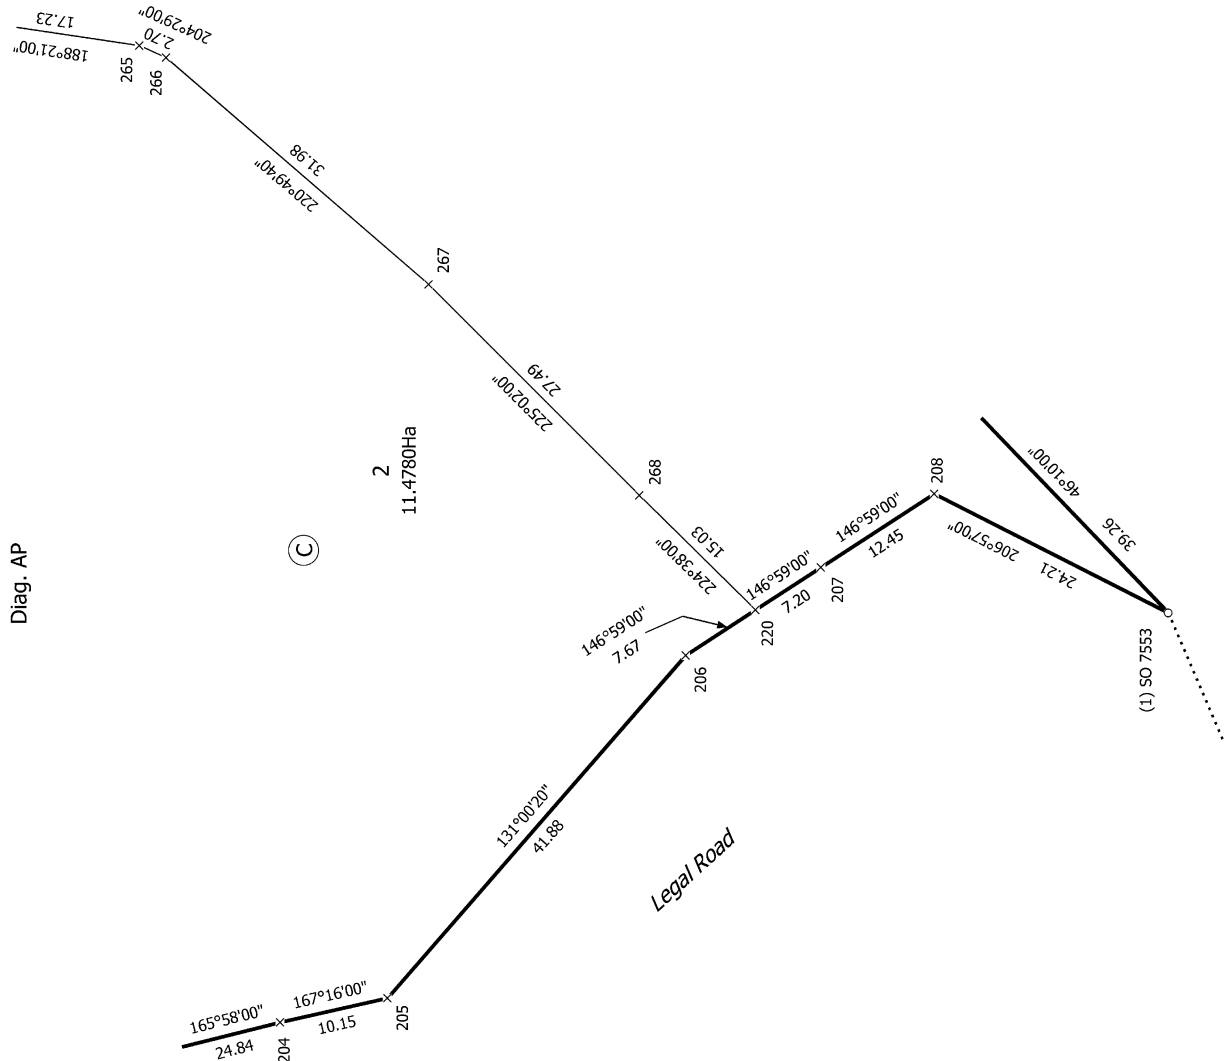

Section 59 Block V Mabel HUN

T 16/16

Land District: Southland	Lots 1 and 2 being a subdivision of Pt Section 29 Block V Mabel Hundred	Surveyor: Christopher Francis Walker Firm: Bonisch Consultants Ltd Date of Survey: 29/09/2022	Record of Survey DP 582996 Deposited on: 1/12/2022
Digitally Generated Plan Generated on: 29/01/2023 12:31pm Page 49 of 49			