

Record of Survey - SO 582611

Survey Number	SO 582611
Surveyor Reference	Findlay_Street_16, Ellerslie - Reinstatement
Surveyor	Robert James Mears
Survey Firm	Civix Limited
Surveyor Declaration	I Robert James Mears, being a licensed cadastral surveyor, certify that-- (a) this dataset provided by me and its related survey are accurate, correct and in accordance with the Cadastral Survey Act 2002 and Cadastral Survey Rules 2021; and (b) the survey was undertaken by me or under my personal direction. Declared on 27 Oct 2022 01:28 PM

Survey Details

Dataset Description	Reinstatement Survey of Section 28 Lawry Settlement		
Purpose	Complex Boundary Reinstatement		
Status	Registered	Type	Survey
Land District	North Auckland	Survey Class	Class A
Meridional Circuit	Mount Eden 2000	Vertical Datum	None

Survey Dates

Surveyed Date	15/09/2022	Certified Date	27/10/2022
Submitted Date	27/10/2022 13:28:57	Survey Approval Date	28/10/2022
Deposit Date			

Referenced Surveys

Survey Number	Land District	Bearing Correction
LT 502710	North Auckland	0°00'00"
SO 44503	North Auckland	0°00'00"
DP 55467	North Auckland	0°00'00"
DP 62244	North Auckland	0°00'00"
SO 14695	North Auckland	0°00'00"
DP 59534	North Auckland	0°00'00"
DP 335953	North Auckland	0°00'00"
DP 38647	North Auckland	0°00'00"
SO 54432	North Auckland	0°00'00"
DP 121007	North Auckland	0°00'00"
DP 14479	North Auckland	0°00'00"

Territorial Authorities

Auckland Council

Mark and Vector

Survey Number SO 582611
Meridional Circuit Mount Eden 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
NAIL 9 DP 502710	AP 1 SO 582611	ob19	307°33'30" M			70.79 M		
AP 1 SO 582611	AP 2 SO 582611	ob23	285°52'15" M			68.32 M		
AP 2 SO 582611	NAIL 9 DP 502710	ob26	116°54'30" M			136.63 M		
NAIL 9 DP 502710	4124 SO 54432	ob20	25°04'40" M			130.69 M		
NAIL 9 DP 502710	AP 13 DP 502710	ob21	116°46'10" M			133.60 M		
NAIL 9 DP 502710	AP 10 DP 502710	ob22	207°08'10" M			68.89 M		
AP 2 SO 582611	IS IV DP 335953	ob27	118°43'30" M			24.50 M		
IS IV DP 335953	NAIL 9 DP 502710	ob32	116°30'55" M			112.15 M		
IS IV DP 335953	AP 1 SO 582611	ob33	98°54'00" M			44.77 M		
AP 2 SO 582611	IB 107 SO 582611	ob28	68°31'00" M			3.47 M		
IB 107 SO 582611	AP 1 SO 582611	ob35	107°43'00" M			65.60 M		
IS IV DP 335953	IB III SO 44503	ob34	305°39'00" A	DP 335953	0°00'00"	22.45 A	DP 335953	
IB III SO 44503	IB 107 SO 582611	ob36	197°47'00" C			0.04 C		
AP 2 SO 582611	LP IV DP 60778	ob29	329°40'00" M			55.62 M		
LP IV DP 60778	IB III SO 44503	ob39	146°06'40" A	DP 335953	0°00'00"	56.23 A	DP 335953	
IB III SO 44503	CP III DP 177897	ob37	319°31'00" A	DP 335953	0°00'00"	4.28 A	DP 335953	
CP III DP 177897	IS II DP 335953	ob0	23°50'30" A	DP 335953	0°00'00"	60.79 A	DP 335953	
IS II DP 335953	IT V DP 62244	ob1	116°16'00" A	DP 335953	0°00'00"	26.89 A	DP 335953	
IT V DP 62244	IT III DP 335953	ob2	120°54'00" A	DP 335953	0°00'00"	9.07 A	DP 335953	
IT III DP 335953	IS IV DP 335953	ob4	212°37'00" A	DP 335953	0°00'00"	65.77 A	DP 335953	
IB III SO 44503	IS VI DP 59534	ob38	109°28'50" A	DP 121007	0°00'00"	70.80 A	DP 121007	
IS VI DP 59534	PEG (10) DP 59534	ob5	64°11'00" A	DP 59534	0°00'00"	9.05 A	DP 59534	
PEG (10) DP 59534	DISK 11 SO 582611	ob6	296°42'00" A	SO 14695	0°00'00"	14.08 A	SO 14695	
DISK 11 SO 582611	PEG (12) SO 14695	ob7	296°42'00" A	SO 14695	0°00'00"	12.08 A	SO 14695	
PEG (12) SO 14695	PEG (13) SO 14695	ob8	296°42'00" A	SO 14695	0°00'00"	12.07 A	SO 14695	
PEG (13) SO 14695	AD (110) DP 335953	ob10	296°42'00" A	SO 14695	0°00'00"	13.87 A	SO 14695	
IT V DP 62244	MARK (15) DP 14479	ob3	70°36'00" A	DP 335953	0°00'00"	5.31 A	DP 335953	
MARK (15) DP 14479	AD (16) DP 335953	ob11	206°42'00" A	DP 14479	0°00'00"	0.10 A	DP 335953	

Mark and Vector

Survey Number SO 582611

Meridional Circuit Mount Eden 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
AD (16) DP 335953	PEG (17) DP 335953	ob12	206°42'00"	A DP 14479	0°00'00"	16.31	A DP 335953	
PEG (17) DP 335953	AD (110) DP 335953	ob13	206°42'00"	A DP 14479	0°00'00"	33.94	A DP 335953	
PEG (32) SO 14695	PEG (33) SO 14695	ob14	296°37'40"	A DP 62244	0°00'00"	12.07	A SO 14695	
PEG (33) SO 14695	MARK (15) DP 14479	ob16	296°37'40"	A DP 62244	0°00'00"	13.87	A SO 14695	
PEG (32) SO 14695	PEG (34) DP 55467	ob15	116°37'40"	A DP 62244	0°00'00"	5.21	C	
PEG (34) DP 55467	PEG 35 SO 582611	ob17	116°38'00"	A DP 55467	0°00'00"	6.87	C	
PEG 35 SO 582611	DISK 11 SO 582611	ob18	206°42'00"	R SO 14695	0°00'00"	50.38	R	Class A
AP 2 SO 582611	AD (110) DP 335953	ob30	80°53'00"	M		31.95	M	
AD (110) DP 335953	IB III SO 44503	ob40	262°28'00"	A DP 335953	0°00'00"	28.54	A DP 335953	
AP 1 SO 582611	DISK 11 SO 582611	ob24	358°19'00"	M		6.66	M	
AP 1 SO 582611	PEG 35 SO 582611	ob25	23°29'00"	M		56.33	M	
4124 SO 54432	IS II DP 38647	ob31	21°51'00"	A SO 54432	0°00'00"	33.65	A SO 54432	
IS II DP 38647	IB I DP 30182	ob41	203°29'00"	A DP 38647	0°00'00"	50.34	A DP 38647	
IB I DP 30182	IS II DP 55467	ob42	293°33'11"	A DP 55467	0°00'00"	77.00	A DP 55467	
IS II DP 55467	IS III DP 55467	ob43	197°34'30"	A DP 55467	0°00'00"	34.66	A DP 55467	
IS III DP 55467	PEG (34) DP 55467	ob44	243°56'00"	A DP 55467	0°00'00"	7.41	A DP 55467	


Mark Name	Mark Condition	Description
4124 SO 54432		This mark is used for deformation monitoring, do not alter the ground mark in any way. L&S bronze plaque set in concrete block.
AD (110) DP 335953		In concrete wall.
AD (16) DP 335953		In concrete footing to concrete post (+50 yrs).
AP 10 DP 502710		Aluminium Plug in concrete footpath
AP 13 DP 502710		Aluminium Plug in Concrete footpath
CP III DP 177897		Copper plug
DISK 11 SO 582611		PEG SO 14695 reinstated.
IB 107 SO 582611		IB III SO 44503 disturbed
IS IV DP 335953		In seal at back of footpath.
NAIL 9 DP 502710		Nail in concrete footpath

Mark and Vector

Survey Number SO 582611
Meridional Circuit Mount Eden 2000

Mark Name	Mark Condition	Description
PEG 35 SO 582611		Old peg - no record.

*** End of Report ***

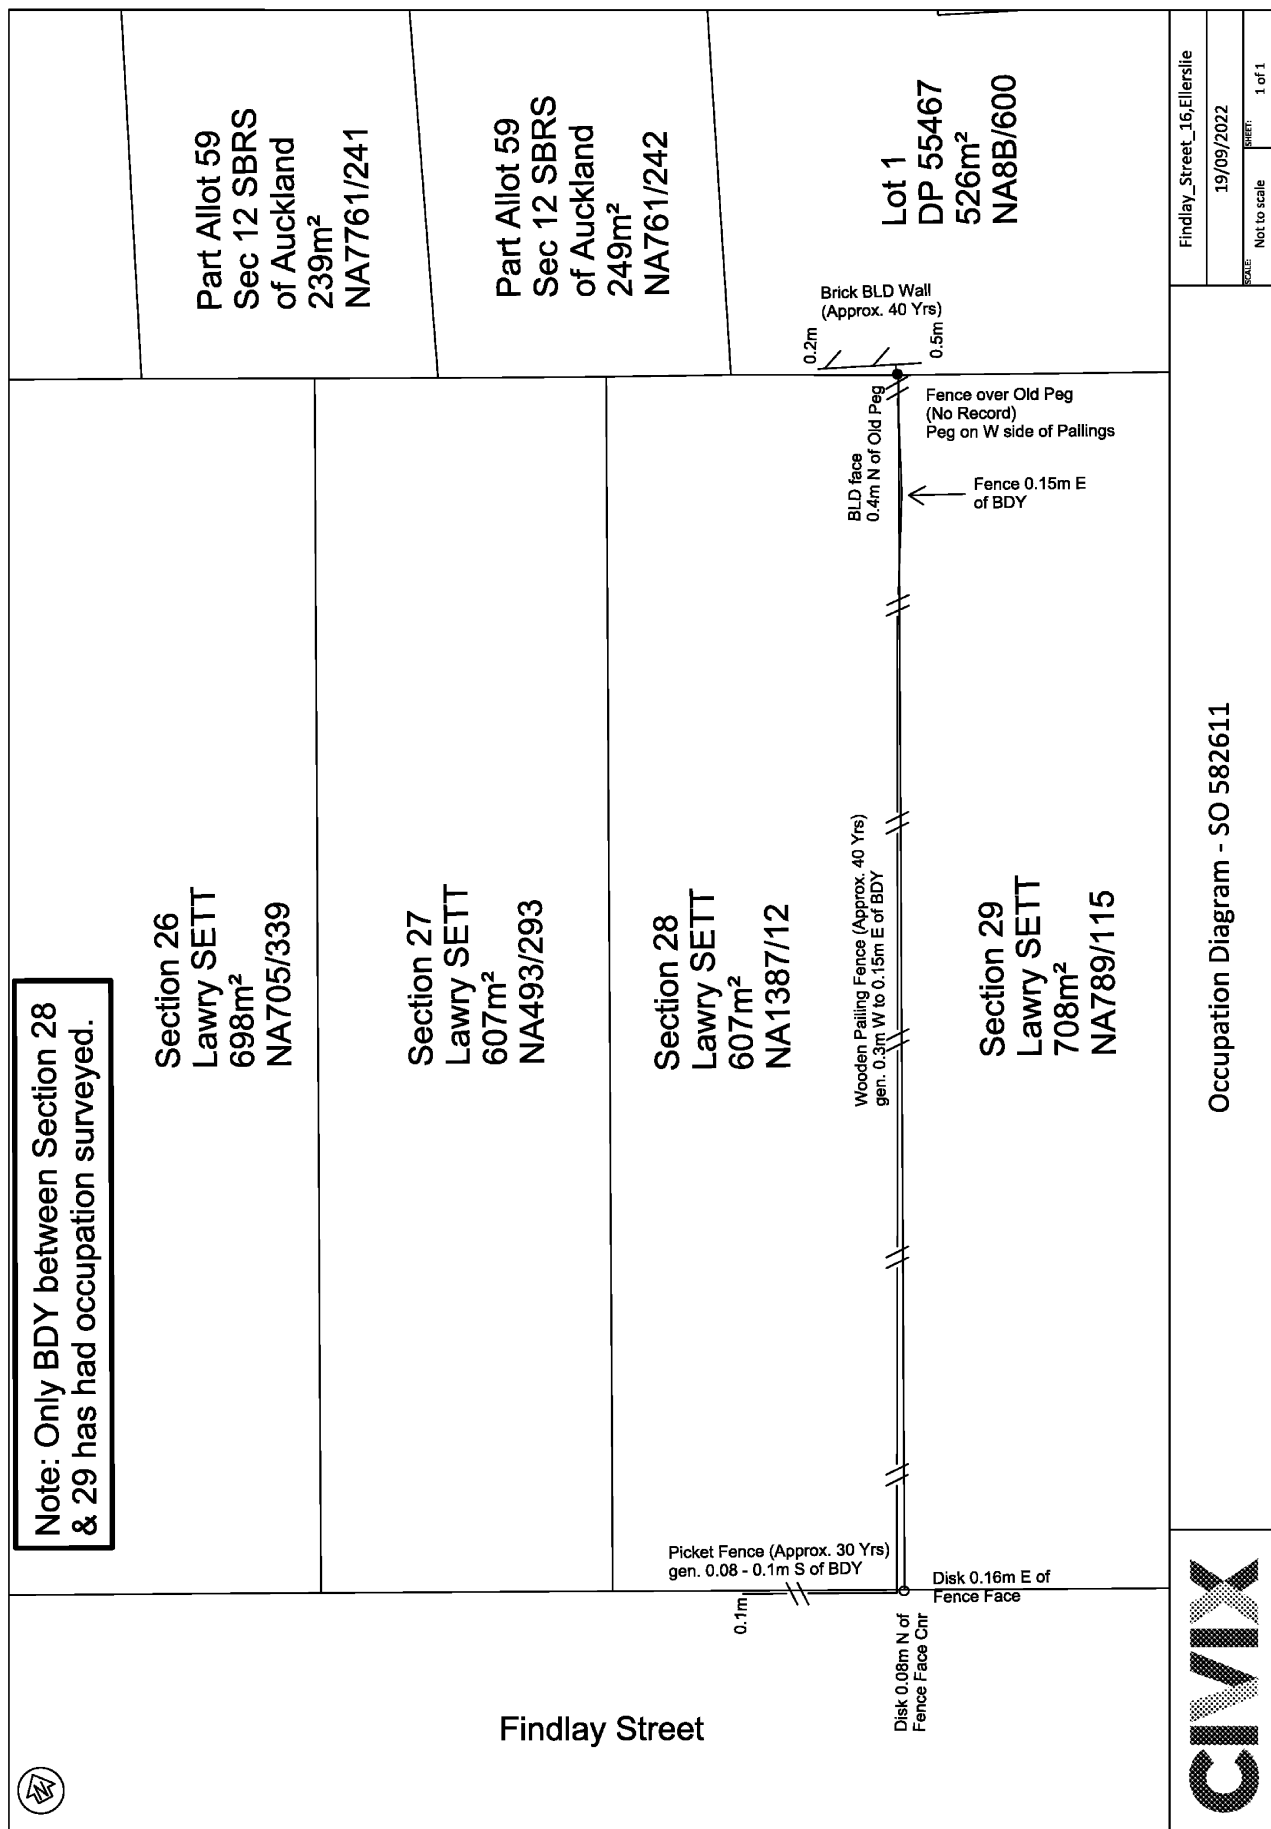



S 1/4

Land District: North Auckland

Digitally Generated Plan

Digitally Generated File
Generated on: 28/10/2022 07:35am Page 6 of 9


Reinstatement Survey of Section 28 Lawry Settlement


Surveyor: Robert James Mears

Firm: Civix Limited


Date of Survey: 15/09/2022

Record of Survey
SO 582611
Approved on: 28/10/2022

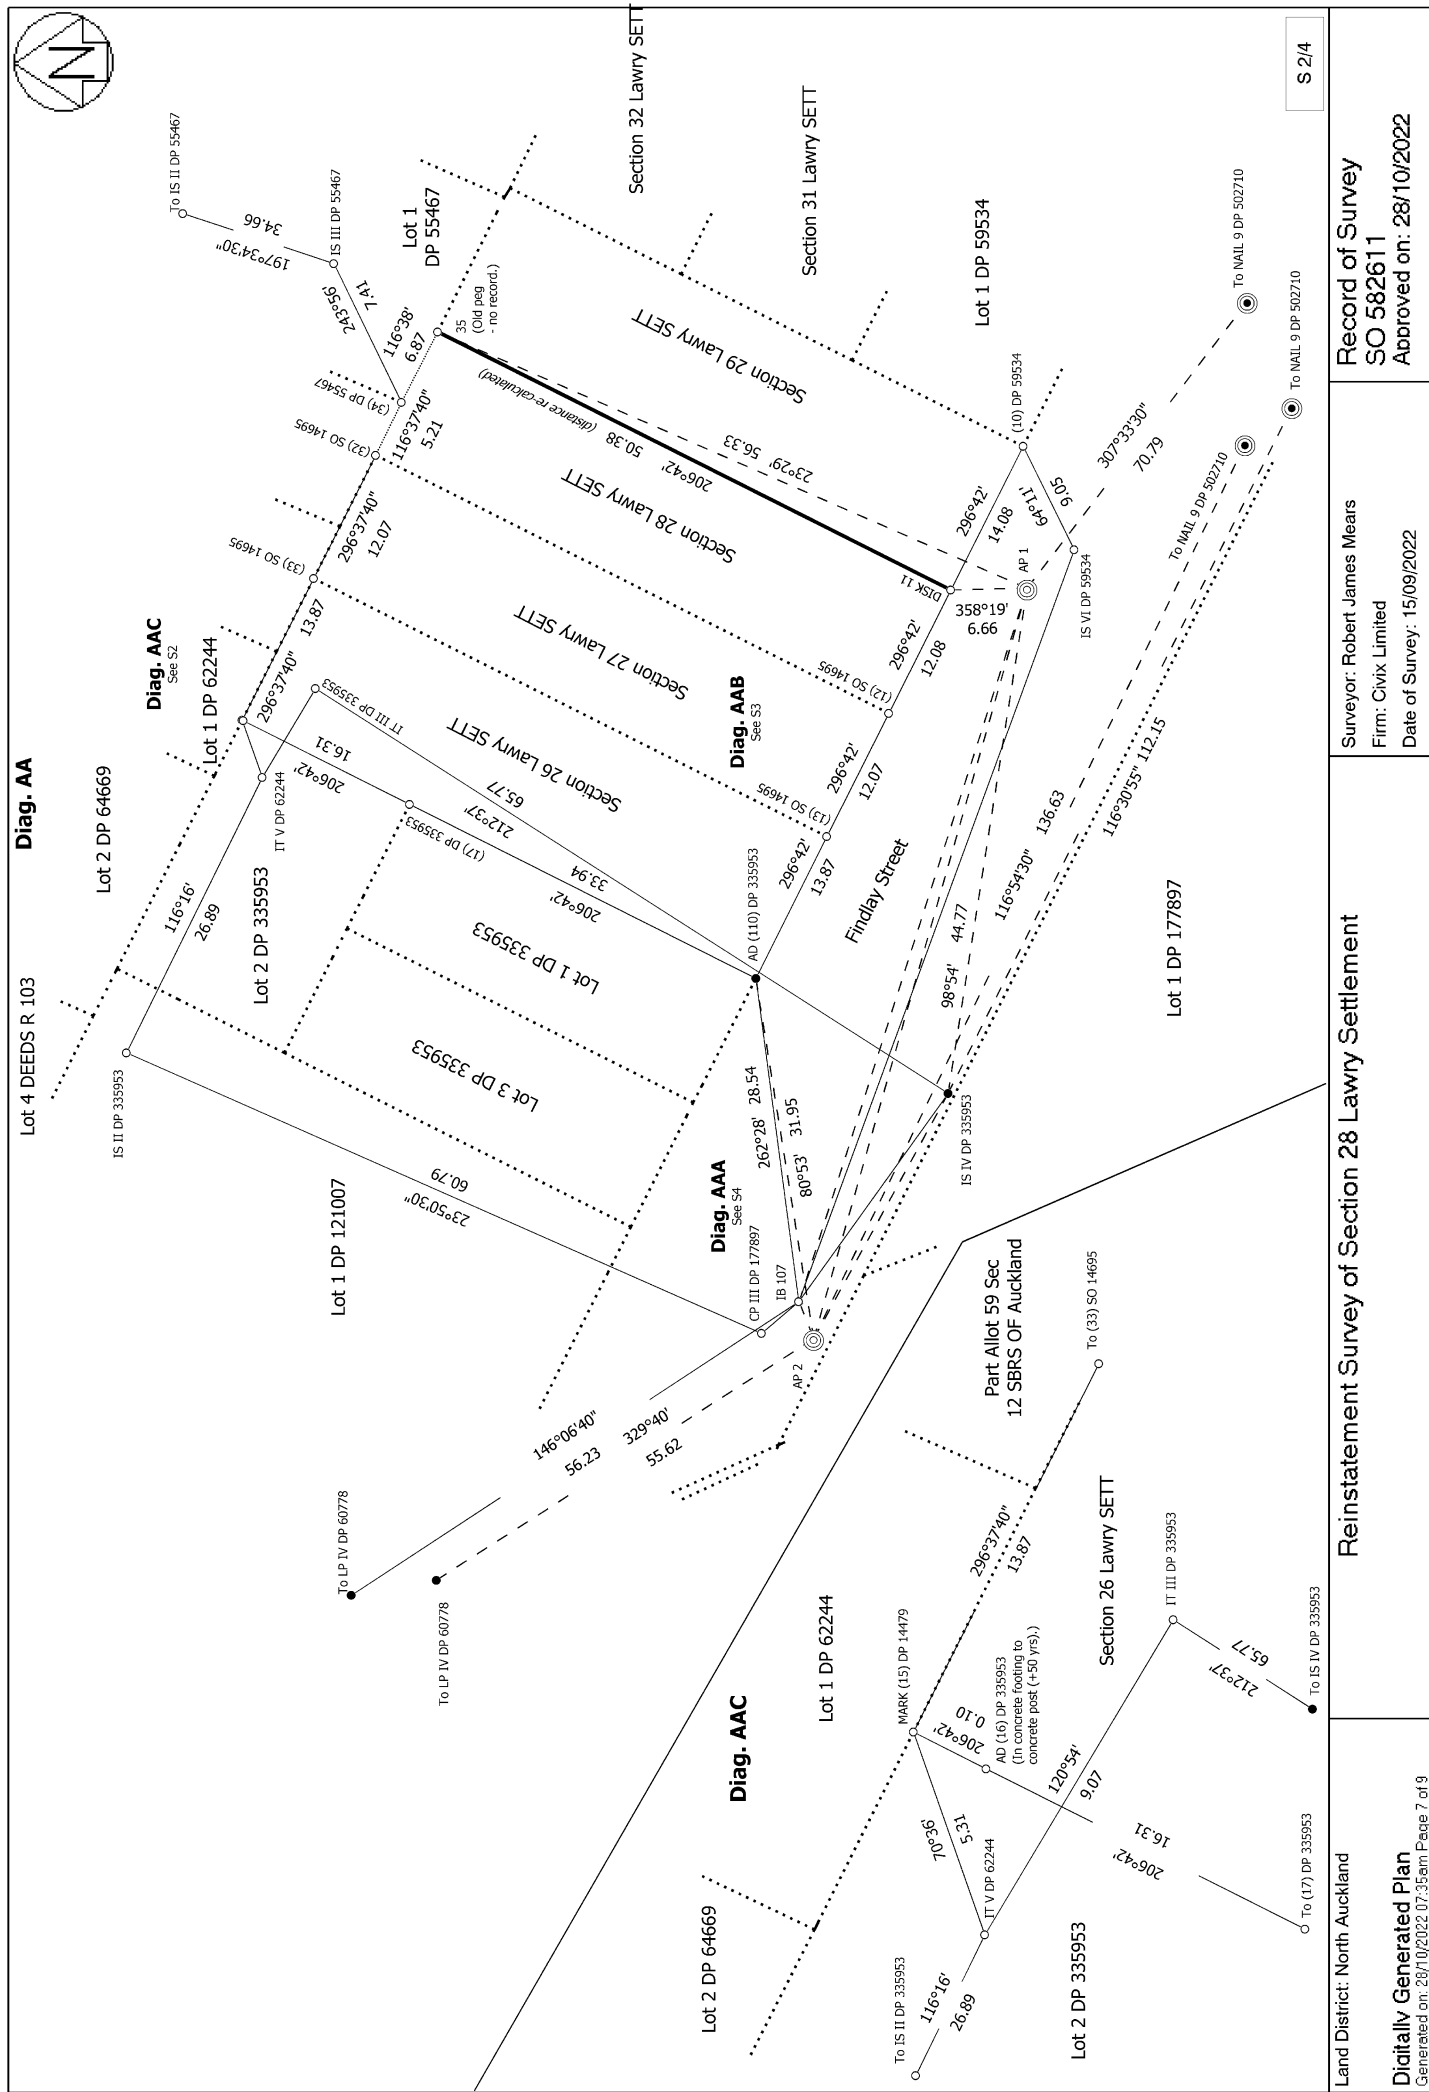




Diag. AAB

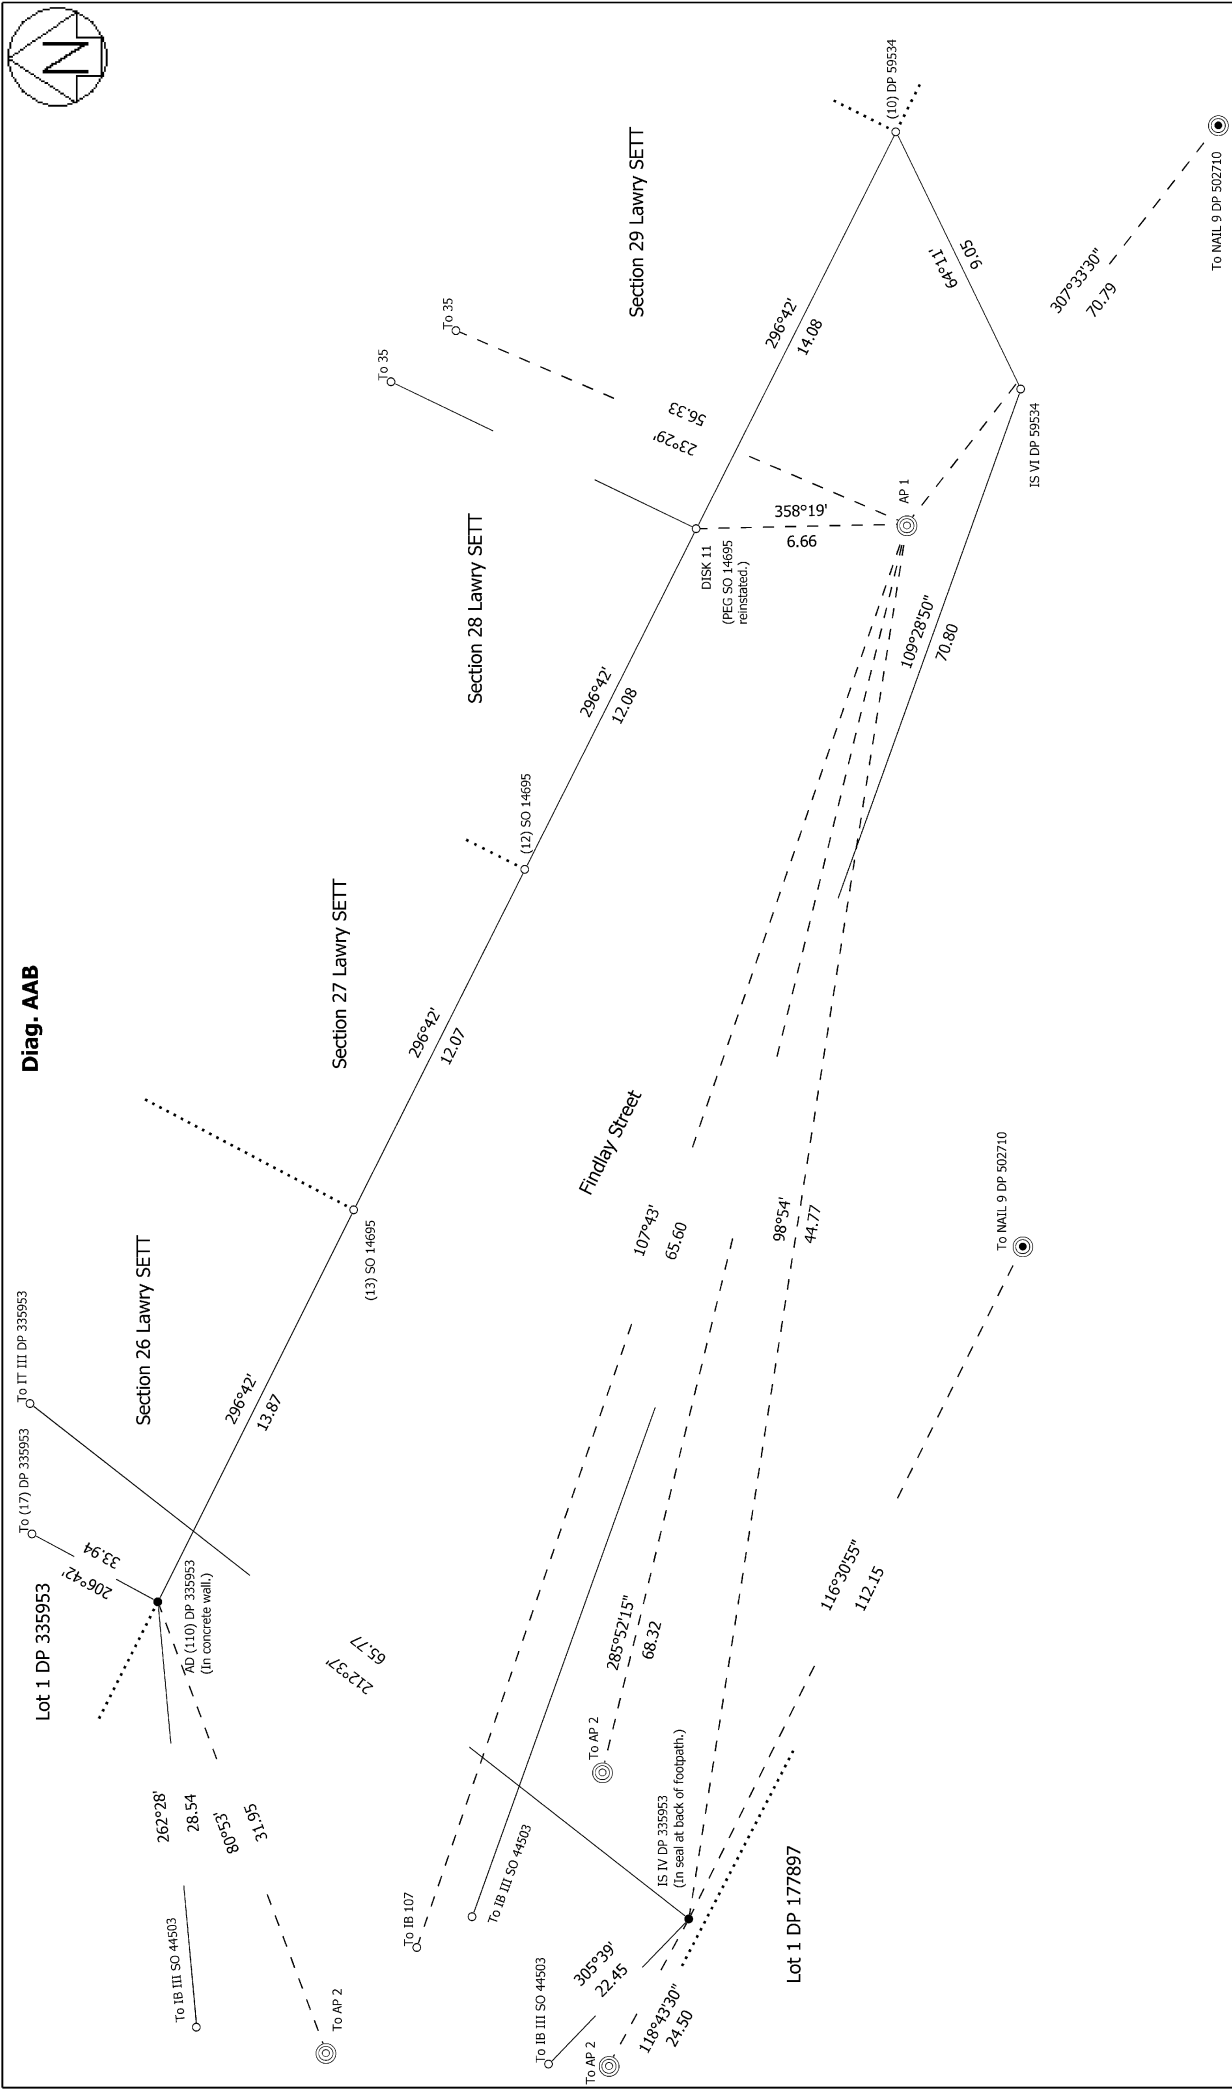

S 3/4

Land District: North Auckland	Reinstatement Survey of Section 28 Lawry Settlement	Surveyor: Robert James Mears Firm: Civix Limited Date of Survey: 15/09/2022	Record of Survey SO 582611 Approved on: 28/10/2022
Digitally Generated Plan Generated on: 28/10/2022 07:35am Page 8 of 9			



Land District: North Auckland

Digitally Generated Plan

Generated on: 28/10/2022 07:35am Page 9 of 9

Reinstatement Survey of Section 28 Lawry Settlement

Surveyor: Robert James Mears

Firm: Civix Limited

Date of Survey: 15/09/2022

Record of Survey
SO 582611
Approved on: 28/10/20