

Record of Survey - DP 581158

Survey Number	DP 581158
Surveyor Reference	2901
Surveyor	Russell Thomas Dick
Survey Firm	Mckenzie & Co Consultants Ltd
Surveyor Declaration	I Russell Thomas Dick, being a licensed cadastral surveyor, certify that-- (a) this dataset provided by me and its related survey are accurate, correct and in accordance with the Cadastral Survey Act 2002 and Cadastral Survey Rules 2021; and (b) the survey was undertaken by me or under my personal direction. Declared on 14 Dec 2022 01:38 PM

Survey Details

Dataset Description	Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block		
Purpose	LT Subdivision		
Status	Deposited	Type	Survey
Land District	South Auckland	Survey Class	Class A
Meridional Circuit	Bay of Plenty 2000	Vertical Datum	None

Survey Dates

Surveyed Date	15/08/2022	Certified Date	14/12/2022
Submitted Date	14/12/2022 13:38:48	Survey Approval Date	14/12/2022
Deposit Date	01/11/2022		

Referenced Surveys

Survey Number	Land District	Bearing Correction
SO 48773	South Auckland	0°00'00"
DPS 11942	South Auckland	-0°00'35"
DPS 64346	South Auckland	0°00'00"
ML 17674	South Auckland	-0°00'35"
DPS 8064	South Auckland	-0°00'35"
ML 17672	South Auckland	-0°00'35"
ML 21394	South Auckland	0°00'00"
ML 497645	South Auckland	0°00'00"
DP 21973	South Auckland	0°00'00"
DP 23699	South Auckland	-0°00'35"
DP 33177	South Auckland	-0°00'35"
DP 8698	South Auckland	0°07'25"
DP 339109	South Auckland	0°00'00"
ML 22226	South Auckland	0°00'00"

Territorial Authorities

Taupo District

Comprised In

RT SA54C/351



Record of Survey - DP 581158

Created Parcels

Parcels	Parcel Intent	Area	RT Reference
Lot 1 Deposited Plan 581158	Fee Simple Title	9.8904 Ha	1088503
Lot 2 Deposited Plan 581158	Fee Simple Title	17.4005 Ha	1088504
Area A Deposited Plan 581158	Easement		
Area B Deposited Plan 581158	Easement		
Area E Deposited Plan 581158	Easement		
Area C Deposited Plan 581158	Easement		
Area D Deposited Plan 581158	Easement		
Total Area		27.2909 Ha	

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT C ML 19097	ACACIA BAY ROAD EAST	ob0	53°16'10"	A ML 497645	0°00'00"	437.03 A	ML 497645	
IT C ML 19097	IT I DP 339109	ob1	55°37'20"	A ML 497645	0°00'00"	214.88 A	ML 497645	
IT I DP 339109	ACACIA BAY ROAD EAST	ob63	51°00'00"	M		222.50 M		
ACACIA BAY ROAD EAST	RM 134 SO 59401	ob2	47°39'20"	M		322.90 M		
RM 134 SO 59401	LP XVI DPS 39034	ob12	231°30'00"	M		24.63 M		
LP XVI DPS 39034	LP XVIII DPS 39034	ob13	52°47'10"	M		50.23 M		
LP XVIII DPS 39034	RM 134 SO 59401	ob14	234°02'00"	M		25.62 M		
LP XV DPS 39034	PEG 60 DP 581158	ob69	183°55'25"	M		15.80 M		
UNMK 41 DP 581158	PEG (1) ML 15772	ob120	25°03'25"	A ML 17672	-0°00'35"	2.52 C		Class A
PEG (1) ML 15772	IT XXXVIII ML 17672	ob27	308°59'05"	A ML 17672	-0°00'35"	5.87 A	ML 17672	
IT XXXVIII ML 17672	LP XV DPS 39034	ob29	205°03'55"	A ML 17672	-0°00'35"	7.39 A	ML 17672	
LP XVIII DPS 39034	LP XV DPS 39034	ob15	52°47'10"	M		111.00 M		
IT VII SO 48773	IT VIII SO 48773	ob64	51°43'40"	A SO 48773	0°00'00"	163.71 A	SO 48773	
IT VIII SO 48773	PEG ML 15856	ob65	72°22'00"	A ML 21394	0°00'00"	39.44 A	ML 21394	
PEG ML 15856	IT I DP 339109	ob66	47°14'00"	M		18.30 M		
PEG ML 15856	UNMK 29 DP 581158	ob67	50°41'50"	C		101.76 C		Class A
UNMK 29 DP 581158	UNMK 30 DP 581158	ob106	50°41'50"	C		11.75 C		Class A
UNMK 30 DP 581158	PEG 1 DP 581158	ob108	50°41'50"	C		363.59 C		Class A
PEG 1 DP 581158	UNMK 17 DP 581158	ob75	50°41'50"	C		4.03 C		Class A
UNMK 17 DP 581158	UNMK 18 DP 581158	ob90	50°41'50"	C		3.00 C		Class A
UNMK 57 DP 581158	PEG 60 DP 581158	ob139	50°41'50"	C		68.19 C		Class A
LP XV DPS 39034	IS IV DPS 64346	ob70	52°47'10"	A DPS 64346	0°00'00"	6.97 A	DPS 64346	
IS IV DPS 64346	IT III DPS 64346	ob74	143°32'30"	A DPS 64346	0°00'00"	53.17 A	DPS 64346	
IT III DPS 64346	IT II DPS 64346	ob72	136°56'00"	A DPS 64346	0°00'00"	142.68 A	DPS 64346	
IT II DPS 64346	RM 129 SO 59401	ob31	34°34'00"	A DPS 64346	0°00'00"	123.54 A	DPS 64346	

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 42 DP 581158	PEG (7) ML 17672	ob119	128°59'05"	A ML 17672	-0°00'35"	175.92 C		Class A
PEG (7) ML 17672	UNMK 15 DP 581158	ob32	220°05'00"	A DPS 64346	0°00'00"	1.33 C		Class A
UNMK 15 DP 581158	UNMK 16 DP 581158	ob88	220°05'00"	A DPS 64346	0°00'00"	8.76 C		Class A
UNMK 16 DP 581158	PEG (2) DPS 64346	ob89	220°05'00"	A DPS 64346	0°00'00"	20.46 C		Class A
PEG (2) DPS 64346	I T II DPS 64346	ob33	147°48'00"	A DPS 64346	0°00'00"	9.09 A	DPS 64346	
PEG (2) DPS 64346	PEG (1) DPS 64346	ob34	131°27'00"	A DPS 64346	0°00'00"	55.15 A	DPS 64346	Class A
PEG (1) DPS 64346	PEG (3) ML 17674	ob35	38°34'00"	A DPS 64346	0°00'00"	32.88 A	DPS 64346	Class A
PEG (3) ML 17674	I T II DPS 64346	ob36	273°06'00"	A DPS 64346	0°00'00"	57.09 A	DPS 64346	
RM 129 SO 59401	IT XXIII ML 17674	ob30	210°39'00"	A DPS 64346	0°00'00"	61.39 A	DPS 64346	
IT XXIII ML 17674	IT XXIV ML 17674	ob50	143°02'55"	A ML 17674	-0°00'35"	110.81 A	ML 17674	
IT XXIV ML 17674	IT DP 23699	ob79	217°10'25"	A ML 17674	-0°00'35"	21.69 A	ML 17674	
IT DP 23699	IT II DPS 8064	ob80	305°17'25"	A DPS 8064	-0°00'35"	12.67 A	DPS 8064	
IT II DPS 8064	IT I DPS 8064	ob82	219°07'25"	A DPS 8064	-0°00'35"	66.60 A	DPS 8064	
PEG (3) ML 17674	PEG (6) ML 17674	ob37	129°00'05"	A ML 17674	-0°00'35"	41.79 A	ML 17674	Class A
PEG (6) ML 17674	PEG (4) ML 17674	ob38	129°00'05"	A ML 17674	-0°00'35"	14.94 A	ML 17674	Class A
PEG (4) ML 17674	IT XXIV ML 17674	ob39	100°54'25"	A ML 17674	-0°00'35"	4.40 A	ML 17674	
IT DP 23699	PEG (2) DPS 8064	ob81	168°00'25"	A DPS 8064	-0°00'35"	0.77 A	DPS 8064	
PEG (2) DPS 8064	POST DP 25788	ob43	219°07'25"	A DPS 8064	-0°00'35"	66.29 A	DPS 8064	Class A
POST DP 25788	PEG XII DP 33177	ob40	263°33'25"	A DPS 8064	-0°00'35"	0.86 A	DPS 8064	
PEG XII DP 33177	IT (2) DP 33177	ob42	302°03'55"	A DPS 8064	-0°00'35"	0.61 A	DPS 8064	
POST DP 25788	PEG DPS 8064	ob41	219°07'25"	A DPS 8064	-0°00'35"	171.09 A	DPS 8064	Class A
PEG DPS 8064	PEG IX DP 33177	ob45	264°09'25"	A DPS 8064	-0°00'35"	0.85 A	DPS 8064	
PEG IX DP 33177	IT (1) DP 33177	ob47	309°11'25"	A DPS 8064	-0°00'35"	0.60 A	DPS 8064	
PEG DPS 8064	PEG 63 DP 581158	ob46	168°43'00"	C		0.10 C		
PEG ML 15856	PEG ML 21394	ob68	129°00'00"	A ML 21394	0°00'00"	418.45 A	ML 21394	Class A

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
PEG ML 21394	IS XXVI ML 21394	ob48	33°42'00"	A DP 21973	0°00'00"	10.73	A DP 21973	
PEG ML 21394	PEG DP 8698	ob49	129°00'00"	A ML 21394	0°00'00"	32.21	A DP 8698	Class B
UNMK 61 DP 8698	UNMK ML 21394	ob142	129°00'00"	A ML 21394	0°00'00"	7.99	C	
UNMK ML 21394	UNMK DP 8698	ob52	66°58'00"	C		357.50	C	
UNMK DP 8698	PEG (4) DP 8698	ob84	309°07'25"	A DP 8698	0°07'25"	86.50	A DP 8698	Class BD
PEG (4) DP 8698	PEG 12 DP 581158	ob86	309°07'25"	A DP 8698	0°07'25"	147.66	C	Class A
PEG 12 DP 581158	PEG DPS 8064	ob87	309°07'25"	A DP 8698	0°07'25"	14.40	C	Class A
IT I DPS 8064	IT (2) DP 33177	ob77	129°13'00"	M		12.05	M	
PEG 1 DP 581158	PEG 2 DP 581158	ob76	123°52'00"	C		12.29	C	Class A
PEG 2 DP 581158	PEG 3 DP 581158	ob53	163°37'00"	C		26.08	C	Class A
PEG 3 DP 581158	PEG 4 DP 581158	ob54	191°38'00"	C		24.69	C	Class A
PEG 4 DP 581158	PEG 5 DP 581158	ob55	150°53'00"	C		20.72	C	Class A
PEG 5 DP 581158	PEG 6 DP 581158	ob56	172°39'00"	C		34.45	C	Class A
PEG 6 DP 581158	PEG 7 DP 581158	ob57	145°16'30"	C		99.68	C	Class A
PEG 7 DP 581158	PEG 8 DP 581158	ob58	185°16'00"	C		28.81	C	Class A
PEG 8 DP 581158	PEG 9 DP 581158	ob59	156°56'00"	C		44.97	C	Class A
PEG 9 DP 581158	PEG 10 DP 581158	ob60	180°01'00"	C		36.01	C	Class A
PEG 10 DP 581158	PEG 11 DP 581158	ob61	131°14'00"	C		11.13	C	Class A
PEG 11 DP 581158	PEG 12 DP 581158	ob62	91°41'00"	C		28.92	C	Class A
IT I DPS 8064	IT XI DPS 8064	ob78	219°07'25"	A DPS 8064	-0°00'35"	171.02	A DPS 8064	
IT XI DPS 8064	IT (1) DP 33177	ob83	129°05'25"	A DPS 8064	-0°00'35"	12.05	A DPS 8064	
UNMK 47 DP 581158	PEG DPS 8064	ob127	62°39'25"	A DP 8698	0°07'25"	10.74	C	Class A
ACACIA BAY ROAD EAST	IT 102 DP 581158	ob3	66°24'20"	M		269.41	M	
IT 102 DP 581158	IT 101 DP 581158	ob4	171°22'20"	M		255.34	M	
IT 101 DP 581158	IT I DPS 8064	ob17	49°49'40"	M		310.33	M	
IT III DPS 64346	IT I DPS 8064	ob73	146°14'40"	M		247.22	M	

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT 102 DP 581158	IT III DPS 64346	ob5	42°00'30" M			206.29 M		
LP XV DPS 39034	IT III DPS 64346	ob71	136°04'00" M			53.53 M		
IT 101 DP 581158	PEG 62 DP 581158	ob18	92°48'00" M			22.65 M		
UNMK 18 DP 581158	UNMK 19 DP 581158	ob93	140°42'30" C			53.19 C		Class A
UNMK 19 DP 581158	UNMK 20 DP 581158	ob94	180°55'30" C			30.69 C		Class A
UNMK 20 DP 581158	UNMK 21 DP 581158	ob95	110°11'00" C			24.23 C		Class A
UNMK 21 DP 581158	UNMK 22 DP 581158	ob96	83°12'30" C			82.22 C		Class A
UNMK 22 DP 581158	UNMK 23 DP 581158	ob97	57°27'30" C			97.70 C		Class A
UNMK 23 DP 581158	UNMK 15 DP 581158	ob98	60°06'30" C			101.67 C		Class A
UNMK 17 DP 581158	UNMK 24 DP 581158	ob91	140°42'30" C			52.10 C		Class A
UNMK 24 DP 581158	UNMK 25 DP 581158	ob99	180°55'30" C			31.72 C		Class A
UNMK 25 DP 581158	UNMK 26 DP 581158	ob100	110°10'30" C			27.07 C		Class A
UNMK 26 DP 581158	UNMK 27 DP 581158	ob101	83°12'30" C			83.63 C		Class A
UNMK 27 DP 581158	UNMK 28 DP 581158	ob102	57°27'30" C			98.31 C		Class A
UNMK 28 DP 581158	UNMK 16 DP 581158	ob103	60°06'30" C			93.37 C		Class A
PEG (2) DPS 8064	PEG (1) DP 23699	ob44	129°00'05" A	ML 17674	-0°00'35"	27.96 A	DPS 11942	Class A
UNMK 46 DP 581158	PEG (2) DP 23699	ob124	39°00'25" A	ML 17674	-0°00'35"	10.26 C		Class A
PEG (2) DP 23699	PEG (4) ML 17674	ob105	309°00'05" A	ML 17674	-0°00'35"	33.13 C		Class A
UNMK 29 DP 581158	UNMK 31 DP 581158	ob107	153°25'00" C			10.39 C		Class A
UNMK 31 DP 581158	UNMK 32 DP 581158	ob109	222°16'00" C			3.72 C		Class A
UNMK 32 DP 581158	UNMK 33 DP 581158	ob110	157°23'00" C			13.07 C		Class A
UNMK 33 DP 581158	UNMK 34 DP 581158	ob111	94°30'00" C			4.94 C		Class A
UNMK 34 DP 581158	UNMK 35 DP 581158	ob112	86°08'00" C			9.81 C		Class A
UNMK 35 DP 581158	UNMK 36 DP 581158	ob113	356°08'00" C			3.00 C		Class A

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 36 DP 581158	UNMK 37 DP 581158	ob114	266°08'00"	C		8.63 C		Class A
UNMK 37 DP 581158	UNMK 38 DP 581158	ob115	337°29'00"	C		12.59 C		Class A
UNMK 38 DP 581158	UNMK 39 DP 581158	ob116	333°26'00"	C		8.98 C		Class A
UNMK 39 DP 581158	UNMK 40 DP 581158	ob117	57°02'00"	C		8.96 C		Class A
UNMK 40 DP 581158	UNMK 30 DP 581158	ob118	328°26'00"	C		5.08 C		Class A
IT 102 DP 581158	PEG 1 DP 581158	ob6	303°11'30"	M		76.55 M		
IT 102 DP 581158	PEG 2 DP 581158	ob7	303°04'00"	M		64.26 M		
IT 102 DP 581158	PEG 3 DP 581158	ob8	282°11'00"	M		47.57 M		
IT 102 DP 581158	PEG 4 DP 581158	ob9	254°38'00"	M		53.38 M		
IT 102 DP 581158	PEG 5 DP 581158	ob10	232°05'00"	M		52.47 M		
IT 102 DP 581158	PEG 6 DP 581158	ob11	209°07'00"	M		76.02 M		
IT 101 DP 581158	PEG 7 DP 581158	ob19	349°55'00"	M		105.75 M		
IT 101 DP 581158	PEG 8 DP 581158	ob20	344°20'00"	M		78.33 M		
IT 101 DP 581158	PEG 9 DP 581158	ob21	354°05'00"	M		34.23 M		
IT 101 DP 581158	PEG 10 DP 581158	ob22	241°04'00"	M		4.05 M		
IT 101 DP 581158	PEG 11 DP 581158	ob23	152°34'00"	M		10.47 M		
IT 101 DP 581158	PEG 12 DP 581158	ob24	106°44'00"	M		35.23 M		
IT 101 DP 581158	IT (1) DP 33177	ob25	66°36'40"	M		151.01 M		
PEG (1) ML 15772	UNMK 42 DP 581158	ob28	128°59'05"	A ML 17672	-0°00'35"	6.38 C		Class A
PEG 60 DP 581158	UNMK 41 DP 581158	ob26	25°03'25"	A ML 17672	-0°00'35"	18.20 C		Class A
UNMK 41 DP 581158	UNMK 43 DP 581158	ob121	136°35'00"	C		5.40 C		Class A
UNMK 43 DP 581158	UNMK 42 DP 581158	ob122	46°35'00"	C		3.19 C		Class A
UNMK 45 DP 581158	UNMK 46 DP 581158	ob123	39°00'25"	A ML 17674	-0°00'35"	3.03 C		Class A
PEG (1) DP 23699	UNMK 45 DP 581158	ob104	39°00'25"	A ML 17674	-0°00'35"	6.83 C		Class A

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
UNMK 44 DP 581158	UNMK 47 DP 581158	ob125	62°39'25"	A DP 8698	0°07'25"	3.47 C		Class A
PEG DPS 8064	UNMK 44 DP 581158	ob143	62°39'25"	A DP 8698	0°07'25"	117.82 C		Class A
UNMK 44 DP 581158	UNMK 48 DP 581158	ob126	302°15'00"	C		9.19 C		Class A
UNMK 48 DP 581158	UNMK 49 DP 581158	ob129	38°53'00"	C		230.52 C		Class A
UNMK 49 DP 581158	UNMK 50 DP 581158	ob130	44°55'00"	C		35.58 C		Class A
UNMK 50 DP 581158	UNMK 51 DP 581158	ob131	132°02'00"	C		12.88 C		Class A
UNMK 51 DP 581158	UNMK 46 DP 581158	ob132	137°15'00"	C		27.49 C		Class A
UNMK 47 DP 581158	UNMK 52 DP 581158	ob128	302°15'00"	C		7.57 C		Class A
UNMK 52 DP 581158	UNMK 53 DP 581158	ob133	38°53'00"	C		227.00 C		Class A
UNMK 54 DP 581158	UNMK 55 DP 581158	ob136	132°02'00"	C		9.90 C		Class A
UNMK 55 DP 581158	UNMK 45 DP 581158	ob135	137°15'00"	C		27.78 C		Class A
UNMK 53 DP 581158	UNMK 54 DP 581158	ob134	44°55'00"	C		32.57 C		Class A
UNMK 56 DP 581158	UNMK 57 DP 581158	ob137	50°41'50"	C		7.52 C		Class A
UNMK 18 DP 581158	UNMK 56 DP 581158	ob92	50°41'50"	C		129.06 C		Class A
UNMK 56 DP 581158	UNMK 58 DP 581158	ob138	141°36'00"	C		4.15 C		Class A
UNMK 58 DP 581158	UNMK 59 DP 581158	ob140	51°38'00"	C		7.82 C		Class A
UNMK 59 DP 581158	UNMK 57 DP 581158	ob141	317°36'00"	C		4.29 C		Class A
IT 101 DP 581158	PEG 63 DP 581158	ob16	66°56'40"	M		152.07 M		
PEG DP 8698	UNMK 61 DP 8698	ob51	129°00'00"	A ML 21394	0°00'00"	2.01 A	DP 8698	Class BD
PEG 62 DP 581158	PEG DPS 8064	ob85	348°43'00"	C		0.10 C		

Mark Name	Mark Condition	Description
ACACIA BAY ROAD I		This mark is used for deformation monitoring, do not alter the ground mark in any way. Stainless steel pin set in concrete, 0.26 below ground level under cast iron cover
IT (1) DP 33177		Down 0.2m in grass
IT 101 DP 581158		Down 0.3m in grass

Mark and Vector

Survey Number DP 581158

Meridional Circuit Bay of Plenty 2000

Mark Name	Mark Condition	Description
IT 102 DP 581158		Down 0.3m in grass
IT I DP 339109		Down 0.2m in grass
PEG 60 DP 581158		In position of PEG ML 15772
PEG 62 DP 581158		OP no record Not original
PEG 63 DP 581158		Old Peg No Record Not original
RM 129 SO 59401		N/A
RM 134 SO 59401		Bronze Plaque in Concrete channel

*** End of Report ***

Schedule / Memorandum

Land Registration District

South Auckland

Survey Number

LT 581158

Territorial Authority (the Council)

Taupo District

Memorandum of Easements in Gross

Last Edited: 27 Oct 2022 12:26:59


<u>Purpose</u>	<u>Shown</u>	<u>Burdened Land</u> <u>(Servient Tenement)</u>	<u>Grantee</u>
Right to drain sewage	A	Lot 1	Taupo District Council
Right to drain water	B	Lot 2	Taupo District Council
	C	Lot 1	Taupo District Council
Right to convey water	D, E	Lot 1	Taupo District Council

Notes


Last Edited: 19 Nov 2022 12:21:16

NOTE:

Lot 1 DP 581158 is subject to a right of way over part Nukuhau Block shown as 'road to be dedicated' pursuant to Section 168(1) Land Transfer Act 1952.

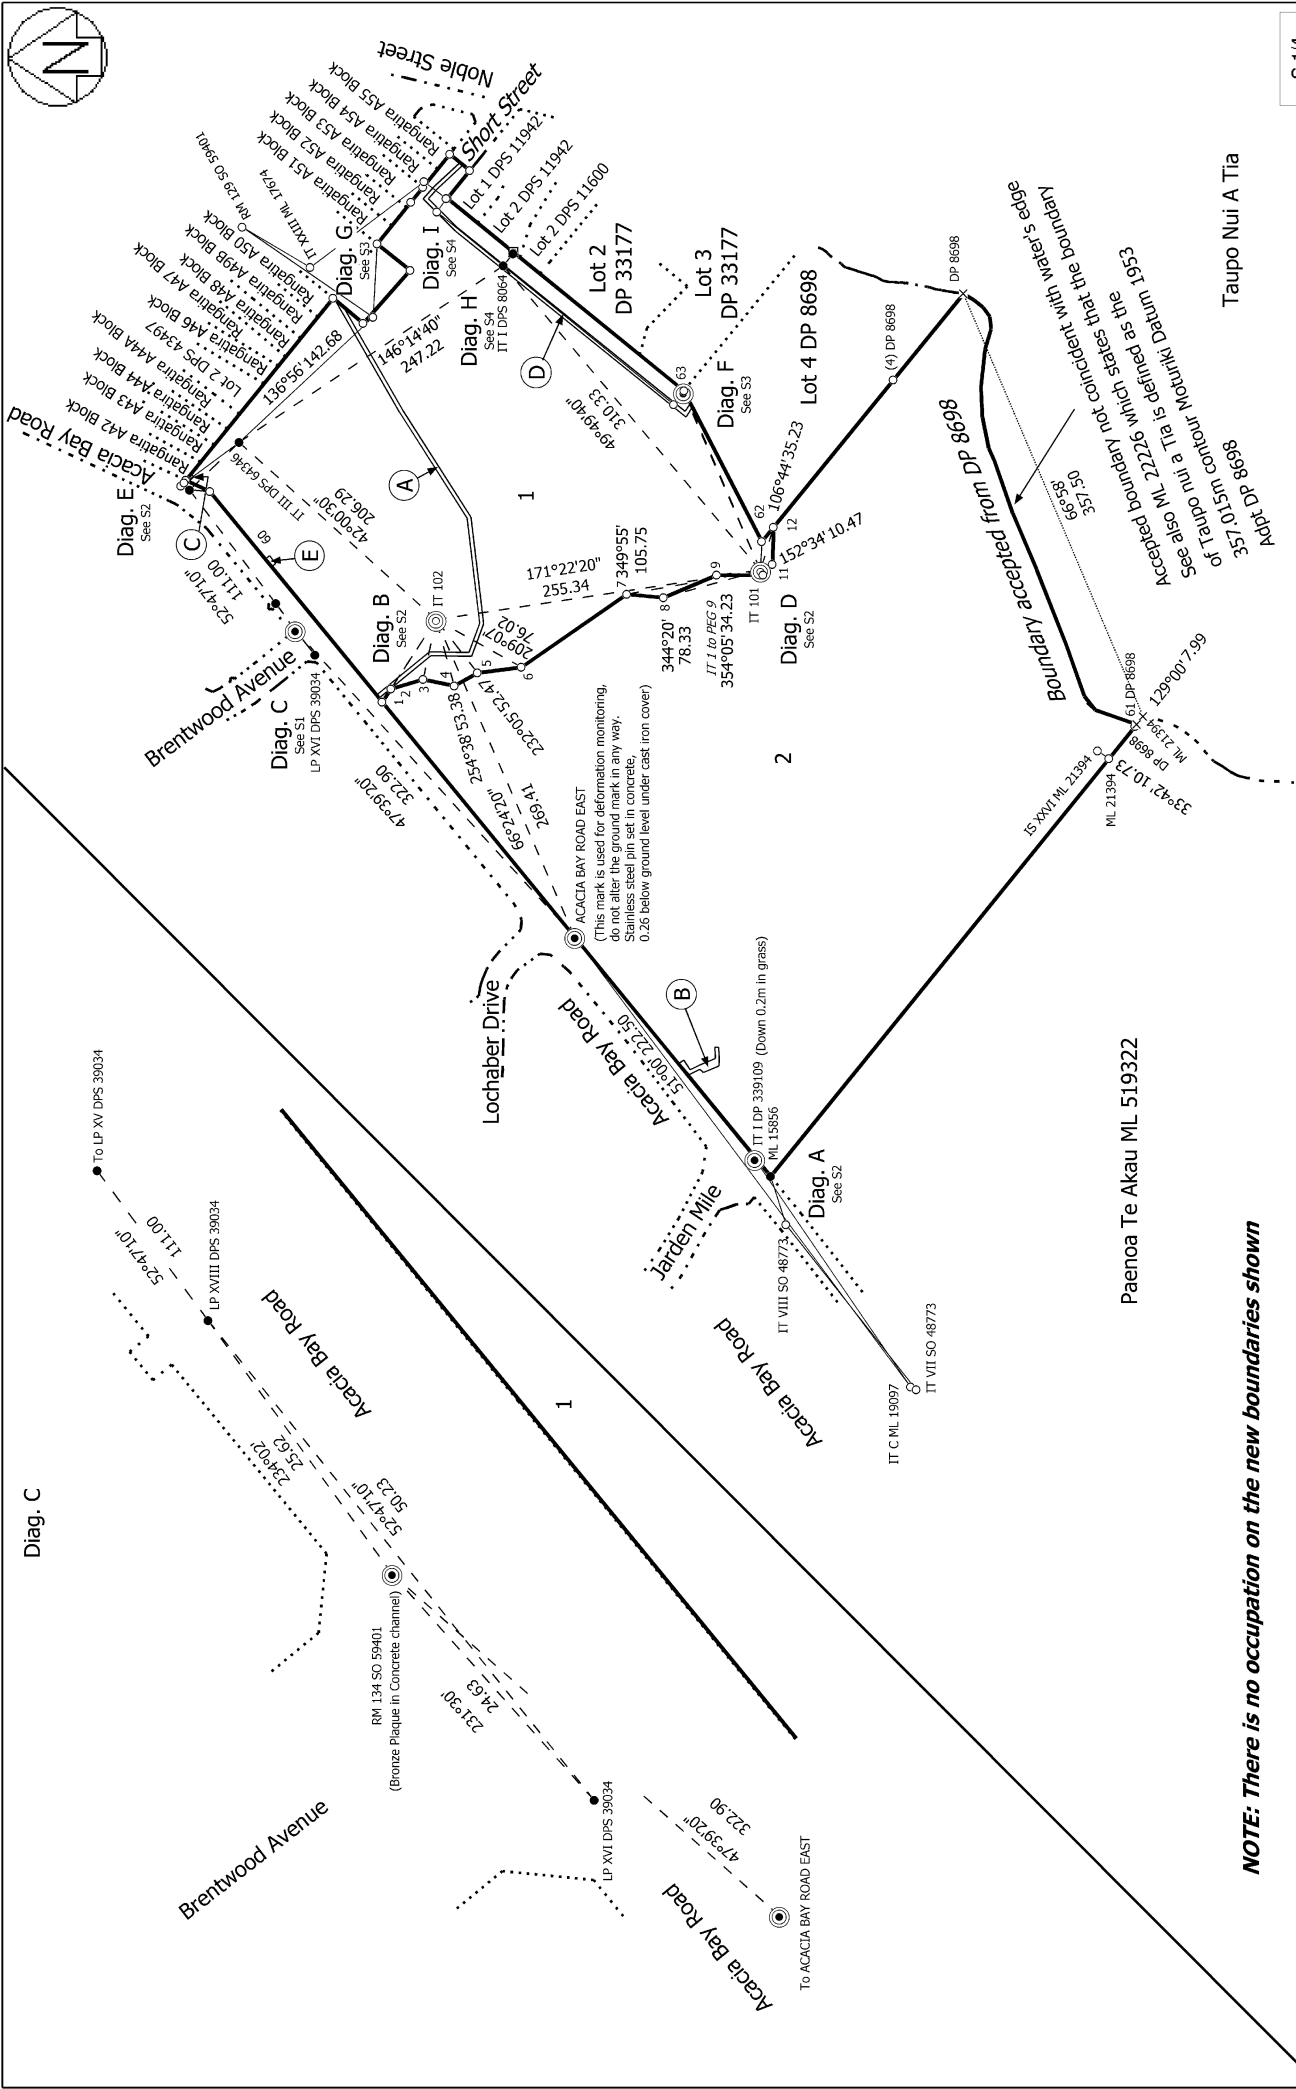

S 1/4		Record of Survey DP 581158	
Deposited on: 1/11/2022		Surveyor: Russell Thomas Dick Firm: McKenzie & Co Consultants Ltd Date of Survey: 15/08/2022	
Land District: South Auckland		Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block	
Digitally Generated Plan Generated on: 15/12/2022 11:48am Page 11 of 18			

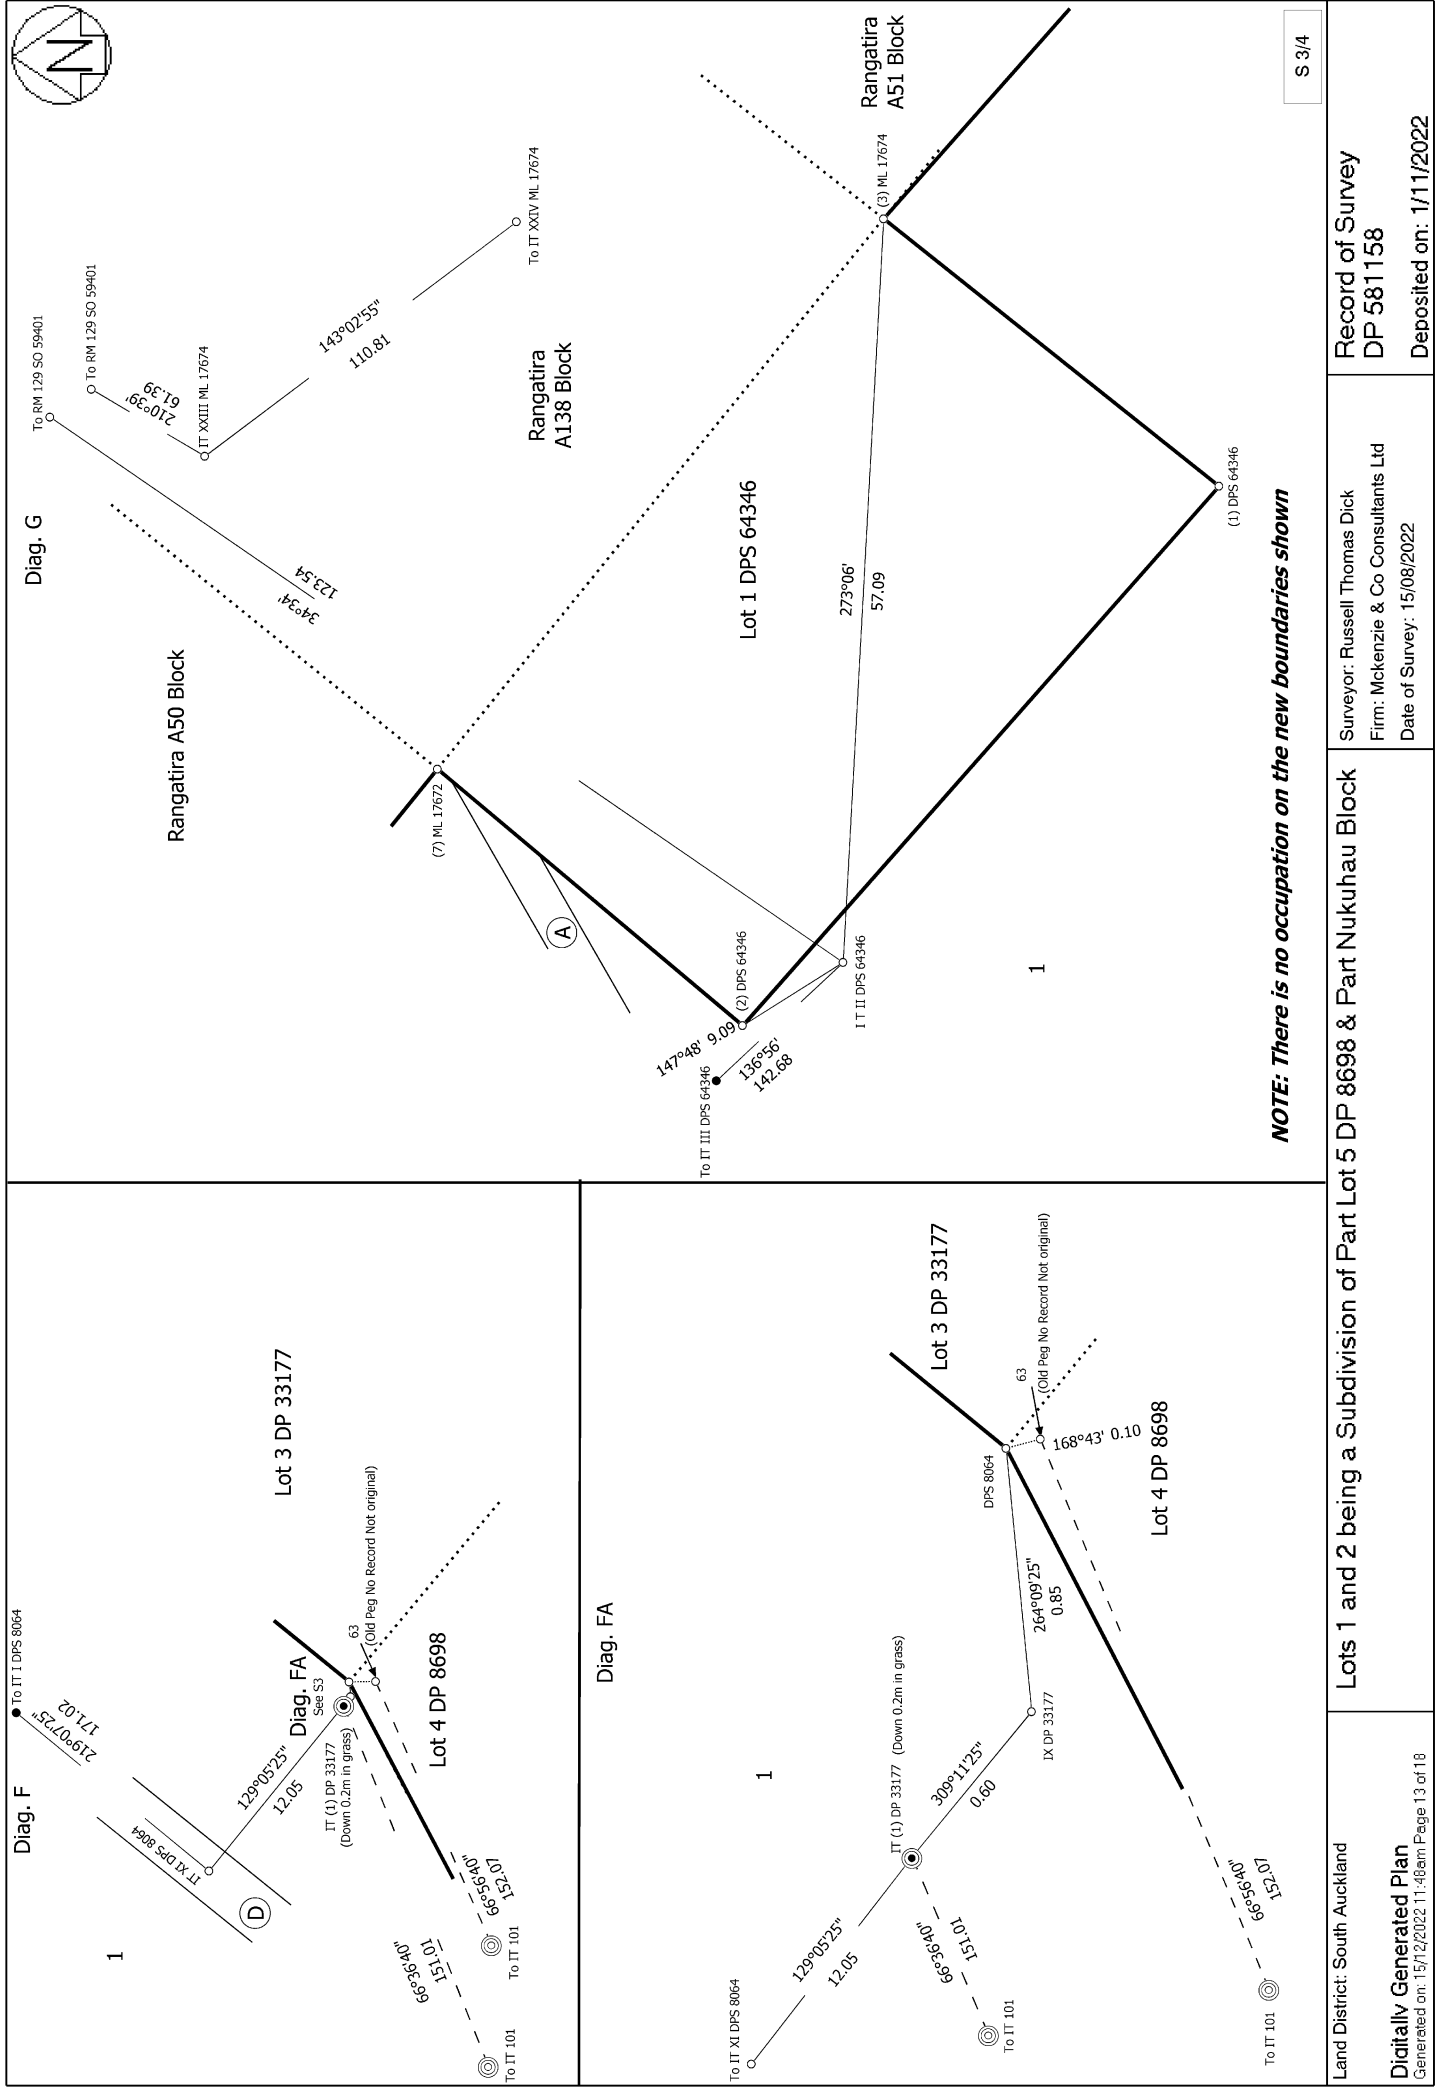


NOTE: There is no occupation on the new boundaries shown

Land District: South Auckland	Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block	Surveyor: Russell Thomas Dick Firm: McKenzie & Co Consultants Ltd Date of Survey: 15/08/2022	Record of Survey DP 581158
Digitally Generated Plan Generated on: 15/12/2022 11:48am Page 13 of 18		Deposited on: 1/11/2022	




Diag. I

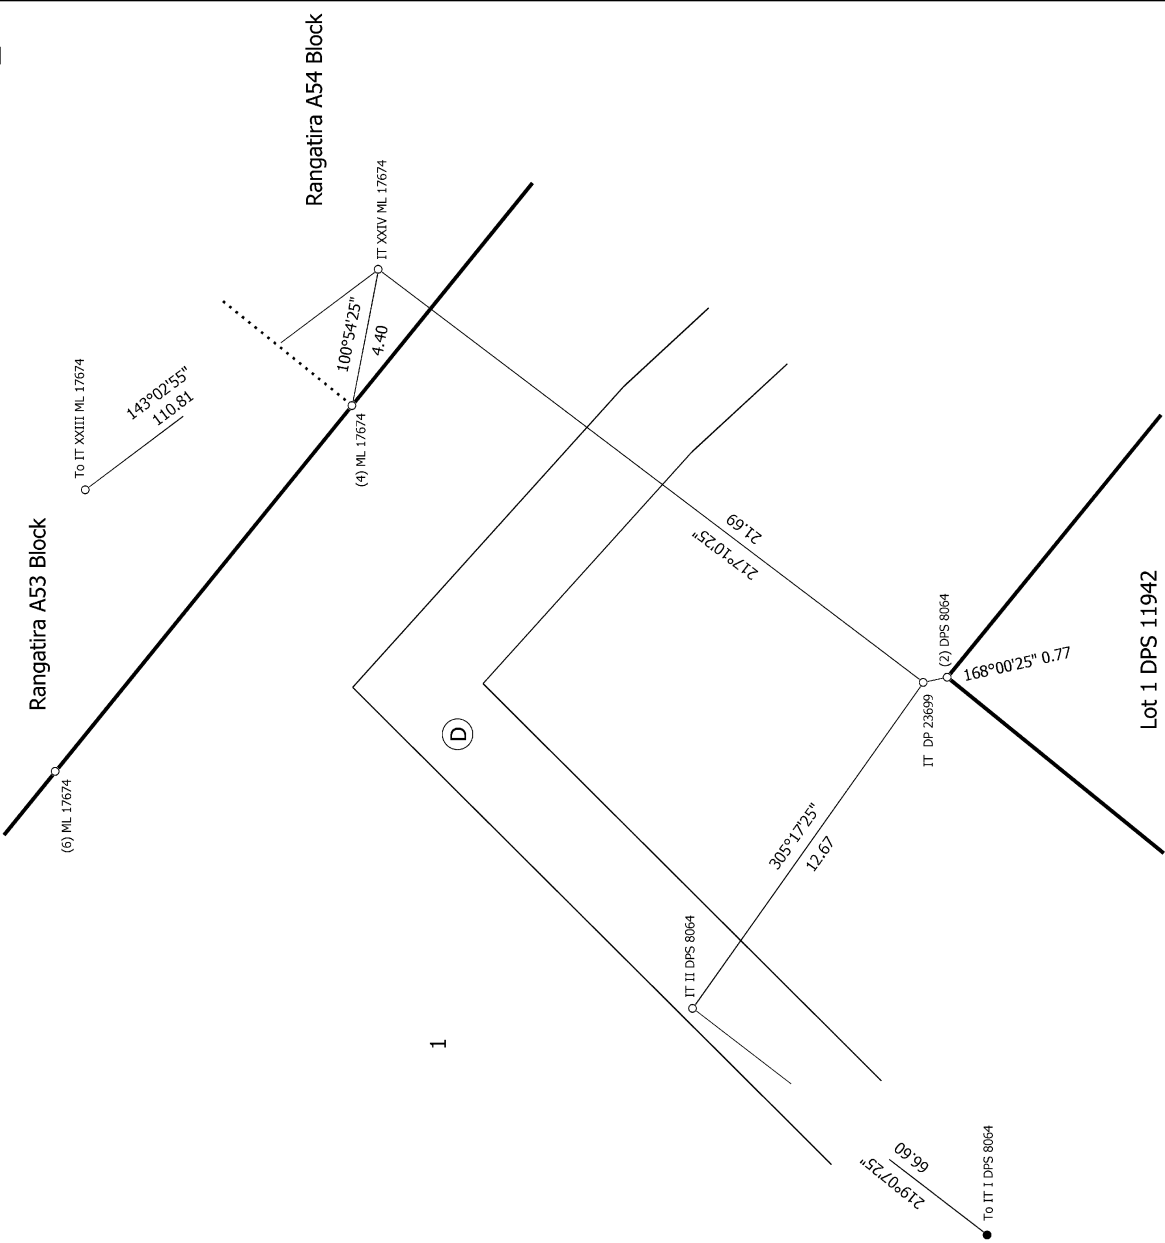


S 4/4

Diag. H


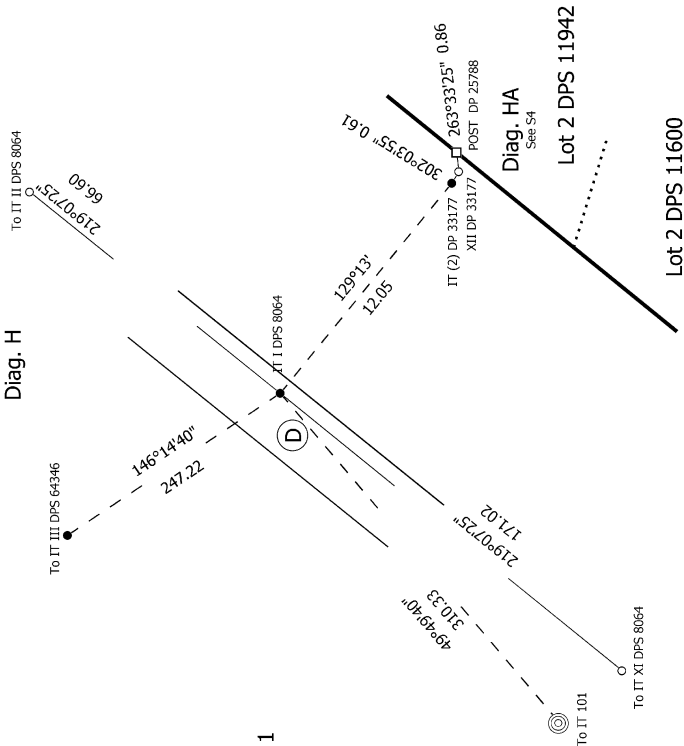


Diag. HA

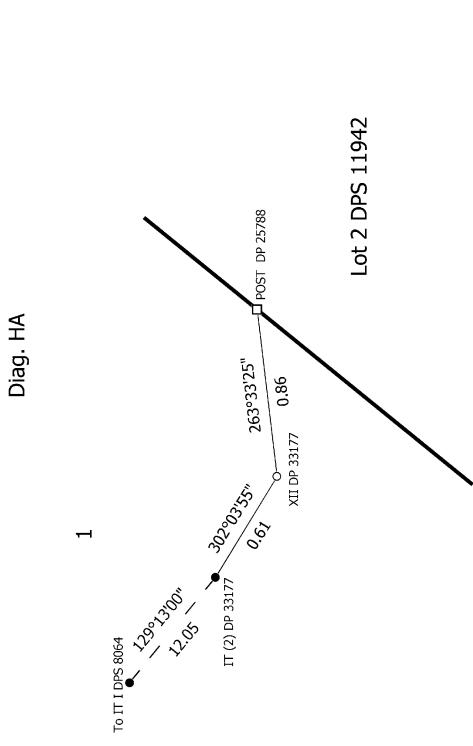

NOTE: There is no occupation on the new boundaries shown

Land District: South Auckland	Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block	Surveyor: Russell Thomas Dick Firm: McKenzie & Co Consultants Ltd Date of Survey: 15/08/2022	Record of Survey DP 581158 Deposited on: 1/11/2022
Digitally Generated Plan Generated on: 15/12/2022 11:48am Page 14 of 18			

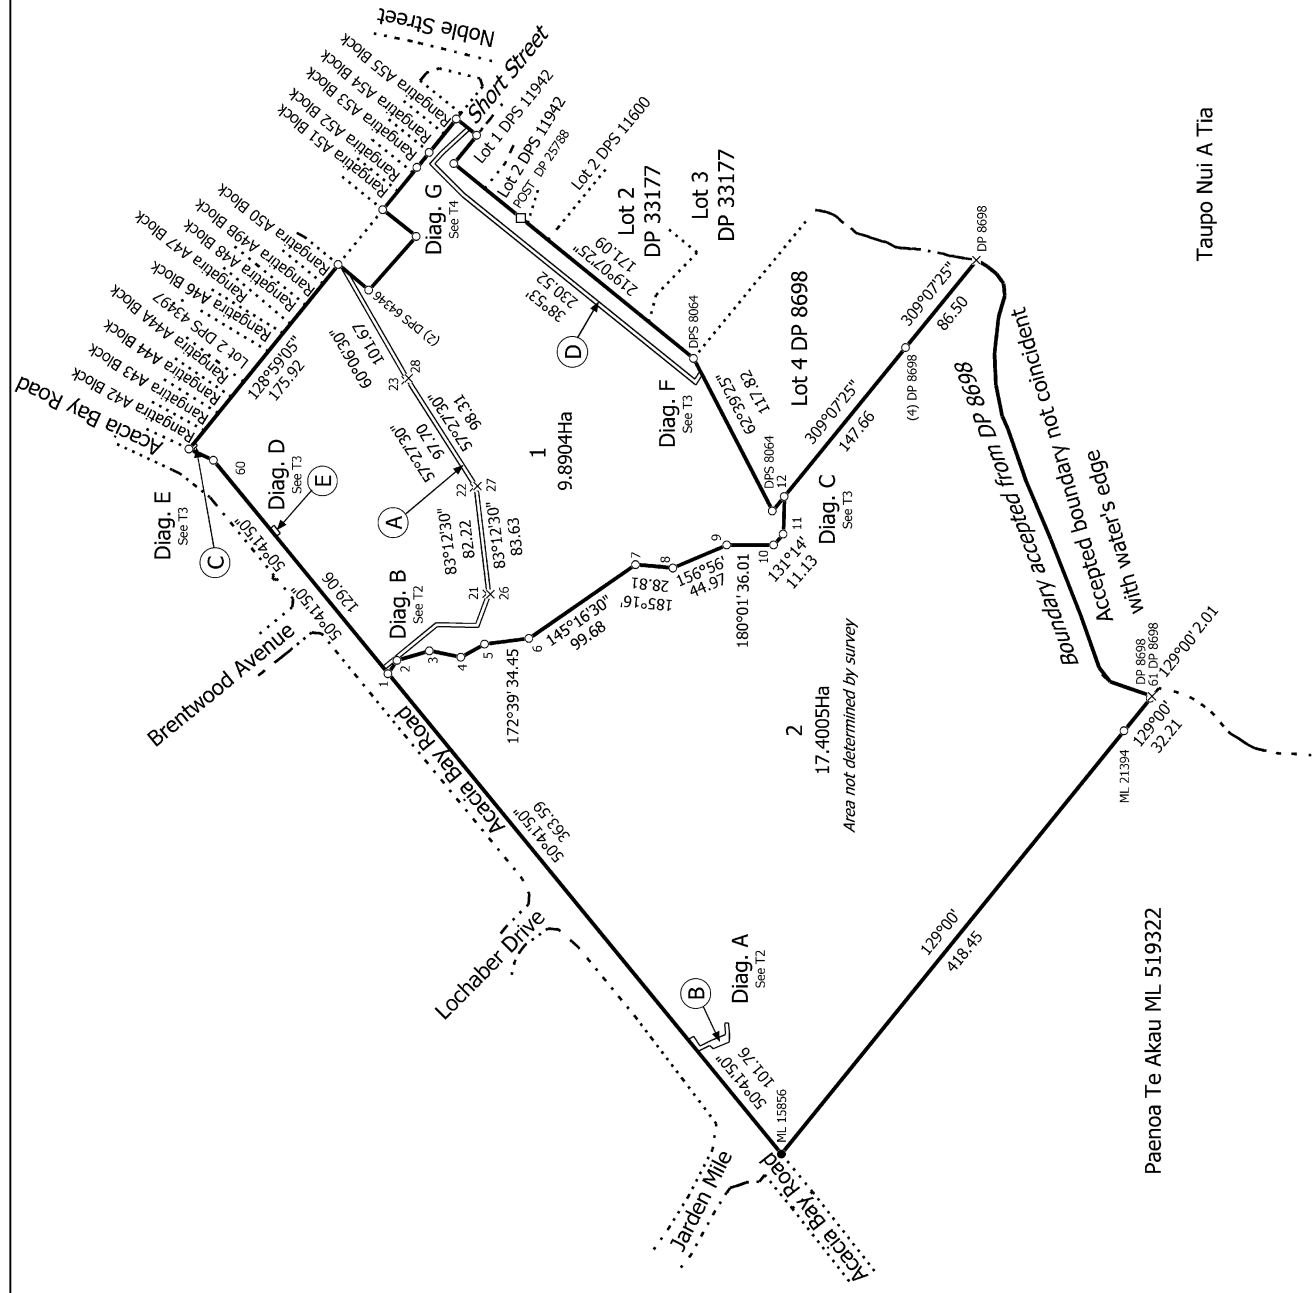


Taupo Nui A Tia

Paenoo Te Akau ML 519322

T 1/4

Land District: South Auckland	Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block	Surveyor: Russell Thomas Dick Firm: McKenzie & Co Consultants Ltd Date of Survey: 15/08/2022	Record of Survey DP 581158 Deposited on: 1/11/2022
Digitally Generated Plan Generated on: 15/12/2022 11:48am Page 15 of 18			

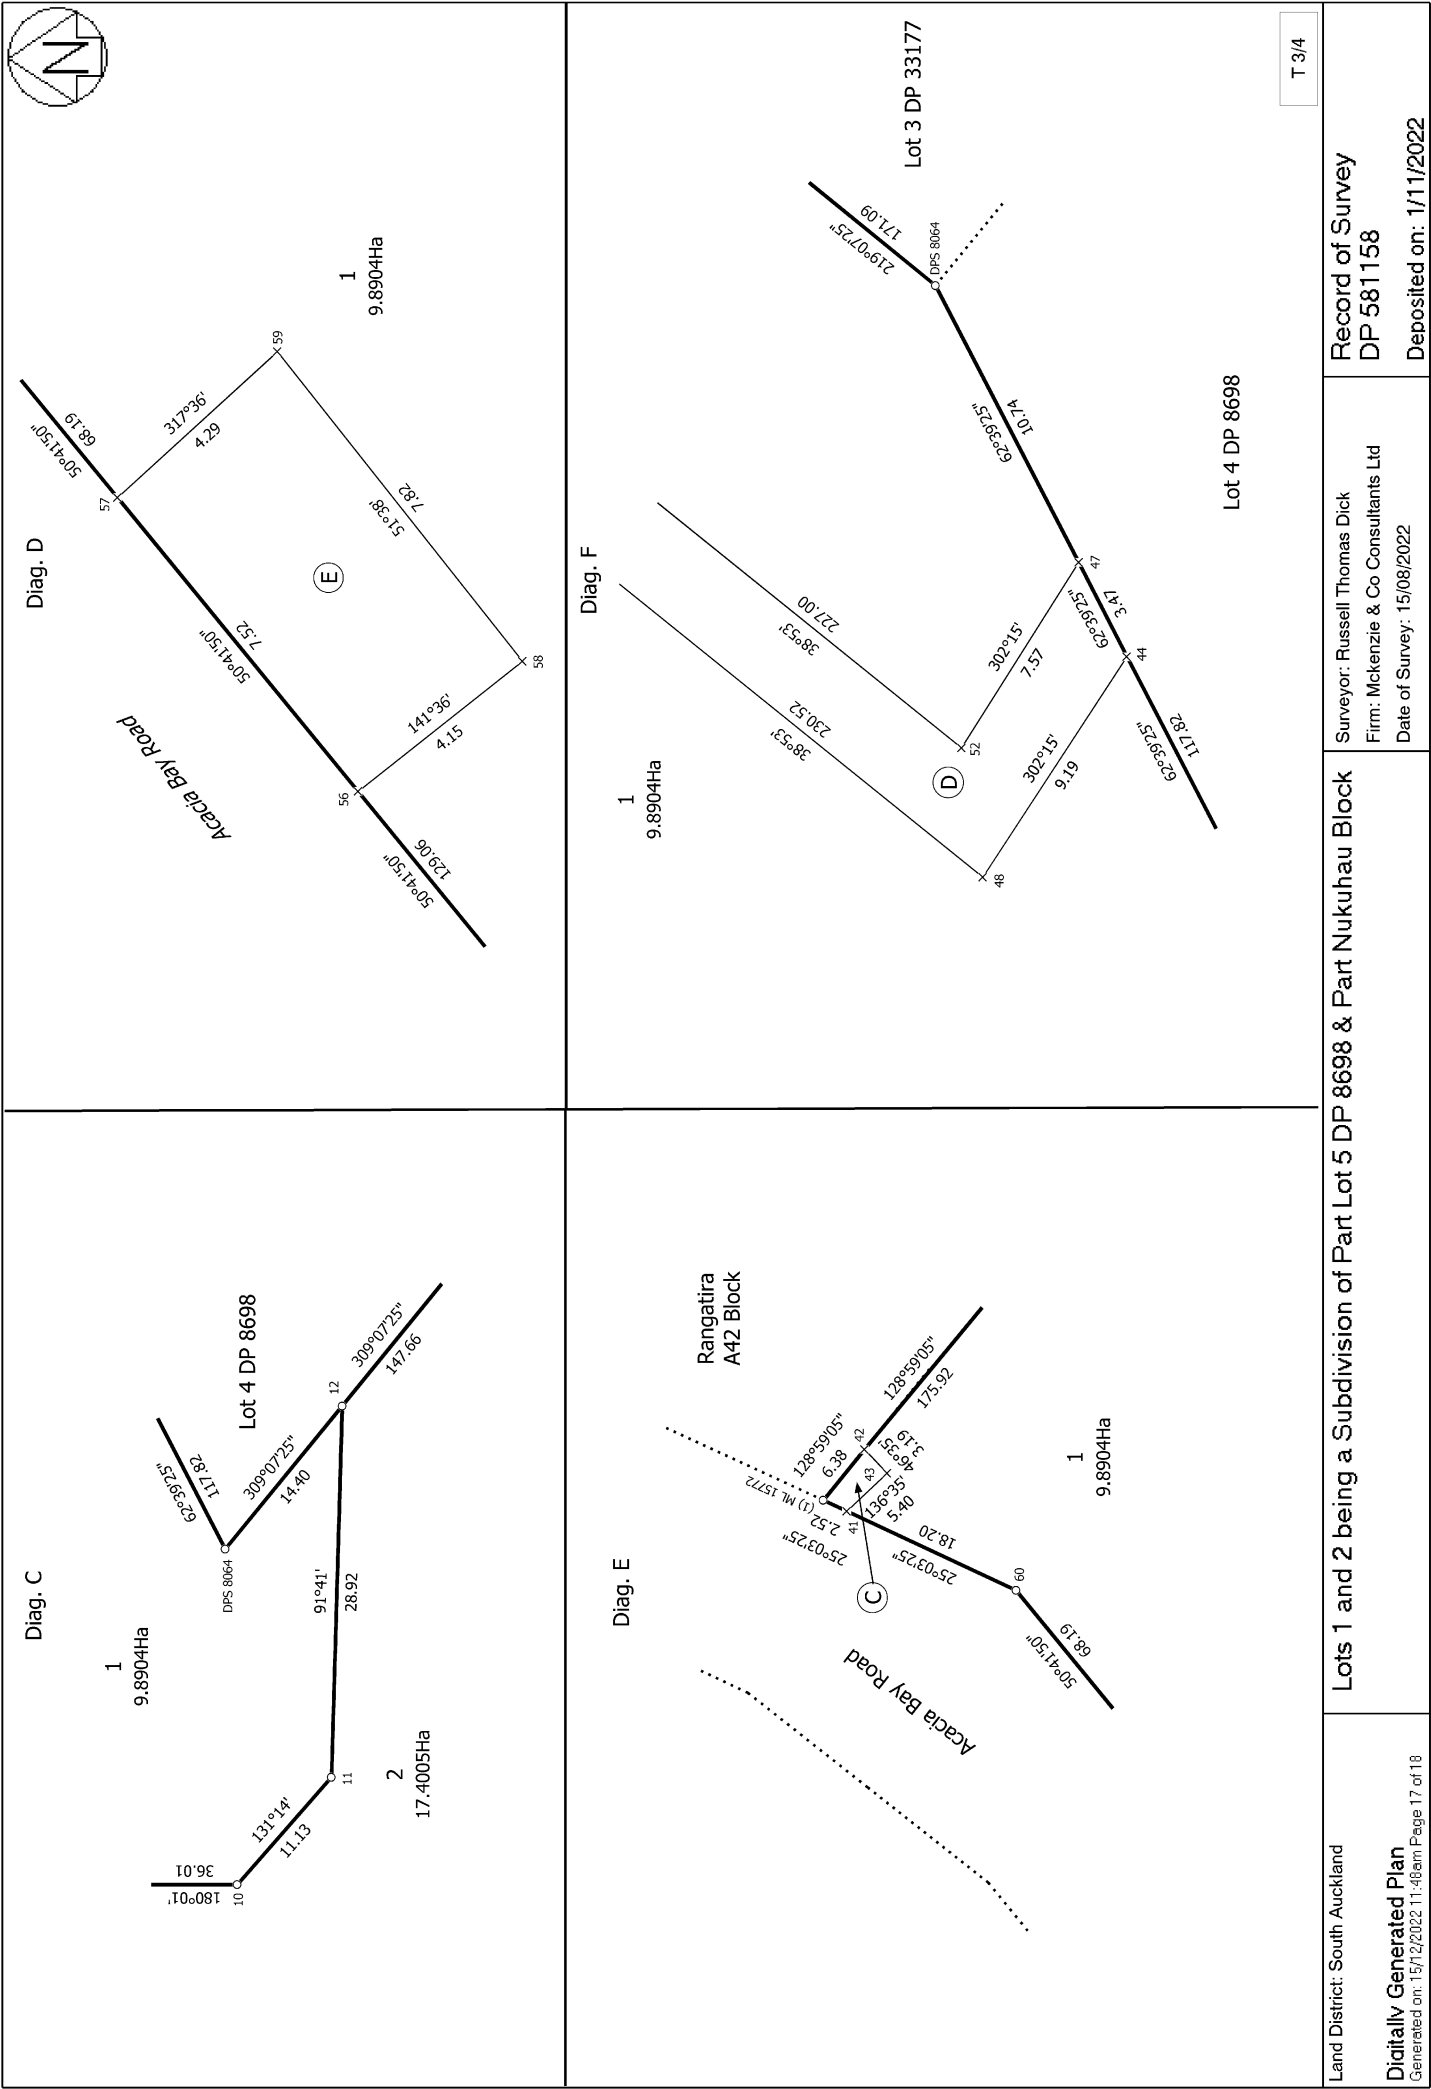

Land District: South Auckland		Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block	Surveyor: Russell Thomas Dick Firm: Mckenzie & Co Consultants Ltd Date of Survey: 15/08/2022	Record of Survey DP 581158 Deposited on: 1/11/2022
Digitally Generated Plan Generated on: 15/12/2022 11:48am Page 17 of 18				
		T 3/4		



T 4/4

Land District: South Auckland	Lots 1 and 2 being a Subdivision of Part Lot 5 DP 8698 & Part Nukuhau Block	Surveyor: Russell Thomas Dick	Record of Survey DP 581158
		Firm: Mckenzie & Co Consultants Ltd	
		Date of Survey: 15/08/2022	Deposited on: 1/11/2022