

Record of Survey - SO 583217

Survey Number SO 583217
Surveyor Reference 46823-Mason.nzt
Surveyor John Moreton Wisker
Survey Firm Cato Bolam Consultants Ltd (Auckland)
Surveyor Declaration I John Moreton Wisker, being a licensed cadastral surveyor, certify that--
 (a) this dataset provided by me and its related survey are accurate, correct and in accordance with the Cadastral Survey Act 2002 and Cadastral Survey Rules 2021; and
 (b) the survey was undertaken by me or under my personal direction.
 Declared on 22 Mar 2023 11:06 AM

Survey Details

Dataset Description Boundary Reinstatement of Lot 44 DP 19976
Purpose Simple Boundary Reinstatement
Status Registered **Type** Survey
Land District North Auckland **Survey Class** Class A
Meridional Circuit Mount Eden 2000 **Vertical Datum** None

Survey Dates

Surveyed Date 04/10/2022 **Certified Date** 22/03/2023
Submitted Date 22/03/2023 11:06:59 **Survey Approval Date** 27/03/2023
Deposit Date

Referenced Surveys

Survey Number	Land District	Bearing Correction
DP 551151	North Auckland	0°00'00"
DP 172874	North Auckland	0°00'00"
DP 47941	North Auckland	0°00'00"
DP 19976	North Auckland	0°00'00"
SO 51317	North Auckland	0°00'00"
DP 202701	North Auckland	0°00'00"
DP 203446	North Auckland	0°00'00"
DP 211796	North Auckland	0°00'00"
SO 475267	North Auckland	0°00'00"
DP 502936	North Auckland	0°00'00"
DP 511366	North Auckland	0°00'00"
SO 546172	North Auckland	0°00'00"

Territorial Authorities

Auckland Council

Comprised In

RT NA849/261

Mark and Vector

Survey Number SO 583217

Meridional Circuit Mount Eden 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
LP VI DP 172874	AP II DP 202701	ob4	228°57'42"	A DP 202701	0°00'00"	19.55 A	DP 202701	
AP 1 SO 546172	LP 2 DP 502936	ob15	51°36'40"	M		3.21 M		
LP 2 DP 502936	AP 2 SO 546172	ob2	51°36'40"	M		17.90 M		
AP 2 SO 546172	LP VI DP 172874	ob17	59°06'00"	M		57.25 M		
AP II DP 202701	ABD (2) DP 202701	ob0	155°32'00"	A DP 202701	0°00'00"	5.37 A	DP 202701	
ABD (2) DP 202701	ABD 1 SO 583217	ob12	231°19'30"	A DP 19976	0°00'00"	35.12 A	DP 19976	
ABD 1 SO 583217	PEG 6 DP 502936	ob11	231°19'30"	A DP 19976	0°00'00"	17.56 A	DP 19976	
PEG 6 DP 502936	LP 2 DP 502936	ob9	316°46'00"	A DP 502936	0°00'00"	13.88 A	DP 502936	
AP 2 SO 546172	AP 3 SO 546172	ob18	141°28'10"	M		41.27 M		
AP 3 SO 546172	IS 4 SO 546172	ob22	201°19'10"	M		16.26 M		
IS 4 SO 546172	AP 1 SO 546172	ob23	313°21'40"	A SO 546172	0°00'00"	49.99 A	SO 546172	
AP 2 SO 546172	AUCKLAND SKY TOWER	ob19	50°31'15"	M				
AP 1 SO 546172	PEG 6 DP 502936	ob16	124°03'00"	A SO 546172	0°00'00"	14.51 A	SO 546172	
AP II DP 202701	AP III DP 202701	ob1	139°44'40"	A DP 202701	0°00'00"	31.69 A	DP 202701	
AP III DP 202701	IS I DP 202701	ob5	101°58'00"	A DP 202701	0°00'00"	15.65 A	DP 202701	
IS I DP 202701	IT IV DP 202701	ob6	165°32'00"	A DP 202701	0°00'00"	16.50 A	DP 202701	
IT IV DP 202701	LP VIII DP 172874	ob7	29°32'00"	A DP 202701	0°00'00"	14.12 A	DP 202701	
LP VIII DP 172874	LP VI DP 172874	ob27	323°50'30"	A DP 172874	0°00'00"	54.45 A	DP 172874	
IT IV DP 202701	UNMK DP 202701	ob8	194°00'00"	A DP 202701	0°00'00"	6.67 A	DP 202701	
UNMK DP 202701	ABD (2) DP 202701	ob3	321°16'30"	A DP 202701	0°00'00"	57.67 A	DP 202701	
ABD 9 SO 546172	PEG 12 DP 551151	ob13	51°20'00"	A DP 47941	0°00'00"	17.56 A	DP 19976	
PEG 12 DP 551151	UNMK DP 202701	ob14	51°20'00"	A DP 47941	0°00'00"	35.12 A	DP 19976	
IS 4 SO 546172	ABD 9 SO 546172	ob24	148°00'30"	A SO 546172	0°00'00"	22.16 A	SO 546172	
ABD 2 SO 583217	ABD 3 SO 583217	ob32	141°19'30"	R		10.00 R		Class A
ABD 3 SO 583217	ABD 4 SO 583217	ob28	141°19'30"	R		11.36 R		Class A
ABD 4 SO 583217	PEG 5 SO 583217	ob31	141°19'30"	R		8.64 R		Class A

Mark and Vector

Survey Number SO 583217


Meridional Circuit Mount Eden 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
PEG 5 SO 583217	PEG 6 SO 583217	ob29	141°19'30" R			6.38 R		Class A
PEG 6 SO 583217	PEG 12 DP 551151	ob30	141°19'30" R			11.29 R		Class A
IS 4 SO 546172	PEG 5 SO 583217	ob25	67°32'00" M			15.58 M		
IS 4 SO 546172	PEG 12 DP 551151	ob26	107°06'00" M			26.63 M		
AP 2 SO 546172	ABD 1 SO 583217	ob20	138°10'00" M			13.77 M		
AP 2 SO 546172	ABD 3 SO 583217	ob21	140°01'00" M			33.76 M		
ABD 1 SO 583217	ABD 2 SO 583217	ob10	141°19'30" R			10.00 R		Class A

Mark Name	Mark Condition	Description
ABD 1 SO 583217		in Conc Drive
ABD 2 SO 583217		in Conc Drive
ABD 3 SO 583217		in Conc Drive
ABD 4 SO 583217		in Conc
AP 1 SO 546172		in channel
AP 2 SO 546172		in driveway crossing
AP 3 SO 546172		in Conc Drive
IS 4 SO 546172		0.30m deep in lawn
LP 2 DP 502936		in channel
LP VI DP 172874		Top of kerb
PEG 12 DP 551151		under corner fence
PEG 5 SO 583217		Plastic peg
PEG 6 SO 583217		Plastic peg

***** End of Report *****

Occupation Diagram

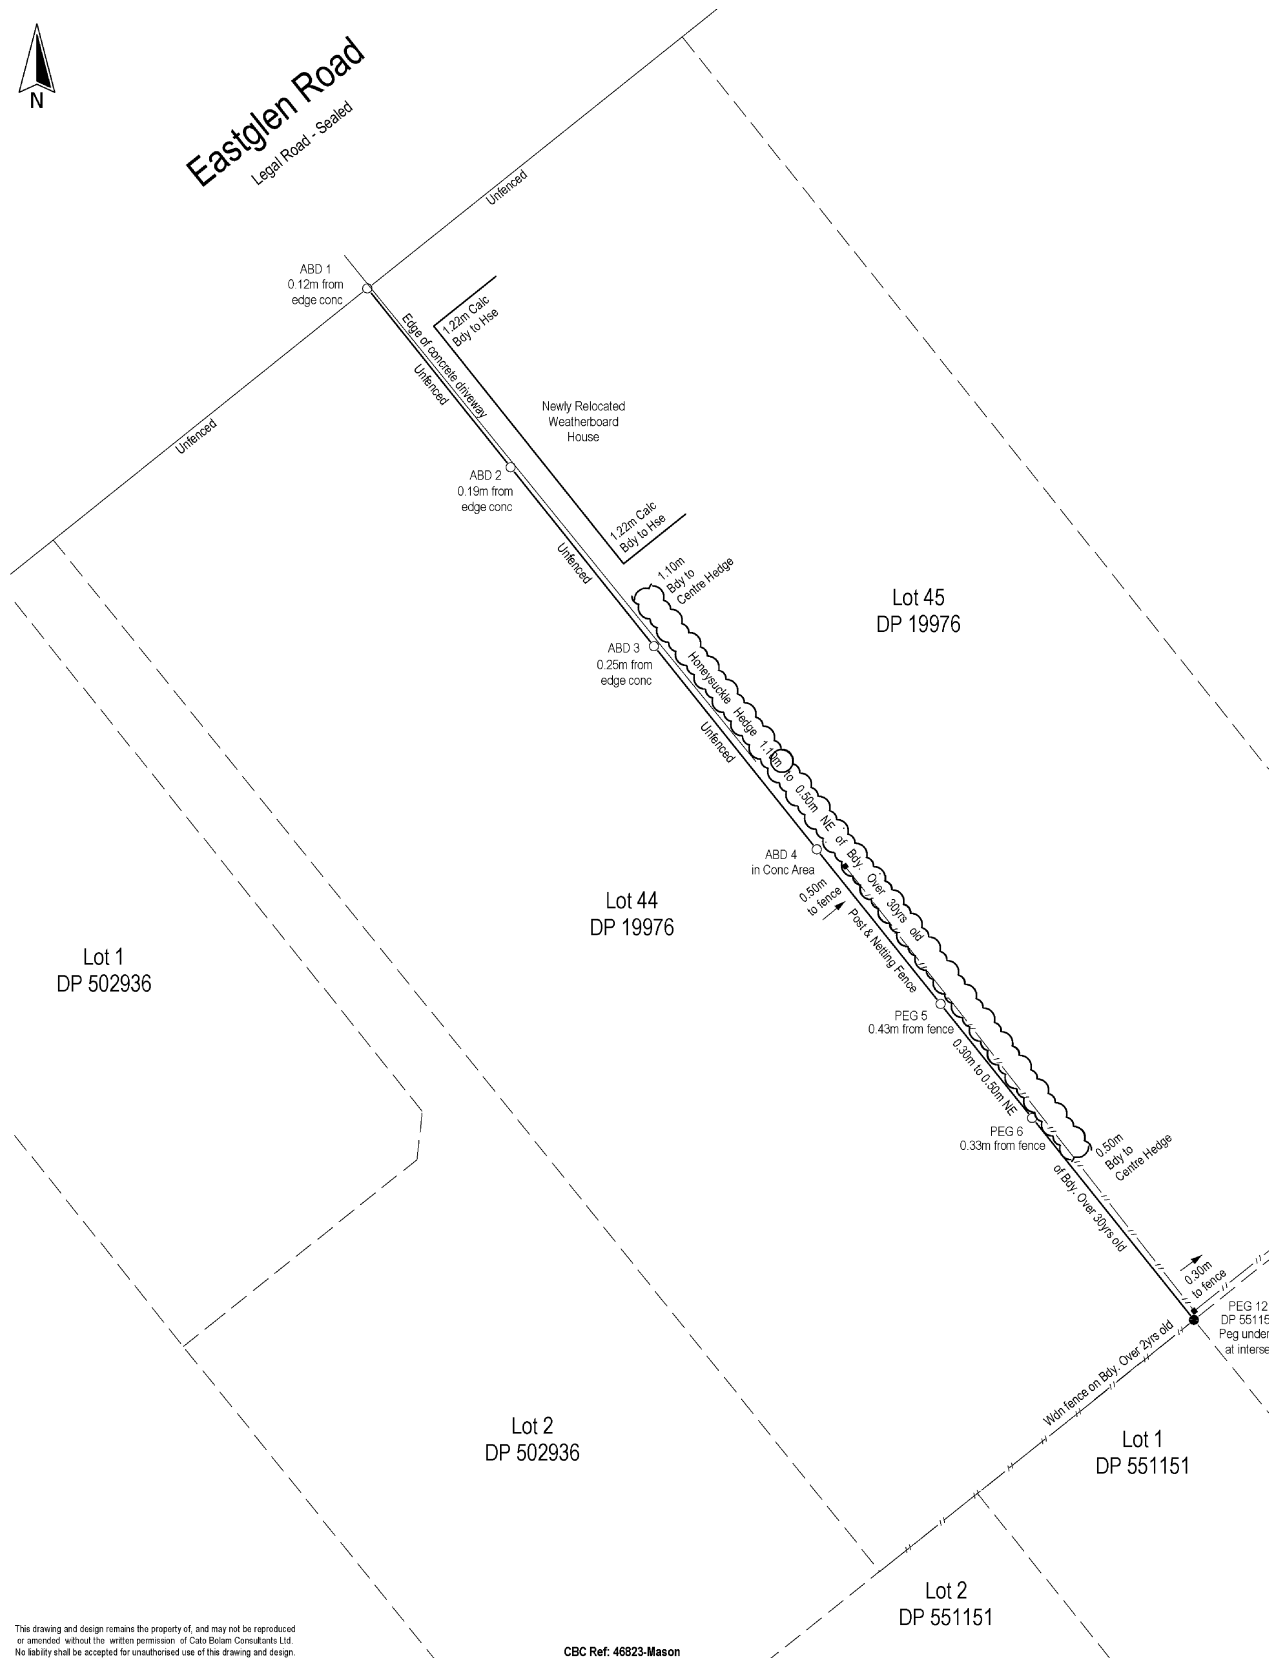


Cato Bolam

creating great places
PLANNERS | SURVEYORS | ENGINEERS
ARCHITECTS | ENVIRONMENTAL

Occupation Diagram for SO 583217

0000

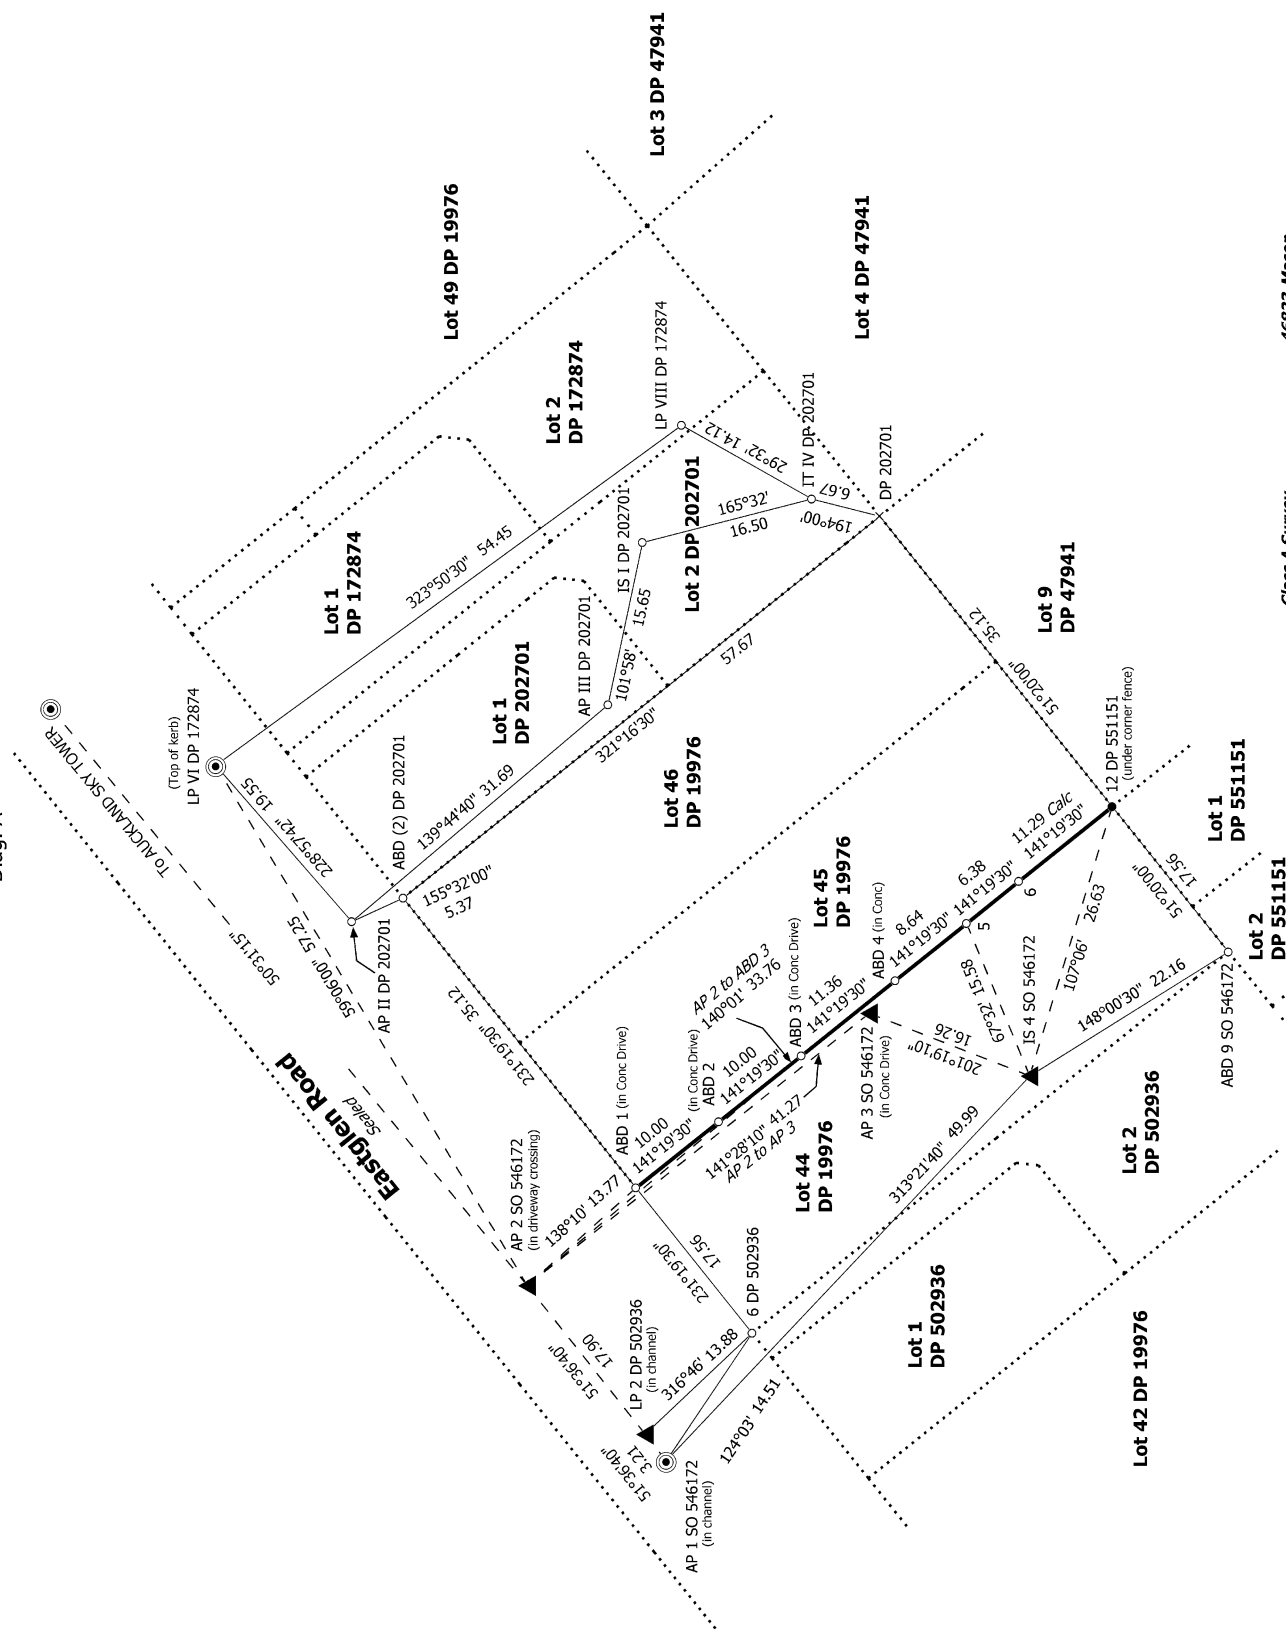

S 1/1

Class A Survey

Land District: North Auckland

Boundary Reinstatement of Lot 44 DP 19976

Record of Survey

Firm: Cato Bolam Consultants Ltd (Auckland)

Digitally Generated Plan
Generated on: 27/03/2023 07:39am Page 5 of 5

Date of Survey: 4/10/2022

Approved on: 27/03/2023