



Record of Survey - DP 581605

Survey Number	DP 581605
Surveyor Reference	CL Milburn 204685/01
Surveyor	Andrew Scott Rabbidge
Survey Firm	Milward Finlay Lobb Ltd
Surveyor Declaration	I Andrew Scott Rabbidge, being a licensed cadastral surveyor, certify that-- (a) this dataset provided by me and its related survey are accurate, correct and in accordance with the Cadastral Survey Act 2002 and Cadastral Survey Rules 2021; and (b) the survey was undertaken by me or under my personal direction. Declared on 08 Mar 2023 12:25 PM

Survey Details

Dataset Description	Lots 1 and 2 being Subdivision of Section 199 Town of Waimate		
Purpose	LT Subdivision		
Status	Deposited	Type	Survey
Land District	Canterbury	Survey Class	Class A
Meridional Circuit	Timaru 2000	Vertical Datum	None

Survey Dates

Surveyed Date	06/09/2022	Certified Date	08/03/2023
Submitted Date	08/03/2023 12:25:46	Survey Approval Date	09/03/2023
Deposit Date	06/03/2023		

Referenced Surveys

Survey Number	Land District	Bearing Correction
DP 17833	Canterbury	0°01'16"
DP 21564	Canterbury	0°01'16"
DP 68997	Canterbury	0°00'00"
SO 871	Canterbury	
SO 10190	Canterbury	
BM 307	Canterbury	

Territorial Authorities

Waimate District

Comprised In

RT CB32/148

Created Parcels

Parcels	Parcel Intent	Area	RT Reference
Lot 1 Deposited Plan 581605	Fee Simple Title	0.0360 Ha	1085188
Lot 2 Deposited Plan 581605	Fee Simple Title	0.0655 Ha	1085189
Total Area		0.1015 Ha	

Mark and Vector

Survey Number DP 581605
Meridional Circuit Timaru 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IT 7 SO 10190	IS VI DP 17833	ob0	221°28'20"	A DP 68997	0°00'00"	40.23 A	DP 21564	
IS VI DP 17833	IS X DP 21564	ob4	221°28'20"	A DP 68997	0°00'00"	90.53 A	DP 21564	
IS X DP 21564	IS XI DP 21564	ob7	221°28'20"	A DP 68997	0°00'00"	33.17 A	DP 21564	
IS XI DP 21564	NAIL 2 DP 581605	ob9	221°28'20"	A DP 68997	0°00'00"	97.73 A	DP 21564	
NAIL 2 DP 581605	IS 3 DP 581605	ob14	131°28'06"	M		123.76 M		
IS 3 DP 581605	IS XIV DP 21564	ob16	41°30'36"	M		57.33 M		
IS XIV DP 21564	IS DP 21564	ob17	41°30'36"	M		68.76 M		
IS DP 21564	IS XIII DP 21564	ob18	41°30'36"	M		68.18 M		
IS XIII DP 21564	IS 1 DP 581605	ob19	41°30'36"	M		67.39 M		
IS 1 DP 581605	IS I DP 17833	ob20	311°28'05"	A DP 21564	0°01'16"	72.19 A	DP 21564	
IS I DP 17833	IT 7 SO 10190	ob29	311°28'05"	A DP 21564	0°01'16"	51.75 A	DP 17833	
IS XI DP 21564	IS IX DP 21564	ob10	126°37'16"	A DP 21564	0°01'16"	57.65 A	DP 21564	
IS IX DP 21564	IS XLVIII DP 21564	ob22	41°30'36"	A DP 21564	0°01'16"	26.49 A	DP 21564	
IS XLVIII DP 21564	IS X DP 21564	ob23	313°16'16"	A DP 21564	0°01'16"	57.49 A	DP 21564	
IS X DP 21564	DISK 17 DP 581605	ob8	86°43'16"	A DP 21564	0°01'16"	7.08 A	DP 21564	
IS XLVIII DP 21564	PEG (2) DP 21564	ob24	25°00'16"	A DP 21564	0°01'16"	7.08 A	DP 21564	
DISK 17 DP 581605	PEG 29 DP 581605	ob26	131°28'16"	C		21.79 C		Class A
PEG 29 DP 581605	PEG (2) DP 21564	ob41	131°28'16"	C		28.64 C		Class A
IS VI DP 17833	IS IV DP 17833	ob5	131°28'05"	A DP 17833	0°01'16"	45.26 A	DP 17833	
IS IV DP 17833	IS III DP 17833	ob30	131°28'05"	A DP 17833	0°01'16"	6.49 A	DP 17833	
IS III DP 17833	IS I DP 17833	ob32	41°28'05"	A DP 17833	0°01'16"	40.23 A	DP 17833	
IS IV DP 17833	PEG (1) DP 17833	ob31	158°02'16"	A DP 17833	0°01'16"	11.25 A	DP 17833	
IS VI DP 17833	PEG (2) DP 17833	ob6	176°28'06"	A DP 17833	0°01'16"	7.11 A	DP 17833	
DISK 17 DP 581605	PEG 28 DP 581605	ob27	41°28'20"	C		16.63 C		Class A
PEG 28 DP 581605	IS 24 DP 581605	ob39	41°28'20"	C		3.50 C		Class A
IS 24 DP 581605	PEG (2) DP 17833	ob33	41°28'20"	C		60.39 C		
IS XLVIII DP 21564	IS XLVI DP 21564	ob25	41°30'36"	A DP 21564	0°01'16"	65.19 A	DP 21564	
IS XLVI DP 21564	IS XIII DP 21564	ob35	131°28'16"	A DP 21564	0°01'16"	66.39 A	DP 21564	

Mark and Vector

Survey Number DP 581605

Meridional Circuit Timaru 2000

From	To	Code	Bearing	Adpt Surv	Bearing Correction	Distance	Adpt Surv	Class
IS XLVI DP 21564	PEG (1) DP 21564	ob36	346°30'16"	A DP 21564	0°01'16"	2.46 A	DP 21564	
PEG (2) DP 21564	DISK 27 DP 581605	ob28	41°30'36"	C		20.13 C		Class A
DISK 27 DP 581605	PEG (1) DP 21564	ob38	41°30'36"	C		39.68 C		
PEG (1) DP 21564	PEG (1) DP 17833	ob37	41°02'00"	C		20.71 C		
IS 24 DP 581605	DISK 27 DP 581605	ob34	131°28'05"	C		50.44 C		Class A
PEG 28 DP 581605	PEG 30 DP 581605	ob40	131°28'05"	C		19.79 C		Class A
PEG 30 DP 581605	PEG 31 DP 581605	ob42	176°28'00"	C		2.83 C		Class A
PEG 31 DP 581605	PEG 29 DP 581605	ob43	221°28'00"	C		14.63 C		Class A
IT 7 SO 10190	NAIL 2 DP 581605	ob1	221°28'20"	M		261.66 M		
IT 7 SO 10190	IS 1 DP 581605	ob2	131°28'05"	M		123.94 M		
IS 1 DP 581605	IT 9 SO 10190	ob21	131°28'05"	M		359.19 M		
NAIL 2 DP 581605	SS 12 SO 871	ob15	221°28'20"	M		325.69 M		
IT 7 SO 10190	IS 4 DP 581605	ob3	227°39'00"	M		110.62 M		
IS 4 DP 581605	IS 5 DP 581605	ob44	221°28'20"	M		20.84 M		
IS 5 DP 581605	NAIL 2 DP 581605	ob11	216°16'20"	M		131.39 M		
IS 5 DP 581605	DISK 17 DP 581605	ob12	114°54'00"	M		17.67 M		
IS 5 DP 581605	PEG 29 DP 581605	ob13	124°03'00"	M		39.05 M		
IS 4 DP 581605	PEG 28 DP 581605	ob45	128°40'00"	M		16.95 M		
IS 4 DP 581605	IS 24 DP 581605	ob46	117°08'00"	M		17.48 M		
IS 4 DP 581605	PEG 31 DP 581605	ob47	133°12'00"	M		38.74 M		
IS 4 DP 581605	PEG 30 DP 581605	ob48	130°10'00"	M		36.73 M		
IS 4 DP 581605	DISK 27 DP 581605	ob49	127°47'40"	M		67.51 M		


Mark Name	Mark Condition	Description
DISK 17 DP 581605		Disk on fence rail above wooden post. Reinstates DP 21564
DISK 27 DP 581605		Disk on wooden post +50 years
IS 1 DP 581605		Flush in carriageway. Reinstates IT I DP 21564
IS 24 DP 581605		Flush in footpath


Mark and Vector


Survey Number DP 581605
Meridional Circuit Timaru 2000



Mark Name	Mark Condition	Description
IS 3 DP 581605		Flush in carriageway. Reinstates IT V DP 21564
IS 4 DP 581605		Flush behind kerb
IS 5 DP 581605		Flush behind kerb
IS DP 21564		Flush in footpath
IS XIII DP 21564		Flush in footpath
IS XIV DP 21564		Flush in footpath
IT 7 SO 10190		Capped in carriageway
IT 9 SO 10190		Capped in carriageway
NAIL 2 DP 581605		Flush in carriageway. Reinstates SS 11 SO 871
SS 12 SO 871		Down 0.20 in grass berm
IS I DP 17833	Searched For and Not Found	
IS VI DP 17833	Searched For and Not Found	
IS X DP 21564	Searched For and Not Found	
IS XI DP 21564	Searched For and Not Found	

*** End of Report ***

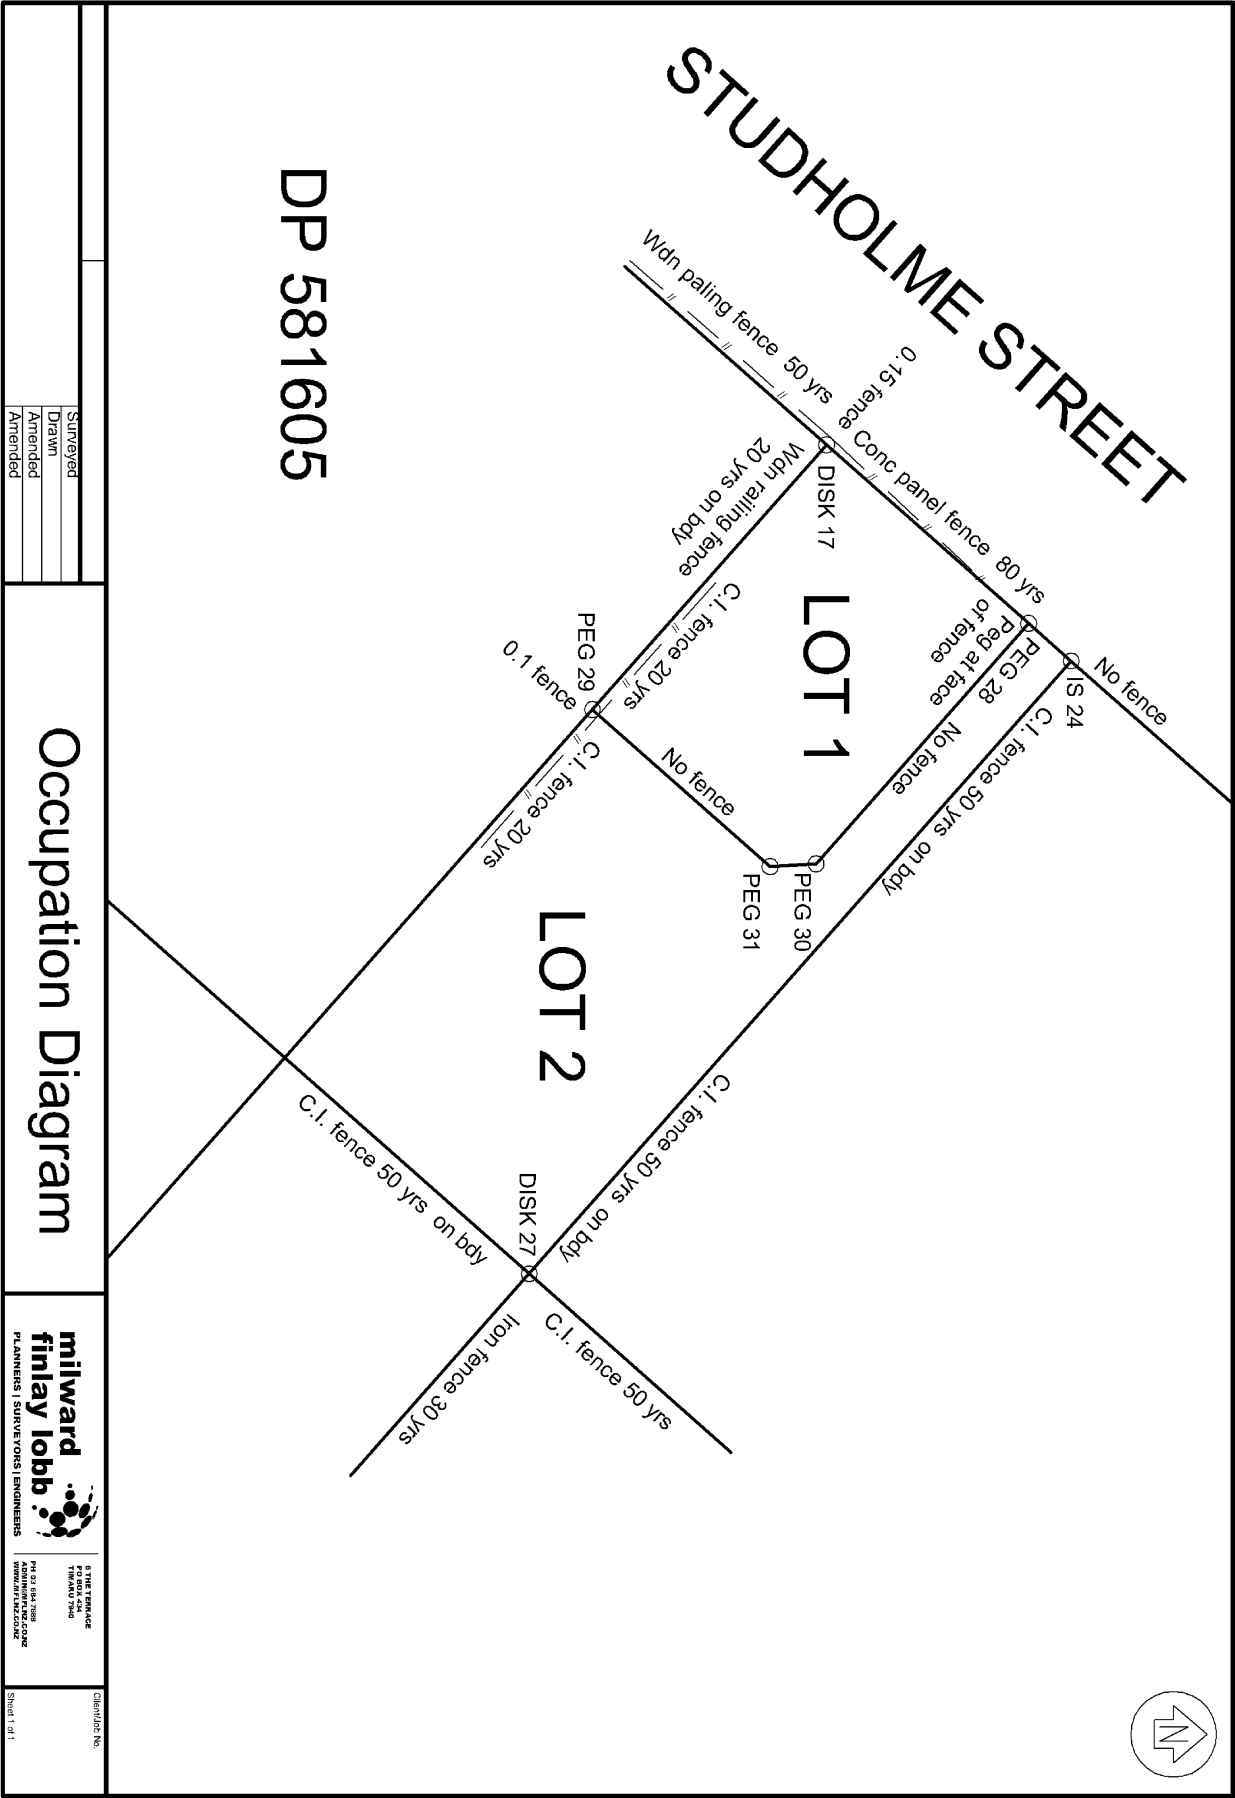

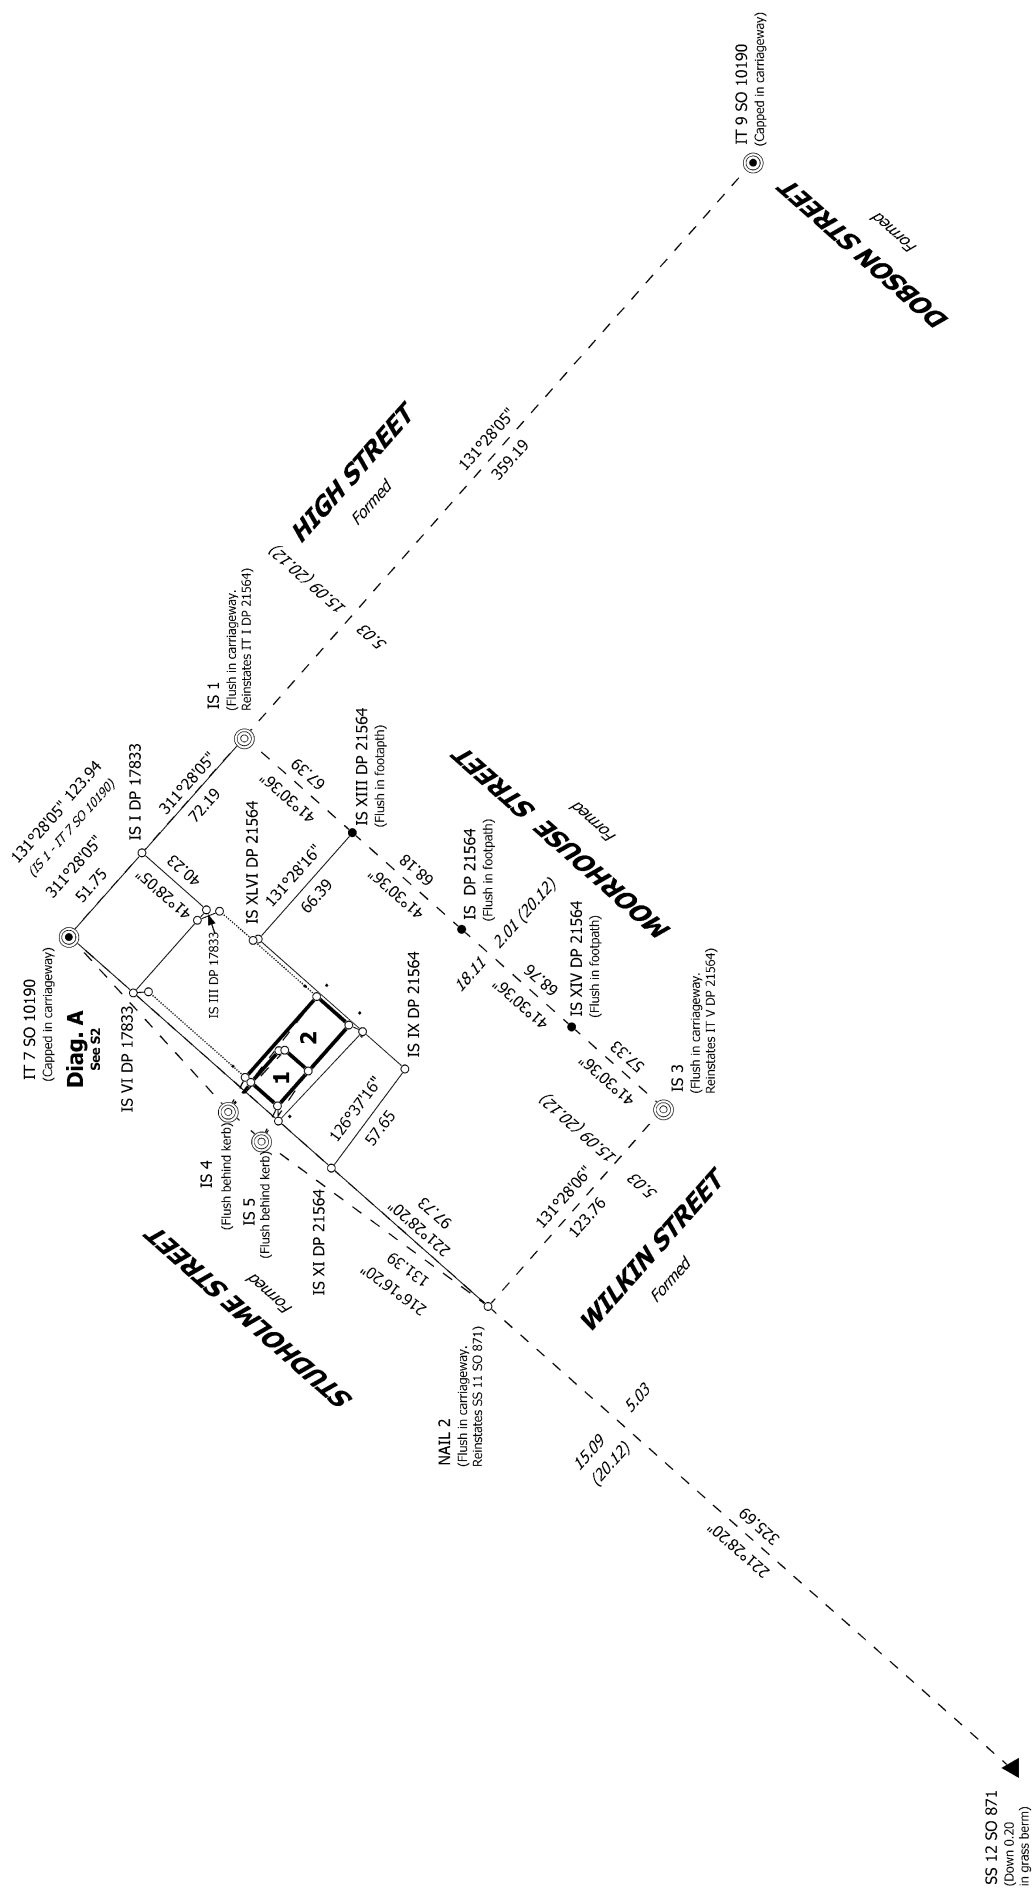


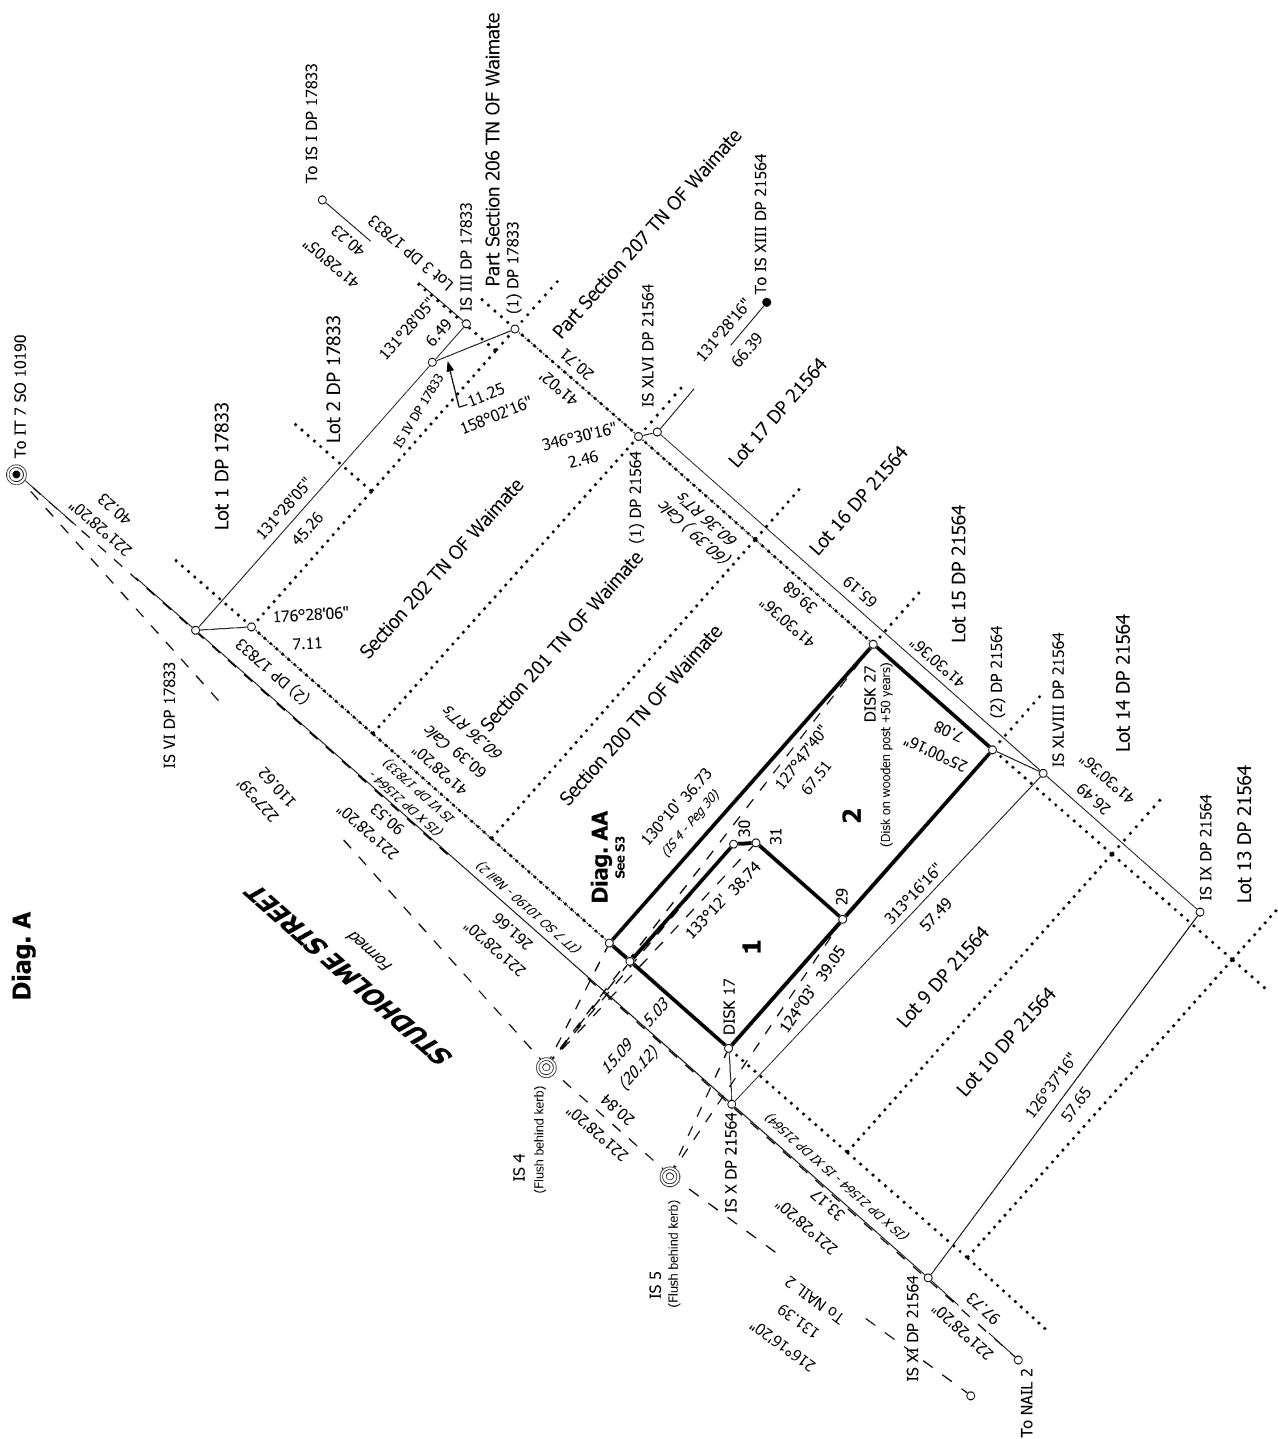

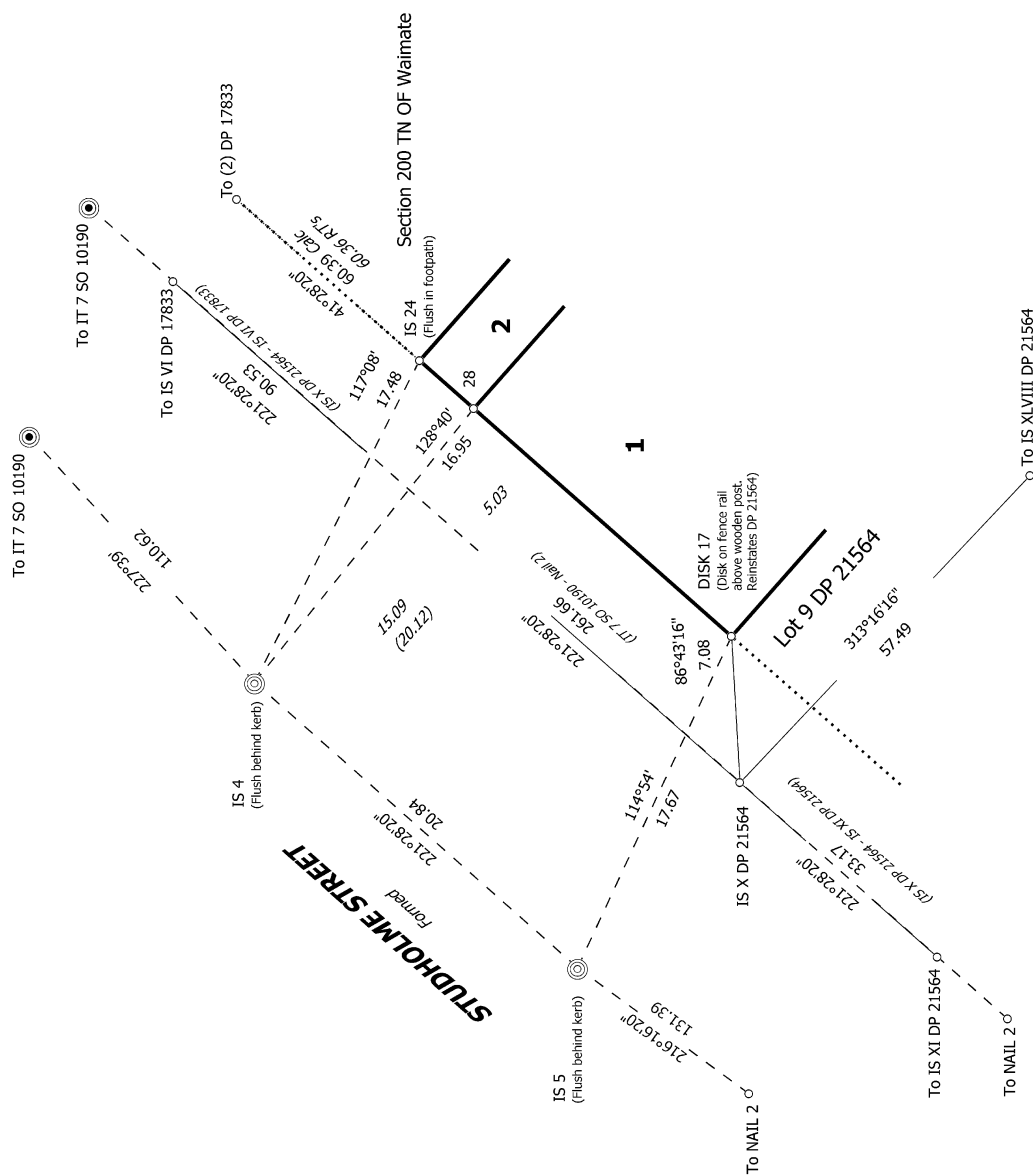



Diag. A

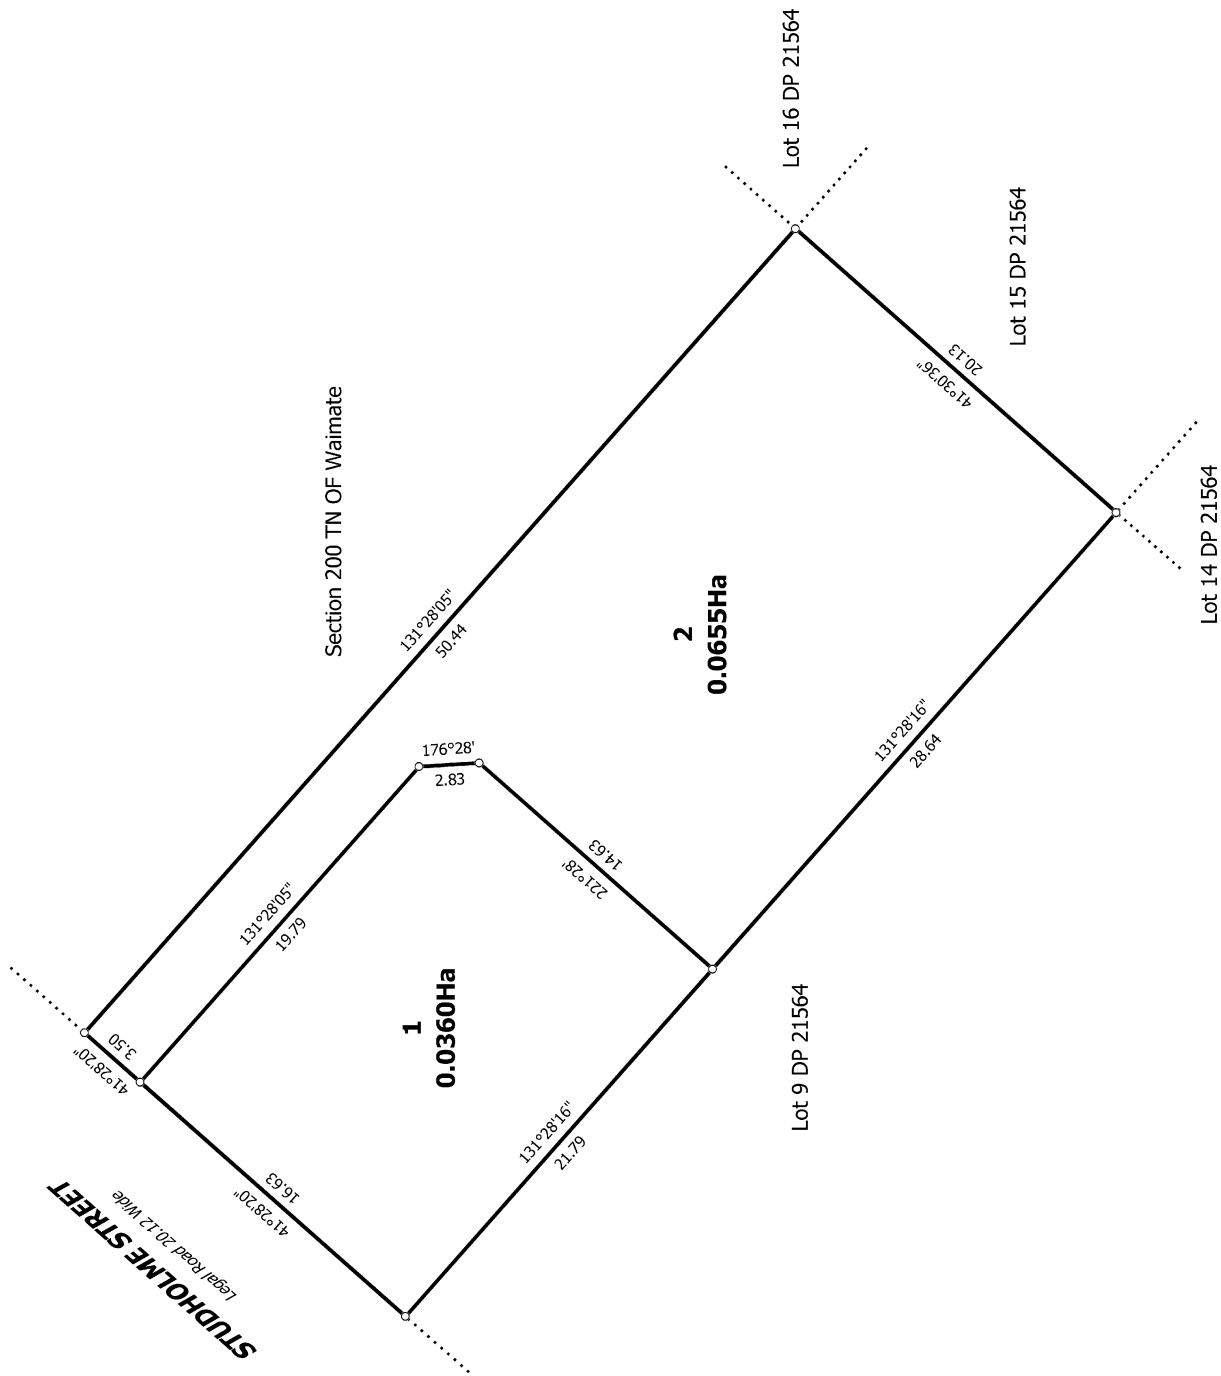

T 1/1

Land District: Canterbury	Lots 1 and 2 being Subdivision of Section 199 Town of Waimate	Surveyor: Andrew Scott Rabbidge Firm: Milward Finlay Lobb Ltd Date of Survey: 6/09/2022	Record of Survey DP 581605 Deposited on: 6/03/2023
Digitally Generated Plan Generated on: 24/03/2023 2:39pm Page 9 of 9			